

**LAI HUAT (MENG KEE)
MOTOR PTE LTD
SIN MING INDUSTRIAL
ESTATE SECTOR A
BLK 21 #01-58
SINGAPORE 575679**

**Full Report - V1
Registration: SFZ 6955Y
Printed: 14/12/2017 01:12**

**Claim Reference:
Assessment Number: LHMJ0556
Version: LAI HUAT/3
Date Calculated: 13/12/2017 17:11**

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Jenny Lim	Date of Incident:	09/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	DMPCSN3065261700	Quote Due Date:	
Other Reference:	OD CLAIM	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

*Not Authorised
11 Day 87
Paying After Paint
Ex @ 10000*

16 days

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Golf
Sub Model:	GTI
Model Sheet Number:	6AF 04
Registration:	SFZ 6955Y
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ1KZAW026078
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 05/2009	CHROME PACKAGE
INS PANEL COOLER BOX	DOOR MIRROR W/MEMORY
RAIN SENSOR	ELECTRIC WINDOWS
SAFE SECURITY	SIDE WINDOW/RR SCRIN
ELEC FOLD DR MIRRORS	AUTO DIPPING MIRROR
8 SPEAKER	RADIO RCD 510
XENON HEADLAMPS	FOG LAMPS
PARKING HELP SYSTEM	HEADLAMP WASHERS
ILLUM SUN VISORS	EQUIPM LEATH VIENNA
SPORT SEATS	HEATED FRONT SEATS
STRG WHEEL LEATHER	MULTI FUNC INDICATOR
DOOR TRIM IMIT LEATH	ELECT LUMBAR ADJUST
OIL LEVEL GAUGE	FRONT CENTRE ARMREST
REAR CENTRE ARMREST	SMOKER EQUIPMENT
ALTERNATOR 140A	2.0 LTR 155KW
6 SPEED DSG	SPORTS SUSPENSION
ADAPTIVE SUSPENSION	UPHILL TRACTION CONT
CRUISE CONTROL	TYRES 225/40 WR 18
WHEELS 7.5J X 18 ALU	SPACE SAVER SP-WHEEL
TYRE PRESSURE CHECK	TWO COAT METALLIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	13/12/2017

LAI HUAT (MENG KEE) MOTOR PTE LTD**Claim Reference:****Full Report - V1****Assessment Number: LHMJ0556****Registration: SFZ 6955Y****Version: LAI HUAT/3****Printed: 14/12/2017 01:12****Date Calculated: 13/12/2017 17:11**

Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF:

Tread Depth LHR:

Damage Areas:

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

**Addresses****Cost Summary**

Total Labour	\$2,916.40
Total Paint/Material	\$292.76
Total Parts	\$17,180.35
Total of Additional Costs	\$512.00
Repair Cost Exc GST:	\$20,901.51
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,000.00
After Deduction -	
Grand Total Exc GST:	\$19,901.51
7 % GST:	\$1,393.11
Grand Total Inc GST:	\$21,294.62

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
44 95 03 00	ALIGN VEHICLE FRONT AND REAR (BEFORE REPAIRS) INCLUDES: CAMBER AND TOE CHECK , BRKT AND SENSOR REMOVE AND REFIT WITHOUT ADJUSTMENTS	9.0	41.40
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.60
50 38 55 50	RENEW FRONT LOCK CARRIER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	7.0	32.20
50 38 19 50	R + R FRONT LOCK CARRIER (BUMPER COVER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMPS	13.0	59.80
66 05 19 00	R + R RADIATOR GRILLE	2.0	9.20
63 29 19 50	R + R FRONT BUMPER COVER (RADIATOR GRILLE REMOVED)	4.0	18.40
63 29 55 69	RENEW FRONT BUMPER COVER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	11.0	50.60
50 55 19 50	R + R L/F WING	9.0	41.40

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

	(BUMPER COVER REMOVED)		
	INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL		
53 29 43 50	DRILL FRONT BUMPER COVER (COMPOSITE WORK) (4 HOLES DRILLED)	3.0	13.80
53 29 41 50	REPAIR FRONT BUMPER COVER (COMPOSITE WORK) (4 BRACKET STUCK)	3.0	13.80
50 55 19 50	R + R R/F WING (BUMPER COVER REMOVED)	9.0	41.40
	INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL		
NO NUMBER	R + R L/F WING STRUT	2.0	9.20
NO NUMBER	R + R R/F WING STRUT	2.0	9.20
94 15 16 10	ADJUST HEADLAMPS	3.0	13.80
94 64 16 00	ALIGN FRONT FOG LAMPS	2.0	9.20
94 15 56 50	RENEW HEADLAMPS (REMOVED)	5.0	23.00
	INCLUDES: CONVERT ATTACHED PARTS		
50 34 19 50	R + R FRONT CROSSMEMBER (COMPOSITE WORK)	3.0	13.80
	(BUMPER COVER REMOVED)		
64 10 55 00	RENEW FRONT SCREEN	22.0	101.20
	INCLUDES: R + R A-PILLAR TRIMS, INTERIOR MIRROR, SUN VISORS AND INTERIOR LAMP		
66 44 19 50	R + R COWL TRIM (WIPER ARMS REMOVED)	2.0	9.20
57 11 19 00	R + R L/F DOOR HANDLE	2.0	9.20
	INCLUDES: R + R LOCK CYLINDER		
58 11 19 00	R + R LEFT REAR DOOR HANDLE	2.0	9.20
66 31 19 00	R + R LEFT SILL TRIM	3.0	13.80
68 05 19 50	R + R L/INN SILL PANEL COVER	1.0	4.60
68 05 19 50	R + R R/INN SILL PANEL COVER	1.0	4.60
69 11 20 50)	R + R BOTH FRONT SEAT BELTS	4.0	18.40
51 90 19 ZAX	R + R L/FLOOR PANEL COVER	2.0	9.20
66 76 19 50	R + R L/R WHEELHOUSE SHELL (WHEEL REMOVED)	2.0	9.20
69 67 55 50	RENEW KNEE BAG (REMOVED)	1.0	4.60
70 28 19 50	R + R LEFT REAR WHEEL HOUSE TRIM	1.0	4.60
70 28 19 50	R + R RIGHT REAR WHEEL HOUSE TRIM	1.0	4.60
70 18 19 00)	R + R INSTRUMENT PANEL (LOWER INSTRUMENT PANEL SHELF, GLOVE BOX AND UPPER A-PILLAR TRIMS REMOVED)	13.0	59.80
	INCLUDES: REMOVE STEERING WHEEL, STEERING COLUMN SWITCH, INSTRUMENT CLUSTER AND KNEE BAG		
NO NUMBER	R + R INSTRUMENT PANEL COVER	1.0	4.60
70 18 55 50	RENEW SWITCH PANEL (REMOVED)	7.0	32.20
	INCLUDES: CONVERT SWITCH PANEL		
68 18 19 50	R + R R/LOWER INSTRUMENT PANEL COVER	2.0	9.20
68 15 19 00)	R + R GLOVE BOX	5.0	23.00
92 60 19 50	R + R WASHER RESERVOIR (BUMPER COVER REMOVED)	2.0	9.20

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

92 60 55 50	RENEW WASHER RESERVOIR (REMOVED)	2.0	9.20
69 58 55 50	INCLUDES: CONVERT ATTACHED PARTS RENEW DRIVER AIRBAG UNIT (REMOVED)	1.0	4.60
40 07 19ZAX)	R + R ASSEMBLY CARRIER (NOISE CONTROL PAN, SUPPORT AND WHEELS REMOVED) INCLUDES: DETACH + REFIT STEERING GEAR AND STABILIZER DOES NOT INCLUDE: ALIGN FRONT AND REAR	13.0	59.80
40 85 19 00)	R + R L/F SPRING STRUT (WHEEL REMOVED) DOES NOT INCLUDE: ALIGN FRONT AND REAR	6.0	27.60
40 90 19 50	R + R LEFT FRONT SHOCK ABSORBER (SPRING STRUT REMOVED) INCLUDES: R + R SPRING STRUT MOUNT AND COIL SPRING	2.0	9.20
40 50 19 00)	R + R L/F WHEEL BEARING HOUSING (WHEEL REMOVED) INCLUDES: R + R SPEED SENSOR AND BRAKE DISC, DETACH + REFIT DRIVE SHAFT DOES NOT INCLUDE: ALIGN FRONT AND REAR	9.0	41.40
40 50 55 50	RENEW L/F WHEEL BEARING HOUSING (WHEEL BEARING HOUSING REMOVED) INCLUDES: R + R WHEEL BEARING AND WHEEL HUB	3.0	13.80
94 78 19 00	R + R L/F VEHICLE LEVEL SENSOR DOES NOT INCLUDE: ADJUST HEADLAMPS, READ OUT FAULT MEMORY (SELF-DIAGNOSIS)	3.0	13.80
40 07 19 53)	R + R L/F LOWER AXLE RADIUS ARM CONSOLE	3.0	13.80
44 10 56 50	RENEW BOTH FRONT WHEELS/TYRES (WHEELS REMOVED) INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS	5.0	23.00
44 05 19 00	R + R REAR WHEEL (WHEELS)	2.0	9.20
44 10 56 50	RENEW BOTH REAR WHEELS/TYRES (WHEELS REMOVED) INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS	5.0	23.00
69 59 55 50	RENEW PASSENGER AIRBAG UNIT (REMOVED)	1.0	4.60
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR DOES NOT INCLUDE: ADJUSTMENT	9.0	41.40
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK) (FRONT AND REAR ALIGNMENT) INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER	3.0	13.80
44 83 03 ZAX	ALIGN TRANSVERSAL INCLINATION (COMPOSITE WORK) MEASURED VALUE OUT OF TOLERANCE	1.0	4.60

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

44 88 15 50	FRONT WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.20
44 94 15 50	(VEHICLE FRONT AND REAR ALIGNMENT) REAR WHEEL CAMBER ALIGNMENT (COMPOSITE WORK)	2.0	9.20
44 93 15 50	(FRONT AND REAR VEHICLE ALIGNMENT) REAR WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.20
9852	(VEHICLE FRONT AND REAR ALIGNMENT) READ OUT ERROR MEMORY	30.0*	138.00 7
9854	READ OUT ERROR MEMORY	15.0*	69.00 7
9973	CARRY OUT TEST DRIVE	5 10.0*	46.00
1482	REPAIR RIGHT FRONT DOOR	42 50.0* X	230.00
1781	REPAIR L/R DOOR	10.0*	46.00
2083	REPAIR L/SIDE FRAME	10 20.0*	92.00
2583	REPAIR REAR BUMPER	5 10.0*	46.00
3481	REPAIR L/SIDE PANEL	40 60.0*	276.00
LABOUR COST			
Total Work Units		441.0	
Panel / Mechanical Labour		41.3HRS	\$1,899.80
Visual Alignment Labour		2.8HRS	\$128.80
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00
Sub Total		44.1HRS	\$2,028.60
Paint Labour		19.3HRS	\$887.80
Total Labour		63.4HRS	\$2,916.40

PAINT WORK

Guide Number Description		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
		WU	Cost Price (\$)
	- TWO COAT METALLIC		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	11.0	
293	FRONT BUMPER CAP NEW PART PAINT K1R	3.0	
301	L/F PARKING AID SENSNEW PART PAINT K1R	3.0	
303	L/F CENTRE SENSOR NEW PART PAINT K1R	3.0	
392	FRT CENTRE SPOILER NEW PART PAINT K1R	4.0	
461	L/DUCT COVER NEW PART PAINT K1R	3.0	
462	R/DUCT COVER NEW PART PAINT K1R	3.0	
1731	L/R DOOR REPAIR PAINTING <50%	14.0	
2103	L/OUTER SILL PANEL REPAIR PAINTING <50%	11.0	
2241	LEFT A-PILLAR REPAIR PAINTING <50%	8.0	
2285	L/CENTRE PILLAR REPAIR PAINTING <50%	9.0	
2583	REAR COVER BUMPER REPAIR PAINT PLASTIC	15.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	24.0	
3481	L/SIDE PANEL REPAIR PAINTING >50%	19.0	
302	R/F PARKING AID SENS SURFACE PAINT PLAST.	3.0	
304	R/F CENTRE SENSOR SURFACE PAINT PLAST.	3.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
LABOUR COST - PAINT			
TIME(PAINT)		164.0	
Preparation Main Work Metal		21.0	

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

Preparation Comp. Work Plastic	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	193.0	
Total Paintwork Labour	19.3HRS	\$887.80
MATERIAL COST - PAINT		Cost Price
New Part Painting		\$39.22
New Part Painting - Plastic K1R		\$59.03
Surface-/Blend Paint		\$20.17
Surface Paint Plastic		\$0.74
Repair Painting		\$99.46
Repair Painting Plastic		\$43.34
Material-Const Main Work Metal		\$18.10
Material-Const Comp. Work Plastic		\$12.70
Total Excluding Pearlescent Uplift		\$292.76
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$292.76

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
399	1	2-COMP ADHESIVE SENS	D 180 KU2 A1		0% 0.00F ?
1000	1	AC DECAL	Renew		0% 6.50* ?
1405	1	APPLICATOR	D 009 500 25		0% 0.00F ?
398	1	APPLICATOR	D 009 500 25		0% 0.00F ?
1410	1	CLEANING SOLUTION	D 009 401 04		0% 0.00F ?
1409	1	CUTTING FILAMENT	357 853 999 B		0% 0.00F ?
7445	1	DRIVER AIRBAG	5K0 880 201 AE 81U	Purn	0% 1,725.00* ✓
3771	1	ENGINE PROTECTION	1K0 825 235 AE		0% 81.00* ?
283	1	FRONT BUMPER	5K0 807 217 CC GRU		0% CM 480.00* ✓
293	1	FRONT BUMPER CAP	5K0 807 241 A ROH		0% M17 16.00* ✓
339	1	FRT BUMPER C-MEMBER	5K0 807 651 D		0% P1 117.00* ✓
392	1	FRT CTR BUMP SPOILER	5K0 807 110 GRU		0% M17 195.00* ✓
930	1	FRT LOCK CARRIER	5K0 805 588 E		0% 520.00* ?
394	1	FRT LWR BUMP SPOILER	5K0 807 110 A 9B9		0% M17 195.00* ✓
393	1	FRT SPOILER BRACKET	5K0 805 915 9B9		0% D17 40.00* ✓
391	1	FRT UPP BUMP SPOILER	5K0 805 903 B 9B9		0% M17 260.00* ✓
362	1	H/LAMP WASHER VALVE	5K0 955 978 A		0% M17 27.00* ✓
361	1	H/LAMP WASHER VALVE	5K0 955 978 A		0% M17 27.00* ✓
1441	1	H-LAMP WASHER PUMP	3B7 955 681		0% 77.00*
4331	1	INSTRUMENT PANEL	5K2 857 001 A 81X		0% T1 2,010.00* ✓
4351	1	KNEE AIRBAG	5K1 880 841 F		0% Purn 785.00* ✓
7009	1	L/ASSY CARRIER CONS	1K0 199 295 E		0% 296.00* ?
7101	1	L/BUFFER	1K0 412 303 E		0% 17.00* ?
461	1	L/DUCT COVER	5K0 955 109 A GRU		0% 19.00* ?
297	1	L/F AIR GUIDE GRILLE	5K0 853 665 C 9B9		0% CM 53.00* ?
303	1	L/F CENTRE SENSOR	1S0 919 275 C GRU		0% T1 90.00* ✓
321	1	L/F CTR SENSOR BRKT	5K0 919 493 G		0% 13.00* ?
637	1	L/F FOG LAMP	5K0 941 699 E		0% M17 115.00* ✓
7061	1	L/F GUIDE JOINT	1K0 407 365 C		0% 60.00* ?

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

7097	1	L/F LEVEL SENSOR	3C0 412 521 B	0%		167.00*	—
319	1	L/F OUT BUMPER BRKT	5K0 807 723 A	0%		18.00*	—
307	1	L/F OUT SENSOR BRKT	5K0 919 491 B	0%		13.00*	—
301	1	L/F PARKING AID SENS	1S0 919 275 C	0%		90.00*	—
			GRU				
7095	1	L/F S-ABSORB BRACKET	1K0 412 249 B	0%		59.00*	7
4661	1	L/F SEAT BELT	1K4 857 705 BK	0%		400.00*	—
			RAA				
7087	1	L/F SHOCK ABSORBER	1T0 413 031 HC	0%		566.00*	—
7091	1	L/F SPRING LEG BRG	1K0 412 331 B	0%		22.00*	—
7047	1	L/F TRACK CONT ARM	1K0 407 151 AC	0%		158.00*	—
7227	1	L/F TYRE	225/40 R 18 .. W	0%		0.00F	—
7201	1	L/F WHEEL	1K0 601 025 BA	0%		0.00F	—
			FZZ				
7131	1	L/F WHEEL HUB/BRG	5K0 498 621	0%		198.00*	—
843	1	L/F W-HOUSE FRT CVR	5K0 805 911 G	0%		50.00*	—
841	1	L/F W-HOUSE RR COVER	5K0 805 977	0%		67.00*	7
741	1	L/F WING	5K6 821 021 B	0%		232.00*	—
4259	1	L/FLOOR PANEL COVER	1K0 825 201 AE	0%		103.00*	—
315	1	L/HEADLAMP MOUNTING	5K0 807 261	0%		62.00*	—
2207	1	L/LOWER SILL TRIM	5K0 853 855 F 9B9	0%		256.00*	—
9565	1	L/R TYRE	225/40 R 18 .. W	0%		0.00F	—
9551	1	L/R WHEEL	1K0 601 025 BA	0%		0.00F	—
			FZZ				
7753	1	L/RADIATOR AIR GUIDE	5K0 121 283 E	0%		14.00*	7
7081	1	L/WHEEL BEARING HSG	1K0 407 255 AA	0%		285.00*	—
761	1	L/WING STRUT	5K6 821 135	0%		16.00*	7
561	1	LEFT HEADLAMP ASSY	5K2 941 753 B	0%		687.00*	—
4325	1	PASSENGER AIRBAG	5K0 880 204 A	0%		1,765.00*	—
462	1	R/DUCT COVER	5K0 955 110 A	0%		19.00*	—
			GRU				
298	1	R/F AIR GUIDE GRILLE	5K0 853 666 C 9B9	0%		53.00*	—
322	1	R/F CTR SENSOR BRKT	5K0 919 493 G	0%		13.00*	7
638	1	R/F FOG LAMP	5K0 941 700 E	0%		115.00*	—
320	1	R/F OUT BUMPER BRKT	5K0 807 724 A	0%		18.00*	—
308	1	R/F OUT SENSOR BRKT	5K0 919 491 B	0%		13.00*	—
4662	1	R/F SEAT BELT	1K4 857 706 BN	0%		370.00*	—
			RAA				
7202	1	R/F WHEEL	1K0 601 025 BA	0%		0.00F	—
			FZZ				
844	1	R/F W-HOUSE FRT CVR	5K0 805 912 E	0%		50.00*	7
842	1	R/F W-HOUSE RR COVER	5K0 805 978	0%		67.00*	7
742	1	R/F WING	5K6 821 022 B	0%		232.00*	—
316	1	R/HEADLAMP MOUNTING	5K0 807 262	0%		62.00*	7
358	1	R/HEADLAMP WASH JET	5K0 955 104 A	0%		47.00*	7
9552	1	R/R WHEEL	1K0 601 025 BA	0%		0.00F	—
			FZZ				
7754	1	R/RADIATOR AIR GUIDE	5K0 121 284 E	0%		14.00*	—
4952	1	R/UPP B-PILLAR TRIM	1K4 867 244 R 6K8	0%		160.00*	7
762	1	R/WING STRUT	5K6 821 136	0%		16.00*	7
562	1	RIGHT HEADLAMP ASSY	5K2 941 754 B	0%		687.00*	—
7435	1	SLIP RING	1K0 959 653 C	0%		170.00*	—
1000	1	SPORT RIM AFTERMKT	Renew	0%		1,000.00*	—
1000	1	WARNING DECAL	Renew	0%		6.50*	—

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

1436	1	WASHER BOTTLE	5K0 955 453 B	0%	<i>De</i>	75.00*	2
1000	1	WASHER JET HOSE	Renew	0%		38.00*	7
1000	1	WASHER JET JOINT 2	Renew	0%		12.00*	?
1000	1	WASHER LEVEL SENSOR	Renew	0%		18.00*	7
1437	1	WASHER PUMP	1K6 955 651	0%		61.00*	7
1000	1	WASHET JET JOINT 1	Renew	0%		8.00*	7
1401	1	WINDSCREEN	5K0 845 011 AB	0%	<i>CR</i>	490.00*	✓
			NVB				
1411	1	WINDSCREEN BOND KIT	D 004 660 M2	0%		0.00F	
1414	1	WINDSCREEN PRIMER	D 009 200 02	0%		0.00F	
f: OEM Parts				Saving		\$2,510.71	
g: Original				Sub Total		\$16,267.00	
h: Secondhand				Mark Up From Cost (5 %)		\$813.35	
p: Parallel				Sundry Parts (Fixed)		\$100.00	
x: Exchange				Total Parts		\$17,180.35	

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
TOP UP AIRCON GAS SPECIALIST	0%	\$50.00
IU BRACKET SPECIALIST		\$10.00
AUDATEX FEE SPECIALIST	0%	\$42.00
W/S SEALANT SPECIALIST		\$40.00
L/F TYRE SPECIALIST	0%	\$185.00
L/R TYRE SPECIALIST		\$185.00
Total Extras		\$512.00

Final Calculation

Total Parts	\$17,180.35
Labour	
Total Panel/Mechanical	\$1,899.80
Total Paintwork	\$887.80
Total Visual Alignment work	\$128.80
Total Labour	\$2,916.40
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$512.00
Total of Additional Costs	\$512.00
Total Paint/Material Costs	\$292.76
Repair Costs Excludes GST	\$20,901.51
Deductions	
Deduction for Excess (Fixed)	-\$1,000.00
Total Deductions	-\$1,000.00
Grand Total Excludes GST (After Deduction)	\$19,901.51
GST @ 7 %	\$1,393.11
Grand Total Includes GST (After Deduction)	\$21,294.62

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Not to Prejudice" basis
- No illegal modification to be allowed
- Supplementary work (if any) must be signed and is subject to the product's insurance company

Acknowledged by: *[Signature]*
 Signature: *[Signature]*
 Date: *[Signature]*

Assessment Notes

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12
