

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AXA17024041/AUA3S2
Date: 03/09/2018

REFERENCE

Handling Insurer: AXA Insurance Pte Ltd Policy No: GA028275
Claimant Vehicle No : SJY4655J **Insured Vehicle No :** SGT8114P
 Date of Loss: 17/12/2017 Nature of Claim: TP Claim No: C0463376

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SJY4655J**
 Make & Model: SUBARU IMPREZA, 1.5 R AWD 5MT ABS AIRBAG (A) Engine No: EL15D578101
 Reg. Date: 06/09/2010 (Man. Year: 2008) Chassis No: JF1GE3KF39G002607
 Colour: Silver Odometer: 37707 km
 Engine Capacity: 1498 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65R15 Rear Tyre Size: 195/65R15
 Front Left Side: Bridgestone 6 mm Rear Left Side: Bridgestone 6 mm
 Front Right Side: Bridgestone 6 mm Rear Right Side: Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	23,887.00	12,515.36	11,371.64	47.61
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,670.00	4,770.00	3,900.00	44.98
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	32,557.00	17,285.36	15,271.64	46.91
Approved Total (Overridden) (S\$)		13,000.00		
Nett Amount (S\$)	32,557.00	13,000.00	19,557.00	60.07
+ Loss of Use (18.0 x S\$60.00/day) (S\$)		1,080.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		14,087.45		

INSPECTION

Date of Assignment: 19/12/2017
 Date Inspected: 18/12/2017 Inspected At: Sm Automotive - Kaki Bukit (HQ)
 Estimated Period of Repair: 14.0 days BLOCK C - 1, KAKI BUKIT AVE 6, #01-43
 Singapore 417883

Adjuster: ADRIAN LING**Manager:** THIN THIN HLAING

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 03 Sep 2018)

Parts: 143 SUBARU IMPREZA 1.5 R AWD 5MT ABS AIRBAG (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SJY4655J)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BONNET (CONSISTENT)	Buckled	648.50 F	*648.50 FL
2	2		*FRONT BONNET HINGE (CONSISTENT)	Not Necessary	96.60 F	*- FL
3	2		*FRONT BONNET SHOCK ABSORBER (CONSISTENT)	Not Necessary	232.40 F	*- FL
4	1		*FRONT BONNET INSULATOR (CONSISTENT)	Crumpled	121.60 F	*121.60 FL
5	8		*FRONT BONNET INSULATOR CLIP (CONSISTENT)	Necessary	52.00 F	*30.00 FL
6	1		*FRONT BONNET LOCK (CONSISTENT)	Damaged	94.30 F	*94.30 FL
7	1		*FRONT BONNET INNER RUBBER (CONSISTENT)	Not Necessary	64.10 F	*- FL
8	1		*FRONT BONNET OUTER RUBBER (CONSISTENT)	Not Necessary	81.80 F	*- FL
9	8		*FRONT BONNET OUTER RUBBER CLIP (CONSISTENT)	Not Necessary	52.00 F	*- FL
10	2		*FRONT HEAD LAMP (CONSISTENT)	Cracked	1,748.40 F	*1,748.40 FL
11	2		*FRONT HEAD LAMP LOWER BRACKET (CONSISTENT)	Cracked	88.60 F	*88.60 FL
12	1		*FRONT GRILLE (CONSISTENT)	Cracked	584.30 F	*584.30 FL
13	1		*FRONT GRILLE CLIP (CONSISTENT)	Necessary	39.00 F	*20.00 FL
14	1	6pcs	*FRONT GRILLE EMBLEM LOGO (CONSISTENT)	Necessary	42.80 F	*42.80 FL
15	1		*FRONT GRILLE CHROME (CONSISTENT)	Cracked	162.80 F	*162.80 FL
16	1		*FRONT BUMPER (CONSISTENT)	Deformed	654.80 F	*654.80 FL
17	8		*FRONT BUMPER CLIP (CONSISTENT)	Necessary	52.00 F	*30.00 FL
18	2		*FRONT BUMPER SIDE RETAINER (CONSISTENT)	Necessary	52.60 F	*52.60 FL
19	1		*FRONT BUMPER NUMBER PLATE (CONSISTENT)	Bent	50.00 F	*50.00 FL
20	1		*FRONT BUMPER TOWING COVER (CONSISTENT)	Not Necessary	29.10 F	*- FL
21	2		*FRONT BUMPER FOG LAMP (CONSISTENT)	Not Necessary	608.80 F	*- FL
22	1		*FRONT BUMPER INNER SPONGE (CONSISTENT)	Deformed	126.40 F	*126.40 FL
23	1		*FRONT BUMPER REINFORCEMENT (CONSISTENT)	Bent	288.40 F	*288.40 FL
24	2		*FRONT BUMPER LOWER BRACKET (CONSISTENT)	Not Necessary	160.60 F	*- FL
25	1		*FRONT FENDER (CONSISTENT)	N/s Buckled	541.00 F	*270.50 FL
26	2		*FRONT FENDER COWLING (CONSISTENT)	Not Necessary	220.80 F	*- FL
27	16		*FRONT FENDER COWLING CLIP (CONSISTENT)	Not Necessary	104.00 F	*- FL
28	1		*FRONT SUPPORT PANEL (CONSISTENT)	Buckled	435.60 F	*435.60 FL
29	2		*FRONT SUPPORT PANEL SIDE AIR DUCT COVER (CONSISTENT)	Not Necessary	256.20 F	*- FL
30	1		*FRONT AIR CLEANER BOX (CONSISTENT)	Not Necessary	261.40 F	*- FL
31	1		*FRONT AIR CLEANER BOX AIR DUCT COVER (CONSISTENT)	Not Necessary	76.30 F	*- FL
32	1		*FRONT AIR-CON CONDENSER (CONSISTENT)	Bent	720.30 F	*720.30 FL
33	1		*FRONT AIR-CON FAN MOTOR ASSY (CONSISTENT)	Not Necessary	499.20 F	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
34	1		*FRONT AIR-CON SECTION PIPE (CONSISTENT)	Not Necessary	220.80 F	*- FL
35	1		*FRONT AIR-CON DISCHARGE PIPE (CONSISTENT)	Not Necessary	270.40 F	*- FL
36	1		*FRONT RADIATOR (CONSISTENT)	Bent	864.00 F	*864.00 FL
37	1		*FRONT RADIATOR FAN MOTOR ASSY (CONSISTENT)	Damaged	487.00 F	*487.00 FL
38	1		*REAR BOOT LID (CONSISTENT)	Buckled	692.80 F	*692.80 FL
39	2		*REAR BOOT LID HINGE (CONSISTENT)	Not Necessary	184.60 F	*- FL
40	1		*REAR BOOT LID EMBLEM LOGO (CONSISTENT)	Necessary	68.40 F	*68.40 FL
41	1		*REAR BOOT LID SUBARU LOGO (CONSISTENT)	Necessary	36.30 F	*36.30 FL
42	1		*REAR BOOT LID IMPREZA LOGO (CONSISTENT)	Necessary	40.30 F	*40.30 FL
43	1		*REAR BOOT LID NUMBER PLATE (CONSISTENT)	Not Necessary	50.00 F	*- FL
44	1		*REAR BOOT LID CENTRE CHROME MOULDING (CONSISTENT)	Not Necessary	336.30 F	*- FL
45	1		*REAR BOOT LID INNER LOCK (CONSISTENT)	Damaged	100.30 F	*100.30 FL
46	1		*REAR BOOT LID INNER RUBBER (CONSISTENT)	Cut	96.80 F	*96.80 FL
47	1		*REAR BOOT LID INNER TRIM BOARD (CONSISTENT)	Not Necessary	264.80 F	*- FL
48	10		*REAR BOOT LID INNER TRIM BOARD CLIP (CONSISTENT)	Not Necessary	65.00 F	*- FL
49	2		*REAR TAIL LAMP (CONSISTENT)	Cracked	776.40 F	*776.40 FL
50	4		*REAR TAIL LAMP CLIP (CONSISTENT)	Necessary	32.00 F	*32.00 FL
51	2		*REAR TAIL LAMP LOWER BRACKET (CONSISTENT)	Not Necessary	56.60 F	*- FL
52	2		*REAR TAIL LAMP PANEL (CONSISTENT)	Repair	317.20 F	*- FL
53	1		*REAR BUMPER (CONSISTENT)	Distorted	654.30 F	*654.30 FL
54	8		*REAR BUMPER CLIP (CONSISTENT)	Necessary	52.00 F	*30.00 FL
55	2		*REAR BUMPER SIDE RETAINER (CONSISTENT)	Necessary	60.60 F	*60.60 FL
56	2		*REAR BUMPER SIDE REFLECTOR (CONSISTENT)	Cracked	320.60 F	*320.60 FL
57	1		*REAR BUMPER TOWING COVER (CONSISTENT)	Deformed	26.30 F	*26.30 FL
58	2		*REAR BUMPER MUD SHIELD (CONSISTENT)	Deformed	137.80 F	*137.80 FL
59	8		*REAR BUMPER MUD SHIELD CLIP (CONSISTENT)	Necessary	52.00 F	*20.00 FL
60	1		*REAR BUMPER REINFORCEMENT (CONSISTENT)	Bent	224.30 F	*224.30 FL
61	1		*REAR L/H FENDER (CONSISTENT)	Repair	1,208.20 F	*- FL
62	2		*REAR FENDER INNER TRIM BOARD (CONSISTENT)	Deformed	585.60 F	*585.60 FL
63	16		*REAR FENDER INNER TRIM BOARD CLIP (CONSISTENT)	Necessary	104.00 F	*60.00 FL
64	1		*REAR END PANEL (CONSISTENT)	Distorted	353.20 F	*353.20 FL
65	1		*REAR END PANEL TOP GARNISH (CONSISTENT)	Deformed	115.20 F	*115.20 FL
66	1		*REAR SPARE TYRE PANEL (CONSISTENT)	Buckled	412.30 F	*412.30 FL
67	2		*REAR SPARE TYRE SIDE PANEL (CONSISTENT)	Repair	200.60 F	*- FL
68	1		*REAR SPARE TYRE PANEL TOP CENTRE SPONGE (CONSISTENT)	Deformed	340.20 F	*340.20 FL
69	2		*REAR SPARE TYRE PANEL TOP SIDE SPONGE (CONSISTENT)	Deformed	232.40 F	*232.40 FL
70	1		*REAR SPARE TYRE PANEL TOP COVER (CONSISTENT)	Deformed	450.20 F	*450.20 FL
71	1		*REAR SPARE TYRE PANEL & END PANEL SEALANT (CONSISTENT)	Necessary	450.00 F	*250.00 FL
72	1		*REAR L/H CHASSIS (CONSISTENT)	Repair	462.30 F	*- FL
73	1		*REAR WINDSCREEN MOULDING (CONSISTENT)	Not Necessary	86.60 F	*- FL
74	1		*REAR EXHAUST (CONSISTENT)	Bent	612.40 F	*612.40 FL
75	1		*REAR CENTRE EXHAUST (CONSISTENT)	Bent	1,044.60 F	*1,044.60 FL
76	1		*REAR EXHAUST ALUMINIUM PIPE (CONSISTENT)	Not Necessary	85.00 F	*- FL
77	4		*REAR EXHAUST MOUNTING (CONSISTENT)	Not Necessary	249.60 F	*- FL
78	1		*REAR BOOT LID CAMERA (CONSISTENT)	Not Necessary	550.00 FS	*- FS
79	1		*REAR BUMPER REVERSE SENSOR (CONSISTENT)	Damaged	350.00 FS	*200.00 FS
80	1		*REAR EXHAUST CHROME PIPE (CONSISTENT)	Bent	160.00 FS	*80.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
81	1		*GUM (CONSISTENT)	Not Necessary	50.00 FS	*- FS
82	1		*GUM (CONSISTENT)	Not Necessary	50.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	23,887.00	15,574.20
- List Item Discount on L Items 0.00/20.00% (\$\$)	0.00	3,058.84
Total Parts (\$\$)	23,887.00	12,515.36

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE & REFIT CUSHION.	New	280.00	200.00
2	TO REMOVE & REFIT REVERSE SENSOR.	New	100.00	50.00
3	TO REMOVE & REFIT REAR CAMERA.	New	180.00	0.00
4	TO REMOVE & REFIT & CENTRE EXHAUST.	New	380.00	160.00
5	TO REMOVE & REFIT REAR WINDSCREEN.	New	120.00	0.00
6	TO REMOVE & REFIT TOP SPOILER.	New	180.00	0.00
7	TO REMOVE & REFIT AIR-CON CONDENSER, RADIATOR, FAN MOTOR & TOP UP GAS.	New	380.00	120.00
8	TO REMOVE & REFIT LH FENDER GLASS.	New	100.00	0.00
9	TOWING FEE.	New	100.00	100.00
10	TUFF KOTE.	New	150.00	80.00
11	TO CHECK WIRING.	New	100.00	60.00
12	PANEL BEATING.	New	3,800.00	2,200.00
13	SPRAY PAINTING.	New	2,800.00	1,800.00
Gross Labour Cost (\$\$)			8,670.00	4,770.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >