408933

Claim Reference: 20170001988 Assessment Number: CTI10125

Version: LKKAUTOC/3

Date Calculated: 30/01/2018 00:44

Full Report - V1 Registration: SGV8921R

Printed: 30/01/2018 08:59

Summary Information

Claim

Location: Singapore (SG) MR LAU Printed by:

Authorisation Status: Interim Work Provider: China Taiping Insurance

20170001988

Claim Reference: Policy Number: Other Reference:

Third Party: Insured Amount: Under Warranty: Warranty Expired: Currency: SGD

Date of Incident: 23/12/2017

Able to Authorise Repairs: TBA Repairs Authorised: **TBA**

Estimated Repair Time: Quote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start:

Hire Car End: Vehicle Collected:

Vehicle Details

Vehicle

Manufacturer: **HONDA** Model: Civic Sub Model: VTI-S Model Sheet Number: H48 38 Registration: SGV8921R

Registration Month: June Registration Year: 2007

VIN Number:

Manufacture Month: June Manufacture Year: 2007 Not Known

Odometer:

Colour:

Engine Number:

Fuel Level:

%

Model Specs

RR PARK DIST CONTROL 1.8 LTR 103 KW **REAR SPOILER**

MUDFLAP

TWO COAT METALLIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Severity of Impact: Vehicle Status on Steering:

DMPCSN3050961700

Inspection:

Brakes Pedal Travel: Date of Inspection: 28/12/2017

Place of Inspection: Pre-Accident Damage:


Tyres Condition: Fair


Tread Depth LHF: Tread Depth RHF: Tread Depth RHR: Tread Depth LHR: Direction of Impact: Damage Areas:

Claim Reference: 20170001988

Assessment Number: CTI10125 Version: LKKAUTOC/3

Date Calculated: 30/01/2018 00:44

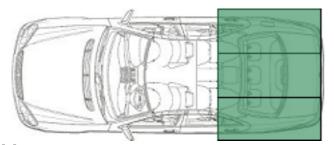

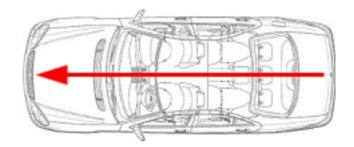

Full Report - V1

Registration: SGV8921R

Printed: 30/01/2018 08:59

Addresses

Cost	Su	mm	ary
------	----	----	-----

Total Labour		\$1,476.60
Total Paint/Material		\$292.65
Total Parts		\$4,172.67
Total of Additional Costs		\$292.00
Repair Cost Exc GST:		\$6,233.92
Overall Discount (0.0%):		- \$0.00
Excess:		-\$250.00
After Deduction -	Grand Total Exc GST:	\$5,983.92
	7 % GST:	\$418.87
	Grand Total Inc GST:	\$6,402.79

Repair Information

LABOUR Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR

		Price/Dent =	= \$46.00/HR
Repair /	v Donais Dataila	VA/11	Cost Dries (¢)
	er Repair Details	WU	Cost Price (\$)
71101-SNB	RENEW COMPLETE FRONT BUMPER	6.0	27.60
	INCLUDES: FRONT BUMPER CPL AND		
NO NUMBER	R + R RADIATOR GRILLE.	2.0	0.20
NO NUMBER	R + R NUMBER PLATE LAMP BULB	2.0	9.20
71501-SNB	RENEW REAR BUMPER	3.0	13.80
NO NUMBER	R + R REAR PARKING AID SENSORS ADD/WORK	3.0	13.80
68500-SNB)	R + R BOOT LID	3.0	13.80
68500-SNB)	RENEW BOOTLID	9.0	41.40
	(REMOVED)		
	INCLUDES: R + R INNER TAILLAMPS, NUMBER		
	PLATE, BADGE, NUMBER PLATE LAMPS AND		
	LOCK		
NO NUMBER	RENEW L/INNER SIDE PANEL CONNECTION	23.0	105.80
NO NUMBER	RENEW R/INNER SIDE PANEL CONNECTION	23.0	105.80
NO NUMBER	R + R REAR END PANEL ATTACHED PARTS	35.0	161.00
	INCLUDES: R + R BUMPER, TAIL LAMP, BOOT		
	TRIM, BOOT FLOOR TRIM, REAR PANEL TRIM,		
	BOOT LOCK AND SEAL		
62100-SMG	RENEW REAR END PANEL CPL	41.0	188.60
9973	CARRY OUT TEST DRIVE	5.0*	23.00
3481	REPAIR L/R SIDE PANEL	10.0*	46.00
3482	REPAIR R/R SIDE PANEL	10.0*	46.00
3900	REPAIR BOOTFLOOR	20.0*	92.00
0411	CHECK GRILL BRACKET		
0412	CHECK GRILLE		
0561	CHECK L/F HEADLAMP CPL		

Claim Reference: 20170001988 Full Report - V1
Assessment Number: CTI10125 Registration: SGV8921R

Version: LKKAUTOC/3 Printed: 30/01/2018 08:59

Date Calculated: 30/01/2018 00:44

4991	CHECK L/R SIDE PANEL TRIM		
4992	CHECK R/R SIDE PANEL TRIM		
8827	CHECK RR EXHAUST SILENCER		
	LABOUR COST		
	Total Work Units	193.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	19.3HRS	\$887.80
	Paint Labour	12.8HRS	\$588.80
	Total Labour	32.1HRS	\$1,476.60
			_

PAINT W	PAINT WORK Time Basis 10 WU = 1 HR. Price = \$46.00/HR			
Guide Nu	umber Description	WU	Cost Price (\$)	
	- TWO COAT METALLIC			
2711	REAR PANEL CPL NEW PART PAINTING	19.0		
2931	BOOTLID NEW PART PAINTING	16.0		
283	FRONT BUMPER NEW PART PAINT K1R	12.0		
2583	REAR BUMPER NEW PART PAINT K1R	13.0		
2587	LOWER BUMPER COVER NEW PART PAINT K1R	3.0		
3481	L/R SIDE PANEL REPAIR PAINTING <50%	15.0		
3482	R/R SIDE PANEL REPAIR PAINTING <50%	15.0		
3900	BOOTFLOOR SURFACE PAINT	9.0		
	LABOUR COST - PAINT			
	TIME(PAINT)	102.0		
	Preparation Main Work Metal	21.0		
	Preparation Comp. Work Plastic	5.0		
	Preparation Work Multi Layer Paint	0.0		
	Total Work Units (10WU/HR)	128.0		
	Total Paintwork Labour	12.8HRS	\$588.80	
	MATERIAL COST - PAINT		Cost Price	
	New Part Painting		\$67.41	
	New Part Painting - Plastic K1R		\$123.48	
	Surface-/Blend Paint		\$28.14	
	Repair Painting		\$46.52	
	Material-Const Main Work Metal		\$18.10	
	Material-Const Comp. Work Plastic		\$9.00	
	Total Excluding Pearlescent Uplift		\$292.65	
	Pearlescent Uplift @ 0.0%		\$0.00	
	Total Paint Material Cost		\$292.65	

PARTS

					Price Valid:	01/06/2015
Guide No	.Qty	Description	Part Number	Supplier	Bet.	Price (\$)
258	1	FRT NO PLATE REINF	KNPL0		0%	35.00*
283	1	FRONT BUMPER	04711SNB010ZZ		0%	601.20*
319	1	L/F UPP BUMPER BRKT	71190SNB000		0%	15.00 *
320	1	R/F UPP BUMPER BRKT	71140SNB000		0%	15.00 *
2583	1	REAR BUMPER	71501SNB010ZB		0%	601.02*
2587	1	LOWER BUMPER COVER	71504SNB000		0%	125.50*
2619	1	L/R BUMPER BRACKET	71598SNAA01		0%	18.07 ∪
2620	1	R/R BUMPER BRACKET	71593SNAA01		0%	18.07 ∪
2621	1	L/R INN BUMPER BRKT	71540SNAA00		0%	13.20*

Claim Reference: 20170001988 Full Report - V1
Assessment Number: CTI10125 Registration: SGV8921R

Version: LKKAUTOC/3 Printed: 30/01/2018 08:59

Date Calculated: 30/01/2018 00:44

2622	1	R/R INN BUMPER BRKT	71540SNAA00		0%	13.20*
2711	1	REAR PANEL CPL	66100SNAA01ZZ		0%	269.50*
2931	1	BOOTLID	68500SNDG00ZZ		0%	530.70*
2944	1	BOOTLID SEAL	74865SNC013		0%	67.40*
2973	1	REAR LOCK STRIKER	74862SE3003		0%	15.56 ∪
2977	1	BOOTLID LOCK	74851SNA003		0%	66.25 ∪
3013	1	BADGE HONDA	75711SNAK01		0%	26.40*
3283	1	L/R INNER LAMP CPL	34156SNB023		0%	204.80*
3284	1	R/R INNER LAMP CPL	34151SNB023		0%	204.80*
3355	1	L/NO PLATE LAMP BULB	33301SNA003HE		0%	2.87 ∪
3356	1	R/NO PLATE LAMP BULB	33301SNA003HE		0%	2.87 U
3372	1	R/NO PLATE LAMP LENS	34106SNB023		0%	7.72 U
3571	1	L/R LAMP PANEL	63720SNBE00ZZ		0%	125.00*
3572	1	R/R LAMP PANEL	63320SNBE00ZZ		0%	125.00*
4907	1	BOOTLID COVER	84620SNBJ01ZA		0%	185.00*
4986	1	SPARE WHEEL COVER	84521SNBE01ZA		0%	258.00*
1000	1	BOOTLID REFLECTER RH	Renew		0%	132.10*
1000	1	BOOTLID REFLECTOR RH	Renew		0%	132.10*
1000	1	BOOTLID WEATHERSTRIP	Renew		0%	67.40*
f: OEM P	arts		Sub Total			\$3,878.73
g: Origin	al		Mark Up Fron	n Cost ((5 %)	\$193.94
h: Secon	dhand		Sundry Parts	(Fixed)	\$100.00
p: Paralle			Total Parts			\$4,172.67
x: Excha	nge					
		ND COLOUD CODED I	FEMC/TOIM DADT NIL	IMPEDC MAY	/ DIEEED	

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description		Betterment	Price
AUDATEX FEE	SPECIALIST	0%	\$42.00
FRONT NO. PLATE	SPECIALIST		\$35.00
REAR NO. PLATE	SPECIALIST	0%	\$35.00
REVERSE SENSOR	SPECIALIST		\$180.00
		Total Extrac	¢202.00

	Total Extras	\$292.00
Final Calculation		
Total Parts		\$4,172.67
Labour		
Total Panel/Mechanical	\$887.80	
Total Paintwork	\$588.80	
Total Labour		\$1,476.60
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$292.00	
Total of Additional Costs		\$292.00
Total Paint/Material Costs		\$292.65
Repair Costs Excludes GST		\$6,233.92
Deductions		
Deduction for Excess (Fixed)	-\$250.00	
Total Deductions		-\$250.00
Grand Total Excludes GST (After Deduction)		\$5,983.92
GST @ 7 %		\$418.87
Grand Total Includes GST (After Deduction)		\$6,402.79

Claim Reference: 20170001988 Full Report - V1
Assessment Number: CTI10125 Registration: SGV8921R

Version: LKKAUTOC/3 Printed: 30/01/2018 08:59

Date Calculated: 30/01/2018 00:44

Assessment Notes