



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

General Details

Involving

1 2007 TOYOTA CAMRY 2.0 (SKA5127A)

Date of Loss

13 January 2018

Time of Loss

12.50

Loss Description

SKA5127A (INSD) > SKR6246T (TP) > SJP7126Y

Comment

Workshop Details

Total Rebate Amount

23493

Nett Loss Amount

\$16,507.00

Assigned Workshop

LKK AUTO CONSULTANTS PTE LTD (OD)

Target Date of Completion *

17/05/2018



Days of work completion *

119



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details Vehicle & Driver Details Vehicle Condition Taxes & Ratio Parts & Labour Miscellaneous

Summary

Vehicle & Driver Details

Vehicle Registration#
SKA5127A

Registration State

SINGAPORE

Mileage

195184

CATEGORY

Manufacturing Year

POLICY INFORMAT... 2007

ASSESSMENT INFO...

2007

Purchase Date

dd/mm/yyyy



Registration Date *

18/09/2007



Age of Vehicle

10

Driver Details

CATEGORY

Driver Name

FNOL INFORMATI...

TAN CHIN POR PHILIP

POST SURVEY INF...

CATEGORY Make

POLICY INFORMAT... TOYOTA

ASSESSMENT INFO... TOYOTA

CATEGORY Model

POLICY INFORMAT... CAMRY 2.0

ASSESSMENT INFO... CAMRY 2.0 AUTO ABS AIRBAG

CATEGORY Type

POLICY INFORMAT...

ASSESSMENT INFO...

CATEGORY Type of Paint

POLICY INFORMAT...

ASSESSMENT INFO...

CATEGORY Chassis No

POLICY INFORMAT... MR053BK4107016818

CATEGORY Date of Birth

FNOL INFORMATI... 18 April 1954

POST SURVEY INF... dd/mm/yyyy

CATEGORY Age

FNOL INFORMATI... 64

POST SURVEY INF...

CATEGORY Occupation

FNOL INFORMATI... Unknown

POST SURVEY INF...

CATEGORY Education Qualification

FNOL INFORMATI... Other

POST SURVEY INF...

CATEGORY Driving Experience

ASSESSMENT INFO...

CATEGORY Engine No

POLICY INFORMAT... 1AZE058834

ASSESSMENT INFO...

CATEGORY Engine Capacity

POLICY INFORMAT...

ASSESSMENT INFO...

CATEGORY Sum Insured

POLICY INFORMAT... 0

ASSESSMENT INFO...

CATEGORY Market Value

POLICY INFORMAT... 0

ASSESSMENT INFO...

FNOL INFORMATI... 40

POST SURVEY INF...

CATEGORY Driver License #

FNOL INFORMATI...

POST SURVEY INF...

CATEGORY License Type

FNOL INFORMATI...

POST SURVEY INF...

CATEGORY License Issue Date

FNOL INFORMATI...

POST SURVEY INF... 

CATEGORY License Expiration Date

FNOL INFORMATI...

POST SURVEY INF... 

CATEGORY Address

FNOL INFORMATI... BLK 331 YISHUN RING ROAD, 760331,
Singapore

POST SURVEY INF...

CATEGORY Address type

FNOL INFORMATI... Residential

POST SURVEY INF...

CATEGORY Gender

FNOL INFORMATI... Male

POST SURVEY INF...

CATEGORY Marital status

FNOL INFORMATI... Married

POST SURVEY INF...

CATEGORY Identification #

FNOL INFORMATI... S0123543E

POST SURVEY INF...



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Detailed Assessment

Inspection Date *

18/01/2018



Total Loss

Yes

No

Towing Charges

0

Voluntary Excess

0

Compulsory Excess

0

Young/Inexperienced/Unnamed Driver Excess

0

Other Excess

Age of Tyres

Front Tyre Size

215/60R16

Condition of Vehicle at time of survey

General condition

Good



Steering (Serviceable)

Yes

No

Footbrake (Serviceable)

Yes

No

Handbrake (Serviceable)

Yes

No

Engine Modification

Yes

No

Pre-accident condition

Good



Tyre Condition

Spare wheel

Rear Tyre Size

215/60R16

Front left side

GOODYEAR2mm

Front right side

GOODYEAR2mm

Rear left side

GOODYEAR6mm

Rear right side

GOODYEAR6mm



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Tax Eligibility & Additional Deduction for Parts

Depr./Bttr%

Salvage%

Discount%

Settlement%

Paint Labour/Material Ratio

Paint Labour Ratio

Paint Material Ratio

Cash Loss

Yes

No

Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Parts

Add

Approve

Deny

	EDIT	SR NO	QUANTITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/ BTTR%	DISC OUNT%	SALV AGE%	PART PRICE(NET)	ACTION (PARTS)
		1	1			BONNET			Buckled	400				400	Review
		2	1			BONNET HINGE LH			Damaged	30				30	Review
		3	1			BONNET HINGE RH			Damaged	30				30	Review
		4	1			BONNET LOCK ASSY			Bent	50				50	Review
		5	1			BONNET DAMPER			Serviceable	0	0	0	0	0	Deny
		6	1			BONNET INSULATOR			Serviceable	0	0	0	0	0	Deny
		7	10			BONNET INSULATOR CLIPS			Necessary	2				20	Review
		8	1			FRONT FENDER LH			Repair	0	0	0	0	0	Deny
		9	1			FRONT FENDER SHIELD LH			Serviceable	0	0	0	0	0	Deny
		10	10			FRONT FENDER SHIELD CLIPS			Serviceable	0	0	0	0	0	Deny
		11	1			FRONT FENDER RH			Repair	0	0	0	0	0	Deny
		12	1			FRONT FENDER SHIELD RH			Serviceable	0	0	0	0	0	Deny

	EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/ BTTR%	DISC OUNT%	SALV AGE%	PART PRICE(NET)	ACTION (PARTS)
		13	10			FRONT FENDER SHIELD CLIPS			Serviceable	0	0	0	0	0	Deny
		14	1			HEADLAMP LH			Cracked	275				275	Review
		15	1			HEADLAMP RH			Cracked	275				275	Review
		16	1			FRONT BUMPER			Cracked	190				190	Review
		17	10			FRONT BUMPER CLIPS			Necessary	1.5				15	Review
		18	1			FRONT BUMPER SIDE RETAINER LH			Damaged	30				30	Review
		19	1			FRONT BUMPER SIDE RETAINER RH			Damaged	30				30	Review
		20	1			FRONT BUMPER UPPER GRILLE CHROME			Damaged	140				140	Review
		21	1			FRONT BUMPER EMBLEM			Necessary	55				55	Review
		22	1			FRONT BUMPER LOWER GRILLE			Serviceable	0	0	0	0	0	Deny
		23	1			FRONT BUMPER TOW COVER			Serviceable	0	0	0	0	0	Deny
		24	1			FOG LAMP LH			Serviceable	0	0	0	0	0	Deny
		25	1			FOG LAMP COVER LH			Damaged	30				30	Review
		26	1			FOG LAMP COVER LINING CHROME LH			Damaged	45				45	Review

	EDIT	SR NO	QUANTITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/ BTTR%	DISCOUNT%	SALVAGE%	PART PRICE(NET)	ACTION (PART)
		27	1			FOG LAMP RH			Serviceable	0	0	0	0	0	Deny
		28	1			FOG LAMP COVER RH			Serviceable	0	0	0	0	0	Deny
		29	1			FOG LAMP COVER LINING CHROME RH			Serviceable	0	0	0	0	0	Deny
		30	1			FRONT BUMPER REINFORCEMENT			Bent	145				145	Review
		31	1			FRONT BUMPER SPONGE			Cracked	50				50	Review
		32	1			SUPPORT PANEL			Bent	310				310	Review
		33	1			SUPPORT PANEL TOP GARNISH			Serviceable	0	0	0	0	0	Deny
		34	10			SUPPORT PANEL TOP GARNISH CLIPS			Necessary	1.4				14	Review
		35	1			RADIATOR ASSY			Damaged	500				500	Review
		36	2			RADIATOR MOUNTING AND RUBBER UPPER			Serviceable	0	0	0	0	0	Deny
		37	2			RADIATOR MOUNTING AND RUBBER LOWER			Serviceable	0	0	0	0	0	Deny
		38	1			AIRCON CONDENSER ASSY			Damaged	350				350	Review
		39	1			AIRCON PIPE DISCHARGE			Serviceable	0	0	0	0	0	Deny
		40	1			AIRCON PIPE SUCTION			Serviceable	0	0	0	0	0	Deny

	EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPRJ BTTR%	DISC OUNT%	SALV AGE%	PART PRICE(NET)	ACTION (PARTS)
		41	1			FRONT BRACE PANEL ASSY			Bent	40				40	Review
		42	1			RADIATOR FAN BLADE			Serviceable	0	0	0	0	0	Deny
		43	1			RADIATOR FAN MOTOR			Damaged	180				180	Review
		44	1			RADIATOR & AIRCON COOLING			Cracked	95				95	Review
		45	1			AIRCON FAN BLADE			Serviceable	0	0	0	0	0	Deny
		46	1			AIRCON FAN MOTOR			Damaged	180				180	Review
		47	1			FAN RESISTANT			Serviceable	0	0	0	0	0	Deny

Labour

Add		Approve		Deny						
EDIT		SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	LABOUR R&R	LABOUR REPAIR	PAINT	ACTION (LABOUR)	COMMENT	RI
		1		ANTI-RUST COATING	0	0	0	Deny		1
		2		PROVIDE SKILL LABOUR TO REMOVE ALL DAMAGED PARTS, PANEL BEAT, CUT & WELD IF NECESSARY AND ALIGN ALL PANEL AND REINSTALL ALL DAMAGED PARTS	700	0	0	Reviewing		1
		3		PROVIDE SKILL LABOUR & MATERIAL TO PUTTY ALL DAMAGED PARTS & PANEL & TO RESPRAY WITH 2K PAINT WITH OVEN SPRAY BOOTH FACILITIES	600	0	0	Reviewing		1
		4		PROVIDE SKILL LABOUR TO DISCONNECT AND CHECK ELECTRICAL WIRING	20	0	0	Reviewing		1

EDIT		SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	LABOUR R&R	LABOUR REPAIR	PAINT	ACTION (LABOUR)	COMMENT	RI
		5		PROVIDE SKILL LABOUR TO REMOVE AND REPLACE AIR-CON CONDENSER, PIPES AND RADIATOR, VACUUM AIR-CON SYSTEM AND REFILL GAS	100	0	0	Reviewing		1

Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Add

Approve

Deny

EDIT

SR
NO

NAME

ACTION

AMOUNT

COMMENT

REMOVE



1

DAYS OF
REPAIR : 6
DAYS

Reviewing



2

RADIATOR
COOLANT

Reviewing

20

NECESSARY



3

FRONT
NUMBER
PLATE WITH
CASING

Reviewing

45

BENT



4

GLUE
SEALANT

Deny

0

NOT NECESSARY



5

BATTERY
TOP
BRACKET

Reviewing

25

DISTORTED
(SUPPLEMENTARY)



6

CHASSIS
BRACKET
LH

Deny

0

NOT NECESSARY



	EDIT	SR NO	NAME	ACTION	AMOUNT	COMMENT	REMOVE
☐		7	CHASSIS BRACKET RH	Deny	0	NOT NECESSARY	
☐		8	DEFLECTOR RADIATOR SIDE LH	Reviewing	45	CRACKED (SUPPLEMENTARY)	
☐		9	REFLECTOR RADIATOR SIDE RH	Reviewing	45	CRACKED (SUPPLEMENTARY)	
☐		10	INLET ASSY, AIR CLEANER	Reviewing	80	CRACKED (SUPPLEMENTARY)	
☐		11	ATF PIPE TO RADIATOR (METAL)- 2PCS	Deny	0	NOT NECESSARY	
☐		12	BONNET RUBBER - 2PCS	Reviewing	56	CUT (SUPPLEMENTARY)	
☐		13	ANTI-RUST COATING	Deny	0	NOT NECESSARY (SUPPLEMENTARY)	

EDIT	SR NO	NAME	ACTION	AMOUNT	COMMENT	REMOVE
						</

EDIT		SR NO	NAME	ACTION	AMOUNT	COMMENT	REMOVE
☐		17	HORN, HIGH PITCH	Reviewing	50	CRACKED (SUPPLEMENTARY)	
☐		18	HORN, LOW PITCH	Reviewing	50	CRACKED (SUPPLEMENTARY)	

Assessment Details

- General & Workshop Details
- Vehicle & Driver Details
- Vehicle Condition
- Taxes & Ratio
- Parts & Labour
- Miscellaneous
- Summary

Claim Amount \$5,343.00

CATEGORY	ESTIMATE	REVISED AMOUNT
Labour	\$1,420.00	\$1,420.00
Spare Parts	\$3,479.00	\$3,479.00
Miscellaneous	\$444.00	\$444.00

Submit for Review