

ASS. REC BY:

REF:

CS/SPF18001231/S rbe2

Special Instruction:

portion

SUMMARY

ASSIGNMENT (Office)From (Person): Lim Wei Yea of SPF Date/Time: 19012018 5:52pm

Estimated Cost: \_\_\_\_\_ Bill to: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CSTo Inspect Vehicle No: YL 9334T Insured: \_\_\_\_\_at Workshop m/s SMART Tel: \_\_\_\_\_of 60 Woodlands Ind Park EstPolicy No: \_\_\_\_\_ Claim No: HOMSPFE TQ 16000399

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

Make of Veh: \_\_\_\_\_ D.O.A. \_\_\_\_\_  
(Client's Record)CA / REV / REP. / REV 24 HRS

H.O.D Endorsement: \_\_\_\_\_

Date/Time: \_\_\_\_\_ Person Contacted: Mr. Kong Vehicle IN OUT

Date/Time	Action/Instruction ( <input checked="" type="checkbox"/> ) Estimate
	<u>YL 9334T - X</u>
	<u>Vehicle is still at Army Base, will be out after two days. Repairer will call to arrange for survey.</u>
	<u>Smt preli thru email.</u>

SPF

Form Date **09/02/2018** File No **YL 9334T** Reg **24 Feb 2005 (2001)**

Estimated Cost: **OD / TP / WS / TP RES / CD RES / EVA / INV / MY**

Truck / Trailer or **Truck / Trailer or**

Make **Mercedes Benz DOG TPT** to **2151**

Colour **Blue / White** A.C. Insured **Std. MIAA**

Se Reading **151608** T-Radio Insured **Std. MIAA**

Eng No **WDB7046222K715495**

Gen Cond. Good / ☒ Fair / Poor / Burnt

Steering ☒ Jammed / Leaked / Burnt or

Brake ☒ Jammed / Leaked / Burnt or

Mod. ☒ / S/Rim / STD A/Rim or

Tyre Size **F: 195/70 R15C** **Michellin**

**Yokohama**

BS / DUN / EXNOVA / GY / FS / LIZA / MIO / OHTSU / PIR / SUM / TOYO / YOKO or

Front: **6** Rear: **6**

R.Bal. **6** L.Bal. **6**

D.O.A. **8/2/18**

Survey held at **20 Sg / cadet Dr**

Des. of Damages **Fr: ☒ Rear: ☒ U.C. ☒ R. ☒**

The U.C. / Chassis frame / Body Structure affected due to collision

Ball or Marker Value

IDAO Accident Report Consistent? : Yes or No

GIA / RP Seen Consistent? : Yes or No


Est. Repairs: days Pass: Yes or No

Lim Sum: % Grant: Yes or No

CA / REV / REP. / 24 HRS

Date Person Contacted

Vehicle IN / OUT

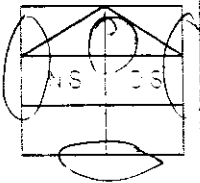

Date Time Action Instruction

**submit Parts : \$0 , Man Hour : 116 hour**

Date Time File Pass / ☐ Preli. Report

**typist**

☒ Final Report

Date Time File Return /

Days Of Repair:

Resurvey No. of Trip

Survey Fee

Inspection

Add Fee: ☐ Site ins: \$

☐ Image: \$

☐ Test: \$

☐ Repair: \$

Report Format:

Lim Sum: \$1000

**200**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTOMOTIVE ENGINEERING & MGT DIVISION

Ref : CS/SPF18001232/Srb

CONTRACT MANAGEMENT SECTION

(SINGAPORE POLICE FORCE)

1 MOUNT PLEASANT ROAD

BLK 8 OLD POLICE ACADEMY SINGAPORE 298333

Date : 20-01-2018



Code : SPF3

## 1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	YL 9334T
Policy No.		Coverage (\$)	0.00
Claim No.	HOMSPFETQ16000399	Excess (\$)	0.00
Assign From	LIM WEI YEA	Assign Date	19/01/2018

## 2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

## 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

## 4. Description of Damages

--	--

## 5. General Information

Accident Date		Inspection Date	22/01/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

## 5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

## Catherine Chong (LKK Auto)

---

**From:** Wei Yea LIM (SPF) <LIM\_Wei\_Yea@spf.gov.sg>  
**Sent:** Friday, 19 January, 2018 5:52 PM  
**To:** assignments  
**Cc:** Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); Perry HE (SPF); Bernard SEAH (SPF); Peng Seng NG (SPF); Rashid ABU HASAN (SPF); 'Ai Phing (LKKAuto)'; 'Shiau Chan (LKKAuto)'  
**Subject:** Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (YL9334T)  
**Attachments:** YL9334T.xlsx

Hi Catherine,

Please provide Appraisal Services for SPF vehicle, **YL 9334T**, at SMRT Automotive Services.  
In attached, please find the recommended Parts and Labour required for the repair of this vehicle.

Kindly contact the following SMRT personnel for viewing of the damaged vehicle:

- Mr Kong Sew Kui
- Mr Jason Yeo

Thank you and best regards,

**WeiYea LIM**  
Contract Management  
AEMD, Police Logistics Department  
Singapore Police Force  
DID: (65) 6478 4844



**HOME TEAM**  
•TRANSFORMATION 2025•  
One Home, One Team  
Building Our Future Together

**WARNING** "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
<b>1</b>	<b>MATERIALS</b>					
1.1	Cabin upholstery (Front & Rear)	2	Deformed	\$ -	\$ -	
1.2	LH rear wheel arc rubber seal	1	Deformed	\$ -	\$ -	
1.3	Compartment rubber seal	1	Necessary	\$ -	\$ -	
1.4	Rear L/H door hinge (Upper & Lower)	2	Bent	\$ -	\$ -	
1.5	Rear L/H door glass moulding	1	Necessary	\$ -	\$ -	
1.6	Rear cabin both inner handle LH & RH	2	Missing	\$ -	\$ -	
<b>2</b>	<b>SCOPE OF REPAIRS</b>					
2.1	Rear L/H compartment door					8
	Repair and align rear L/H compartment door					
	Putty & spray paint rear L/H compartment door					
2.12	Rear L/H wheel arc panel					10
	Panel beat & align rear L/H wheel arc panel					
	Remove & replace rear L/H wheel arc panel rubber seal					
	Putty & spray paint rear LH wheel arc panel					
2.13	Front L/H compartment door					14
	Repair & align front L/H compartment door					
	Cut & weld front L/H compartment dislodged structure					
	Cut & weld front L/H compartment dislodged panel					
	Remove & replace front L/H compartment rubber seal					
	Putty & spray paint front L/H compartment and door					
2.14	Rear R/H wheel arc panel					8
	Repair & align rear R/H wheel arc dislodged panel					
	Putty & spray paint rear R/H wheel arc panel					
2.15	Front R/H compartment door					8
	Repair & align front R/H compartment door					
	Putty & spray paint front R/H compartment door					
2.16	Rear R/H panel					2
	Repair rear R/H panel					
	Putty & spray paint rear R/H panel					
2.17	Rear R/H compartment door					8
	Repair & align rear R/H compartment door					
	Putty & spray paint rear R/H compartment door					
2.18	Front cabin upholstery					2
	Remove & replace front cabin upholstery					
2.19	Front cabin roof top panel					16
	Remove & re-install light bar					
	Remove front cabin roof top panel sealant					
	Cut & weld front cabin roof panel holes					
	Panel beat front cabin roof top dented panel					
	Putty & spray paint complete front cabin roof top panel					
2.20	Rear L/H door					22
	Remove rear L/H door					
	Remove rear L/H door upper & lower hinge					
	Cut & weld rear L/H corroded door frame					
	Cut & weld rear L/H door hinge pillar					
	Cut & weld rear door panel					
	Replace rear L/H door upper & lower hinge					
	Re-install rear L/H door					
	Putty & spray paint rear L/H door & pillar & frame					
	Replace rear L/H door handle					
	Replace rear R/H door handle					
2.23	Rear door					18
	Repair & putty rear R/H door fibre glass panel					
	Putty & spray paint rear both door					
	Remove & replace rear both door rubber casket					
<b>COSTING</b>		<b>TOTAL PARTS COST</b>			<b>\$0.00</b>	
		<b>TOTAL MAN-HOUR</b>				<b>116</b>



Scope Of Work  
Home Team Agency

**SCOPE OF WORK**

**1 To provide labour, materials, transportation, tools and parts and others deemed necessary to carry out the following repairs:**

CONTRACTOR :	SMRT	VEH TYPE :	DOG TPT	UNIT :	DOG UNIT
VEH NO :	YL 9334 T	REPAIR TYPE :	ACCIDENT		
VEH MAKE/MODEL :	MERCEDES BENZ	ODOMETER :	151607		

Reference No.
9334/SPF/4W/18/01/15

S/N	PARTS DESCRIPTION	PART COST (\$)	QTY	Mark Up Rate	Parts Cost Per Unit After Mark Up (\$)	Total Parts Cost Per Unit After Mark Up (\$)
<b>1</b>	<b>Scope Of Repairs</b>					
1.1	Cabin upholstery (Front & Rear) ✓ Deform		2		0.00	0.00
1.2	LH rear wheel arc rubber seal ✓ Deform		1		0.00	0.00
1.3	Compartment rubber seal ✓ NEC		1		0.00	0.00
1.4	Rear L/H door hinge (Upper & Lower) ✓ B7		2		0.00	0.00
1.5	Rear L/H door glass moulding ✓ NEC		1		0.00	0.00
1.6	Rear cabin both inner handle LH & RH ✓ MS		2		0.00	0.00
<b>2</b>	<b>Additional Services</b>					
2.1	NA			0%	0.00	0.00
<b>Remarks:</b>					<b>Parts Total:</b>	<b>\$</b>

S/N	LABOUR DESCRIPTION	Man-Hour Rate (\$)	Man-Hour Qty	Total Man-Hour Cost (\$)
<b>1</b>	<b>Scope Of Repairs</b>			
<b>1</b>	<b>Rear L/H compartment door</b>	4	9	0.00
1.1	Repair and align rear L/H compartment door			
1.2	Putty & spray paint rear L/H compartment door			
<b>2</b>	<b>Rear L/H wheel arc panel</b>	10	12	0.00
2.1	Panel beat & align rear L/H wheel arc panel			
2.2	Remove & replace rear L/H wheel arc panel rubber seal			
2.3	Putty & spray paint rear LH wheel arc panel			
<b>3</b>	<b>Front L/H compartment door</b>	14	18	0.00
3.1	Repair & align front L/H compartment door			
3.2	Cut & weld front L/H compartment dislodged structure			
3.3	Cut & weld front L/H compartment dislodged panel			
3.4	Remove & replace front L/H compartment rubber seal			
3.5	Putty & spray paint front L/H compartment and door			
<b>4</b>	<b>Rear R/H wheel arc panel</b>	8	12	0.00
4.1	Repair & align rear R/H wheel arc dislodged panel			
4.2	Putty & spray paint rear R/H wheel arc panel			
<b>5</b>	<b>Front R/H compartment door</b>	8	8	0.00
5.1	Repair & align front R/H compartment door			
5.2	Putty & spray paint front R/H compartment door			
<b>6</b>	<b>Rear R/H panel</b>	2	6	0.00
6.1	Repair rear R/H panel			
6.2	Putty & spray paint rear R/H panel			
<b>7</b>	<b>Rear R/H compartment door</b>	8	10	0.00
7.1	Repair & align rear R/H compartment door			
7.2	Putty & spray paint rear R/H compartment door			
<b>8</b>	<b>Front cabin upholstery</b>	2	4	0.00
8.1	Remove & replace front cabin upholstery			
<b>9</b>	<b>Front cabin roof top panel</b>	16	19	0.00
9.1	Remove & re-install light bar			
9.2	Remove front cabin roof top panel sealant			
9.3	Cut & weld front cabin roof panel holes			
9.4	Panel beat front cabin roof top dented panel			
9.5	Putty & spray paint complete front cabin roof top panel			
<b>10</b>	<b>Rear L/H door</b>	22	26	0.00
10.1	Remove rear L/H door			
10.2	Remove rear L/H door upper & lower hinge			
10.3	Cut & weld rear L/H corroded door frame			
10.4	Cut & weld rear L/H door hinge pillar			
10.5	Cut & weld rear door panel			
10.6	Replace rear L/H door upper & lower hinge			
10.7	Re-install rear L/H door			
10.8	Putty & spray paint rear L/H door & pillar & frame			
11	Replace rear L/H door handle			
12	Replace rear R/H door handle			
<b>13</b>	<b>Rear door RH</b>	18	20	0.00
13.1	Repair & putty rear R/H door fibre glass panel			
13	Putty & spray paint rear both door			




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation International Insurance Co. Ltd. (FIA) Automobile				
AUTOMOTIVE ENGINEERING & MGT DIVISION		Ref : CS/SPF18001232/Srbe2		
CONTRACT MANAGEMENT SECTION (SINGAPORE POLICE FORCE) 1 MOUNT PLEASANT ROAD BLK 8 OLD POLICE ACADEMY SINGAPORE 298333		Date : 06-03-2018		
		Code : SPF3		
<b>1. Policy Particulars - OWN DAMAGE</b>				
Insured Veh.	Veh. Inspected		YL 9334T	
Policy No.	Coverage (\$)		0.00	
Claim No. HOMSPFETQ16000399	Excess (\$)		0.00	
Assign From LIM WEI YEA	Assign Date		19/01/2018	
<b>2. Vehicle Particulars - Condition</b>				
Make & Model	MERCEDES BENZ DOG TPT	c.c	2151	
Engine No.	HIDDEN	Year of Reg.	2005	
Chassis No.	WDB9046222R715495	Colour	BLUE/WHITE	
Odometer	151608	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	195/70 R15C	MICHELIN	6 mm	
L/H Front Tyre	195/70 R15C	MICHELIN	6 mm	
R/H Rear Tyre	195/70 R15C	YOKOHAMA	6 mm	
L/H Rear Tyre	195/70 R15C	YOKOHAMA	6 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S, N/S BODY, REAR AND ROOFTOP PORTION. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	Inspection Date		08/02/2018	
Survey held at	2B SUNGEI KADUT DR			
Repairer	SMRT AUTOMOTIVE SERVICES PTE LTD			
<b>5a. Remarks</b>				



Auto  
Consultants  
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Registration No. YL 9334T

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
<b>1</b>	<b>MATERIALS</b>					
1.1	Cabin upholstery (Front & Rear)	2	Deformed	\$ -	\$ -	
1.2	LH rear wheel arc rubber seal	1	Deformed	\$ -	\$ -	
1.3	Compartment rubber seal	1	Necessary	\$ -	\$ -	
1.4	Rear L/H door hinge (Upper & Lower)	2	Bent	\$ -	\$ -	
1.5	Rear L/H door glass moulding	1	Necessary	\$ -	\$ -	
1.6	Rear cabin both inner handle LH & RH	2	Missing	\$ -	\$ -	
<b>2</b>	<b>SCOPE OF REPAIRS</b>					
<b>2.1</b>	<b>Rear L/H compartment door</b>					<b>8</b>
	Repair and align rear L/H compartment door					
	Putty & spray paint rear L/H compartment door					
<b>2.12</b>	<b>Rear L/H wheel arc panel</b>					<b>10</b>
	Panel beat & align rear L/H wheel arc panel					
	Remove & replace rear L/H wheel arc panel rubber seal					
	Putty & spray paint rear LH wheel arc panel					
<b>2.13</b>	<b>Front L/H compartment door</b>					<b>14</b>
	Repair & align front L/H compartment door					
	Cut & weld front L/H compartment dislodged structure					
	Cut & weld front L/H compartment dislodged panel					

	Remove & replace front L/H compartment rubber seal					
	Putty & spray paint front L/H compartment and door					
<b>2.14</b>	<b>Rear R/H wheel arc panel</b>					<b>8</b>
	Repair & align rear R/H wheel arc dislodged panel					
	Putty & spray paint rear R/H wheel arc panel					
<b>2.15</b>	<b>Front R/H compartment door</b>					<b>8</b>
	Repair & align front R/H compartment door					
	Putty & spray paint front R/H compartment door					
<b>2.16</b>	<b>Rear R/H panel</b>					<b>2</b>
	Repair rear R/H panel					
	Putty & spray paint rear R/H panel					
<b>2.17</b>	<b>Rear R/H compartment door</b>					<b>8</b>
	Repair & align rear R/H compartment door					
	Putty & spray paint rear R/H compartment door					
<b>2.18</b>	<b>Front cabin upholstery</b>					<b>2</b>
	Remove & replace front cabin upholstery					
<b>2.19</b>	<b>Front cabin roof top panel</b>					<b>16</b>
	Remove & re-install light bar					
	Remove front cabin roof top panel sealant					
	Cut & weld front cabin roof panel holes					
	Panel beat front cabin roof top dented panel					
	Putty & spray paint complete front cabin roof top panel					
<b>2.20</b>	<b>Rear L/H door</b>					<b>22</b>
	Remove rear L/H door					
	Remove rear L/H door upper & lower hinge					
	Cut & weld rear L/H corroded door frame					
	Cut & weld rear L/H door hinge pillar					
	Cut & weld rear door panel					
	Replace rear L/H door upper & lower hinge					
	Re-install rear L/H door					
	Putty & spray paint rear L/H door & pillar & frame					
	Replace rear L/H door handle					
	Replace rear R/H door handle					
<b>2.23</b>	<b>Rear door</b>					<b>18</b>
	Repair & putty rear R/H door fibre glass panel					
	Putty & spray paint rear both door					
	Remove & replace rear both door rubber casket					
<b>COSTING</b>		<b>TOTAL PARTS COST</b>			<b>\$0.00</b>	
		<b>TOTAL MAN-HOUR</b>				<b>116</b>

**Registration No. YL 9334T**

**Vehicle Inspected By**

**YEANG WAI KEEN**  
*Automotive Assessor*

**ADRIAN LING WAI PING**  
*B.Eng, AMSOE, AMIRTE, AMSAE-A, M. MATAI*  
*Licensed Appraiser*

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.