


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SMB49X
 Ref. No : BUS/01/18/1033
 Reg. Date : 24/01/2018
 Vehicle Type : BUS -12M
 Make : MBOC500 (MERCEDES)
 Model : MERCEDES MBOC500
 Name of Driver : Raja Muhammad Khaled Bin Raja Basir
 Type of Accident : SIDE SWIPE
 Date / Time of Accident : 19/01/2018 12:45:00 PM
 Accident Reported Date / Time : 22/01/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by : MSIG
 Vehicle is Towed Back? : No
 Towed Back Date/Time : 19/01/2018
 Replacement Vehicle issued? : No
 Accident Repair Job Card No :
 Special Instruction to ARC, if any :
 smb49x - right view mirror broken
 yn7665r(tp) insured with MSIG
 Prepared Date : 24/01/2018 11:24:03 AM

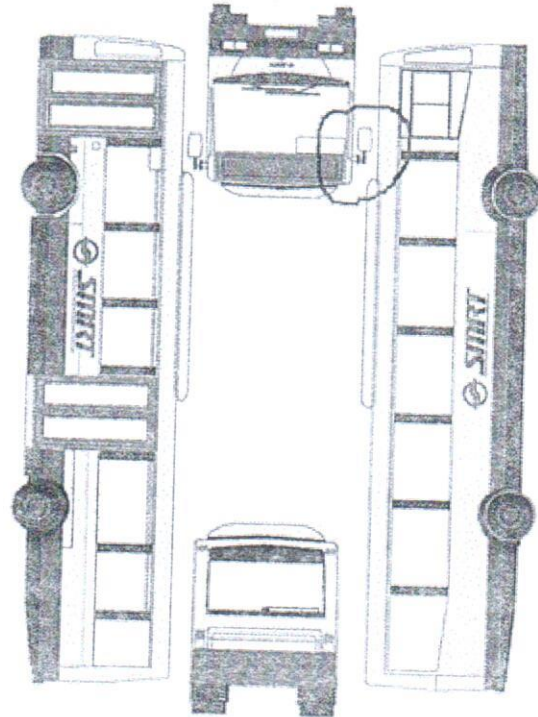

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Sebastian

25/1/18.

- Lump Sum Repair.

- Photo After Paint

96036121

sebastianyeang@lkkauto.com.