

21/03/2006 **PRS**
 ASS. REC. BY: REF: MSG17012728 C 00-1 large
 Surveyor: Richard **ASSIGNMENT (Office)**
 From (Person): Lionel Tan of MSG Date/Time: 13-02-2018
 Estimated Cost: _____ Bill to: _____
 OD ☒ TP ☐ WS ☐ TP RES / OD RES / EVA / INV / MV / CS
 To Inspect Vehicle No: FBG44220 Insured: SABISIE
 at Workshop m/s Hiap Lek Automobile Tel: 96601743
 of BK14 Sg Ming 2nd Off #01-19
 Policy No: 027746210 GMY Claim No: 520489
 Sum Insured: _____ Excess: _____
 Make of Veh: _____ D.O.A. 28/6/2017
 (Client's Record)
 CA / REV / IEP. / REV 24 HRS sup 3/7/2017
 Date/Time 30/6/2017 3:00pm Person Contacted: Han Wei Vehicle IN/OUT

Date/Time	Action/Instruction (*) Estimate	Do Not Finalize
	FBG44220 *	
	SABISIE - 666/01011017747 / K-121102	RM - 12/5/2017
07/24/17 10:31am	Send email inform Lionel Tan we can't estimate by ourselves	
	Repair Range \$2K - 3K (2 days)	
	Diagnose Part: 06/07/2017	
	After repair: 24/07/2017	

20/2/18 Submit LS \$3350, 3 days (Red \$1750, 34%)


 19/2/2018

TOTAL

28/8/2017



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MSIG INSURANCE (SINGAPORE) PTE LTD		Ref : CS3/MSG17012728/qb-1	
16 RAFFLES QUAY #24-01 HONG LEONG BLDG SINGAPORE 048581		Date : 14-02-2018	
		Code : MSG	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SQ 8151E	Veh. Inspected	FBG 4422D
Policy No.	D27746210QMX	Coverage (\$)	0.00
Claim No.	520489	Excess (\$)	0.00
Assign From	MERIMEN (LIONEL TAN)	Assign Date	13/02/2018
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	28/06/2017	Inspection Date	14/02/2018
Survey held at	HIAP LEK AUTOMOBILE TRADING BLK 14 #01-19 SECTOR B SIN MING INDUSTRIAL ESTATE SINGAPORE 575658.		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

S/N	Description	Qty	Condition	Original Quotation	Revised Quotation
	<u>Material</u>				
1	Handle bar front cover	1 pc	Cracked	120.00	120.00
2	Handle bar	1 pc	Bent	90.00	90.00
3	Handle balancer	1 set	Grazed	32.00	32.00
4	Brake reservoir pump	1 pc	Grazed	110.00	110.00
5	Brake lever @ \$22/-	1/2 pcs	Bent OS	44.00	44.00
6	Mirror @\$65/-	1/2 pcs	Grazed OS	130.00	130.00
7	Front cowling	1 pc	Cracked	360.00	360.00
8	Cowling screen	1 pc	Scratches	220.00	220.00
9	Meter assy	1 pc	Usable	320.00	0.00
10	Counter shield	1 pc	Cut/grazed	312.00	312.00
11	Headlamp top garnish (SYM)	1 pc	Cracked	55.00	55.00
12	Headlamp	1 pc	Hdr cracked	380.00	380.00
13	Front signal @\$140/-	1/2 pcs	Grazed OS	280.00	280.00
14	Front mudguard	1 pc	Cracked	95.00	95.00
15	Front fork assy @ \$300/-	2 pcs	Bent	600.00	600.00
16	Fork under bracket	1 pc	Bent	220.00	220.00
17	Front rim	1 pc	Bent	350.00	350.00
18	Front rim shaft	1 pc	Bent	35.00	35.00
19	Front brake disc	1 pc	Warped	150.00	150.00
20	Radiator	1 pc	Dented	350.00	350.00
21	Radiator cover	1 pc	Cracked/grazed	98.00	98.00
22	Lower fairing @\$175/-	2 pcs	Grazed OS	350.00	350.00
23	Under cover tray	1 pc	Deformed	80.00	80.00
24	Rear footrest	1 pc	Bent Rh	30.00	30.00
25	Tail board Rh	1 pc	Grazed	180.00	180.00
26	Exhaust protector (Front)	1 pc	Bent	35.00	35.00
27	Exhaust protector (Rear)	1 pc	Dented	80.00	80.00
28	Exhaust muffler assy	1 pc	Dented	680.00	680.00
				5786.00	5466.00
			Less 10% discount	578.60	546.60
				5207.40	4919.40
	<u>Special nett</u>				
29	Front number plate	1 pc	Necessary	12.00	10.00
30	Steering bearing & cone	1 pc	Necessary	55.00	27.50
31	Brake fluid	1 bot	Necessary	35.00	35.00
32	Coolant	1 bot	Necessary	50.00	50.00
33	Tailboard "GTS 200" sticker	1 set	Necessary	24.00	24.00
34	Rear rack	1 pc	Bent	150.00	120.00
35	Rear box	1 pc	Grazed	300.00	280.00
	Towing fee (Two ways)			60.00	50.00
	Check electrical			80.00	60.00
	Spraying painting			600.00	500.00
	Labour charges			400.00	350.00
				6973.40	6425.90
	Lump sum repair adjustment				5100.00

3 days

OH APPRAISAL SERVICES

Vehicle No: FBG4422D

Our Ref : FBG4422D/TP5081

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS

The information contained in this document is privileged and confidential and is intended for the exclusive use of the addressee designation. If you are not the addressee: any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this document not meant for you, please contact us immediately to arrange for it to return.



A handwritten signature in ink, appearing to be "C. C. C." or similar, written over a horizontal line.

For Oh Appraisal Services

...CLAIM SUBFOLDER...(Pending for Survey Report)

Paper Survey

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	28 Jun 2017		30 Jun 2017 15:04 Edit Adj Rpt	S\$3,350.00 Edit Estimates	S\$3,350.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
----------------------	---------------------------	-------------------------------	---------------------------	--------------------------

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	TAN PEI SZE CECILIA, ID: S7519071I, Tel: +6597654330, Email: SH313HS@SINGNET.COM.SG		
Main Claimant:	TYAU WEI KIT, ID: S8685656E		
Vehicle Reg. No.:	FBG4422D	Date of Loss:	28/06/2017 08:00 - :59
Claim Type:	TP / 520489	Policy/Cover Note No.:	D27746210QMX (Comprehensive) Coverage: 28/07/2016 - 27/07/2017
Vehicle Reg. No. (Insured):	SQ8151E	Policy No. (Claimant):	
		Excess:	S\$300.00
Repairer:	Hiap Lek Automobile Trading () Blk 14 #01-19 Sector B, Sin Ming Industrial Est, 575658 Sin Ming - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Lionel Tan Tian Pei - 6643 1307]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Richard Harjanto] ... [Final Rpt due 15/02/2018]		
Driver/Custodian (Insured):	TAN HIM CHYE (67 / Male), NRIC: S0166312G		
Adj Asg. Remarks:	Please contact the workshop directly @ 6453 1743 to arrange for survey		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- MSIG_SG (13/02/2018): Report Send Back Alerts - FBG4422D (TP)

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***FBG4422D (520489)**
[SQ8151E]
TP
TYAU WEI KIT
Jun 28 2017 8:00AM
[TAN PEI SZE CECILIA]
Hiap Lek Automobile Trading

Upload Documents | Upload Photos | Compose New Letter

View View in Browser ▼

Photos/Images			3 per page ▼	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	21/07/17 16:23	General View	 Load JPG	☒
2	21/07/17 16:23	General View	 Load JPG	☒
3	21/07/17 16:23	General View	 Load JPG	☒
4	21/07/17 16:23	General View	 Load JPG	☒
5	21/07/17 16:23	General View	 Load JPG	☒
6	21/07/17 16:23	General View	 Load JPG	☒
7	21/07/17 16:23	General View	 Load JPG	☒
8	21/07/17 16:23	General View	 Load JPG	☒
9	21/07/17 16:23	General View	 Load JPG	☒
10	21/07/17 16:23	General View	 Load JPG	☒
11	21/07/17 16:23	General View	 Load JPG	☒
12	21/07/17 16:23	General View	 Load JPG	☒
13	21/07/17 16:23	General View	 Load JPG	☒
14	21/07/17 16:23	General View	 Load JPG	☒
15	21/07/17 16:23	General View	 Load JPG	☒
16	21/07/17 16:23	General View	 Load JPG	☒
17	21/07/17 16:23	General View	 Load JPG	☒
18	21/07/17 16:23	General View	 Load JPG	☒
19	21/07/17 16:23	General View	 Load JPG	☒
20	21/07/17 16:23	General View	 Load JPG	☒
21	21/07/17 16:23	General View	 Load JPG	☒
22	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
23	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
24	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
25	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
26	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
27	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
28	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
29	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
30	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
31	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
32	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
33	21/07/17 16:28	Reinspection Photo	 Load JPG	☒
34	21/07/17 16:28	Reinspection Photo	 Load JPG	☒

			1		☒
35	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
36	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
37	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
38	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
39	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
40	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
41	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
42	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
43	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
44	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
45	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
46	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
47	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
48	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
49	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
50	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
51	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
52	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
53	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
54	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
55	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
56	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
57	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
58	21/07/17 16:28	Reinspection Photo	1	Load JPG	☒
59	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
60	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
61	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
62	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
63	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
64	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
65	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
66	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
67	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
68	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
69	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
70	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
71	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
72	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
73	26/07/17 17:31	Photo After Spray	1	Load JPG	☒
74	26/07/17 17:32	Photo After Spray	1	Load JPG	☒
75	26/07/17 17:32	Photo After Spray	1	Load JPG	☒
Documentation			1 per page ▼	☒	
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print
1	29/06/17 16:55	OI SQ8151E GIA REPORT	1	Load PDF	
2	30/06/17 15:05	Pre-Repair Survey	1	Load PDF	
3	12/02/18 15:58	TPD & TPI FBG4422D - SURVEY REPORT & TAX INVOICE	1	Load PDF	
4	12/02/18 15:58	TPD & TPI FBG4422D - COLOUR PHOTO	1	Load PDF	

5	12/02/18 15:58	TPD & TPI FBG4422D - COLOUR PHOTO		Load PDF	
6	12/02/18 15:58	TPD & TPI FBG4422D - COLOUR PHOTO		Load PDF	
7	12/02/18 15:58	TPD & TPI FBG4422D - COLOUR PHOTO		Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	13/07/17 16:37	TP GIA REPORT		Load PDF	
2	22/02/18 15:46	Invoice		Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST

ResetSavePrint

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG17012728/CQBE2-1
Date: 22/02/2018

REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	D27746210QMX
Claimant Vehicle No :	FBG4422D	Insured Vehicle No :	SQ8151E
Date of Loss:	28/06/2017	Nature of Claim:	TP
		Claim No:	520489

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBG4422D	Engine No:	KB608866
Make & Model:	SYM GTS 200, 172cc	Chassis No:	RFGLM18WXCS001677
Reg. Date:	16/07/2012 (Man. Year: 2012)	Odometer:	43188 km
Colour:	Black		
Engine Capacity:	172 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	110-90/13	Rear Tyre Size:	130-70/12
Front Left Side:	Maxxis 2 mm	Rear Left Side:	Maxxis 2 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,833.40	3,787.10	2,046.30	35.08
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,140.00	430.00	710.00	62.28
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	6,973.40	4,217.10	2,756.30	39.53
Approved Total (Overridden) (S\$)		3,350.00		
Nett Amount (S\$)	6,973.40	3,350.00	3,623.40	51.96

INSPECTION

Date of Assignment:	30/06/2017	
Date Inspected:	03/07/2017	Inspected At: Hiap Lek Automobile Trading Blk 14 #01-19 Sector B, Sin Ming Industrial Est Singapore 575658
Estimated Period of Repair:	3.0 days	

Adjuster: Richard Harjanto

Manager: CATHERINE CHONG KAI LING

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS**Reference**

Part Source: (Last Synchronised: 22 Feb 2018)

Parts: N/A SYM GTS 200 172cc (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for FBG4422D)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*HANDLE BAR FRONT COVER	Cracked	120.00 FL	*120.00 FL
2	1		*HANDLE BAR	Bent	90.00 FL	*90.00 FL
3	1		*SET HANDLE BALANCER	Grazed	32.00 FL	*32.00 FL
4	1		*BRAKE RESERVOIR PUMP	Grazed	110.00 FL	*110.00 FL
5	1		*BRAKE LEVER	O/S Bent	44.00 FL	*22.00 FL
6	1		*MIRROR	O/S Grazed	130.00 FL	*65.00 FL
7	1		*FRONT COWLING	Cracked	360.00 FL	*360.00 FL
8	1		*COWLING SCREEN	Scratched	220.00 FL	*220.00 FL
9	1		*METER ASSY	Usable	320.00 FL	*- FL
10	1		*COUNTER SHIELD	Cut / Grazed	312.00 FL	*312.00 FL
11	1		*HEADLAMP TOP GARNISH (SYM)	Cracked	55.00 FL	*55.00 FL
12	1		*HEADLAMP	Holder Cracked	380.00 FL	*380.00 FL
13	1		*FRONT SIGNAL	O/S Grazed	280.00 FL	*140.00 FL
14	1		*FRONT MUDGUARD	Cracked	95.00 FL	*95.00 FL
15	2		*FRONT FORK ASSY	Bent	600.00 FL	*600.00 FL
16	1		*FORK UNDER BRAKET	Bent	220.00 FL	*220.00 FL
17	1		*FRONT RIM	Not Necessary	350.00 FL	*- FL
18	1		*FRONT RIM SHAFT	Bent	35.00 FL	*35.00 FL
19	1		*FRONT BRAKE DISC	Not Necessary	150.00 FL	*- FL
20	1		*RADIATOR	Dented	350.00 FL	*350.00 FL
21	1		*RADIATOR COVER	Cracked / Grazed	98.00 FL	*98.00 FL
22	1		*LOWER FAIRING	O/S Grazed	350.00 FL	*175.00 FL
23	1		*UNDER COVER TRAY	Deformed	80.00 FL	*80.00 FL
24	1		*REAR FOOTREST	Bent	30.00 FL	*30.00 FL
25	1		*TAIL BOARD RH	Grazed	180.00 FL	*180.00 FL
26	1		*EXHAUST PROTECTOR (FRONT)	Bent	35.00 FL	*35.00 FL
27	1		*EXHAUST PROTECTOR (REAR)	Dented	80.00 FL	*80.00 FL
28	1		*EXHAUST MUFFLER ASSY	Not Necessary	680.00 FL	*- FL
29	1		*FRONT NUMBER PLATE	Necessary	12.00 FS	*10.00 FS
30	1		*BRAKE FLUID	Necessary	35.00 FS	*20.00 FS
31	1		*COOLANT	Necessary	50.00 FS	*30.00 FS
32	1		*SET TAILBOARD GTS 200 STICKER	Necessary	24.00 FS	*24.00 FS
33	1		*REAR RACK	Not Necessary	150.00 FS	*- FS
34	1		*REAR BOX	Grazed	300.00 FS	*180.00 FS
35	1		*STEERING BEARING & CONE	Necessary	55.00 FS	*27.50 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	6,412.00	4,175.50
- List Item Discount on L Items 10.00/10.00% (S\$)	578.60	388.40
Total Parts (S\$)	5,833.40	3,787.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	CHECK ELECTRICAL	New	80.00	20.00
2	SPRAYING PAINTING	New	600.00	200.00
3	LABOUR CHARGES	New	400.00	180.00
4	TOWING FEE (TWO WAYS)	New	60.00	30.00
Gross Labour Cost (\$\$)			1,140.00	430.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >