



Your Ref : DM18HO00552

Date: 09th March 2018

Our Ref : CS/EQI18003980/Uqd3s2

M/s EQ Insurance Company Ltd

5 Maxwell Road
#17-00 Tower Block
MND Complex
Singapore 069110
(The Motor Claims Department)

Dear Sirs/Madam,

**AUTOMOBILE INSPECTION REPORT OF ACCIDENT VEHICLE GBE 3352P
ACCIDENT ON 23/02/2018**

Instruction was received to inspect the vehicle Reg. No. GBE 3352P. The inspection was conducted on 01/03/2018 at the premises of M/s Soc Leon Motor Works, 1 Kaki Bukit Ave 6 Blk D #01-91 Autobay @ Kaki Bukit Singapore 417883.

The following vehicle information was recorded:

Registration Number	: GBE 3352P
Make/Model	: Toyota Hiace (M)
Year of Registration	: 2015
Body Colour	: White
Chassis Number	: KDH2010172813
Engine Capacity	: 2982 cc
Speedometer Reading	: Battery Flat

The vehicle sustained damages at the front portion and rooftop. The undercarriage and chassis frame affected due to collision. (Details see photographs enclosed)

In view of this, we are of the opinion that it would be **uneconomical** to proceed with the repairs due to extensive repair cost and recommend it to be written off as **"Total Loss"**.

Market Value	S\$ 60,000.00
Less: LTA Reimbursement Value (RV)	(S\$ 33,647.00)
Nett Liability	<u>S\$ 26,353.00</u>

Vehicle Inspected By:



CHUA KANG SENG
Licensed Appraiser

K.K.LAU
MSc(Eng M), B Eng(Hons), Peng(UK),
MASME(USA), B Bus(Aust), MBA(UK),
IEng(UK), MII(mech), MinstAEA, MFIEA,
MIRTE, MIMI, MSAE, MCIARD, AM, NIJAAR(USA),
AM CATARI(CAN), M.MATA(USA), M.MdATA(USA),
Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.