51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

408933

Claim Reference: SNM18D01044C01 Assessment Number: CCA00352

Version: LKKAUTOC/5

Date Calculated: 03/05/2018 08:20

Full Report - V1 Registration: SJQ930H Printed: 03/05/2018 15:21

Summary Information

Claim

Location: Singapore (SG)
Printed by: LKK AUTO
Authorisation Status: Interim

Work Provider: China Taiping Insurance

(S) Pt

Claim Reference: SNM18D01044C01
Policy Number: DMPCSN1214511705

Other Reference: OD/18056

Third Party: Insured Amount: Under Warranty: Warranty Expired: Currency: SGD

Date of Incident: 25/02/2018

Able to Authorise Repairs: TBA Repairs Authorised: TBA

Estimated Repair Time:
Quote Due Date:
Actual Repair Days:
Parts Ordered Date:
Hire Car Start:
Hire Car End:

Hire Car End: Vehicle Collected:

Vehicle Details

Vehicle

Manufacturer: HONDA
Model: Stream
Sub Model: LS
Model Sheet Number: H36 01
Registration: SJQ930H
Registration Month: April
Registration Year: 2009

VIN Number: RN61085237

Manufacture Year: 2008 Odometer: 148263 Colour: Other

Engine Number: R18A1794548

Fuel Level: %

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Good Steering: Satisfactory

Brakes Pedal Travel: Satisfactory

Axles

Place of Inspection: Owner

Pre-Accident Damage:

Tyres Condition: Good

Tyres - Tread Depth (MM):

Left Tyre Right Tyre

Depth Depth

 LHF
 0
 7.0
 7.0
 RHF

 LHR
 1
 2.0
 2.0
 RHR

Damage Areas: Direction of Impact:

Model Specs

AUTO AIR CON ELECT DOOR MIRRORS FOG LAMPS

PAINTED DOOR HANDLES PAINTED DOOR MIRRORS

TOW BAR

AUTOMATIC GEARBOX PAINTING OFF VEHICLE

Severity of Impact:

Date of Inspection:

Vehicle Status on

Inspection:

TINTED WINDOWS
NAVIGATION SYSTEM
DRIVER SEAT ARMREST

1.7 LTR 92 KW

Heavy Panel

Roadworthy

26/02/2018

TWO COAT METALLIC


51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore


Claim Reference: SNM18D01044C01

Assessment Number: CCA00352

Version: LKKAUTOC/5

Date Calculated: 03/05/2018 08:20

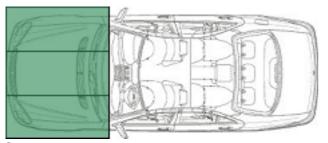

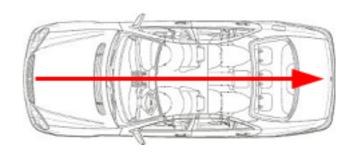

Full Report - V1

Registration: SJQ930H

Printed: 03/05/2018 15:21

Addresses

Cost	Sum	mary
------	-----	------

Total Labour		\$949.20
Total Paint/Material		\$187.26
Total Parts		\$3,943.00
Total of Additional Costs		\$152.00
Repair Cost Exc GST:		\$5,231.46
Overall Discount (0.0%):		- \$0.00
Excess:		-\$850.00
After Deduction -	Grand Total Exc GST:	\$4,381.46
	7 % GST:	\$306.70
	Grand Total Inc GST:	\$4,688.16

Repair Information

LABOUR	Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR

Repair /		Price/ Delic	– \$ 1 2.00/11K
	er Repair Details	WU	Cost Price (\$)
75700-S5A)	R + R FRONT BADGE	3.0	12.60
NO NUMBER	R + R BONNET	3.0	12.60
74111-S7A	R + R LOWER ENGINE PROTECTION	3.0	12.60
76840-S7A)	R + R FRONT WIPER RESERVOIR	3.0	12.60
	(BUMPER REMOVED)		
38100-SX0	R + R LOW TONE HORN	2.0	8.40
38150-ST7)	R + R HIGH TON HORN	2.0	8.40
60211-S7A	R + R L/F WING	10.0	42.00
	INCLUDES: $R + R$ FRONT BUMPER, HEADLAMP		
	AND WHEELHOUSE COVER		
60211-S7A)	R + R R/F WING	5.0	21.00
	(BUMPER REMOVED)		
	DOES NOT INCLUDE: R + R WHEELHOUSE		
	COVER		
	AND HEADLAMP		
04695-S7A	RENEW FRONT PANEL CPL	27.0	113.40
19010-PNA)	R + R RADIATOR CPL	16.0	67.20
80100-S7A)	R + R AIR CONDITIONING CONDENSER	2.0	8.40
80322-S7A)	R + R COMPRESSOR/EVAPORATOR HOSE	1.0	4.20
NO NUMBER	REFILL + VENT AIR CONDITIONING	10.0	42.00
0471	REPAIR BONNET	10.0*	42.00
0741	REPAIR L/F WING	10.0*	42.00
0742	REPAIR R/F WING	10.0*	42.00
0637	CHECK L/F FOG LAMP		
0638	CHECK R/F FOG LAMP		

LABOUR COST

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D01044C01 Full Report - V1
Assessment Number: CCA00352 Registration: SJQ930H

Version: LKKAUTOC/5 Printed: 03/05/2018 15:21

Date Calculated: 03/05/2018 08:20

Total Work Units	117.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	11.7HRS	\$491.40
Paint Labour	10.9HRS	\$457.80
Total Labour	22.6HRS	\$949.20

PAINT WO	INT WORK Time Basis 10 WU = 1 HR. Price = \$4		
Guide Nun	nber Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
340	FRT BUMPER BRACKET SURFACE PAINT	4.0	
1009	FRONT PANEL CPL SURFACE PAINT	7.0	
283	FRONT BUMPER NEW PART PAINT K1R	12.0	
412	RADIATOR GRILLE TRIMNEW PART PAINT K1R	4.0	
471	BONNET REPAIR PAINTING >50%	30.0	
741	L/F WING REPAIR PAINTING >50%	16.0	
742	R/F WING REPAIR PAINTING >50%	16.0	
1251	L/F SIDE MEMBER SURFACE PAINT	4.0	
	LABOUR COST - PAINT		
	TIME(PAINT)	93.0	
	Preparation Main Work Metal	11.0	
	Preparation Comp. Work Plastic	5.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	109.0	
	Total Paintwork Labour	10.9HRS	\$457.80
	MATERIAL COST - PAINT		Cost Price
	New Part Painting - Plastic K1R		\$61.01
	Surface-/Blend Paint		\$22.91
	Repair Painting		\$76.24
	Material-Const Main Work Metal		\$18.10
	Material-Const Comp. Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$187.26
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$187.26

					Price Valid:	01/06/2015
Guide No	.Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER	71101S7AG00ZE		0%	390.00*
317	1	L/F OUT BUMPER BRKT	71198S7A000		0%	18.00*
318	1	R/F OUT BUMPER BRKT	71193S7A000		0%	18.00*
319	1	L/F UPP BUMPER BRKT	71190S7A000		0%	32.00*
320	1	R/F UPP BUMPER BRKT	71140S7A000		0%	32.00*
340	1	FRT BUMPER BRACKET	71130S7AE01ZZ		0%	185.00*
410	1	GRILLE	71121S7A003ZE		0%	165.00 *
412	1	RADIATOR GRILLE TRIM	71122S7A003ZE		0%	160.00*
431	1	GRILLE BADGE	75700S5PE00		0%	23.00*
561	1	L/F HEADLAMP CPL	33151S7AE01		0%	450.00*
562	1	R/F HEADLAMP CPL	33101S7AE01		0%	450.00*
1009	1	FRONT PANEL CPL	60400S7A306ZZ		0%	360.00*
4465	1	CONDENSER	80100S7A305		0%	500.00*

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D01044C01 Full Report - V1
Assessment Number: CCA00352 Registration: SJQ930H

Version: LKKAUTOC/5 Printed: 03/05/2018 15:21

Date Calculated: 03/05/2018 08:20

4.400			00000		201	
4482	1	RETURN PIPE	803229		0%	210.00*
7761	1	RADIATOR	19010P		0%	850.00*
f: OEM Pa				Sub Total	(0.0/)	\$3,843.00
g: Origina h: Second				Mark Up From Cost	(0 %)	\$0.00 #100.00
p: Parallel	-			Sundry Parts Fotal Parts	(Fixed)	\$100.00
x: Exchan				IOLAI PAILS		\$3,943.00
X. LXCHall	ye	NR - COLOLID	CODED ITEMS/TD	IM - PART NUMBERS	MAY DIFFED	
Extras		ND - COLOUR	CODED TIEMS/TK.	IM - FART NOMBERS	MAI DITTER	
ZXC. GO		Description		Betterment		Price
		AUDATREX FEES	SPECIALIST	0%		\$42.00
		NUM PLATE &	SPECIALIST			\$40.00
		HOLDER				,
		ANTI-FREEZE	SPECIALIST	0%		\$20.00
		COOLANT				
		AIR-CON GAS	SPECIALIST			\$50.00
				Total Extras		\$152.00
Final Ca		ation				
Total Par	ts					\$3,943.00
Labour						
		l Panel/Mechanical			\$491.40	
		l Paintwork			\$457.80	
Total Lab		_				\$949.20
Additiona			1		40.00	
		Prot Materials Extern	-		\$0.00	
		Prot Materials Intern	aı		\$0.00	
Total of A		of Specialist			\$152.00	\$152.00
		aterial Costs				\$187.26
	-	Excludes GST				\$187.26 \$5,231.46
Deductio		excludes GS1			-	\$5,231.40
Deductio	_	uction for Excess (Fix	red)		-\$850.00	
Total Dec			(cu)		φοσοίου	-\$850.00
		xcludes GST (After	Deduction)			\$4,381.46
		@ 7 %	,	-		\$306.70
Grand To		ncludes GST (After	Deduction)			\$4,688.16
		•	-			

Assessment Notes