

ASS. REC. BY:

REF: CS / III 18004252 / Ard3

Special Instruction:

Survey of
Mulm

Adrian

ASSIGNMENT (Office)

From (Person):

Gabriel Wee

of

II

Date/Time:

5/3/18 @ 5:23pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

WYX 5867

Insured:

SHC2633A

at Workshop m/s

C & L Automotive

Tel:

92327457

of

1 Kaki Bukit Ave 6 #02-11 Autobuy

Policy No:

Claim No:

KSG / 4605 / 2018 / W / ct

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A

01/03/2018

CA / REV / REP. / REV 24 HRS

1up

H.O.D. Endorsement:

Date/Time:

9:43am 36/3/18

Person Contacted:

Ah xian

Vehicle

IN / OUT

Date/Time

Action/Instruction

(✓)

Estimate

WYX 5867x

SHC2633A - CCB / III 15015237 / F19352

D.O.A: 4/9/15

Contin L15 \$18K, 21 days

Red: \$14,527.43, 45%.

III

ASSIGNMENT

Date 6/3/18

Estimated Cost

GO/TP/WS/TP/RES/GO/RES/EVA/INV/MV

To inspect vehicle No WYX 5867

at/for name C & L Automotive

at 1kaki Bukit Ave 6 # 02-11

Insured

Policy No

Damage No

Sum Insured

Excess

Client's Record

11h xian @ 9232 7157

Make of Van

Policy Condition

Remarks: The van had commenced its repair at the time of inspection.

NS	OS

Est. of Market Value

CAC Accident Point Consistent? Yes or No

CA - PP Seen Consistent? Yes or No

Est. Repairs days Rep Yes or No

Est. Sum to 3 Yes or No

CA / REV / REP / 24 HRS w/p

Date Person Contacted Vehicle IN OUT

Date Time Action/ Instruction

TP III

* Malaysia car no G111

MV: 55K (RM)

≈ 18K (Sing Dollar)

RECEIVED 13 APR 2018

Check The File Pass of

by put

☐ Prelim. Report
☒ Final Report

Days Of Repair

21

Resurvey No. of This

2

Check The File Return of

Add Fee

☐ Estimate
☐ Repair
☐ Test
☐ Repack

Report Format

TP

Est. Sum → 18K

WYX 5867

2013 Sept

Time of Day 10:00pm Even Van Lorry Taxi Panna Motor

Trade Trail and

Make

Toyota Prius C

1497

Color

Silver

Insured Std N / N2

Chassis No

73835

Insured Std N / N2

Eng No

JTDKD383101545009

C No

Gen Cond Good Fair Poor Bad

Steering Good Jammed Locked Burnt

Brake Good Jammed Locked Burnt

Mod Nil SR STD ARUM

Tyre Size

185/60R15

R

185/60R15

BE/DUN/EXNOVA GT/PS/LIZA/MIO/OHTU/PIR/SUM

TOYO/YOKO

Kumho

Front

Rear

R.Ba

06

R.Ba

06

L.Ba

06

L.Ba

06

O.D.A

O.D

06/03/18

Survey Price

Cand L

Des of Damages Rt Rear OS NS UC Roofed

The U.C - Chassis/frame Body Structure affected due to 30%

450



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

INDIA INTERNATIONAL INSURANCE PL

Ref : CS/III18004252/Ard3

64 CECIL STREET
#05-02 IOB BUILDING SINGAPORE 049711

Date : 06-03-2018



Code : III2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 2633A	Veh. Inspected	WYX 5687
Policy No.		Coverage (\$)	0.00
Claim No.	KSG/4605/2018/W/ct	Excess (\$)	0.00
Assign From	GABRIEL WEE	Assign Date	06/03/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	01/03/2018	Inspection Date	06/03/2018
Survey held at	-		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

-Nivitha (LKK Auto)

From: Motor Claim - III <motorclaim@iii.com.sg>
Sent: Monday, 5 March 2018 5:23 PM
To: Cindy Tan; 'sur@lkkauto.com'; Catherine Chong (LKK Auto)
Cc: Sundari Nagarajan - III
Subject: RE: Yref: SHC 2633A Oref: KSG/4605/2018/W/ct

Dear Sir / Mdm,

Please conduct a survey on TP vehicle WYX5867 and let us have your report urgently.

This claim will be handled by Ms Sundari.

*Kindly upload this survey request email to merimen.

Thank You.

Best Regards,

Gabriel Wee

Motor Claims Dept.

India International Insurance Pte Ltd

64 Cecil Street | #05 IOB Building | Singapore 049711

Tel: 6347 6100, Ext - 248

From: Cindy Tan [mailto:cindy.tan@kannansg.com.sg]
Sent: 05 March, 2018 3:24 PM
To: Motor Claim - III <motorclaim@iii.com.sg>
Subject: RE: Yref: SHC 2633A Oref: KSG/4605/2018/W/ct

Dear Sirs / Mdm

WITHOUT PREJUDICE

RE: PROPERTY DAMAGE CLAIM

CLAIMANT: WILLIAM NICHOLAS BRODIE (FIN NO. F2745938L)

ACCIDENT INVOLVING VEH NO. WYX 5867 & SHC 2633A AT THE JUNCTION OF TELOK BLANGAH ROAD & ALEXANDRA ROAD ON 1 MARCH 2018 AT 2300 HRS

PRE-REPAIR INSPECTION NOTICE

We refer to the above matter and to your email of even date.

We are instructed to propose using Mr Adrian Ling from LKK Auto Consultants Pte Ltd as the single joint expert as listed in your said email.

Kindly contact Ah Xian – 9232 7457 to arrange for the pre-repair inspection soonest possible.

Regards

Cindy Tan

M/S KANNAN SG

Advocates & solicitors

50 Chin Swee Road

#08-03 Thong Chai Building

Singapore 169874

TEL: (+65) 6429 0253
FAX: (+65) 6223 1660

IMPORTANT: THIS E-MAIL IS INTENDED ONLY FOR THE USE OF THE ADDRESSEE AND MAY CONTAIN CONFIDENTIAL INFORMATION AND/OR MAY BE COVERED BY PROFESSIONAL PRIVILEGE. IT MUST NOT BE READ, USED OR DISCLOSED BY ANY PERSON OTHER THAN THE ADDRESSEE(S) NAMED. IF YOU HAVE RECEIVED THIS E-MAIL IN ERROR, PLEASE NOTIFY US IMMEDIATELY BY TELEPHONE (COLLECT INTERNATIONAL CALL IF APPROPRIATE) AT (+65) 6429 0252 OR BY E-MAIL AND DELETE THE E-MAIL IMMEDIATELY. THANK YOU.

From: Motor Claim - III [<mailto:motorclaim@iii.com.sg>]
Sent: Monday, 5 March, 2018 1:36 PM
To: Cindy Tan
Subject: RE: Yref: SHC 2633A Oref: KSG/4605/2018/W/ct

Dear Sir / Mdm,

We acknowledge receipt of your email.

We propose using one of the following motor surveyors:

- LKK Auto Consultants Pte Ltd
- Vicom Assessment Centre Pte Ltd

Please notify us within 02 days of receipt of this letter for surveyor agreed on or if you have any objections to the above list.

Best Regards,

Gabriel Wee

Motor Claims Dept.

India International Insurance Pte Ltd

64 Cecil Street | #05 IOB Building | Singapore 049711

Tel: 6347 6100, Ext - 248

From: Cindy Tan [<mailto:cindy.tan@kannansg.com.sg>]
Sent: 05 March, 2018 9:55 AM
To: Motor Claim - III <motorclaim@iii.com.sg>
Subject: RE: Yref: SHC 2633A Oref: KSG/4605/2018/W/ct

Dear Sirs / Mdm

WITHOUT PREJUDICE

RE: PROPERTY DAMAGE CLAIM

CLAIMANT: WILLIAM NICHOLAS BRODIE (FIN NO. F2745938L)

ACCIDENT INVOLVING VEH NO. WYX 5867 & SHC 2633A AT THE JUNCTION OF TELOK BLANGAH ROAD & ALEXANDRA ROAD ON 1 MARCH 2018 AT 2300 HRS

PRE-REPAIR INSPECTION NOTICE

We act for Mr William Nicholas Brodie, the owner of motor vehicle No. WYC 5867, which was involved in the aforesaid accident.

As a result of the accident, our client's vehicle has been damaged. Before our client proceeds to repair the damaged vehicle, please let us know within 2 working days of your receipt of this notice whether you would like to conduct a pre-repair survey of the vehicle at our clients' workshop. The details are as follows:-

Place: M/s C & L Automotive LLP
1 Kaki Bukit Avenue 6
#02-11 Autobay@Kaki Bukit
Singapore 417883

Contact Person: Ah Xian – 9232 7457

If we do not receive any reply from you within the stipulated timeline, our client shall proceed to repair the vehicle without further reference to you.

Kindly revert.

Regards

Cindy Tan

M/S KANNAN SG
Advocates & solicitors
50 Chin Swee Road
#08-03 Thong Chai Building
Singapore 169874

TEL: (+65) 6429 0253

FAX: (+65) 6223 1660

IMPORTANT: THIS E-MAIL IS INTENDED ONLY FOR THE USE OF THE ADDRESSEE AND MAY CONTAIN CONFIDENTIAL INFORMATION AND/OR MAY BE COVERED BY PROFESSIONAL PRIVILEGE. IT MUST NOT BE READ, USED OR DISCLOSED BY ANY PERSON OTHER THAN THE ADDRESSEE(S) NAMED. IF YOU HAVE RECEIVED THIS E-MAIL IN ERROR, PLEASE NOTIFY US IMMEDIATELY BY TELEPHONE (COLLECT INTERNATIONAL CALL IF APPROPRIATE) AT (+65) 6429 0252 OR BY E-MAIL AND DELETE THE E-MAIL IMMEDIATELY. THANK YOU.

Kindly note that by submitting this claim to us, you are deemed to have agreed to us collecting, using, disclosing and processing your personal data, sharing your personal data with our service providers (located both inside and outside Singapore) and/or with other insurers in the general insurance industry, including the General Insurance Association of Singapore. This enables us to ensure proper processing, handling and/or dealing with your claim, which includes investigating the said claim, and complying with applicable laws. If you do not agree to the same, kindly let us know immediately.

DISCLAIMER:

This email is intended solely for the person to whom it has been addressed.

It may contain confidential and/or legally privileged information.

If you are not the person for whom this e-mail was intended, or if this e-mail has reached you by mistake, please delete it immediately and inform us of the error and also be hereby notified that any use, distribution, transmission, printing, copying or dissemination of this information in any way or in any manner is strictly prohibited and may be unlawful. Internet communications may not be entirely secure or accurate as information could be intercepted, corrupted, lost, delayed or contain viruses.

Therefore, we do not accept liability for any errors or omissions in the content of this message or any delay in delivery which may arise as a result of Internet transmission or any modification.

Print this email only if it is absolutely necessary and help in preservation of environment.

India International Insurance Pte Ltd.

Registration No. 198703792-K

Kindly note that by submitting this claim to us, you are deemed to have agreed to us collecting, using, disclosing and processing your personal data, sharing your personal data with our service providers (located both inside and outside Singapore) and/or with other insurers in the general insurance industry, including the General Insurance Association of Singapore. This enables us to ensure proper processing, handling and/or dealing with your claim, which includes investigating the said claim, and complying with applicable laws. If you do not agree to the same, kindly let us know immediately.

DISCLAIMER:

This email is intended solely for the person to whom it has been addressed.

It may contain confidential and/or legally privileged information.

If you are not the person for whom this e-mail was intended, or if this e-mail has reached you by mistake, please delete it immediately and inform us of the error and also be hereby notified that any use, distribution, transmission, printing, copying or dissemination of this information in any way or in any manner is strictly prohibited and may be unlawful. Internet communications may not be entirely secure or accurate as information could be intercepted, corrupted, lost, delayed or contain viruses.

Therefore, we do not accept liability for any errors or omissions in the content of this message or any delay in delivery which may arise as a result of Internet transmission or any modification.

Print this email only if it is absolutely necessary and help in preservation of environment.

India International Insurance Pte Ltd.

Registration No. 198703792-K



SINGAPORE POLICE FORCE



T/20180302/2123

DRIVER

1 of 3

Police Station Of Origin:

Eunos NPP

629 Bedok Reservoir Road #01-1620

SINGAPORE 470629

Tel No: 1800-4439999

Report No. T/20180302/2123

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 02/03/2018 16:57	Vide Report No.: D/20180301/0150	Station Diary No.: 42
--	-------------------------------------	--------------------------

Informant's Particulars

Name of Informant: WILLIAM NICHOLAS BRODIE			Address: APT BLK 4 HOLLAND CLOSE #03-23 PODIUM B, 2ND STOREY, ITE SINGAPORE 271004		
ID Type / ID No.: FIN NO / F2745938L			Contact No.: Home/Office:		

General Information of the Accident

Type of Accident:	Non-Injury Foreign Vehicle	Drink Drive: No	Date/Time of Accident: 01/03/2018 23:00	Type of Location: X-Junction
Location: Junction of Road 1 and Road 2 TELOK BLANGAH ROAD ALEXANDRA ROAD At the junction of Telok Blangah Road and Alexandra Road				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow: Two Way		Traffic Control: Traffic Light - Working		Traffic Volume: Light
Type of Collision: Between Moving Vehicles - Head To Side				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No. of Passenger
SHC2633A	Car	TOYOTA	PRIUS	Blue	Seriously Damaged	0
WYX5867	Car	TOYOTA	PRIUS C	Silver	Seriously Damaged	1

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



SINGAPORE POLICE FORCE



T/20180302/2123

2 of 3

Report No. T/20180302/2123

Police Station Of Origin:

Eunos NPP

629 Bedok Reservoir Road #01-1620

SINGAPORE 470629

Tel No: 1800-4439999

CONTINUATION OF REPORT

Name	Unknown	ID No.	NIL
Related Vehicle	SHC2633A (Car)	Contact No.	NIL
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	WILLIAM NICHOLAS BRODIE	ID No.	F2745938L
Related Vehicle	WYX5867 (Car)	Contact No.	86911609
Hospital/Clinic	ALEXANDRA HOSPITAL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	02/03/2018	Date Discharge	02/03/2018
No. of Days granted Medical Leave	03	Degree of Injury	Slight

Brief Details.

On 01/03/2018 at 2300hrs, I was driving along Telok Blangah Road towards Pasir Panjang Road. I was driving straight on the first lane that was going straight, while I was at the junction of Telok Blangah Road and Alexandra road, the traffic light was green and I proceed to drive straight. A Car bearing the registration number of SHC2633A was making a illegal right turn from Pasir Panjang Road to Labrador Road. The vehicle then hit on to my side of the vehicle and my car then spin and roll backwards, thus hitting the curb and the traffic light lamppost and came to a stop. Both parties then exchanged particulars and called for police. The driver also admitted that he was in the wrong as there is a sign stating that no right turn is allowed. I wish to state that this is the first time such an incident happen to me. I also like to state that I suffered bruises and pain on my back and neck. I was given 3 days of MC, My car suffered damage on the right side of the vehicle.



**SINGAPORE
POLICE FORCE**



T/20180302/2123

3 of 3

Police Station Of Origin:
Eunos NPP
629 Bedok Reservoir Road #01-1620
SINGAPORE 470629
Tel No: 1800-4439999

Report No. T/20180302/2123

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report: G / Sgt 2 CHUA CHANG YU <i>CC</i>	Signature Of Informant: <i>[Signature]</i>
Signature Of Interpreter: Not applicable	Date/Time: 02/03/2018 16:57
Officer In Charge Of Case: TP / AEIT / Sgt 2 YEO KIA HUAT Contact No.: 65476325	Classification Of Case:
Authentication Stamp NP168	<div style="border: 1px solid black; padding: 5px; text-align: center;"> SINGAPORE POLICE FORCE <i>CC</i> SIGNATURE</div>



Policy Schedule

Page 3 of 5

THE SCHEDULE
JADUALPRIVATE MOTOR CAR INSURANCE POLICY
POLISI INSURANS KERETA PERSENDIRIAN

NAME OF INSURED / NAMA PIHAK DIINSURANSKAN WILLIAM NICHOLAS BRODIE 6EJLN PERMAS 9/7, BANDAR BARU PERMAS JAYA, 81750 JB JOHOR TEL: 6586911609		POLICY NUMBER / NOMBOR POLISI R0096835	
		ACCOUNT NUMBER / NOMBOR AKAUN 123223140	
		PERIOD OF INSURANCE / TEMPON INSURANS From / Dari: 21/12/2017 To / Hingga: 29/12/2018	
(both dates inclusive / termasuk kedua-dua tarikh)			
Financial Interest <u>Keperluan Keagamaan</u> CIMB ISLAMIC BANK BERHAD Business Registration No./NRIC No. No. Pendaftaran Perniagaan No. E.P. Business/Profession Perniagaan/Pekerjaan Vehicle Use Keperluan Kenderaan		Bank Ref/Branch No. Bilik/Bank Cawangan	
: 800830-11-5963			
: 12 BANK/FINANCIAL INSTITUTION			
: PRIVATE CAR			
Cover <u>Perfudangan</u>	: COMPREHENSIVE	Make/Model <u>Buatan/Jenis Roda</u>	: TOYOTA PRIUS C
Log Book No. <u>No. Buku Log</u>	:	Vehicle Registration No. <u>No. Pendaftaran Kenderaan</u>	: WYX5867
Chassis No. <u>No. Chasis</u>	: JTDK1330310545009	Year of Manufacture <u>Tahun Diperbuat</u>	: 2013
Engine No. <u>No. Enjin</u>	: 1N2R049944	Cubic Capacity <u>Kemampuan Enjin</u>	: 1497 CAPACITY
Seating Capacity Including <u>Driver</u> <u>Muatan Tempatan Duduk</u> <u>Termasuk Pemandu</u>	: 5	Excess <u>Lebihan</u>	: RM 0.00
<u>Named Driver / Pemandu yang Ditertaklukkan</u>			
THE INSURED			
Your Estimate Value Including Accessories: <u>Nilai Anggaran Anda Termasuk Aksesori</u>		RM 55000.00	
Basic Premium <u>Premi asas</u>		RM 1453.07	
Additional Benefits/Extensions: <u>Facility Tambahan/Lanjutan</u>			
		Annual Premium <u>Premi Tahunan</u>	RM 1453.08
Replacing Cover Note No. <u>Menggantikan No. Nota Perlindungan</u> YAS09G29		Premium Payable <u>Premi Yang Dibayar</u>	RM 1453.08
Salesman ID : 10001872		Stamp Duty <u>Duit Setem</u>	RM 10.00
		Good and Services Tax <u>Cukai Barangan Dan Perkhidmatan</u>	RM 87.18
		Amount Due <u>Amount Perlu Dibayar</u>	RM 1550.26

**SIJIL PEMILIKAN KENDERAAN**

JABATAN PENGANGKUTAN JALAN

00RK51VM

No. Pendaftaran : WYX5867
No. ID : 800830135963
Nama Pemunya Berdaftar : WILLIAM NICHOLAS BRODIE
Alamat : LOT 3142 JLN FICUS KPG LUAK 3 WIRI
98000 SARAWAK SARAWAK

No. Chasis/No. Enjin : JTDKD3B3101545009 / 1NZR048944
Buatan/Nama Model : TOYOTA / TOYOTA PRIUS C 1.5L (A)
Keupayaan Enjin : 1497
Bahan Bakar : PETROL
Status Asal : KENDERAAN IMPORT BARU
Kelas Kegunaan : PERSENDIRIAN-MOTOKAR INDIVIDU
Jenis Badan/Tahun Dibuat : MOTOKAR / 2013
Tarikh Pendaftaran : 12/09/2013
B. D. M/B. G. K/BTM : -
Syarat Pendaftaran 1 : -
Syarat Pendaftaran 2 : -
Syarat Pendaftaran 3 : -

C & L AUTOMOTIVE LLP

1 KAKI BUKIT AVE 6 #02-11 AUTOBAYBAY @ KAKI BUKIT SINGAPORE 417883

HP: 9786 4483 @AH SIONG / HP: 9232 7457 @AH XIAN Fax: 6758 3325

Email: cl_automotive@yahoo.com

TP 111
Jince

Vehicle No.: WYX 5867

Model: Toyota Prius

QTY	DESCRIPTION	AMT S\$
	<u>List Items</u>	
1	Front door -R/H <i>Distorted</i>	\$ 1,265.60 ✓
1	Front door inner trim board <i>caulked</i>	\$ 780.10 ✓ 568
1	Front door lock <i>Jammed</i>	\$ 415.40 ✓
1	Front door outer handle <i>not in</i>	\$ 178.50 x
1	Front door regulator <i>Angled</i>	\$ 191.40 ✓
1	Front door regulator motor <i>not in</i>	\$ 647.90 x
1	Front door rubber <i>cut</i>	\$ 245.40 ✓
1	Centre pillar -R/H <i>Dented</i>	\$ 655.90 ✓
1	Centre pillar inner garnish <i>not in</i>	\$ 198.00 x
1	Rocker panel -R/H <i>Distorted</i>	\$ 485.00 ✓
1	Rear door R/H <i>Distorted</i>	\$ 1,265.50 ✓
1	Rear door checker <i>not in</i>	\$ 68.50 x
1	Rear door glass outer moulding <i>not in</i>	\$ 115.00 x
2	Rear door hinges <i>Bent</i>	\$ 157.00 ✓
1	Rear door inner trim board <i>caulked</i>	\$ 780.90 ✓ 592
1	Rear door inner lock <i>Jammed</i>	\$ 455.20 ✓
1	Rear door outer handle <i>not in</i>	\$ 169.50 x
1	Rear door glass regulator <i>Angled</i>	\$ 291.40 ✓
1	Rear door glass regulator motor <i>not in</i>	\$ 647.90 x
1	Rear door rubber <i>cut</i>	\$ 243.40 ✓
1	Rear door step garnish <i>not in</i>	\$ 171.30 x
1	Roof top panel inner trim <i>crumpled</i>	\$ 2,337.50 ✓ 1586
1	Roof top panel side air bag	\$ 2,835.00 ✓
1	Air bag control unit <i>Activated</i>	\$ 2,419.00 ✓
1	Driver seat with air bag	\$ 1,950.00 ✓
1	Rear safety belt <i>not in</i>	\$ 895.80 x
1	Rear taillamp -R/H <i>not in</i>	\$ 440.50 x
1	Rear bumper <i>Delivered</i>	\$ 885.00 ✓
1	Rear bumper clip (1 set) <i>not in</i>	\$ 55.00 30
1	Rear bumper side retainer <i>not in</i>	\$ 64.00 ✓
1	Rear side chassis member <i>Paint</i>	\$ 561.90 x
1	Rear exhaust silencer <i>Bent</i>	\$ 822.70 ✓
2	Rear exhaust mountings <i>not in</i>	\$ 97.90 x
1	Rear exhaust heat shield <i>not in</i>	\$ 42.20 x
1	Centre exhaust pipe <i>Bent</i>	\$ 2,534.70 ✓
		\$ 25,370.00 985

c/f: \$ 25,370.00

List Items

1	Rear fender -R/H <i>Dischd</i>	\$	1,081.60 ✓
1	Rear fender inner shield <i>Don</i>	\$	124.10 ✓
1	Rear fender inner shield clip (1 set) <i>Don</i>	\$	50.00 ✓
1	Rear fender inner trim board <i>Don</i>	\$	692.40 ✓
1	Rear wheel hub with bearing <i>Don</i>	\$	781.70 ✓
1	Rear shock absorber <i>Don</i>	\$	441.50 ✓
1	Rear axle beam <i>Don</i>	\$	2,017.50 ✓
1	Rear axle beam bush <i>Don</i>	\$	185.50 ✓
1	Rear brake hose <i>Don</i>	\$	80.00 ✓
1	ABS sensor <i>Don</i>	\$	245.00 ✓
1	Rear fuel tank <i>Don</i>	\$	1,365.60 ✓
1	Hand brake cable <i>Don</i>	\$	175.00 ✓
		\$	32,609.90
		Less 25%	\$ 8,152.48
			\$ 24,457.43

25349.40
19012.05

Special Nett Items

1	Front door black tape <i>Don</i>	\$	120.00 <i>60</i>
1	Rear door black tape <i>Don</i>	\$	120.00 <i>60</i>
1	Rear tyre <i>at</i>	\$	400.00 <i>200</i>
1	Rear sport rim -R/H <i>at</i>	\$	750.00 <i>400</i>
1	Centre pillar black tape <i>Don</i>	\$	120.00 <i>60</i>
		\$	1,510.00

780

S/N. Labour Charges

1	To remove, replaced damaged lamps and check up rear wiring.	\$	80.00 <i>30</i>
2	To remove and refit roof top lining and interior upholstery.	\$	180.00 <i>120</i>
3	To remove and refit rear reverse sensor.	\$	120.00 <i>50</i>
4	To remove and refit rear undercarriage.	\$	450.00 <i>300</i>
5	To conduct wheel alignment.	\$	180.00 <i>80</i>
6	To mount vehicle onto the chassis alignment bench.	\$	450.00 <i>X</i>
7	To remove, replace door damaged parts & transfer fittings to new door.	\$	350.00 <i>160</i>
8	To apply tuff kite.	\$	200.00 <i>80</i>
9	Panel beating.	\$	1,800.00 <i>1600</i>
10	To respray painting.	\$	1,600.00 <i>1200</i>
11	To remove and refit A.B.S pump and reset brake system.	\$	250.00 <i>80</i>
12	To diagnose erase fault memory after repair.	\$	400.00 <i>X</i>
13	To remove and refit and reset air-bag system.	\$	350.00 <i>280</i>
14	To remove and refit fuel tank assembly.	\$	150.00 <i>80</i>
		\$	6,560.00

A060

total 23852.05

h/s: 181K (Nett Value)
21 Days

Total Repair Cost : \$ 32,527.43

Acknowledged by Repairer

Signature:

Date:

...CLAIM SUBFOLDER...(Pending for Survey Report)

WP

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	16 Apr 2018 Edit Reg		05 Mar 2018 00:00 Edit Adj Rpt	S\$18,000.00 Edit Estimates	S\$18,000.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	--------------------------

CLAIM SUBFOLDER DETAILS (Created by adjuster)

Insured:	- ID: -		
Main Claimant:	-		
Vehicle Reg. No.:	WYX5867	Date of Loss:	01/03/2018 23:00 - :59 [53 Months and 17 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / MCT18030088	Policy/Cover Note No.:	MC0M0015
Vehicle Reg. No. (Insured):	SHC2633A	Policy No. (Claimant):	
		Excess:	
Repairer:	C & L Automotive Llp (HQ) 1 KAKI BUKIT AVENUE 6, #02-11 AUTOBAY @ KAKI BUKIT, 417883 Kaki Bukit - Tel: 92327457		
Handling Insurer:	India International Insurance Pte Ltd (HQ) - Tel: 63476100 ... [Handled by Sundari Nagaraajan - 6347 6071]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 24/04/2018]		

ASSOCIATED MAIL RECEIVED [View All](#) [Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS [View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents






































*WYX5867 (MCT18030088)
[SHC2633A]


















































TP



















































Mar 1 2018 11:00PM




































[-]

C & L Automotive Llp

Upload Documents Upload Photos Compose New Letter			View View in Browser	
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
2	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
3	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
4	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
5	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
6	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
7	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
8	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
9	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
10	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
11	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
12	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
13	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
14	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
15	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
16	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
17	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
18	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
19	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
20	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
21	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
22	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
23	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
24	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
25	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
26	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
27	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
28	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
29	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
30	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
31	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
32	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
33	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
34	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
35	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
36	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
37	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
38	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
39	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
40	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
41	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
42	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
43	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
44	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
45	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
46	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
47	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
48	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
49	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
50	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
51	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
52	13/04/18 16:08	General View	 Load JPG	<input checked="" type="checkbox"/>
53	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
54	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
55	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
56	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
57	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
58	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
59	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
60	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
61	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
62	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
63	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
64	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
65	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
66	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
67	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
68	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
69	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
70	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
71	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
72	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
73	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
74	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
75	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
76	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
77	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
78	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
79	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
80	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
81	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
82	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
83	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
84	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
85	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
86	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
87	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
88	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
89	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
90	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
91	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
92	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
93	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
94	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
95	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
96	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
97	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
98	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
99	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
100	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
101	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
102	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
103	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
104	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
105	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
106	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
107	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
108	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
109	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
110	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
111	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
112	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
113	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
114	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
115	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
116	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
117	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
118	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
119	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
120	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
121	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
122	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
123	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
124	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
125	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
126	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
127	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
128	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
129	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
130	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
131	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
132	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
133	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
134	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
135	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
136	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
137	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
138	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
139	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
140	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
141	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
142	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
143	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
144	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
145	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
146	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
147	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
148	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
149	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
150	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
151	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
152	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
153	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
154	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
155	13/04/18 16:14	Dismantled Parts	 Load JPG	<input checked="" type="checkbox"/>
156	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
157	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
158	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
159	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
160	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
161	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
162	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
163	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
164	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
165	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
166	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
167	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
168	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
169	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
170	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
171	13/04/18 16:15	Photo After Spray	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	India International Insurance Pte Ltd (HQ)	Thumbnail	Print
1	16/04/18 08:55	Singapore Accident Statement	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin-top: 5px;"></div>			
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

LKK Auto Consultants Pte Ltd (Co. Reg No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/III18004252/ARD3Q2

Date: 19/04/2018

REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: MCOM0015
 Claimant Vehicle No: WYX5867 Insured Vehicle No: SHC2633A
 Date of Loss: 01/03/2018 Nature of Claim: TP Claim No: MCT18030088

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: WYX5867 Engine No: 1NZR048944
 Make & Model: TOYOTA PRIUS C, 1.5 (A) Chassis No: JTDKD3B3101545009
 Reg. Date: 12/09/2013 (Man. Year: 2013) Odometer: 73835 km
 Colour: Silver
 Engine Capacity: 1497 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 185/60 R15 Rear Tyre Size: 185/60 R15
 Front Left Side: Kumho 6 mm Rear Left Side: Kumho 6 mm
 Front Right Side: Kumho 6 mm Rear Right Side: Kumho 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	25,967.42	19,976.10	5,991.32	23.07
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,560.00	4,060.00	2,500.00	38.11
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	32,527.42	24,036.10	8,491.32	26.11
Approved Total (Overridden) (S\$)		18,000.00		
Nett Amount (S\$)	32,527.42	18,000.00	14,527.42	44.66

INSPECTION

Date of Assignment: 05/03/2018
 Date Inspected: 06/03/2018 Inspected At: C & L Automotive Llp (HQ)
 1 KAKI BUKIT AVENUE 6, #02-11
 AUTOBAY @ KAKI BUKIT
 Singapore 417883
 Estimated Period of Repair: 21.0 days

Adjuster: ADRIAN LING

Manager: Janice Lee Si Hua

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 19 Apr 2018)
Parts: 144	TOYOTA PRIUS C 1.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for WYX5867)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT DOOR -R/H	Distorted	1,265.60 FL	*1,265.60 FL
2	1		*FRONT DOOR INNER TRIM BOARD	Cracked	780.10 FL	*568.00 FL
3	1		*FRONT DOOR LOCK	Jammed	415.40 FL	*415.40 FL
4	1		*FRONT DOOR OUTER HANDLE	Not Necessary	178.50 FL	*- FL
5	1		*FRONT DOOR REGULATOR	Damaged	191.40 FL	*191.40 FL
6	1		*FRONT DOOR REGULATOR MOTOR	Not Necessary	647.90 FL	*- FL
7	1		*FRONT DOOR RUBBER	Cut	245.40 FL	*245.40 FL
8	1		*CENTRE PILLAR -R/H	Dented	655.90 FL	*655.90 FL
9	1		*CENTRE PILLAR INNER GARNISH	Not Necessary	198.00 FL	*- FL
10	1		*ROCKER PANEL -R/H	Distorted	485.00 FL	*485.00 FL
11	1		*REAR DOOR R/H	Distorted	1,265.50 FL	*1,265.50 FL
12	1		*REAR DOOR CHECKER	Not Necessary	68.50 FL	*- FL
13	1		*REAR DOOR GLASS OUTER MOULDING	Not Necessary	115.00 FL	*- FL
14	2		*REAR DOOR HINGES	Bent	157.00 FL	*157.00 FL
15	1		*REAR DOOR INNER TRIM BOARD	Cracked	780.90 FL	*545.00 FL
16	1		*REAR DOOR INNER LOCK	Jammed	455.20 FL	*455.20 FL
17	1		*REAR DOOR OUTER HANDLE	Not Necessary	169.50 FL	*- FL
18	1		*REAR DOOR GLASS REGULATOR	Damaged	291.40 FL	*291.40 FL
19	1		*REAR DOOR GLASS REGULATOR MOTOR	Not Necessary	647.90 FL	*- FL
20	1		*REAR DOOR RUBBER	Cut	243.40 FL	*243.40 FL
21	1		*REAR DOOR STEP GARNISH	Not Necessary	171.30 FL	*- FL
22	1		*ROOF TOP PANEL INNER TRIM	Crumpled	2,337.50 FL	*1,580.00 FL
23	1		*ROOF TOP PANEL SIDE AIR BAG	Activated	2,835.00 FL	*2,835.00 FL
24	1		*AIR BAG CONTROL UNIT	Activated	2,419.00 FL	*2,419.00 FL
25	1		*DRIVER SEAT WITH AIR BAG	Activated	1,950.00 FL	*1,950.00 FL
26	1		*REAR SAFETY BELT	Not Necessary	895.80 FL	*- FL
27	1		*REAR TAILLAMP -R/H	Not Necessary	440.50 FL	*- FL
28	1		*REAR BUMPER	Deformed	885.00 FL	*885.00 FL
29	1		*SET REAR BUMPER CLIP	Necessary	55.00 FL	*30.00 FL
30	1		*REAR BUMPER SIDE RETAINER	Necessary	64.00 FL	*64.00 FL
31	1		*REAR SIDE CHASSIS MEMBER	Repair	561.90 FL	*- FL
32	1		*REAR EXHAUST SILENCER	Bent	822.70 FL	*822.70 FL
33	2		*REAR EXHAUST MOUNTINGS	Not Necessary	97.90 FL	*- FL
34	1		*REAR EXHAUST HEAT SHIELD	Not Necessary	42.20 FL	*- FL
35	1		*CENTRE EXHAUST PIPE	Bent	2,534.70 FL	*985.00 FL
36	1		*REAR FENDER -R/H	Distorted	1,081.60 FL	*1,081.60 FL
37	1		*REAR FENDER INNER SHIELD	Torn	124.10 FL	*124.10 FL
38	1		*SET REAR FENDER INNER SHIELD CLIP	Necessary	50.00 FL	*50.00 FL
39	1		*REAR FENDER INNER TRIM BOARD	Deformed	692.40 FL	*692.40 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
40	1		*REAR WHEEL HUB WITH BEARING	Damaged	781.70 FL	*781.70 FL
41	1		*REAR SHOCK ABSORBER	Bent	441.50 FL	*441.50 FL
42	1		*REAR AXLE BEAM	Bent	2,017.50 FL	*2,017.50 FL
43	1		*REAR AXLE BEAM BUSH	Damaged	185.50 FL	*185.50 FL
44	1		*REAR BRAKE HOSE	Damaged	80.00 FL	*80.00 FL
45	1		*ABS SENSOR	Damaged	245.00 FL	*245.00 FL
46	1		*REAR FUEL TANK	Dented	1,365.60 FL	*1,365.60 FL
47	1		*HAND BRAKE CABLE	Damaged	175.00 FL	*175.00 FL
48	1		*FRONTDOOR BLACK TAPE	Necessary	120.00 FS	*60.00 FS
49	1		*REAR DOOR BLACK TAPE	Necessary	120.00 FS	*60.00 FS
50	1		*REAR TYRE	Cut	400.00 FS	*200.00 FS
51	1		*REAR SPORT RIM -R/H	Cut	750.00 FS	*400.00 FS
52	1		*CENTRE PILLAR BLACK TAPE	Necessary	120.00 FS	*60.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	34,119.90	26,374.80
- List Item Discount on L Items 25.00/25.00% (\$\$)	8,152.48	6,398.70
Total Parts (\$\$)	25,967.42	19,976.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE,REPLACE DAMAGED LAMPS AND CHECK UP REAR WIRING	New	80.00	30.00
2	TO REMOVE AND REFIT ROOF TOP LINING AND INTERIOR UPHOLSTERY	New	180.00	120.00
3	TO REMOVE AND REFIT REAR REVERSE SENSOR	New	120.00	50.00
4	TO REMOVE AND REFIT REAR UNDERCARRIAGE	New	450.00	300.00
5	TO CONDUCT WHEEL ALIGNMENT	New	180.00	80.00
6	TO MOUNT VEHICLE ONTO THE CHASSIS ALIGNMENT BENCH	New	450.00	0.00
7	TO REMOVE,REPLACE DOOR DAMAGED PARTS & TRANSFER FITTINGS TO NEW DOOR	New	350.00	160.00
8	TO APPLY TUFF KITE	New	200.00	80.00
9	PANEL BEATING	New	1,800.00	1,600.00
10	TO RESPRAY PAINTING	New	1,600.00	1,200.00
11	TO REMOVE AND REFIT A.B.S PUMP AND RESET BRAKE SYSTEM	New	250.00	80.00
12	TO DIAGNOSE ERASE FAULT MEMORY AFTER REPAIR	New	400.00	0.00
13	TO REMOVE AND REFIT AND RESET AIR-BAG SYSTEM	New	350.00	280.00
14	TO REMOVE AND REFIT FUEL TANK ASSEMBLY	New	150.00	80.00
Gross Labour Cost (\$\$)			6,560.00	4,060.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >