



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLQ 5551L

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	SUNDRIES (SN)	NECESSARY	100.00	30.00
1	FACE ASSYRR.BUMPER (SN)	DEFORMED	462.90	462.90
4	SENSOR ASSYPARKING (SN)	SERVICEABLE	239.40	-
4	CLIPHARNES BAND (SN)	NECESSARY	0.60	0.60
1	BEAM COMPRR.BUMPER (SN)	BENT	120.00	120.00
1	GARNISHRR.BUMPER LOWER (SN)	SCRATCHED	26.47	26.47
1	SPACERR.RR.BUMPER SIDE (SN)	NECESSARY	8.62	8.62
1	SPACERL.RR.BUMPER SIDE (SN)	NECESSARY	8.62	8.62
1	REFLECTOR ASSYR.RR. (SN)	SERVICEABLE	5.25	-
1	REFLECTOR ASSYL.RR. (SN)	SERVICEABLE	5.25	-
1	COVERR.FINISHER (SN)	SERVICEABLE	8.92	-
1	COVERL.FINISHER (SN)	SERVICEABLE	8.92	-
8	CLIPBUMPER (SN)	NECESSARY	12.00	12.00
1	LIP COMP TRUNK (SN)	TO REPAIR SEE LABOUR	354.07	-
1	EMBLEM SETRR. (SN)	SERVICEABLE	8.62	-
1	EMBLEM (SN)	SERVICEABLE	17.62	-
1	HINGE COMPR.TRUNK (SN)	SERVICEABLE	32.62	-
1	HINGE COMPL.TRUNK (SN)	SERVICEABLE	32.62	-
1	GARNISH ASSYRR.LICENCE (SN)	SERVICEABLE	73.27	-
1	LINING ASSYRR.PANEL (SN)	SERVICEABLE	15.75	-
1	LID ASSYSPARE TIRE (SN)	SERVICEABLE	43.80	-
1	WEATHERSTRIPTRUNK LID (SN)	SERVICEABLE	52.50	-
1	LOCK ASSYTRUNK (SN)	SERVICEABLE	54.15	-
1	STRIKERTRUNK LID (SN)	SERVICEABLE	5.17	-
1	PANEL SETRR. (SN)	SERVICEABLE	177.00	-
1	TAILLIGHT ASSYR. (SN)	SERVICEABLE	190.35	-
1	TAILLIGHT ASSYL. (SN)	CRACKED	204.82	204.82
1	LIGHT ASSYR.LID (SN)	SERVICEABLE	89.02	-
1	LIGHT ASSYL.LID (SN)	SERVICEABLE	89.02	-
1	PAN COMPSPARE TIRE (SN)	SERVICEABLE	157.80	-

Report Ref No. CC4/EQI18004339/R1wa3s2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
3	OILSHEET (SN)	SERVICEABLE	89.77	-
1	COVERRR.TOWING HOOK (SN) (ADDITIONAL)	CUT	2.25	2.25
1	GARNISHL.RR.BUMPER SIDE (SN) (ADDITIONAL)	SCRATCHED	5.70	5.70
			2,702.87	881.98
	<b>LABOUR</b>			
	INSPECT RR LIGHTING MECHANISMS. PERFORM WATER.		180.00	180.00
	REMOVE & RENEW REVERSE SENSORS.		180.00	180.00
	BODY JOINT SEALANT FOR END PANEL.	NOT NECESSARY	80.00	-
	BODY JOINT SEALANT FOR REAR FLOOR PANEL.	NOT NECESSARY	80.00	-
	BODY JOINT SEALANT FOR TRUNK LID.	NOT NECESSARY	80.00	-
	REMOVE & TRANSFER ITEMS TO NEW TRUNK. ADJUST &.	NOT NECESSARY	560.00	-
	REMOVE & INSTALL REAR COMPARTMENT LININGS.		560.00	280.00
	RREMOVE & INSTALL FUEL TANK FUEL PIPES.	NOT NECESSARY	560.00	-
	RESET & CALIBRATE VEHICLE SMART ENTRY SYSTEM.		380.00	280.00
	REMOVE & INSTALL REAR VIEW CAMERA.		380.00	280.00
	REMOVE & INSTALL TRUNK SPOILER.		180.00	180.00
	CUT OFF & RENEW RR PANEL. STRAIGHTEN. INCLUSIVE OF THE REPAIR OF LIP COMP TRUNK.		4,500.00	1,120.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS.		3,200.00	900.00
	APPLY BODY UNDERSIDE COATING.	NOT NECESSARY	450.00	-
	REMOVE & RENEW RR FLOOR INSULATOR.	NOT NECESSARY	450.00	-
			11,820.00	3,400.00
<b>GRAND TOTAL</b>			<b>14,522.87</b>	<b>4,281.98</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>4,281.98</b>

Report Ref No. CC4/EQ18004339/R1wa3s2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.