

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	07 Mar 2018 16:31 Sendback Est	07 Mar 2018 17:28 S\$13,037.10	08 Mar 2018 10:04 Edit Adj Rpt	S\$6,175.00 Edit Estimates	S\$6,175.00 View Rpt		Pending for Survey Report Cancel Case
Supp #1	03 Apr 2018 19:39	03 Apr 2018 19:40 S\$46.20	03 Apr 2018 19:40			(Combined)	Combined with Main Uncombine Suppl.

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured: HITACHI CAPITAL ASIA PACIFIC PTE. LTD. , Co. Reg. No.: 199400399N									
Vehicle Reg. No.: SKW6474A		Date of Loss: 03/03/2018 00:00 - :59 [27 Months and 22 Days From LTA Reg Date (Man Yr)]							
Claim Type: OD / MSC/V/18-000330		Policy/Cover Note No.: MSD/VPCP/17-002474 (Comprehensive) Coverage: 14/10/2017 - 13/10/2018							
		Excess: S\$3,500.00							
Repairer: Hitachi Capital Asia Pacific Pte. Ltd (HQ) No 8 Fourth Lok Yang Road, 629705 Pioneer - Tel: 64663022									
Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Kwok Woon Choo - 6643 1330]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD TAUFIKH BIN HAMID] ... [Final Rpt due 07/04/2018]									
Driver/Custodian: YEO HONG SIAH, EUGENE (37 / Male), NRIC: S8027365G, Tel: +6590915556									
Adj Asg. Remarks: Please revert. tks.									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- MSIG_SG (13/04/2018): Alert - Adj Mandate Approved (S\$6175.00) - SKW6474A - Claim Handler: Kwok Woon C... - MSIG_SG (14/03/2018): Alert - Adj Mandate Approved (S\$5824.80) - SKW6474A - Claim Handler: Kwok Woon C... - MSIG_SG (13/03/2018): Alert - Adj Mandate Approved (S\$0.00) - SKW6474A - Claim Handler: Kwok Woon Choo									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

SKW6474A (MSC/V/18-000330)
OD
Mar 3 2018 12:00AM
[HITACHI CAPITAL ASIA PACIFIC PTE. LTD.]
Hitachi Capital Asia Pacific Pte. Ltd

Upload Documents		Upload Photos	Compose New Letter	View View in Browser	
Video					1 per page ☐
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)	Thumbnail	Print	
1	06/03/18 20:35	Video - Accident [Linked Accident Report Documents]	Load MOV	☐	
2	06/03/18 20:36	Video - Accident [Linked Accident Report Documents]	Load MOV	☐	
Assessment Reports					1 per page ☐
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)	Thumbnail	Print	
1	06/03/18 20:42	Accident Statement	Load HTM	☐	
2	07/03/18 17:28	Repairer Estimates	Load HTM	☐	
3	03/04/18 19:40	Repairer Estimates Suppl. #1	Load HTM	☐	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print	
1	12/03/18 12:10	Adjuster Immediate Advice	Load HTM	☐	
2	14/03/18 11:00	Adjuster Immediate Advice	Load HTM	☐	
3	12/04/18 10:58	Adjuster Immediate Advice	Load HTM	☐	
Photos/Images					3 per page ☐
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)	Thumbnail	Print	
1	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
2	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
3	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
4	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
5	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
6	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
7	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
8	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
9	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
10	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
11	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
12	06/03/18 20:17	Accident Photo [Linked Accident Report Documents]	Load JPG	☒	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print	
1	12/03/18 11:55	General View	Load JPG	☒	
2	12/03/18 11:55	General View	Load JPG	☒	
3	12/03/18 11:55	General View	Load JPG	☒	
4	12/03/18 11:55	General View	Load JPG	☒	
5	12/03/18 11:55	General View	Load JPG	☒	
6	12/03/18 11:55	General View	Load JPG	☒	
7	12/03/18 11:55	General View	Load JPG	☒	
8	12/03/18 11:55	General View	Load JPG	☒	

Video			1 per page	☒
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)	Thumbnail	Print
9	12/03/18 11:55	General View	 Load JPG	☒
10	12/03/18 11:55	General View	 Load JPG	☒
11	12/03/18 11:55	General View	 Load JPG	☒
12	12/03/18 11:55	General View	 Load JPG	☒
13	12/03/18 11:55	General View	 Load JPG	☒
14	12/03/18 11:55	General View	 Load JPG	☒
15	12/03/18 11:55	General View	 Load JPG	☒
16	12/03/18 11:55	General View	 Load JPG	☒
17	12/03/18 11:55	General View	 Load JPG	☒
18	12/03/18 11:55	General View	 Load JPG	☒
19	12/03/18 11:55	General View	 Load JPG	☒
20	12/03/18 11:55	General View	 Load JPG	☒
21	12/03/18 11:55	General View	 Load JPG	☒
22	12/03/18 11:55	General View	 Load JPG	☒
23	12/03/18 11:55	General View	 Load JPG	☒
24	12/03/18 11:55	General View	 Load JPG	☒
25	12/03/18 11:55	General View	 Load JPG	☒
26	12/03/18 11:55	General View	 Load JPG	☒
27	12/03/18 11:55	General View	 Load JPG	☒
28	12/03/18 11:55	General View	 Load JPG	☒
29	12/03/18 11:55	General View	 Load JPG	☒
30	12/03/18 11:55	General View	 Load JPG	☒
31	12/03/18 11:55	General View	 Load JPG	☒
32	12/03/18 11:55	General View	 Load JPG	☒
33	12/03/18 11:55	General View	 Load JPG	☒
34	12/03/18 11:55	General View	 Load JPG	☒
35	12/03/18 11:55	General View	 Load JPG	☒
36	12/03/18 11:55	General View	 Load JPG	☒
37	12/03/18 11:55	General View	 Load JPG	☒
38	12/03/18 11:55	General View	 Load JPG	☒
39	12/03/18 11:55	General View	 Load JPG	☒
40	12/03/18 11:55	General View	 Load JPG	☒
41	12/03/18 11:55	General View	 Load JPG	☒
42	12/03/18 11:55	General View	 Load JPG	☒
43	12/03/18 11:55	General View	 Load JPG	☒
44	12/03/18 11:55	General View	 Load JPG	☒
45	12/03/18 11:55	General View	 Load JPG	☒
46	12/03/18 11:55	General View	 Load JPG	☒
47	12/03/18 11:55	General View	 Load JPG	☒
48	12/03/18 11:55	General View	 Load JPG	☒
49	12/03/18 11:55	General View	 Load JPG	☒
50	12/03/18 11:55	General View	 Load JPG	☒
51	12/03/18 11:55	General View	 Load JPG	☒
52	12/03/18 11:55	General View	 Load JPG	☒
53	12/03/18 11:55	General View	 Load JPG	☒
54	12/03/18 11:55	General View	 Load JPG	☒
55	12/03/18 11:55	General View	 Load JPG	☒
56	12/03/18 11:55	General View	 Load JPG	☒
57	12/03/18 11:55	General View	 Load JPG	☒
58	12/03/18 11:55	General View	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)	Thumbnail	Print
59	12/03/18 11:55	General View	 Load JPG	☒
60	12/03/18 11:55	General View	 Load JPG	☒
61	12/03/18 11:55	General View	 Load JPG	☒
62	12/03/18 11:55	General View	 Load JPG	☒
63	12/03/18 11:55	General View	 Load JPG	☒
64	12/03/18 11:55	General View	 Load JPG	☒
65	12/03/18 11:55	General View	 Load JPG	☒
66	12/03/18 11:55	General View	 Load JPG	☒
67	12/03/18 11:55	General View	 Load JPG	☒
68	12/03/18 11:55	General View	 Load JPG	☒
69	12/03/18 11:55	General View	 Load JPG	☒
70	12/03/18 11:55	General View	 Load JPG	☒
71	12/03/18 11:55	General View	 Load JPG	☒
72	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
73	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
74	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
75	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
76	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
77	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
78	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
79	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
80	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
81	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
82	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
83	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
84	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
85	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
86	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
87	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
88	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
89	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
90	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
91	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
92	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
93	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
94	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
95	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
96	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
97	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
98	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
99	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
100	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
101	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
102	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
103	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
104	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
105	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
106	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
107	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
108	12/04/18 11:00	Reinspection Photo	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)	Thumbnail	Print
109	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
110	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
111	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
112	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
113	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
114	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
115	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
116	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
117	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
118	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
119	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
120	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
121	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
122	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
123	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
124	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
125	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
126	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
127	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
128	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
129	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
130	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
131	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
132	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
133	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
134	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
135	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
136	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
137	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
138	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
139	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
140	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
141	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
142	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
143	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
144	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
145	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
146	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
147	12/04/18 11:00	Reinspection Photo	 Load JPG	☒
148	12/04/18 11:01	Reinspection Photo	 Load JPG	☒
149	12/04/18 11:01	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	08/03/18 09:48	SCHEDULE From: TP - Reg. No: SHC8285G, Claimant: COMFORT TRANSPORTATION PTE LTD	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	12/03/18 11:56	MARK ESTIMATE	 Load PDF	
2	12/04/18 10:43	SKW 6474A SUPPLEMENTARY	 Load PDF	
3	23/04/18 11:33	Parts Invoice	 Load PDF	

Linked Accident Report Documents

View View in Browser

Video				1 per page	☒
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)		Thumbnail	Print
1	06/03/18 20:35	Video - Accident		Load MOV	
2	06/03/18 20:36	Video - Accident		Load MOV	

Assessment Reports				1 per page	☒
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)		Thumbnail	Print
1	06/03/18 20:42	Accident Statement		Load HTM	

Photos/Images				3 per page	☒
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)		Thumbnail	Print
1	06/03/18 20:17	Accident Photo		Load JPG	☒
2	06/03/18 20:17	Accident Photo		Load JPG	☒
3	06/03/18 20:17	Accident Photo		Load JPG	☒
4	06/03/18 20:17	Accident Photo		Load JPG	☒
5	06/03/18 20:17	Accident Photo		Load JPG	☒
6	06/03/18 20:17	Accident Photo		Load JPG	☒
7	06/03/18 20:17	Accident Photo		Load JPG	☒
8	06/03/18 20:17	Accident Photo		Load JPG	☒
9	06/03/18 20:17	Accident Photo		Load JPG	☒
10	06/03/18 20:17	Accident Photo		Load JPG	☒
11	06/03/18 20:17	Accident Photo		Load JPG	☒
12	06/03/18 20:17	Accident Photo		Load JPG	☒

Documentation				1 per page	☒
No	Finalized On	Hitachi Capital Asia Pacific Pte. Ltd (HQ)		Thumbnail	Print
1	06/03/18 20:42	Sketch Plan		Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) 			
Show Remarks To: ☐ Repairer ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way, #21-01 SGX Centre 2
Singapore 068807

Our File No: CS/MSG18004498/T1RD3E2

Date: 23/04/2018

REFERENCE

Insured/Claimant: HITACHI CAPITAL ASIA PACIFIC PTE. LTD.

Policy No:

MSD/PCP/17-002474

Date of Loss: 03/03/2018

Nature of Claim:

OD

Claim No:

MSC/V/18-000330

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKW6474A**

Make & Model: TOYOTA VELLFIRE, 2.5 CVT (A)

Reg. Date: 09/11/2015 (Man. Year: 2015)

Colour: Black

Engine Capacity: 2494 cc

Market Value/New Car Price: S\$148,000.00

Sum Insured (S\$): **Market Value/New Car Price**

Engine No: 2ARH640669

Chassis No: JTNGF3DH208002862

Odometer: 169342 km

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 235/50 R18

Rear Tyre Size:

235/50 R18

Front Left Side: Hankook 6 mm

Rear Left Side:

Hankook 6 mm

Front Right Side: Hankook 6 mm

Rear Right Side:

Hankook 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,483.30	4,185.00	4,298.30	50.67
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,600.00	1,990.00	2,610.00	56.74
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	13,083.30	6,175.00	6,908.30	52.80
- Excess (S\$)	1,500.00	3,500.00	-2,000.00	-133.33
(S\$)	11,583.30	2,675.00	8,908.30	76.91
+ GST 7.00/7.00% (S\$)	810.83	187.25	623.58	76.91
Nett Amount (S\$)	12,394.13	2,862.25	9,531.88	76.91

INSPECTION

Date of Assignment: 08/03/2018 Present Location:

Hitachi Capital Asia Pacific Pte. Ltd (HQ)

Date Inspected: 09/03/2018 Inspected At:

No 8 Fourth Lok Yang Road
Singapore 629705

Estimated Period of Repair: 7.0 days

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: Janice Lee Si Hua

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 23 Apr 2018)
Parts:	M1-MPV	TOYOTA VELLFIRE 2.5 CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKW6474A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*Bonnet (WCP)	Repair	230.00 F	*- F
2	2		*Bonnet hinge LH/RH (WCP)	Not Necessary	60.00 F	*- F
3	1		*Front grille (WCP)	Not Necessary	430.00 F	*- F
4	1		*Bonnet chrome moulding (WCP)	Not Necessary	160.00 F	*- F
5	1		*Headlamp RH (WCP)	Cracked	1,100.00 F	*1,100.00 F
6	1		*Headlamp lower bracket RH (WCP)	Necessary	120.00 F	*120.00 F
7	1		*Headlamp center garnish RH (WCP)	Cut	45.00 F	*45.00 F
8	1		*Support panel (NPA)(WCP)	Repair	-	*- F
9	1		*Front bumper (WCP)	Deformed	210.00 F	*210.00 F
10	10		*Front bumper clips (WCP)	Necessary	15.00 F	*15.00 F
11	1		*Front bumper side retainer inner LH/RH (2PCS)(WCP)	N/S Necessary	16.00 F	*8.00 F
12	2		*Front bumper side retainer outer LH/RH (WCP)	N/S Necessary/ O/SBoth Cracked	70.00 F	*70.00 F
13	1		*Front bumper center lower grille (WCP)	Not Necessary	80.00 F	*- F
14	1		*Front fog lamp RH (WCP)	Cut	95.00 F	*95.00 F
15	1		*Front fog lamp cover RH (WCP)	Cut	45.00 F	*45.00 F
16	1		*Front bumper sponge (WCP)	Deformed	40.00 F	*40.00 F
17	1		*Front bumper lower rubber lip (NPA)(WCP)	Not Necessary	-	*- F
18	1		*Front reinforcement (WCP)	Not Necessary	120.00 F	*- F
19	1		*Wiper tank (WCP)	Deformed	80.00 F	*80.00 F
20	1		*Wiper tank motor (WCP)	Not Necessary	75.00 F	*- F
21	1		*Air duct (WCP)	Not Necessary	60.00 F	*- F
22	1		*Air resonator box (WCP)	Not Necessary	55.00 F	*- F
23	1		*Aircon condensor (WCP)	Not Necessary	500.00 F	*- F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
24	1		*Radiator (WCP)	Not Necessary	550.00 F	*- F
25	1		*Chassis frame RH (NPA)(WCP)	Not Necessary	-	*- F
26	1		*Front fender RH (WCP)	Bent	290.00 F	*290.00 F
27	1		*Front fender shield RH (WCP)	Deformed	95.00 F	*95.00 F
28	10		*Front fender shield clips RH (WCP)	Necessary	15.00 F	*15.00 F
29	1		*Front fender mudflap RH (WCP)	Not Necessary	40.00 F	*- F
30	1		*Front fender quarter glass with moulding RH (WCP)	Not Necessary	95.00 F	*- F
31	1		*Sealant	Not Necessary	45.00 FS	*- FS
32	1		*Driver door (NPA) (WCP)	Repair	-	*- F
33	2		*Driver door hinge top and bottom (WCP)	Repair	60.00 F	*- F
34	1		*Driver door checker (WCP)	Repair	120.00 F	*- F
35	1		*Engine undercover RH (WCP)	Not Necessary	40.00 F	*- F
36	1		*Engine undercover center (WCP)	Not Necessary	65.00 F	*- F
37	10		*Engine undercover clips (WCP)	Not Necessary	15.00 F	*- F
38	1		*Front original RIM RH (WCP)	Cut	950.00 F	*500.00 F
39	1		*Front tyre RH (80%)	Cut	350.00 FS	*280.00 FS
40	1		*Front shock absorber RH (WCP)	Bent	185.00 F	*185.00 F
41	1		*Front knuckle arm RH (WCP)	Bent	175.00 F	*175.00 F
42	1		*Front wheel hub with bearing RH (WCP)	Bent	210.00 F	*210.00 F
43	1		*Front lower arm RH (WCP)	Bent	140.00 F	*140.00 F
44	1		*Front lower arm ball joint RH (WCP)	Bent	70.00 F	*70.00 F
45	1		*Front tie rod end RH (WCP)	Not Necessary	40.00 F	*- F
46	1		*Front fender inner panel RH (NPA)(WCP)	Not Necessary	-	*- F
47	1		*Steering rack (WCP)	Not Necessary	550.00 F	*- F
Supplementary #1						
48	8		*Front fender clip RH (WCP)	Necessary	12.00 F	*12.00 F
49	1		*Front fender bracket to support RH (WCP)	Bent	30.00 F	*30.00 F

F=Franchise part. S=SpcNett.

Sub Total (S\$)	7,748.00	3,830.00
+ Margin on L,N Items 10.00/10.00% (S\$)	735.30	355.00
Total Parts (S\$)	8,483.30	4,185.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Panel beat, cut, weld, re-align & replace damaged parts of affected area	New	1,400.00	700.00
2	Putty, blend and paint affected area	New	1,400.00	900.00
3	Check Wiring, re-align headlamps and ensure proper function	New	80.00	30.00
4	Refill compressor oil, vacuum and refill aircond gas	New	120.00	0.00
5	Remove & reinstall bumper sensors	New	120.00	30.00
6	Conduct four wheel alignment / side slip test	New	150.00	80.00
7	Realign chassis member	New	300.00	0.00
8	Mount chassis alignment jig	New	300.00	0.00
9	Remove, replace & balance rim / tire	New	50.00	30.00
10	Remove, replace & re-install undercarriage parts	New	280.00	120.00
11	Remove & re-install Front fender quarter glass	New	120.00	0.00
12	Diagnostic Check & Reset	New	280.00	100.00
Gross Labour Cost (S\$)			4,600.00	1,990.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >