

Surveyor
Mufiman

REF: CS3 / msh17023167 / T1 v6-1

Special Instruction:

ASSIGNMENT (Office)

From (Person): Katherine Wong of msh1 Date/Time: 15032018
Estimated Cost: Bill to:

Third Parties:

Claimant:

Surveyor:

Workshop:

OD/TP Re-inspection / Evaluation

To Inspect Vehicle No: SJW 5809J Insured: SKJ 3063R

at Workshop m/s Han Car Repairs Tel: 6271 0275

of Blk 1001 Bukit Merah Lane 3 # 01-49

Policy No: Claim No: 539552

Sum Insured: Excess:

Make of Veh: D.O.A. 05122017

(Client's Record)

26 03 2018 (Monday) @ 1pm

H.O.D. Enforcement/Date:

Date/Time: Person Contacted: Vehicle IN / OUT

Date/Time: Confirmed with Final Fig days (Red \$ / %; Original days)

Date/Time: Submit Final Fig 4/5/18 9900, 11 days (Red \$ / %; Original days)

Date/Time	Action/Instruction
SJW 5809J	CS3 / msh17023167 / T1 v6-1
SKJ 3063R	X

4/5/18 @ 518pm Informed Katherine Wong LS \$5800 (Red 8500, 59%)

[Signature]
25/6/2018

Para(1) : Parts found not replaced (To highlight R or UB, LR, Etc)

Para(2) : Comments on consistency of damages (Parts Not Consistent : NC)

RECEIVED 25 JUN 2018

Para(3) : Nett Value

Market Value : _____

Salvage Value : _____

Nett Value : _____

Inspected/
Evaluated by:

Fee Charged:

Basic & Add
Transport
Photos
Others
Total

Date:

1) Date/Time 4/6- typist File Pass to _____

3) Date/Time _____ File Pass to _____

5) Date/Time _____ File Pass to _____

2) Date/Time _____ File Return to _____

4) Date/Time _____ File Return to _____

6) Date/Time _____ File Return to _____

REF:

General

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: _____

Yr Regn: _____

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: _____

G.C. _____

Colour _____

A/C: Insured / Std / NI / NA

Sp. Reading _____

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: _____

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or _____

Brake: Inorder / Jammed / Leaked / Burnt or _____

Modi: Nil / S/Rim / STD A/Rim or _____

Tyre Size: F: _____

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. _____ mm

R/Bal. _____ mm

L/Bal. _____ mm

L/Bal. _____ mm

D.O.A. _____

D.O.I. _____

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or _____

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee

Transportation

\$ - RS. \$

Photos

Other

TOTAL

Report Format :

Lump Sum / I.B.I: (\$



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MSIG INSURANCE (SINGAPORE) PTE LTD		Ref : CS3/MSG17023167/vb-1	
16 RAFFLES QUAY #24-01 HONG LEONG BLDG SINGAPORE 048581		Date : 26-03-2018	
		Code : MSG	
1. Policy Particulars :- THIRD PARTY CLAIM (RESURVEY INSPECTION)			
Insured Veh.	SKJ 3063R	Veh. Inspected	SJN 5809J
Policy No.		Coverage (\$)	0.00
Claim No.	539552	Excess (\$)	0.00
Assign From	MERIMEN (KATHERINE WONG)	Assign Date	15/03/2018
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	05/12/2017	Inspection Date	26/03/2018
Survey held at	HAN CAR REPAIRS BLK 1001 #01-49 BUKIT MERAH LANE 3 ALEXANDRA VILLAGE SINGAPORE 159718		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

Tanaka

MS16

7/12/17

SJN5809J

2009 Feb

OWS THREE CORES E.A. (V. 1)

SJN 5809J

Han Car Repairs

Blk 1001, Blk + Merah Tem 3 # 01-19-159718

Toyota Camry

1998

253631

MR0535K 4107042832



Remarks: The veh had commenced its repair at the time of inspection.

Base of Vehicle: Blue
DAD Accident Room: Consistent? Yes or No
DAD PP Seal: Consistent? Yes or No
Base Paint: days Pass Yes or No
Lub Seal: Pass Yes or No

OK REV REP 24 HRS 'up'

Date: Patch Contacted: Vehicle IN/OUT

ES/DUN/EXNOVA GY FS LIZA MIC DHTSU PR SUM
TOYO YOKO

6 6 6 6
2/12/17 @ 435pm

Des of Damage: Pass OS NS UC Roofed

The U.C. Chassis frame Body Structure affected

09/03/18 Damage at rear portion only.
Range for rear portion
rear bumper, sensor, and panel garnish, rear reinforcement.
\$2000/- \$2500/- with 4 days rep.

REC

09/03/2018
Final Report

Date Of Repair
Resurvey No of Trip

Add Fee

PRS

Catherine Chong (LKK Auto)

From: Katherine Wong <katherine_wong@sg.msigg-asia.com>
Sent: Thursday, 15 March, 2018 11:05 AM
To: assignments
Subject: FW: MSIG ref: 539552; KSCGP ref: GS/17/5236/HC/sy

Dear Catherine

Please arrange the re-inspection on 26.3.18.

Best Regards

Katherine Wong
Executive, Claims Services (Motor)
Direct line +65 6594 2544 | Direct fax +65 6225 7402 | katherine_wong@sg.msigg-asia.com



MSIG



Insurer Claims
Team of the Year
2016

MSIG Insurance (Singapore) Pte Ltd 16 Raffles Quay, #24-01 Hong Leong Building, Singapore 048581 | T: +65 6220 9644 | F: +65 6225 6371 | Co. Reg. No. 200412212G | msigg.com.sg



A Member of **MS&AD** INSURANCE GROUP

From: motor@kscgp.com [mailto:motor@kscgp.com]
Sent: Thursday, March 15, 2018 10:26 AM
To: Katherine Wong <katherine_wong@sg.msigg-asia.com>
Subject: MSIG ref: 539552; KSCGP ref: GS/17/5236/HC/sy

Dear Katherine,

We refer to your email dated 12 March 2018.

As requested, the re-inspection of our client's vehicle no. SJN 5809J has been scheduled as follows: -

Date: 26 March 2018 (Monday)

Time: 1.00 p.m.

Venue: Han Car Repairs, Block 1001 #01-49 Bukit Merah Lane 3, Alexandra Village, Singapore 159718

Tel: 6271 0275

Contact person: Ms. Susan / Athena

Kindly confirm the above appointment, as soon as possible.
Thank you.

Regards,
See Yee
Executive
KSCGP Juris LLP
10 Hoe Chiang Road
#13-03A Keppel Towers
Singapore 089315
Tel: 6538 3611 / DID: 3152 0987 / Fax: 6538 3708

Email: motor@kscgp.com

KSCGP Juris LLP (UEN/Registration No: T10LL1855L) is registered in Singapore under the Limited Liability Partnerships Act (Chapter 163A) with limited liability. This message is intended only for the use of the individual or entity to whom it is addressed (including any attachments) and is confidential and may be protected by legal privilege. If you are not the intended recipient, please notify the sender immediately by return email, delete this message and you should not disseminate, distribute or copy any information contained herein. Please note that e-mails are susceptible to change and we shall not be liable for the improper or incomplete transmission of the information contained in this communication nor for any delay in its receipt or damage to your system. We do not guarantee that the integrity of this communication has been maintained nor that this communication is free of viruses, interceptions or interference.

CONFIDENTIALITY NOTICE

This e-mail (including any attachments) may contain information that is privileged or confidential. The sending of this e-mail to any person other than the intended recipient is not a waiver of the privilege or confidentiality that attaches to it. If you are not the intended recipient, please notify the sender immediately, delete the email and do not copy, distribute or disclose its contents.

...CLAIM SUBFOLDER...(Pending for Survey Report)

Reinspection

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Dec 2017		06 Dec 2017 10:49 Edit Adj Rpt	\$0.00 Edit Estimates	\$0.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
----------------------	---------------------------	-------------------------------	---------------------------	--------------------------

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	YONG HWEE HONG, ID: S1675891D		
Main Claimant:	Jupiter Solutions Pte Ltd, Co. Reg. No.: 200008342E		
Vehicle Reg. No.:	SJN5809J	Date of Loss:	05/12/2017 12:00 - :59
Claim Type:	TP / 539552	Policy/Cover Note No.:	P27655833DMA (Comprehensive) Coverage: 18/03/2017 - 17/03/2018
Vehicle Reg. No. (Insured):	SKJ3063R	Policy No. (Claimant):	
		Excess:	\$500.00
Repairer:	Han Car Repairs (HQ) BLK 1001 BUKIT MERAH LANE 3 #01-49 ALEXANDRA VILLAGE, 159718 Alexandra - Tel: 62710275		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Katherine Wong Chew Shong - 6594 2544]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD TAUFIKH BIN HAMID] ... [Final Rpt due 19/03/2018]		
Driver/Custodian (Insured):	YONG HWEE HONG (), NRIC: S1675891D		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- MSIG_SG (15/03/2018): Report Send Back Alerts - SJN5809J (TP)
- MSIG_SG (19/02/2018): Re: SJN5809J
- MSIG_SG (19/02/2018): SJN5809J



ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

GURDEEP SINGH SEKHON
CHIA KOK SENG
REY POO JONG HAN
TONG LAM CHUAN
RAVINDER SINGH
P. PADMAN
KWEH SOON HAN
PRADEEP KUMAR GOBIND
TUE JA PEI
MUNIRAH BINTE MYDIN
TIMOTHY YEO ZHI WEN
JASPREET KAUR PURBA

KSCGP

J U R I S T S


*Celebrating 25 Years of
Professional and Personalised
Legal Service*

MAIN OFFICE:
10 Hoe Chiang Road, #13-03A
Keppel Towers
Singapore 089315
Tel: 6538 3611
Fax: 6538 3706

Website: www.kscgp.com
(Not a firm for service of court documents)
Registered in Singapore with limited liability
as a Limited Liability Partnership
Registration Number T101214556

Your Ref : 539552 ✓
Our Ref : GS/17/5236/HC/sy/cl
Date : 8 March 2018

DID: 3152 0987
Email: motor@kscgp.com

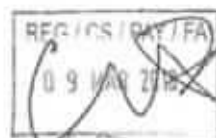

MSIG Insurance (Singapore) Pte. Ltd.
16 Raffles Quay
#24-01 Hong Leong Building
Singapore 048581

BY HAND

Dear Sirs,

JUPITER SOLUTIONS PTE LTD
C/o 10 Hoe Chiang Road #13-03A Keppel Towers Singapore 089315
ACCIDENT INVOLVING SJN 5809J, SKJ 3063R AND SLH 1549T ALONG LORONG 6 TOA
PAYOH ON 05.12.2017

We are instructed by the above named to claim damages against you in connection with a road traffic accident on 05 December 2017 along Lorong 6 Toa Payoh, involving our client's motor vehicle bearing registration number SJN 5809J, the motor vehicle bearing registration number SLH 1549T and the motor vehicle bearing registration number SKJ 3063R, which was insured by you at the material time.

We are instructed that the accident was caused by the negligent driving and/or management of the authorised driver of SKJ 3063R. As a result of the accident, our client's vehicle was damaged and our client has been put to loss and expenses, particulars of which are as follows:

(1)	Cost of repairs	-	\$	15,301.00
(2)	Cost of rental	-	\$	2,340.00
(3)	Survey fee	-	\$	1,070.00
(4)	LTA	-	\$	10.00
(5)	GIA search	-	\$	43.00
(6)	Incidentals	-	\$	100.00
(7)	Costs	-	\$	900.00
(8)	GST on items (6) & (7)	-	\$	70.00
				\$ 19,834.00

BRANCH: [PRIVATE PROPERTY CONVEYANCING]
490 Lorong 6 Toa Payoh, B12-3 Lobby 2
#09-18 HDB Hub, Singapore 310490
Tel: 6591 7696 Fax: 6258 1625

BRANCH: [HDB CONVEYANCING]
490 Lorong 6 Toa Payoh B12-3 Lobby 2
#09-18 HDB Hub, Singapore 310490
Tel: 6591 7696 Fax: 6258 1409

BRANCH: [SHIPPING, ADMIRALTY & COMMERCIAL]
92 Arab Street #05-01 & #05-02
Singapore 196799
Tel: 6534 1346 Fax: 6634 1356

The information contained in this letter / facsimile message is CONFIDENTIAL and may also be LEGALLY PRIVILEGED, intended only for the individual or entity named above. If you are not the intended recipient, you are hereby notified that any use, revelation, dissemination, distribution or copying of this document is strictly prohibited. If you have received this document in error, please notify us immediately by telephone (call the number above) and destroy the original message.

IVNR, please upload
ack. → request for
physical being sent.
Done
9/3/18

A copy each of the supporting documents are enclosed.

S/NO.	AVAILABLE DOCS	PARTICULARS
<u>Client's Documents</u>		
1.	06.12.2017	GIA Statement / Traffic Police report
2.		Witness(es) Statement
3.		Accident site photographs
4.		Video footage / CCTV / CD recording
5.	20.02.2018	Repair bill / invoice / Excess Tax invoice
6.	05.12.2017	Rental bill / invoice and agreement / receipts
7.		Vehicle Entry Permit receipt / E-day license for off-peak vehicle
8.		Towing fees / receipt (Singapore / Malaysia)
9.		Client sold off vehicle and produce letter from LTA
10.		Spare Part Ordering Form
11.		Levy at Custom / receipts
12.	05.02.2018	Survey invoice and surveyor's report
13.	05.02.2018	225 Original / Copies of damage photographs
14.		Enquire PARF / COE Rebate for Registered Vehicle
15.		Enquire Transfer fee
16.	31.07.2017	Certificate of Insurance / Motor Cover Note / New Policy Schedule / Registration Card / Grant / Road Tax
17.	05.12.2017 06.12.2017	Pre-repair Inspection Notices
18.		Traffic Police investigation results
19.		Estimated agreement between surveyor and repairer
20.	06.03.2018	Tax invoices and search results from General Insurance Association of Singapore (GIA) and Traffic Police search fees
<u>Third Party's Documents</u>		
21.	05.12.2017	GIA Statement / Traffic Police report
22.		Admission Note
23.	05.12.2017	LTA search / receipt / tax invoice
24.		Malaysia Vehicles Searches / service
25.		RCB / ACRA search
26.		Enhanced Individual search / receipt
27.		Property tax search / receipt
<u>Others (Apply only in chain collisions and/or any other documents)</u>		
28.	06.12.2017	GIA Statement for SLH 1549T

We have, on 05 December 2017 and 06 December 2017, notified you of the accident and a pre-repair inspection of our client's motor vehicle was carried out by the appointed surveyors.

 
Subject to our client's instructions, please confirm in writing within 7 days hereof if you or your insured wish to inspect our client's vehicle or conduct an inspection.

Please note that you or your insured should send to us an acknowledgement of receipt of this letter within 14 days of your receipt of this letter, failing which our client will have no alternative but to commence proceedings against your insured without further notice to you or your insured. In this event, you will be liable for any and all legal costs incurred.

Please also note that if your insured has a counterclaim against our client arising out of the accident, you are also required to send to us a letter giving full particulars of the counterclaim together with all relevant supporting documents within 8 weeks of your receipt of this letter, which we will then forward to our client and/or the insurers for consideration on a without prejudice basis.

For avoidance of doubt, kindly note that this claim is made without prejudice to our client's personal injury claim.

Yours faithfully,

A handwritten signature in black ink, appearing to read 'KSCGP', with a stylized flourish at the end.

(Main Office)

Enc.

Cc client

Cc owner / driver – Yong Hwee Hong



HAN CAR REPAIRS

Blk 1001, #01-49, Bukit Merah Lane 3, Alexandra Village, Singapore 159718
 Tel: 6271 0275, 6274 1311 Fax: 6377 2240 Email: her0504@hotmail.com
 Business Registration Number: 53178607B GST Registration Number: 201415805H

JUPITER SOLUTIONS PTE LTD
 BLK 1001 JALAN BUKIT MERAH #04-11
 REDHILL INDUSTRIAL EST SINGAPORE 159455

Attention : THE OWNER
 Contact : 64179192 Fax No. : 62733121

Tax Invoice : TP000242

Date : 20/02/2018
 Vehicle Num. : SJN 5809 J
 Make/Model : TOYOTA CAMRY-2009
 Chassis/Eng# : MR053BK4107042632/1AZE129743
 Accident Date : 05/12/2017
 Claim No. :
 Reference :
 Policy No. : 17-MD004818-R05

	Amount S\$
LUMP SUM REPAIRS	14,300.00

E. & O.E.	Total S\$:	14,300.00
	GST @ 7% S\$:	1,001.00
	Amount Due S\$:	15,301.00
		=====



Autocar Leasing Pte Ltd

Company Regn. No. 200806807W
Blk 19 Sin Ming Industrial Estate Sector A #01-03
Singapore 575677
Telephone : 9363 3186 Facsimile : 6451 6902

HIRING AGREEMENT cum INVOICE

No. : 00385

Vehicle Number : SKA 857 J
Make & Model : TOYOTA COMBY 2.0 (A)

HIRER's PARTICULARS

Name of Hirer : Jupiter Solutions Pte Ltd
Address : Blk 1001 Redhill Ind Est #04-11
Tan Bukit Merah (S) 159455
Contact Number : (Off) _____ Licence Number : _____
(Res) _____ Licence Expiry : _____
(H/p) _____
Nationality : _____
NRIC No. : _____ Date of Birth : _____

Name of Driver : Chan Kwang Hor
Address : Blk 782 Pasir Ris St. 71
#05-586 (S) 570782
Contact Number : (Off) 62722242 Licence Number : _____
(Res) _____ Licence Expiry : _____
(H/p) 82689095
Nationality : Singaporean
NRIC No. : 31309189/G Date of Birth : 29-10-1958

RENTAL PRICING

Daily Rental Rate	: S\$	<u>180.00</u>	Date Out	: <u>05-12-2017</u>
Days on Rental	:	<u>13</u>	Time Out	: <u>4 pm</u>
Sub-total	: S\$	<u>2340.00</u>	Date Return	: <u>18-12-2017</u>
Misc. charges	: S\$	<u>-</u>	Time Return	: <u>11am</u>
TOTAL	: S\$	<u>2340.00</u>		

- *** RENTER's Liability for Vehicle Damage EXCESS is \$94,500.00 ON ALL CLAIMS.
** Applicable to Driver below 23 YRS old OR with less than 2 YRS driving experience EXCESS is \$3,500.00
* The Vehicle is strictly for Singapore use only.

Remark

HIRER's DECLARATION

I agree to the terms and conditions above and as set out overleaf. If I opt to pay by Credit / Charge Card, my signature here is deemed to have made on application credit card charge slip. I have removed all valuables from the car.

Autocar Leasing Pte Ltd

JUPITER SOLUTIONS PTE LTD

Authorised Signatory and Company Stamp

Date : _____

Prepared by : _____

Date : _____

PAL'S

APPRAISER PTE LTD

No. 1 Kaki Bukit Ave 6 #01-53 AutoBay @ Kaki Bukit Singapore 417883

Tel: 81818802 Fax: 67471017 Registration No: 201000268D

Billing Name & Address

Jupiter Solutions Pte Ltd
c/o Blk 1001 Bukit Merah Lane 3
#01-49 Alexandra Village
Singapore 159718

Invoice No 12-17010/DY

Date 5 Feb 2018

Vehicle No : SJN 5809 J

Model : Toyota Camry

Item	Descriptions	Amount S\$
1	Date of inspection : <u>6 Dec 2017</u> A copy of the inspection / survey report Correspondence, postages and etc.	
2	Photography Services - Purchase of films, develop negatives - Storage of negatives - Submission of photographs <u>225</u> copies	
3	Transportation Charges	
4	2nd Inspection	
	Total	<u>\$ 1070.00</u>
	SDLS : ONE THOUSAND AND SEVENTY ONLY	

Notes :

1. All cheque payment should be "Crossed" and made payable to "Pal's Appraiser Pte. Ltd."
2. All cheque should have our "Invoice No." written on the reverse side of the cheque
3. For further enquiries on this invoice, please feel free to contact us



Official Stamp

E & O. E

Tokio Marine Insurance Singapore Ltd.

(Company Reg. No: 132300014M) (GST Reg No: M2-0000223-4)

20 McCallum Street #05-01 Tokio Marine Centre Singapore 069046

Tel: (65) 6221 6111 F: (65) 6221 4355 / (65) 6224 0855 E: tms@tokiomarine.com.sg W: www.tokiomarine.com



TOKIO MARINE
INSURANCE GROUP

FORM MX4

Certificate of Insurance

MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960
ROAD TRANSPORT ACT, 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

Policy No.: 17-MD004818-R05 (Private Motor Car)

1. Index Mark and Registration Number of Vehicle SJN5809J Chassis No.: MR053BK4107042632
2. Name of Policyholder JUPITER SOLUTIONS PTE LTD
3. Effective date of the Commencement of Insurance for the purposes of the Act 20/08/2017
4. Date of Expiry of Insurance 19/08/2018

5. Persons or Class of Persons entitled to drive*

Any person who is driving on the policyholder's order or with their permission.

* Provided that the Person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle. And provided further that the Motor Vehicle is registered under the Road Traffic Act and its registration under the Road Traffic Act has not been cancelled at the time of the accident loss or damage.

6. Limitations as to use*

Use only for social domestic and pleasure purposes and for the Policyholder's business.

The policy does not cover use for hire or reward, racing, pace-making, reliability trial, speed-testing or the carriage of goods (other than samples) in connection with any trade or business or use for any purpose in connection with the Motor Trade.

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

We hereby certify that the Policy to which this Certificate relates is issued in accordance with the provision of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Please refer to the Policy Schedule for full details, terms and conditions of the insurance.

IMPORTANT NOTICE

This Certificate is not transferable. During its currency, if the insurance is cancelled for whatsoever reason, you must return the Certificate to Tokio Marine Insurance Singapore Ltd. within 7 days thereof or, if the Certificate has been lost destroyed, you must make a statutory declaration to that effect. Failure to comply with this duty is an offence under Motor Vehicle (Third-Party Risks and Compensation) Act (Chapter 189).

ADDITIONAL INFORMATION

Account: 1195DDA

Insurance Plan:	Comprehensive Approved Workshop Plan
Limit for total loss or theft:	Prevailing Market Value
Policy Excess:	Own Damage Claims SGD 800
	Windscreen Excess SGD 100
Financial Interest:	BANK OF EAST ASIA LTD

Tokio Marine Insurance Singapore Ltd.

Authorised Signature

User Name: Intermediaries from TM O

Printed 31/07/2017

Your Insured's vehicle : SKJ 3063R
Our client's vehicle / ref: SJN 5809J ; HC/sy
Date : 5 December 2017

MSIG Insurance (Singapore) Pte Ltd

By Email Only

Dear Sirs,

 
DATE OF ACCIDENT: 5 DECEMBER 2017
NOTICE TO INSURER TO CONDUCT PRE-REPAIR SURVEY / INSPECTIONS

We are instructed by Jupiter Solutions Pte Ltd, the owner of SJN 5809J to notify you of a road traffic accident on 5 December 2017 at 12.20 p.m. along Lorong 6 Toa Payoh, involving our client's vehicle registration number SJN 5809J (2nd vehicle), other vehicle registration number SLH 1549T (1st vehicle) and vehicle registration number SKJ 3063R (3rd vehicle) which was insured by you at the material time. A copy of our client's Accident Report will be sent to you in due course.

As a result of the accident, our client's vehicle has been damaged. Before our client proceeds to repair the damaged vehicle, please let us know within 2 working days excluding any intervening Saturday, Sunday and/or Public Holiday of your receipt of this notice whether you would like to conduct a pre-repair survey of the vehicle. If we do not receive any reply from you within the stipulated timeline, our client shall proceed to repair the vehicle without further reference to you.

NB. Any settlement or offer is on the express condition that this settlement is in respect of our client's claim for property-related damages only and shall not preclude client's driver/passenger from claiming injury-related damages arising from this accident.

Yours sincerely,



Your Insured's vehicle : SKJ 3063R
Our client's vehicle / ref: SJN 5809J ; HC/sy
Date : 6 December 2017

MSIG Insurance (Singapore) Pte Ltd

By Email Only

Dear Sirs,

DATE OF ACCIDENT: 5 DECEMBER 2017
NOTICE TO INSURER TO CONDUCT PRE-REPAIR SURVEY / INSPECTIONS

We refer to your email of even date.

Please be informed that our client is not agreeable to your proposed motor surveyors. Instead we propose you to choose a surveyor from our client's list of surveyors as appended below:-

S/N	Name of Surveyor	Company Name
1.	Yap Teck Lee	LCW Appraiser Pte Ltd
2.	Yap Teck Chye	Mc-Coy Appraiser Pte Ltd
3.	Dixon Yeo	Treasure Appraisal Services
4.	Dennis Yap Teck Wee	Pal's Appraiser Pte Ltd
5.	S. Kumanan	SK Auto Consultants

Please be informed that if we do not hear from you within 2 working days from the date hereof, we will assume, as per the Protocol, that you have no objections to our list of motor surveyors. You will be deemed to have agreed to any of the above motor surveyors as a "single joint expert". We will inform you who the "single joint expert" is in due course.

If you object to our client's list of motor surveyors, we will accordingly inform the client to instruct his choice of motor surveyor to conduct the pre-repair survey. Also, please let us know within 2 working days excluding any intervening Saturday, Sunday and/or Public Holiday of your receipt of this notice whether you would like to conduct a pre-repair survey of the vehicle failing which our client will commence repairs thereafter without any further notice or reference to you. Please be informed that the said vehicle can be surveyed / inspected at:

Address : Han Car Repairs
Block 1001 #01-49 Bukit Merah Lane 3
Alexandra Village, Singapore 159718
Contact Person/Hp/Tel/Fax : Ms. Susan / 9777 7266 / 6271-0275 / 6377 2240

Kindly acknowledge upon inspection in the acknowledgement box below.

Yours sincerely,

Acknowledgement

This is to confirm that I _____ [Full Name of Surveyor] of _____ [Surveyor's Company] have completed as follows:-

(a) Pre- Repair Survey/Inspection on _____ [Date] at _____ [Time].

Signature of Appointed Surveyor _____
Company Stamp _____
Witnessed by: _____
Date _____

(b) Pre- Repair Survey/Inspection (after dismantling) on _____ [Date] at _____ [Time].

Signature of Appointed Surveyor _____
Company Stamp _____
Witnessed by: _____
Date _____

(c) Post - Repair Survey/Inspection on _____ [Date] at _____ [Time].

Signature of Appointed Surveyor _____
Company Stamp _____
Witnessed by: _____
Date _____



RECORDS MANAGEMENT CENTRE

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE
RECORDS MANAGEMENT CENTRE**

6 Raffles Quay #18-00, Singapore 048580
Phone: +65 6224 0010 Fax: +65 6224 0030
Operating Hours: Monday to Friday 9am to 5pm
GST Registration No: M400017735

SEARCH RESULTS

Our Ref No: GR-18-034274

Date of Request: 06/03/2018

Your Ref No: GS/17/5236/HC/SY/CL

KSCGP JURIS LLP
10 Hoe Chiang Road #13-03A
Keppel Tower
Singapore 089315

Dear Sir/Madam,

Your Search Criteria:

Date of Accident: 05/12/2017
Place of Accident: ALONG LORONG 6 TOA PAYOH
Client Vehicle No: SJN5809J

With reference to your search criteria for the accident report, the following documents were found to closely match your search criteria:

REQ. VEHICLE	ACCIDENT LOCATION	ACCIDENT DATE
SKJ3063R	BRADDELL RD TOWARD TOA PAYOH LOR 6	05/12/2017 12:25
SLH1549T	ALONG LORONG 6 TOA PAYOH	05/12/2017 12:20

Thank You.

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

This is a computer generated document and requires no signature.



RECORDS MANAGEMENT CENTRE

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE
RECORDS MANAGEMENT CENTRE**6 Raffles Quay #18-00, Singapore 048580
Phone: +65 6224 0010 Fax: +65 6224 0030
Operating Hours: Monday to Friday 9am to 5pm
GST Registration No: M400017735**TAX INVOICE**

Our Ref No: GR-18-034274

Date of Request: 06/03/2018

Your Ref No: GS/17/5236/HC/SY/CL

KSCGP JURIS LLP
10 Hoe Chiang Road #13-03A
Keppel Tower
Singapore 089315

Dear Sir/Madam,

Your Search Criteria:Date of Accident: 05/12/2017
Place of Accident: ALONG LORONG 6 TOA PAYOH
Client Vehicle No: SJN5809J

DESCRIPTION	AMOUNT (S\$)
E-File Search Fee (Public)	
GST Amount	14.02
Total Amount Due (GST Inclusive)	0.98
	15.00

Thank You.

This is a computer generated document and requires no signature.

For GIARMC Official use:

Date:

☒ GIRO ☐ Cash ☐ Cheque



RECORDS MANAGEMENT CENTRE

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE
RECORDS MANAGEMENT CENTRE**

 6 Raffles Quay #18-00, Singapore 048580
 Phone: +65 6224 0010 Fax: +65 6224 0030
 Operating Hours: Monday to Friday 9am to 5pm
 GST Registration No: M400017735
TAX INVOICE

Our Ref No: GR-18-034283

Date of Request: 06/03/2018

Your Ref No: GS/17/5236/HC/SY/CL

 KSCGP JURIS LLP
 10 Hoe Chiang Road #13-03A
 Keppel Tower
 Singapore 089315

Dear Sir/Madam,

 Date of Accident: 05/12/2017
 Vehicle No: SJN5809J
 Place of Accident: LOR 6 TOA PAYOH TOWARDS LOR 8 TOA PAYOH
 Involving Vehicle No: SKJ3063R

With reference to your application for the accident report, we have attached the following accident reports as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (S\$)	QTY	AMOUNT (S\$)
SKJ3063R	LOR 6 TOA PAYOH TOWARDS LOR 8 TOA PAYOH	14.00	1	13.08
GST Amount				0.92
Total Amount Due (GST Inclusive)				14.00

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank You.

This is a computer generated document and requires no signature.

For GIARMC Official use:

Date:

☒ GIRO ☐ Cash ☐ Cheque



RECORDS MANAGEMENT CENTRE

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE
RECORDS MANAGEMENT CENTRE**

 6 Raffles Quay #18-00, Singapore 048580
 Phone: +65 6224 0010 Fax: +65 6224 0030
 Operating Hours: Monday to Friday 9am to 5pm
 GST Registration No: M400017735
TAX INVOICE

Our Ref No: GR-18-034282

Date of Request: 06/03/2018

Your Ref No: GS/17/5236/HC/SY/CL

 KSCGP JURIS LLP
 10 Hoe Chiang Road #13-03A
 Keppel Tower
 Singapore 089315

Dear Sir/Madam,

 Date of Accident: 05/12/2017
 Vehicle No: SJN5809J
 Place of Accident: LOR 6 TOA PAYOH TOWARDS LOR 8 TOA PAYOH
 Involving Vehicle No: SLH1549T

With reference to your application for the accident report, we have attached the following accident reports as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (S\$)	QTY	AMOUNT (S\$)
SLH1549T	LOR 6 TOA PAYOH TOWARDS LOR 8 TOA PAYOH	14.00	1	13.08
GST Amount				0.92
Total Amount Due (GST Inclusive)				14.00

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank You.

This is a computer generated document and requires no signature.

For GIARMC Official use:

Date:

☒ GIRO ☐ Cash ☐ Cheque

Enquire Vehicle & Owner Information (Vehicle No. SKJ3063R As At 05 Dec 2017 / 12:20:00)**Law Firm Search Details**

Search Reason: Insurance claim in relation to traffic accident
Law Firm Case No.: SJN5809J/HC

Current Owner Details

Owner ID Type: Singapore NRIC
Owner ID: S1675891D
Owner Name: YONG HWEE HONG
Registered Address Type: HDB / HUDC
Registered Block/House No.: 547
Registered Street Name: CHOA CHU KANG STREET 52
Registered Unit No.: # 06 - 15
Registered Building Name: -
Registered Postal Code: 680547

Current Vehicle Details

Vehicle No.: SKJ3063R
Make Description/Model: HYUNDAI / ELANTRA 1.6 AT ABS D/AB 2WD 4DR
Insurance Company Name: MSIG INSURANCE (SINGAPORE) PTE LTD



Prime Auto Claims Service Pte Ltd

GST Reg. No: 201606560M
5 Bonoi Place Singapore 629926
Tel: 6861 0908 Fax: 6515 2948

Date: 19.03.2018

Sompo Insurance Singapore Pte Ltd
50 Raffles Place #05-01/06
Singapore Land Tower
Singapore 048623

Attn: Motor Claims Dept

RE: COST OF REPAIR TO VEHICLE SKWS412K TOYOTA PRIUS HYBRID 1.8L A (2015)

To Supply

1)	1pc	Rear bumper	\$	1,218.00	DE
2)	1pc	Rear bumper right side retainer	\$	122.25	AM
3)	1set	Rear bumper clip	\$	30.00	AM
4)	1pc	Tail gate	\$	1,450.00	PM
5)	1pc	Tail gate weatherstrip	\$	284.00	AM
6)	1pc	Tail gate "Toyota" emblem	\$	62.00	AM
7)	1pc	Tail gate "Prius" emblem	\$	72.00	AM
8)	1pc	Tail gate "Hybrid Synergy Drive" emblem	\$	51.00	AM
9)	1pc	Rear end panel	\$	782.00	R
10)	1pc	Rear end panel top garnish	\$	562.00	AM
11)	1set	Rear end panel top garnish clip	\$	40.00	AM

Sub total parts	\$	4,878.25	2
Less: 25% discount	\$	1,168.31	-
	\$	3,504.94	3

To Supply S. Nett Parts

1)	1tube	Rear glass sealant	\$	15.00	AM
2)	1pc	Inner seal	\$	40.00	AM
3)	2pcs	Tail gate lower glass moulding (2pcs)	\$	60.00	AM
4)	1set	Tail gate glass moulding (3pcs)	\$	240.00	AM

Sub total S. Nett Parts	\$	355.00	AM
-------------------------	----	--------	----

L/charge

1)	To remove & refit tail gate glass	\$	120.00	✓
2)	To remove & refit tail gate lower glass	\$	150.00	✓

11.36 From

To 182659941

- | | | |
|---|----|------|
| 3) To transfer tail gate trim, handle & mechanism parts | \$ | 1.00 |
| 4) To cut / welding rear end panel, knock floor panel. To remove rear bumper, tail gate & end panel. Replace the above parts. Align & adjust rear bumper & tail gate | \$ | 85 |
| 5) To putty, respray painting tail gate inlet & outer, rear end panel, floor panel, rear bumper | \$ | 1.00 |

Sub total L/charges	\$	1.00
Estimated Grand Total	\$	1.00

less 5/

Rasul
4p 9001368

5 days

4/5

19/03/15 21:00

Resary ft. 11

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No legal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

PAL'S

APPRAISER PTE LTD

No. 1 Kaki Bukit Ave 6 #01-53 AutoBay @ Kaki Bukit Singapore 417912
Tel: 81818802 Fax: 67471017 Registration No: 2010002173

Report Reference : TP / 12-17010/DY / 2017
Date of Report : 5 Feb 2018

Jupiter Solutions Pte Ltd
c/o Blk 1001 Bukit Merah Lane 3
#01-49 Alexandra Village
Singapore 159718

THIRD PARTY SURVEY
ACCIDENT HAPPENED ON 5 Dec 2017

As per your instruction dated 6 Dec 2017 with regard to the above matter, We have carried out a physical inspection on the said vehicle SJN 5809 J. We are submitting our report and findings as follows:

1. VEHICLE PARTICULARS

Registration No : SJN 5809 J
Model : Toyota Camry
Year / Capacity : 2009/1998
Chassis No : MR053BK4107042632
Engine No : 1AZE129743
Mileage : 253691
Colour : Black

2. TYRES CONDITION

			Size	Made	Balance
FRONT	O/S	:	215/60 R16	Michelin	6.00
REAR	O/S	:	215/60 R16	Michelin	6.00
FRONT	N/S	:	215/60 R16	Michelin	6.00
REAR	N/S	:	215/60 R16	Michelin	6.00

PAL'S

APPRAISER PTE LTD

No. 1 Kaki Bukit Ave 6 #01-53 AutoBay @ Kaki Bukit Singapore 417883
Tel: 81818802 Fax: 67471017 Registration No: 201000363D

3. DESCRIPTION OF DAMAGES

At the time of inspection, we noted that the vehicle has sustained an impact damages on the rear and front portion(s). For more detail of the damages, please see photograph a/c

4. Workshop Address : Han Car Repairs
Blk 1001 Bukit Merah Lane 3
#01-49 Alexandra Village
Singapore 159718

5. Estimated normal period of repair : 13 working days and including lead time to complete.
6. Enclosed number of photograph : 225 copies.
7. In accordance to your instruction, we have Not Authorised repair to the vehicle and the survey was done on a "Without Prejudice" basis. We hope that this report will be of assistance to you in dealing with the matter.
8. Should you discover any discrepancy in the report, please kindly notify us with 2 weeks, or the report will be treated as correct.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for the purpose of compensation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicles and accidents in other legal proceedings.

Vehicle No: SJN 5809 J
Report No: TP/ 12-17010/DY / 2017

SPARE PARTS

Qty	Parts Description	Condition	Workshop's Estimation	Our Revised Estimation
<u>List Items</u>				
1	Bonnet	Damage	1711.08	\$ 1711.08
1	Bonnet dampers	Intact	258.00	\$
1	Bonnet insulator	Intact	356.85	\$
1	Bonnet insulator clip (1 set)	Necessary	38.00	\$ 38.00
1	Bonnet lock	Damage	81.62	\$ 81.62
1	Bonnet rubber	Necessary	66.90	\$ 66.90
2	Front headlamps (HID) LH / RH - Not change	Damage	5233.68	\$ 5233.68 1616.84
1	Front grille	Damage	439.52	\$ 439.52
1	Front grille logo	Necessary	59.60	\$ 59.60
1	Front bumper	Damage	552.50	\$ 552.50
1	Front bumper chrome moulding	Damage	348.45	\$ 348.45
2	Front bumper fog lamp covers	Damage	86.10	\$ 86.10
1	Front bumper fog lamp chrome	Damage	46.10	\$ 46.10
1	Front bumper inner sponge	Damage	113.82	\$ 113.82
1	Front bumper lower grille	Damage	198.30	\$ 198.30
1	Front bumper reinforcement	Damage	340.19	\$ 340.19
2	Front bumper side retainers	Necessary	100.30	\$ 100.30
1	Front fender	Repair	775.94	\$
1	Front support panel	Repair	1042.50	\$
1	Air con condenser	Damage	1485.91	\$ 1485.91 K Not change
1	Radiator side garnish	Damage	48.50	\$ 48.50
1	Boot lid	Damage	957.00	\$ 957.00 Rx
2	Boot lid hinges	Intact	288.40	\$
1	Boot lid lock	Damage	360.56	\$ 360.56 K Rx
1	Boot lid logo	Necessary	58.50	\$ 58.50
1	Boot lid rubber	Necessary	231.40	\$ 231.40
1	Boot lid 'CAMRY' emblem	Necessary	48.60	\$ 48.60
1	Boot lid '2.4' emblem	Necessary	32.30	\$ 32.30
2	Rear taillamps	Damage	948.60	\$ 948.60
1	Rear end panel	Damage	639.13	\$ 639.13 Rx
1	Rear end panel inner garnish	Damage	434.25	\$ 434.25
1	Rear bumper	Damage	545.70	\$ 545.70
2	Rear bumper reflectors	Damage	139.60	\$ 139.60
1	Rear bumper reinforcement	Damage	377.30	\$ 377.30
2	Rear bumper side retainers	Necessary	110.00	\$ 110.00
1	Rear exhaust silencer	Damage	826.55	\$ 826.55
2	Rear exhaust silencer mountings	Necessary	147.76	\$ 147.76

List Items Sub Total 9529.51 \$ 16807.2

Vehicle No: SJN 5809 J
Report No: TP/ 12-17010/DY / 2017

SPARE PARTS

Qty	Parts Description	Condition	Workshop's Estimation	Our Revised Estimation
-----	-------------------	-----------	-----------------------	------------------------

List Items Total c/f \$ 19529.51 \$ 16807.82

List Items

1	Rear exhaust silencer tail pipe	Damage	\$ 185.80	\$ 185.80
2	Rear fenders	Repair	\$ 1975.40	\$
1	Rear fender inner shield	Damage	\$ 123.30	\$ 123.30
			<u>\$ 2184.01</u>	<u>\$ 17116.92</u>
	Discount 25.0%		\$ 5453.50	\$ 4279.23
			<u>\$ 16360.51</u>	<u>\$ 12837.69</u>

11/08.94

8331.71

Special Nett Items

1	Front bumper clip (1 set)	Necessary	\$ 40.00	\$ 40.00
1	Front number plate	Damage	\$ 50.00	\$ 50.00
1	Rear bumper clip (1 set)	Necessary	\$ 40.00	\$ 40.00
1	Rear reverse sensor (1 set)	Damage	\$ 350.00	\$ 280.00
			<u>\$ 480.00</u>	<u>\$ 410.00</u>

45

200

325

Spare Parts Total \$ 16840.51 \$ 13247.69

Vehicle No: SJN 5809 J
Report No: TP/ 12-17010/DY / 2017

LABOUR COST

S/No	Job Descriptions	Workshop's Estimation	Our Revised Estimation
	Spare Parts Total c/f	\$ 16840.51	\$ 13247.69
1	To disconnect and reconnect, check electrical wiring, harness wires, sockets, replace damaged parts.	\$ 50.00	\$ 40.00 30
2	To remove and refit damage parts, test for proper functioning and focus of headlamps.	\$ 50.00	\$ 40.00 30
3	To remove and refit inner trims, inner garnishes, to facilitate the repairs.	\$ 120.00	\$ 80.00 60
4	To remove and refit rear bumper sensor.	\$ 120.00	\$ 80.00 30
5	To remove and refit air-con system, refill gas and test for leakages.	\$ 180.00	\$ 120.00 100
6	To remove and refit rear windscreen glass.	\$ 200.00	Not Required
7	To remove and refit, straighten and re-adjust exhaust pipe and replace rear exhaust silencer and mountings.	\$ 130.00	\$ 80.00 -
8	To remove and replace the above damaged parts, straighten, knock out, realign and repair including cut and weld body panels. To re-adjust to the original position using power tools.	\$ 2000.00	\$ 1750.00 1540
9	To spray paint on the replaced and repaired parts, prepare spray such as masking tape the unaffected areas with paper, cleaning and sanding of surfaces, final polishing and waxing are also available.	\$ 2500.00	\$ 2250.00 1750
10	To apply undercoating on the repaired and replaced panels for rust protection.	\$ 300.00	\$ 210.00 100
Total		22490.51	\$ 17897.69 3720

12376.71
4599.00

Vehicle No: SJN 5809 J
Report No: TP/ 12-17010/DY / 2017


LABOUR COST

S/No	Job Descriptions	Workshop's Estimation	Our Revised Estimation
Total c/f		22490.51	\$ 17897.69

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a Lump Sum Repair Contract of:

\$ 14300.00

SDLS: FOURTEEN THOUSAND THREE HUNDRED ONLY

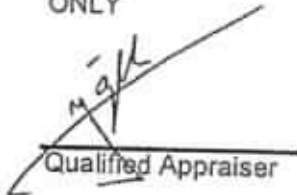
Qualified Appraiser

4/5 @ 518pm Informed Katherine Wong Ls \$ 5500 p

PAL'S

APPRAISER PTE LTD

No. 1 Kaki Bukit Ave 6 #01-53 AutoBay @ Kaki Bukit Singapore 417883

Tel: 81818802 Fax: 67471017 Registration No: 201000268D

Report Reference : TP / 12-17010/DY / 2017

Date of Report : 5 Feb 2018

Jupiter Solutions Pte Ltd
c/o Blk 1001 Bukit Merah Lane 3
#01-49 Alexandra Village
Singapore 159718

THIRD PARTY SURVEY

ACCIDENT HAPPENED ON 5 Dec 2017

As per your instruction dated 6 Dec 2017 with regard to the above matter. We have carried out a physical inspection on the said vehicle SJN 5809 J. We enclosed herewith our report and findings as follows:

1. VEHICLE PARTICULARS

Registration No : SJN 5809 J
Model : Toyota Camry
Year / Capacity : 2009/1998
Chassis No : MR053BK4107042632
Engine No : 1AZE129743
Mileage : 253691
Colour : Black

2. TYRES CONDITION

		<u>Size</u>	<u>Made</u>	<u>Balance</u>		<u>Rim</u>
FRONT	O/S	: 215/60 R16	Michelin	6.00	mm	Sport
REAR	O/S	: 215/60 R16	Michelin	6.00	mm	Sport
FRONT	N/S	: 215/60 R16	Michelin	6.00	mm	Sport
REAR	N/S	: 215/60 R16	Michelin	6.00	mm	Sport

PAL'S

APPRAISER PTE LTD

No. 1 Kaki Bukit Ave 6 #01-53 AutoBay @ Kaki Bukit Singapore 417883
Tel: 81818802 Fax: 67471017 Registration No: 201000268D

3. DESCRIPTION OF DAMAGES

At the time of inspection, we noted that the vehicle has sustained an impact damages on the rear and front portion(s). For more detail of the damages, please see photograph attached.

4. Workshop Address : Han Car Repairs
Blk 1001 Bukit Merah Lane 3
#01-49 Alexandra Village
Singapore 159718

5. Estimated normal period of repair : 13 working days and including lead time to complete.
6. Enclosed number of photograph : 225 copies.
7. In accordance to your instruction, we have Not Authorised repair to the vehicle and the survey was done on a "Without Prejudice" basis. We hope that this report will be of assistance to you in dealing with the matter.
8. Should you discover any discrepancy in the report, please kindly notify us within 2 weeks, or the report will be treated as correct.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicles and/or other accidents in other legal proceedings.

Vehicle No: **SJN 5809 J**
 Report No: **TP/ 12-17010/DY / 2017**

SPARE PARTS

Qty	Parts Description	Condition	Workshop's Estimation	Our Revised Estimation
<u>List Items</u>				
1	Bonnet	Damage	\$ 1711.08	\$ 1711.08 ✓
1	Bonnet dampers	Intact	\$ 258.00	\$
1	Bonnet insulator	Intact	\$ 356.85	\$
1	Bonnet insulator clip (1 set)	Necessary	\$ 38.00	\$ 38.00 ✓
1	Bonnet lock	Damage	\$ 81.62	\$ 81.62 ✓ _R
1	Bonnet rubber	Necessary	\$ 66.90	\$ 66.90 ✓ ₄₅
2	Front headlamps (HID)	Damage	\$ 5233.68	\$ 5233.68 ✓
1	Front grille	Damage	\$ 439.52	\$ 439.52 ✓
1	Front grille logo	Necessary	\$ 59.60	\$ 59.60 ✓
1	Front bumper	Damage	\$ 552.50	\$ 552.50 ✓
1	Front bumper chrome moulding	Damage	\$ 348.45	\$ 348.45 ✓
2	Front bumper fog lamp covers	Damage	\$ 86.10	\$ 86.10 ✓ _{nn}
1	Front bumper fog lamp chrome	Damage	\$ 46.10	\$ 46.10 ✓ _{nn}
1	Front bumper inner sponge	Damage	\$ 113.82	\$ 113.82 ✓
1	Front bumper lower grille	Damage	\$ 198.30	\$ 198.30 ✓ _{nn}
1	Front bumper reinforcement	Damage	\$ 340.19	\$ 340.19 ✓
2	Front bumper side retainers	Necessary	\$ 100.30	\$ 100.30 ✓
1	Front fender	Repair	\$ 775.94	\$
1	Front support panel	Repair	\$ 1042.50	\$
1	Air con condenser	Damage	\$ 1485.91	\$ 1485.91 ✓ ₅₀
1	Radiator side garnish	Damage	\$ 48.50	\$ 48.50 ✓ _{nn}
1	Boot lid	Damage	\$ 957.00	\$ 957.00 ✓ _R
2	Boot lid hinges	Intact	\$ 288.40	\$
1	Boot lid lock	Damage	\$ 360.56	\$ 360.56 ✓ _R
1	Boot lid logo	Necessary	\$ 58.50	\$ 58.50 ✓
1	Boot lid rubber	Necessary	\$ 231.40	\$ 231.40 ✓
1	Boot lid 'CAMRY' emblem	Necessary	\$ 48.60	\$ 48.60 ✓
1	Boot lid '2.4' emblem	Necessary	\$ 32.30	\$ 32.30 ✓ ₅₀
2	Rear taillamps	Damage	\$ 948.60	\$ 948.60 ✓ _R
1	Rear end panel	Damage	\$ 639.13	\$ 639.13 ✓ _{nn}
1	Rear end panel inner garnish	Damage	\$ 434.25	\$ 434.25 ✓ _R
1	Rear bumper	Damage	\$ 545.70	\$ 545.70 ✓
2	Rear bumper reflectors	Damage	\$ 139.60	\$ 139.60 ✓
1	Rear bumper reinforcement	Damage	\$ 377.30	\$ 377.30 ✓
2	Rear bumper side retainers	Necessary	\$ 110.00	\$ 110.00 ✓
1	Rear exhaust silencer	Damage	\$ 826.55	\$ 826.55 ✓ _R
2	Rear exhaust silencer mountings	Necessary	\$ 147.76	\$ 147.76 ✓ _{nn}

List Items Sub Total \$ 19529.51 \$ 16807.82

Vehicle No: SJN 5809 J
 Report No: TP/ 12-17010/DY / 2017

SPARE PARTS

Qty	Parts Description	Condition	Workshop's Estimation	Our Revised Estimation
-----	-------------------	-----------	-----------------------	------------------------

List Items Total c/f \$ 19529.51 \$ 16807.82

<u>List Items</u>				
1	Rear exhaust silencer tail pipe	Damage	\$ 185.80	\$ 185.80 <i>X^{suc}</i>
2	Rear fenders	Repair	\$ 1975.40	\$
1	Rear fender inner shield	Damage	\$ 123.30	\$ 123.30 ✓
			<u>\$ 21814.01</u>	<u>\$ 17116.92</u>
	Discount	25.0%	\$ 5453.50	\$ 4279.23
			<u>\$ 16360.51</u>	<u>\$ 12837.69</u>

<u>Special Nelt Items</u>				
1	Front bumper clip (1 set)	Necessary	\$ 40.00	\$ 40.00 ✓
1	Front number plate	Damage	\$ 50.00	\$ 50.00 <i>45</i>
1	Rear bumper clip (1 set)	Necessary	\$ 40.00	\$ 40.00 ✓
1	Rear reverse sensor (1 set)	Damage	\$ 350.00	\$ 280.00 <i>220</i>
			<u>\$ 480.00</u>	<u>\$ 410.00</u>

Spare Parts Total \$ 16840.51 \$ 13247.69

Vehicle No: **SJN 5809 J**
 Report No: **TP/ 12-17010/DY / 2017**

LABOUR COST

S/No	Job Descriptions	Workshop's Estimation	Our Revised Estimation
Spare Parts Total c/f		\$ 16840.51	\$ 13247.69
1	To disconnect and reconnect, check electrical wiring, harness wires, sockets, replace damaged parts.	\$ 50.00	\$ 40.00 <i>30</i>
2	To remove and refit damage parts, test for proper functioning and focus of headlamps.	\$ 50.00	\$ 40.00 <i>30</i>
3	To remove and refit inner trims, inner garnishes, to facilitate the repairs.	\$ 120.00	\$ 80.00 ✓
4	To remove and refit rear bumper sensor.	\$ 120.00	\$ 80.00 <i>60</i>
5	To remove and refit air-con system, refill gas and test for leakages.	\$ 180.00	\$ 120.00 <i>100</i>
6	To remove and refit rear windscreen glass.	\$ 200.00	Not Required
7	To remove and refit, straighten and re-adjust exhaust pipe and replace rear exhaust silencer and mountings.	\$ 130.00	\$ 80.00 <i>X</i>
8	To remove and replace the above damaged parts, straighten, knock out, realign and repair including cut and weld body panels. To re-adjust to the original position using power tools.	\$ 2000.00	\$ 1750.00 <i>1300</i>
9	To spray paint on the replaced and repaired parts, prepare spray such as masking tape the unaffected areas with paper, cleaning and sanding of surfaces, final polishing and waxing are also available.	\$ 2500.00	\$ 2250.00 <i>1500</i>
10	To apply undercoating on the repaired and replaced panels for rust protection.	\$ 300.00	\$ 210.00 <i>150</i>
Total		\$ 22490.51	\$ 17897.69

Vehicle No: **SJN 5809 J**
Report No: **TP/ 12-17010/DY / 2017**

LABOUR COST

S/No	Job Descriptions	Workshop's Estimation	Our Revised Estimation
------	------------------	-----------------------	------------------------

Total c/f \$ 22490.51 \$ 17897.69

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a Lump Sum Repair Contract of:

\$ 14300.00

SDLS: FOURTEEN THOUSAND THREE HUNDRED ONLY


Qualified Appraiser

...CLAIM SUBFOLDER...(Pending for Survey Report)






































Reinspection





































CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Dec 2017		06 Dec 2017 10:49 Edit Adj Rpt	S\$5,800.00 Edit Estimates	S\$5,800.00 View Rpt		Pending for Survey Report Cancel Case



















































Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured: YONG HWEE HONG , ID: S1675891D									
Main Claimant: Jupiter Solutions Pte Ltd , Co. Reg. No.: 200008342E									
Vehicle Reg. No.:	SJN5809J	Date of Loss:	05/12/2017 12:00 - :59 [105 Months and 15 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / 539552	Policy/Cover Note No.:	P27655833DMA (Comprehensive) Coverage: 18/03/2017 - 17/03/2018						
Vehicle Reg. No. (Insured):	SKJ3063R	Policy No. (Claimant):							
		Excess:	S\$500.00						
Repairer:	Han Car Repairs (HQ) BLK 1001 BUKIT MERAH LANE 3 #01-49 ALEXANDRA VILLAGE, 159718 Alexandra - Tel: 62710275								
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Katherine Wong Chew Shong - 6594 2544]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD TAUFIKH BIN HAMID] ... [Final Rpt due 19/03/2018]								
Driver/Custodian (Insured):	YONG HWEE HONG (J) , NRIC: S1675891D								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
<ul style="list-style-type: none"> MSIG_SG (15/03/2018): Report Send Back Alerts - SJN5809J (TP) MSIG_SG (19/02/2018): Re: SJN5809J MSIG_SG (19/02/2018): SJN5809J 									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									



















































Claim Documents
















*SJN5809J (539552)
[SKJ3063R]
TP
Jupiter Solutions Pte Ltd
Dec 5 2017 12:00PM
[YONG HWEE HONG]
Han Car Repairs

Upload Documents			Upload Photos			Compose New Letter			View		View in Browser	
Photos/Images									3 per page		<input checked="" type="checkbox"/>	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)								Thumbnail	Print	
1	09/03/18 16:39	Odometer Reading								Load JPG	<input checked="" type="checkbox"/>	
2	09/03/18 16:39	Chassis Number								Load JPG	<input checked="" type="checkbox"/>	
3	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
4	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
5	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
6	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
7	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
8	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
9	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
10	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
11	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
12	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
13	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
14	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
15	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
16	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
17	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
18	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
19	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
20	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
21	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
22	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
23	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
24	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
25	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
26	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
27	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
28	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
29	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
30	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
31	09/03/18 16:39	General View								Load JPG	<input checked="" type="checkbox"/>	
32	09/03/18 16:40	Photographs of Damaged Parts								Load JPG	<input checked="" type="checkbox"/>	
33	09/03/18 16:40	Photographs of Damaged Parts								Load JPG	<input checked="" type="checkbox"/>	
34	09/03/18 16:40	Photographs of Damaged Parts								Load JPG	<input checked="" type="checkbox"/>	
35	09/03/18 16:40	Photographs of Damaged Parts								Load JPG	<input checked="" type="checkbox"/>	
36	09/03/18 16:40	Photographs of Damaged Parts								Load JPG	<input checked="" type="checkbox"/>	
37	09/03/18 16:40	Photographs of Damaged Parts								Load JPG	<input checked="" type="checkbox"/>	

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
38	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
39	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
40	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
41	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
42	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
43	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
44	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
45	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
46	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
47	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
48	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
49	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
50	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
51	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
52	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
53	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
54	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
55	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
56	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
57	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
58	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
59	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
60	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
61	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
62	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
63	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
64	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
65	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
66	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
67	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
68	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
69	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
70	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
71	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
72	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
73	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
74	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
75	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
76	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
77	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
78	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
79	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
80	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
81	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
82	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
83	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
84	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
85	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
86	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
87	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
88	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
89	09/03/18 16:40	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
90	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
94	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
95	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
96	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
97	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
98	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
99	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
100	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
101	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
102	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
103	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
104	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
105	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
106	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
107	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
108	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
109	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
110	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
111	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
112	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
113	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
114	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
115	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
116	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
117	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
118	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
119	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
120	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
121	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
122	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
123	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
124	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
125	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
126	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
127	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
128	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
129	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
130	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
131	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
132	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
133	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
134	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
135	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
136	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
137	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
138	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
139	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
140	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
141	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
142	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
143	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
144	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
145	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
146	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
147	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
148	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
149	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
150	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
151	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
152	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
153	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
154	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
155	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
156	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
157	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
158	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
159	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
160	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
161	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
162	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
163	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
164	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
165	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
166	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
167	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
168	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
169	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
170	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
171	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
172	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
173	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
174	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
175	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
176	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
177	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
178	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
179	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
180	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
181	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
182	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
183	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
184	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
185	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
186	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
187	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
188	25/06/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	06/12/17 09:04	OI E FILE REPORT.	 Load PDF	
2	07/12/17 15:07	1ST CAR - SLH1549T, OI THIRD CAR. LAST From: OD - Reg. No: SKJ3B63R, Claimant: YONG HWEE HONG	 Load PDF	
3	07/12/17 15:07	2ND CAR - SJN5809J From: OD - Reg. No: SKJ3B63R, Claimant: YONG HWEE HONG	 Load PDF	
4	12/03/18 14:14	LOD- Repair Bill - Rental Bill - Survey Bill -CI - PRI Request- GIA Fees - LTA Search	 Load PDF	
5	12/03/18 14:14	Survey Report	 Load PDF	
6	12/03/18 14:14	Survey Photo 1	 Load PDF	
7	12/03/18 14:14	Survey Photo 2	 Load PDF	
8	12/03/18 14:14	Survey Photo 3	 Load PDF	
9	12/03/18 14:14	Survey Photo 4	 Load PDF	
10	12/03/18 14:14	Survey Photo 5	 Load PDF	
11	15/03/18 10:57	Reinspection date on 26.3.18	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	26/06/18 17:08	PHOTO	 Load PDF	
2	26/06/18 17:08	PHOTO2	 Load PDF	
3	26/06/18 17:10	PRS Invoice	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin-top: 5px;"></div>
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG17023167/T1VBE2-1

Date: 26/06/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. Policy No: P27655833DMA
 Claimant Vehicle No: SJN5809J Insured Vehicle No: SKJ3063R
 Date of Loss: 05/12/2017 Nature of Claim: TP Claim No: 539552

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SJN5809J Engine No: 1AZE129743
 Make & Model: TOYOTA CAMRY, 2.0 ABS AIRBAG (A) Chassis No: MR053BK4107042632
 Reg. Date: 20/02/2009 (Man. Year: 2009) Odometer: 0 km
 Colour: Black
 Engine Capacity: 1998 cc
 Market Value/New Car Price: N/A
 Sum Insured (\$\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 215/60 R16 Rear Tyre Size: 215/60 R16
 Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm
 Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,840.51	4,013.52	12,826.99	76.17
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,650.00	3,250.00	2,400.00	42.48
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	22,490.51	7,263.52	15,226.99	67.70
Approved Total (Overridden) (\$\$)		5,800.00		
Nett Amount (\$\$)	22,490.51	5,800.00	16,690.51	74.21

INSPECTION

Date of Assignment: 06/12/2017
 Date Inspected: 26/03/2018 Inspected At: Han Car Repairs (HQ)
 BLK 1001 BUKIT MERAH LANE 3 #01-49
 ALEXANDRA VILLAGE
 Singapore 159718
 Estimated Period of Repair: 11.0 days

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 26 Jun 2018)
Parts:	143	TOYOTA CAMRY 2.0 ABS AIRBAG (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJN5809J)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Replaced	1,711.08 FL	*1,711.08 FL
2	1		*BONNET DAMPERS	Intact	258.00 FL	*- FL
3	1		*BONNET INSULATOR	Intact	356.85 FL	*- FL
4	1		*SET BONNET INSULATOR CLIP	Replaced	38.00 FL	*38.00 FL
5	1		*BONNET LOCK	Repaired	81.62 FL	*- FL
6	1		*BONNET RUBBER	Replaced	66.90 FL	*66.90 FL
7	2		*FRONT HEADLAMPS (HID)	Used Back	5,233.68 FL	*- FL
8	1		*FRONT GRILLE	Replaced	439.52 FL	*439.52 FL
9	1		*FRONT GRILLE LOGO	Replaced	59.60 FL	*59.60 FL
10	1		*FRONT BUMPER	Replaced	552.50 FL	*552.50 FL
11	1		*FRONT BUMPER CHROME MOULDING	Replaced	348.45 FL	*348.45 FL
12	2		*FRONT BUMPER FOG LAMP COVERS	Not Necessary	86.10 FL	*- FL
13	1		*FRONT BUMPER FOG LAMP CHROME	Not Necessary	46.10 FL	*- FL
14	1		*FRONT BUMPER INNER SPONGE	Replaced	113.82 FL	*113.82 FL
15	1		*FRONT BUMPER LOWER GRILLE	Not Necessary	198.30 FL	*- FL
16	1		*FRONT BUMPER REINFORCEMENT	Replaced	340.19 FL	*340.19 FL
17	2		*FRONT BUMPER SIDE RETAINERS	Replaced	100.30 FL	*100.30 FL
18	1		*FRONT FENDER	Repaired	775.94 FL	*- FL
19	1		*FRONT SUPPORT PANEL	Repaired	1,042.50 FL	*- FL
20	1		*AIR CON CONDENSER	Serviceable	1,485.91 FL	*- FL
21	1		*RADIATOR SIDE GARNISH	Not Necessary	48.50 FL	*- FL
22	1		*BOOT LID	Repaired	957.00 FL	*- FL
23	2		*BOOT LID HINGES	Intact	288.40 FL	*- FL
24	1		*BOOT LID LOCK	Repaired	360.56 FL	*- FL
25	1		*BOOT LID LOGO	Replaced	58.50 FL	*58.50 FL
26	1		*BOOT LID RUBBER	Replaced	231.40 FL	*231.40 FL
27	1		*BOOT LID CAMRY EMBLEM	Replaced	48.60 FL	*48.60 FL
28	1		*BOOT LID 2.4 EMBLEM	Replaced	32.30 FL	*32.30 FL
29	2		*REAR TAILLAMPS	Serviceable	948.60 FL	*- FL
30	1		*REAR END PANEL	Repaired	639.13 FL	*- FL
31	1		*REAR END PANEL INNER GARNISH	Not Necessary	434.25 FL	*- FL
32	1		*REAR BUMPER	Repaired	545.70 FL	*- FL
33	2		*REAR BUMPER REFLECTORS	Replaced	139.60 FL	*139.60 FL
34	1		*REAR BUMPER REINFORCEMENT	Replaced	377.30 FL	*377.30 FL
35	2		*REAR BUMPER SIDE RETAINERS	Replaced	110.00 FL	*110.00 FL
36	1		*REAR EXHAUST SILENCER	Repaired	826.55 FL	*- FL
37	2		*REAR EXHAUST SILENCER MOUNTINGS	Not Necessary	147.76 FL	*- FL
38	1		*REAR EXHAUST SILENCER TAIL PIPES	Serviceable	185.80 FL	*- FL
39	2		*REAR FENDERS	Repaired	1,975.40 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
40	1		*REAR FENDER INNER SHIELD	Replaced	123.30 FL	*123.30 FL
41	1		*SET FRONT BUMPER CLIP	Replaced	40.00 FS	*40.00 FS
42	1		*FRONT NUMBER PLATE	Replaced	50.00 FS	*45.00 FS
43	1		*SET REAR BUMPER CLIP	Replaced	40.00 FS	*40.00 FS
44	1		*SET REAR REVERSE SENSOR	Replaced	350.00 FS	*220.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	22,294.01	5,236.36
- List Item Discount on L Items 25.00/25.00% (\$\$)	5,453.50	1,222.84
Total Parts (\$\$)	16,840.51	4,013.52

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISCONNECT AND RECONNECT,CHECK ELECTRICAL WIRING,HARNESS WIRES,SOCKETS,REPLACE DAMAGED PARTS	New	50.00	30.00
2	TO REMOVE AND REFIT DAMAGE PARTS,TEST FOR PROPER FUNCTIONING AND FOCUS OF HEADLAMPS	New	50.00	30.00
3	TO REMOVE AND REFIT INNER TRIMS,INNER GARNISHES,TO FACILITATE THE REPAIRS	New	120.00	80.00
4	TO REMOVE AND REFIT REAR BUMPER SENSOR	New	120.00	60.00
5	TO REMOVE AND REFIT AIR-CON SYSTEM,REFILL GAS AND TEST FOR LEAKAGES	New	180.00	100.00
6	TO REMOVE AND REFIT REAR WINDSCREEN GLASS	New	200.00	-
7	TO REMOVE AND REFIT,STRAIGHTEN AND RE-ADJUST EXHAUST PIPE AND REPLACE REAR EXHAUST SILENCER AND MOUNTINGS	New	130.00	-
8	TO REMOVE AND REPLACE THE ABOVE DAMAGED PARTS.STRAIGHTEN,KNOCK OUT,REALIGN AND REPAIR INCLUDING CUT AND WELD BODY PANELS.TO RE-ADJUST TO THE ORIGINAL POSITION USING POWER TOOLS	New	2,000.00	1,300.00
9	TO SPRAY PAINT ON THE REPAIRED AND REPLACED PARTS,PREPARE SPRAY SUCH AS MASKING TAPE THE UNAFFECTED AREAS WITH PAPER,CLEANING AND SANDING OF SURFACES,FINAL POLISHING AND WAXING ARE ALSO AVAILABLE	New	2,500.00	1,500.00
10	TO APPLY UNDERCOATING ON THE REPAIRED AND REPLACED PANELS FOR RUST PROTECTION	New	300.00	150.00
Gross Labour Cost (S\$)			5,650.00	3,250.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >