

ASS. REC. BY:

REF: CS/MSG18007085/Kvb2 Special Instruction:

Surveyor:

Merimen

ASSIGNMENT (Office)

From (Person): Monica Chung of MSU Date/Time: 16/04/2018 5:32pm

Estimated Cost: Bill to:

OD / ~~FB~~ / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SKA 3709J Insured: FBJ 278P

at Workshop m/s Cheng Hoe Tel: 67056142

of Bk 1019 Yishun Rd Park A #01-374

Policy No: MSD/VMS/17-374327-0A Claim No:

Sum Insured: Excess:

Make of Veh: D.O.A. 13/04/2018
(Client's Record)

CA / REV / REP. / REV 24 HRS w/p H.O.D. Endorsement:

Date/Time: 17/04/2018 10:40am Person Contacted: June Vehicle-IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SKA 3709J - X
	FBJ 278P - X
19/4/18	Informed Monica pending workshop est by merimen
5/7	11 Lm @ 36501 Carfund Inc (Red 2240.60, 3870)

ASS. REC. BY:

REF:

MSG/

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

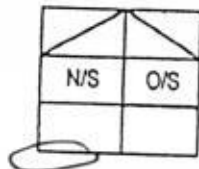

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

08 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SKA 37097 Yr Regn: 02, 11

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Toy Altis

C.C:

1598

Colour:

M. Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

201019

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

MR053REE104112702

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal.

8

mm

Rear

R/Bal.

8

mm

L/Bal.

8

mm

L/Bal.

8

mm

D.O.A.

13/4/18

D.O.I.

18/4/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

19/4

File pass to Catherine, EPI not ready

5/7/18

Send preli revised via merimen.

RECEIVED 05 JUL 2018

Date/Time, File Pass to?

☐

: Prell. Report

Days Of Repair:

8

1)

☐

: Final Report

Resurvey No. of Trip:

2

Date/Time, File Return to?

2)

5/7- typist

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

150

S - RS. \$

10

Photos

Others

Report Format:

merimen

Lump Sum / I.B.I. (\$

3650/2

TOTAL

160



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MSIG INSURANCE (SINGAPORE) PTE LTD		Ref : CS/MSG18007085/Kvb		
16 RAFFLES QUAY #24-01 HONG LEONG BLDG SINGAPORE 048581		Date : 17-04-2018		
		Code : MSG		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	FBJ 278P	Veh. Inspected	SKA 3709J	
Policy No.	MSD/VMS/17-374327-CA	Coverage (\$)	0.00	
Claim No.		Excess (\$)	0.00	
Assign From	MERIMEN (MONICA CHUNG)	Assign Date	16/04/2018	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	13/04/2018	Inspection Date		
Survey held at	CHENG HOE MOTOR PL BLK 1019 YISHUN IND. PARK A #01-374/382 SINGAPORE 768761			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Monica Chung Pei Zhen

Date: 05 Jul 2018

Preliminary Advice

Insured Vehicle No	: FBJ278P		
TP Vehicle No	: SKA3709J	Accident Date	: 13/04/2018
Make	: TOYOTA COROLLA ALTIS	Assignment Date	: 16/04/2018
Date of Inspection	: 18/04/2018	Est. Duration of Repair	: 8.00
Inspection At	: CHENG HOE MOTOR PTE LTD (YISHUN) BLK 1019 #01-374/382, YISHUN INDUSTRIAL PARK A SINGAPORE 768761		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages rear n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	5,890.60
Revised Amount	:S\$	4,568.96
Check Items (Estimated)	:S\$	0.00
Total	:S\$	4,568.96

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	
COE / PARF Rebate	:S\$	
Salvage Value	:S\$	
Margin for Repair	:S\$	

Remarks

() The vehicle is economical/not economical for repair.

(X) The above survey was conducted on a 'without prejudice' basis.

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	14 Apr 2018		16 Apr 2018 17:32 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

Show All

CLAIM SUBFOLDER DETAILS

Insured:	CHONG KONG CHIN, ID: S2506656A			[Created by insurer]
Main Claimant:	TAN YEE SIM, ID: S1573541D			
Vehicle Reg. No.:	SKA3709J	Date of Loss:	13/04/2018 16:00 - :59 [85 Months and 22 Days From LTA Reg Date (Man Yr)]	
Claim Type:	TP	Policy/Cover Note No.:	MSD/VMS/17-374327-CA (TP, Fire & Theft) Coverage: 10/12/2017 - 09/12/2018	
Vehicle Reg. No. (Insured):	FBJ278P	Policy No. (Claimant):		
		Excess:		
Repairer:	Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A, 768761 Yishun - Tel: 6755 6142			
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Monica Chung Pei Zhen - 6594 2552]			
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 17/04/2018]			
Driver/Custodian (Insured):	CHONG KONG CHIN (58 / Male), NRIC: S2506656A			
Adj Asg. Remarks:	Please appoint MR KENNETH KONG to conduct the survey .Kindly contact MS JUNE PHUA @ 6755 6142 to arrange for survey.			

ASSOCIATED MAIL RECEIVED

There are no mail for this case.

View All

Compose Case Mail

ALL ASSOCIATED TASKS

Due Date Priority Type Task Group Subject Handler View All Search Tasks Create New Task Complete

Assigned By Completed On Created On Done?

No results.

View Sent Message

This mail is associated with :

***SKA3709J (MSC/V/18-000551)**
[FBJ278P]

TP
TAN YEE SIM
Apr 13 2018 4:00PM
[CHONG KONG CHIN]
Cheng Hoe Motor Pte Ltd

[Resend](#)[View Recipients](#)[Print Message](#)[Delete Message](#)[Forward](#)

From LKK Auto Consultants Pte Ltd (LKK_HQ), sent on **19/04/2018 12:28 PM.**

To MSIG_CPZ

Subject TP SURVEY SKA 3709J

Dear Monica,

Please be informed that we have inspected the vehicle SKA 3709J on 18/4/2018.

We are pending estimate from repairer.

Best Regards,
Veron Chen

DOCUMENTS SUMMARY

There are no documents.

Enquire Vehicle & Owner Information (Vehicle No. FBJ278P As At 13 Apr 2018 / 16:30:00)**Law Firm Search Details**

Search Reason: Insurance claim in relation to traffic accident
Law Firm Case No.: CHM-SKA3709

Current Owner Details

Owner ID Type: Singapore NRIC
Owner ID: S2506656A
Owner Name: CHONG KONG CHIN
Registered Address Type: HDB / HUDC
Registered Block/House No.: 303
Registered Street Name: YISHUN CENTRAL
Registered Unit No.: # 10 - 129
Registered Building Name: -
Registered Postal Code: 760303

Current Vehicle Details

Vehicle No.: FBJ278P
Make Description/Model: YAMAHA / JUPITER MX (HC)
Insurance Company Name: MSIG INSURANCE (SINGAPORE) PTE LTD

4KA 3709 J.

1 m rear bumper R-

44 reflector CR-

44 side reflector D-R-

clips R-

1 m rear 44 fender inner shield ?

1 m 44 tail lamp CR-

1 m rear 44 fender R-

1 m rear w/green moulding R-

1 m rear panel ?

1 m rear boot R-X

logo —

emblem VVTi —

emblem EcoRun —

emblem ALTiS —

44 reflector CR-

inner lock R-X

R44 reflector ?

inner rubber sunx

1 m rear up green gun
1 set reverse sensor

#40/50 ✓
#200/50 ?

① R & R rear up green light

#120/ ✓

② Panel beatty

#1500/ ?

③ R & R rear seat, top roof lining,
garnish etc

#120/100

④ body assembly

#1100/800

⑤ Rustproofing.

#90/ ?

⑥ R & R reverse camera
and reset system

#60/50

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
 TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
 GST:201001158E RCB NO:201001158E

08
 SKA 3709 J
 TP/MSIG

M/S : MSIG INSURANCE (S) PTE LTD (SGX)

16 RAFFLES QUAY
 #24-01 HONG LEONG BUILDING
 SINGAPORE 048581

TEL: 68277660

FAX: 62257402

ATTN: Motor Claim Department

WS Ref: TP/MSIG/YS

Claim Type: Third Party

Accident Date: 13/04/2018

TP Veh Reg No: FBJ278P

Estimate No: ES1890434/YISHUN

Date: 18 Apr 2018

Policy No: 5058210571-05

Veh Reg No: SKA3709J

Make/Model: TOYOTA COROLLA
 ALTIS 1.6 AUTO

Chassis No: MR053REE104112702

Engine No: 1ZRX071919

Reg. Date: 22/02/2011

Estimate Repair Cost to Vehicle No :SKA3709J

Description	U/Price	Quantity	List Price	Amount
			SS	SS
List Price				
1 REAR BUMPER	482.00	1 PC	482.00	✓
2 REAR BUMPER LH REFLECTOR	38.90	1 PC	38.90	✓
3 REAR BUMPER LH SIDE RETAINER	75.73	1 PC	75.73	✓
4 REAR BUMPER CLIPS	3.50	6 PCS	21.00	✓
5 REAR LH FENDER INNER SHIELD	57.96	1 PC	57.96	X
6 TAILLAMP LH	281.90	1 PC	281.90	✓
7 REAR LH FENDER	1,029.70	1 PC	1,029.70	✓
8 REAR WINDSCREEN GLASS MOULDING	75.67	1 PC	75.67	✓
9 REAR PANEL	209.10	1 PC	209.10	✓
10 REAR BOOT	552.29	1 PC	552.29	X
11 REAR BOOT LOGO	54.30	1 PC	54.30	✓
12 REAR BOOT EMBLEM 'VVTI'	50.20	1 PC	50.20	✓
13 REAR BOOT EMBLEM 'COROLLA'	38.43	1 PC	38.43	✓
14 REAR BOOT EMBLEM 'ALTIS'	45.92	1 PC	45.92	✓
15 REAR BOOT LH REFLECTOR	129.10	1 PC	129.10	✓
16 REAR BOOT INNER LOCK	100.30	1 PC	100.30	X
17 REAR BOOT RH REFLECTOR	129.62	1 PC	129.62	X
18 REAR BOOT INNER RUBBER	175.35	1 PC	175.35	X
			3,547.47	1776.18
		Less 25%	886.87	2,660.60
Special Net				
19 REAR WINDSCREEN GLASS GUM	40.00	1 PC	40.00	✓
20 REVERSE SENSOR	200.00	1 SET	200.00	✓
			240.00	240.00

Not Authorized
 11 Apr 8 3650h
 Recovery After Paint
 8 days

2,661.57
 665.39

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

M/S : MSIG INSURANCE (S) PTE LTD (SGX)

16 RAFFLES QUAY

#24-01 HONG LEONG BUILDING

SINGAPORE 048581

TEL: 68277660

FAX: 62257402

ATTN: Motor Claim Department

WS Ref: TP/MSIG/YS

Claim Type: Third Party

Accident Date: 13/04/2018

TP Veh Reg No: FBJ278P

Estimate No: ES1890434/YISHUN

Date: 18 Apr 2018

Policy No: 5058210571-05

Veh Reg No: SKA3709J

Make/Model: TOYOTA COROLLA
ALTIS 1.6 AUTO

Chassis No: MR053REE104112702

Engine No: 1ZRX071919

Reg. Date: 22/02/2011

Estimate Repair Cost to Vehicle No :SKA3709J

Description	U/Price	Quantity	List Price S\$	Amount S\$
Labour				
21 REMOVE AND REFIX REAR WINDSCREEN GLASS	120.00	1 LA	120.00	✓ 12000
22 PANEL BEATING	1,500.00	1 LA	1,500.00	1000
23 REMOVE & REFIX REAR SEAT, TOP ROOF LINING, GARNISH, ETC	120.00	1 LA	120.00	900
24 PUTTY & REPSRAY	1,100.00	1 LA	1,100.00	600
25 RUSTPROOFING	90.00	1 LA	90.00	500
26 REMOVE & REFIX REVERSE CAMERA & RESET SYSTEM	60.00	1 LA	60.00	
			2,990.00	2,990.00
Total				S\$ 5,890.60
Add GST @ 7%				412.34
Total Amount Payable				S\$ 6,302.94

For Cheng Hoe Motor Pte Ltd

AUTHORISED SIGNATURE

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG18007085/KVBN2

Date: 06/07/2018

REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	MSD/VMS/17-374327-CA
Claimant Vehicle No :	SKA3709J	Insured Vehicle No :	FBJ278P
Date of Loss:	13/04/2018	Nature of Claim:	TP
		Claim No:	MSCN/18-000551

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKA3709J	Engine No:	1ZRX071919
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 (A)	Chassis No:	MR053REE104112702
Reg. Date:	22/02/2011 (Man. Year: 2011)	Odometer:	201019 km
Colour:	Metallic Silver		
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65R15	Rear Tyre Size:	195/65R15
Front Left Side:	Michelin 8 mm	Rear Left Side:	Michelin 8 mm
Front Right Side:	Michelin 8 mm	Rear Right Side:	Michelin 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	2,900.60	2,138.96	761.64	26.26
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,990.00	2,430.00	560.00	18.73
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	5,890.60	4,568.96	1,321.64	22.44
Approved Total (Overridden) (\$\$)		3,650.00		
(\$\$)	5,890.60	3,650.00	2,240.60	38.04
+ GST 7.00/7.00% (\$\$)	412.34	255.50	156.84	38.04
Nett Amount (\$\$)	6,302.94	3,905.50	2,397.44	38.04

INSPECTION

Date of Assignment:	16/04/2018	
Date Inspected:	18/04/2018 Inspected At:	Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A Singapore 768761

Estimated Period of Repair: 8.0 days

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 06 Jul 2018)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKA3709J)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Bent	482.00 FL	*482.00 FL
2	1		*REAR BUMPER LH REFLECTOR	Cracked	38.90 FL	*38.90 FL
3	1		*REAR BUMPER LH SIDE RETAINER	Distorted	75.73 FL	*75.73 FL
4	6		*REAR BUMPER CLIPS	Necessary	21.00 FL	*21.00 FL
5	1		*REAR LH FENDER INNER SHIELD	Serviceable	57.96 FL	*- FL
6	1		*TAILLAMP LH	Cracked	281.90 FL	*281.90 FL
7	1		*REAR LH FENDER	Bent	1,029.70 FL	*1,029.70 FL
8	1		*REAR WINDSCREEN GLASS MOULDING	Necessary	75.67 FL	*75.67 FL
9	1		*REAR PANEL	Bent	209.10 FL	*209.10 FL
10	1		*REAR BOOT	Repair	552.29 FL	*- FL
11	1		*REAR BOOT LOGO	Necessary	54.30 FL	*54.30 FL
12	1		*REAR BOOT EMBLEM VVTI	Necessary	50.20 FL	*50.20 FL
13	1		*REAR BOOT EMBLEM COROLLA	Necessary	38.43 FL	*38.43 FL
14	1		*REAR BOOT EMBLEM ALTIS	Necessary	45.92 FL	*45.92 FL
15	1		*REAR BOOT LH REFLECTOR	Cracked	129.10 FL	*129.10 FL
16	1		*REAR BOOT INNER LOCK	Repair	100.30 FL	*- FL
17	1		*REAR BOOT RH REFLECTOR	Serviceable	129.62 FL	*- FL
18	1		*REAR BOOT INNER RUBBER	Serviceable	175.35 FL	*- FL
19	1		*REAR WINDSCREEN GLASS GUM	Necessary	40.00 FS	*40.00 FS
20	1		*SET REVERSE SENSOR	Shorted	200.00 FS	*200.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	3,787.47	2,771.95
- List Item Discount on L Items 25.00/25.00% (\$\$)	886.87	632.99
Total Parts (\$\$)	2,900.60	2,138.96

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REMOVE AND REFIX REAR WINDSCREEN GLASS	New	120.00	120.00
2	PANEL BEATING	New	1,500.00	1,200.00
3	REMOVE & REFIX REAR SEAT, TOP ROOF LINING, GARNISH, ETC	New	120.00	100.00
4	PUTTY & RESPRAY	New	1,100.00	900.00
5	RUSTPROOFING	New	90.00	60.00
6	REMOVE & REFIX REVERSE CAMERA & RESET SYSTEM	New	60.00	50.00
Gross Labour Cost (\$\$)			2,990.00	2,430.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >