



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2103336

INV Date 12/05/2021

Reference CC4/LPC18007188/M1es3q

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJP 5630X
Insured Veh. SCX 1308U
Claim No. 17/18/18/VP05/020551
Policy No. Z17VP05016029
Accident Date 16/04/2018
Inspection Date 18/04/2018

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC18007188/M1es3q2 Date: 12/05/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SCX 1308U	Veh. Inspected	SJP 5630X	
Policy No.	Z17VP05016029	Coverage (\$)	0.00	
Claim No.	17/18/18/VP05/020551	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	18/04/2018	
2. Vehicle Particulars & Condition				
Make & Model	HONDA ODYSSEY	c.c	2354	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	JHMRB38509C200703	Colour	BLACK	
Odometer	185371 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	YOKOHAMA	7 mm	
L/H Front Tyre	215/55 R17	YOKOHAMA	7 mm	
R/H Rear Tyre	215/55 R17	MAXXIS	7 mm	
L/H Rear Tyre	215/55 R17	MAXXIS	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/04/2018	Inspection Date	18/04/2018	
Survey held at	KUM CHEW MOTOR WORKSHOP 160 SIN MING DRIVE #05-08 SIN MING AUTOCITY SINGAPORE 575722			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJP 5630X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR LID	DENTED	1,010.70	1,010.70
1	REAR LID WIPER ARM	NOT NECESSARY	41.30	-
1	REAR LID WIPER MOTOR	NOT NECESSARY	245.40	-
1	REAR LID RUBBER	CRUSHED	116.90	116.90
1	REAR LID LOCK	BENT	189.00	189.00
1	REAR LID LOWER CATCH	BENT	26.70	26.70
1	REAR LID 'H' EMBLEM	NECESSARY	25.90	25.90
1	REAR LID 'ODYSSEY' EMBLEM	NECESSARY	29.20	29.20
1	REAR LID OUTER GARNISH	CRUSHED	492.90	492.90
18	REAR LID OUTER GARNISH CLIPS @\$4.00	NECESSARY	72.00	72.00
2	REAR LID NUMBER PLATE LAMP @\$32.80	NOT NECESSARY	65.60	-
2	REAR LID REFLECTOR @\$187.00	BROKEN	374.00	374.00
2	REAR LID REFLECTOR CLIPS @\$4.00	NECESSARY	8.00	8.00
1	REAR LID INNER GARNISH	CRUSHED	214.90	214.90
22	REAR LID INNER GARNISH CLIP @\$4.00	NECESSARY	88.00	88.00
1	REAR WINDSCREEN	NOT NECESSARY	1,103.50	-
1	REAR WINDSCREEN INNER SEAL	NOT NECESSARY	220.00	-
2	REAR WINDSCREEN CLIPS @\$45.00	NOT NECESSARY	90.00	-
1	REAR BUMPER	BROKEN	703.40	703.40
8	REAR BUMPER CLIPS @\$3.80	NECESSARY	30.40	30.40
16	REAR BUMPER LOWER CLIPS @\$5.80	NECESSARY	92.80	92.80
1	REAR BUMPER TOW COVER	MISSING	15.20	15.20
2	REAR BUMPER RETAINER @\$20.20	BROKEN	40.40	40.40
2	REAR BUMPER BRACKET @\$15.20	NOT NECESSARY	30.40	-
1	REAR BUMPER REINFORCEMENT	DENTED	97.20	97.20
1	REAR BUMPER INNER SPONGE	NOT NECESSARY	89.70	-
1	REAR BUMPER REFLECTOR	BROKEN	42.20	42.20
1	REAR END PANEL	DENTED	490.80	490.80
1	REAR END PANEL TOP GARNISH	CRUSHED	187.00	187.00
4	REAR END PANEL TOP GARNISH CLIP @\$4.00	NECESSARY	16.00	16.00
1	REAR SPARE TYRE PANEL	DENTED	309.00	309.00

Report Ref No. CC4/LPC18007188/M1es3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SPARE TYRE INSULATOR	NECESSARY	55.00	55.00
1	REAR SPARE TYRE CARDBOARD -TOP	CRUSHED	371.60	371.60
1	SPARE TYRE SPONGE	BROKEN	167.80	167.80
2	REAR LAMP @\$220.00	NOT NECESSARY	440.00	-
2	REAR LAMP CLIP @\$4.00	NECESSARY	8.00	8.00
1	REAR FENDER -LH	TO REPAIR SEE LABOUR	864.70	-
1	REAR FENDER DUST COVER -LH	NOT NECESSARY	101.90	-
8	REAR FENDER DUST COVER CLIPS @\$5.80	NOT NECESSARY	46.40	-
1	REAR FENDER INNER GARNISH -LH	NOT NECESSARY	297.30	-
1	REAR FENDER GLASS -LH	NOT NECESSARY	465.50	-
1	REAR FENDER GLASS RUBBER -LH	NOT NECESSARY	58.00	-
1	REAR FENDER GLASS SEAL	NOT NECESSARY	49.00	-
1	FRT BUMPER	NOT NECESSARY	712.40	-
8	FRT BUMPER CLIPS @\$3.80	NOT NECESSARY	30.40	-
1	FRT BUMPER SIDE RETAINER	NOT NECESSARY	12.00	-
1	FRT BUMPER BRACKET -TOP	NOT NECESSARY	37.40	-
6	FRT BUMPER LOWER LIP CLIPS @\$5.80	NOT NECESSARY	34.80	-
1	FRT HEADLAMP -RH	NOT NECESSARY	724.50	-
1	FRT FENDER DUST COVER -RH	NOT NECESSARY	102.90	-
8	FRT FENDER DUST COVER CLIPS @\$3.80	NOT NECESSARY	30.40	-
1	FRT LOWER ARM	BENT	303.80	303.80
1	FRT LOWER BALL JOINT-RH	NOT NECESSARY	123.40	-
1	FRT UPPER ARM -RH	NOT NECESSARY	218.40	-
1	FRT BALL JOINT -UPPER	NOT NECESSARY	123.40	-
1	FRT KNUCKLE-RH	DISTORTED	324.30	324.30
1	FRT KNUCKLE BEARING -RH	DISTORTED	142.60	142.60
1	FRT SUSPENSION -RH	NOT NECESSARY	286.00	-
1	FRT SUSPENSION MOUNTING (TOP)	NOT NECESSARY	85.00	-
1	FRT DRIVE SHAFT-RH	NOT NECESSARY	1,027.40	-
1	FRT STEERING SHAFT-RH	NOT NECESSARY	1,798.70	-
1	FRT STABILIZER BAR (CHECK)	NOT NECESSARY	165.40	-
1	FRT CROSS MEMBER	NOT NECESSARY	1,223.10	-

Report Ref No. CC4/LPC18007188/M1es3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR LOWER ARM -RH	NOT NECESSARY	330.80	-
1	REAR STAY BAR-RH	NOT NECESSARY	96.80	-
1	REAR KNUCKLE -RH	NOT NECESSARY	396.70	-
1	REAR KNUCKLE BEARING -RH	NOT NECESSARY	294.40	-
	LESS 20% DISCOUNT		-3,621.74	-1,209.14
			14,486.96	4,836.56
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER LOWER LIP (SN)	NOT NECESSARY	450.00	-
1	FRT BUMPER LOWER LIP (SN)	NOT NECESSARY	550.00	-
1	FRT TYRE (SN)	NOT NECESSARY	450.00	-
1	FRT SPORT RIM (SN)	NOT NECESSARY	724.50	-
1	SET REVERSE SENSOR (SN)	BROKEN	280.00	200.00
			2,454.50	200.00
	<u>LABOUR</u>			
	TOWING CHARGE.	NOT NECESSARY	120.00	-
	TO PULL KNOCK ON ACCIDENT PORTION & CHARGE ABOVE PART.INCLUSIVE OF THE REPAIR OF REAR FENDER -LH .		1,800.00	1,200.00
	TO SPRAY PAINT ON ACCIDENT PORTION .		2,500.00	1,000.00
	TO SUPPLY REAR WINDSCREEN AND SIDE FENDER GLASS SEALANT .		120.00	50.00
	TO DISMANTLE & REFIX REAR WINDSCREEN .		180.00	120.00
	TO DISMANTLE & REFIX REAR FENDER GLASS .	NOT NECESSARY	80.00	-
	TO ANTI-RUST REAR AFFECTED AREAS .		150.00	50.00
	TO DISMANTLE & REPLACE UNDERCARRIAGE.		480.00	180.00
	TO CHECK WIRING FUNCTIONS .		180.00	30.00
	TO DISMANTLE ,REFIX TYRE & TYRE BALANCING .	NOT NECESSARY	50.00	-
	TO COMPUTER 4 WHEEL ALIGNMENT .		200.00	60.00
	TO DISMANTLE & REPLACE 1 SET REVERSE SENSOR .		150.00	40.00
	TO DISMANTLE ,REFIX TOP UPHOLSTERY ,DOOR BOARD ,SEAT INNER GARNISH & ETC.		300.00	80.00
			6,310.00	2,810.00
	GRAND TOTAL		23,251.46	7,846.56

Report Ref No. CC4/LPC18007188/M1es3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,250.00
---	--	--	----------

Report Ref No. CC4/LPC18007188/M1es3q2

MA CHIN FOOK

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJP 5630X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJP 5630X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

