408933

Claim Reference: SNM18D02196C01 Assessment Number: SH000219

Version: CHINATAI/2

Date Calculated: 07/05/2018 04:44

Full Report - V1 **Registration: SKA1849B** Printed: 07/05/2018 11:44

Summary Information

Claim

Location: Singapore (SG) LKK AUTO Printed by: **Authorisation Status:** Interim

Work Provider: China Taiping Insurance

(S) Pt

Claim Reference: SNM18D02196C01 Policy Number: DMPCSN3000211801

Other Reference: Third Party: Insured Amount: Under Warranty: Warranty Expired:

SGD Currency:

Date of Incident: 28/04/2018

Able to Authorise Repairs: TBA Repairs Authorised: **TBA**

Estimated Repair Time: Quote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

Vehicle Details

Vehicle

MERCEDES Manufacturer: Model: C Class C 200 CGI BE Sub Model: Model Sheet Number: 304 26 Registration: SKA1849B

Registration Month:

Registration Year:

VIN Number:

Odometer: Colour:

Engine Number:

Fuel Level:

Model Specs

FR A395./F500./R131. RAIN SENSOR FOLDING DOOR MIRRORS AUDIO SYSTEM 20 CD LEATHER UPHOLSTERY EOUIPMENT AVANTGARDE DRIVER SEAT MEMORY L/F SEAT WITH MEMORY LEATHER STRG WHEEL

ENGINE PROTECTION PARAMETER STEERING

TYRES 225/45 WR 17 SPARE WHEEL

Date of Inspection:

RIGHT HAND DRIVE PREPARE OFF VEHICLE **MODEL 2011 DIPPING MIRROR** ALU DESIGN PARTS STRG WHEEL LEATHER

H/DUTY ALTERNATOR **AUTO GEARBOX 5 SPEED** CRUISE CONTROL WHEELS 7.5J X 17 ALU PARKTRONIC SYSTEM TWO COAT METALLIC

CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Severity of Impact: Vehicle Status on Steering: Inspection:

WDD2040482A473956

Not Known

%

Brakes Pedal Travel: Place of Inspection:

Pre-Accident Damage:


Tyres Condition:


Tread Depth LHF: Tread Depth RHF: Tread Depth RHR: Tread Depth LHR: Damage Areas: Direction of Impact: 03/05/2018

Claim Reference: SNM18D02196C01 Assessment Number: SH000219

Assessment Number: SH0002 Version: CHINATAI/2

Date Calculated: 07/05/2018 04:44

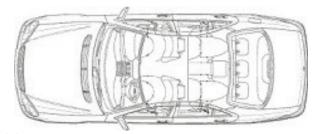

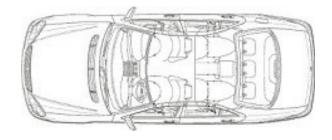

Full Report - V1

Registration: SKA1849B

Printed: 07/05/2018 11:44

Addresses

Cost Summary	,
--------------	---

Total Labour		\$1,205.20
Total Paint/Material		\$232.30
Total Parts		\$5,640.00
Total of Additional Costs		\$285.00
Repair Cost Exc GST:		\$7,362.50
Overall Discount (0.0%):		- \$0.00
Excess:		-\$1,250.00
After Deduction -	Grand Total Exc GST:	\$6,112.50
	7 % GST:	\$427.88
	Grand Total Inc GST:	\$6,540.38

Repair Information

LABOUR Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /		Price/Dent	– \$40.00/ NK
	er Repair Details	WU	Cost Price (\$)
88-1102 01		9.0	41.40
	INCLUDES: R + R RADIATOR COVER,		
	DETACH + REFIT L/- AND R/PARTITION		
	PANEL,		
	ADJUST FRONT FOG LAMPS		
88-1105 02	DIS + ASS FRONT BUMPER	6.0	27.60
	(BUMPER REMOVED)		
	AFTER CHECK: RENEW PARTS IF NECESSARY		
88-1358 01	ADD TO DIS + ASS FRONT BUMPER	3.0	13.80
	(VEHICLE WITH PARKING SYSTEM)		
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER	3.0	13.80
	(REMOVED)		
	(VEHICLE WITH LUXURY EQUIPMENT)		
88-2506 01	RENEW BONNET	11.0	50.60
	INCLUDES: R + R BONNET,		
	CONVERT ALL PARTS		
82-4790 01)	RENEW L/F LAMP UNIT (DET/REFIT BUMPER)	3.0	13.80
88-9663 01	R + R L/F WING MOULDING	3.0	13.80
88-3814 01	R + R L/F WING	7.0	32.20
	(FRONT BUMPER REMOVED)		
88-3816 01)	RENEW L/F WING (REMOVED)	2.0	9.20
88-3511 01	FIT L/WING BADGE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE	12.0	55.20
	COMPARTMENT FOR RENEWAL OF THE FRONT		
	MODULE		
	INCLUDES: R + R ALL ATTACHED PARTS IN		

Claim Reference: SNM18D02196C01 Full Report - V1
Assessment Number: SH000219 Registration: SKA1849B
Version: CHINATAI/2 Printed: 07/05/2018 11:44

Version: CHINATAI/2 Printed: 0
Date Calculated: 07/05/2018 04:44

	THE REPAIR SECTION		
62-1301 01	R + R L/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL	13.0	59.80
	(STOSSFAENGER AUSGEBAUT)		
0305	REMOVE AND REFIT FRONT BUMPER GRILLE	1.0*	4.60
0481	REMOVE AND REFIT BONNET INSULATION	2.0*	9.20
9973	KN TEST DRIVE	5.0*	23.00
0930	REPAIR CTR FRT REINF	10.0*	46.00
1111	REPAIR L/F WHEELHOUSE ASSY	20.0*	92.00
1155	REPAIR L/UPP W-HOUSE S-MEMB	30.0*	138.00
1283	REPAIR L/F C-MEMBER BRACKET	10.0*	46.00
LAB	OUR COST		
	Total Work Units	160.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	16.0HRS	\$736.00
	Paint Labour	10.2HRS	\$469.20
	Total Labour	26.2HRS	\$1,205.20

PAINT V	WORK Tin	ne Basis 10 WU = 1 HR. Price	= \$46.00/HR
	umber Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	28.0	
741	L/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAIN	T K1R 10.0	
361	L/F OUTER SENSOR NEW PART PAINT K1		
365	L/F INNER SENSOR NEW PART PAINT K1	R 3.0	
742	R/F WING SURFACE PAINT	5.0	
1111	L/F WHEELHOUSE ASSY SURFACE PAINT		
1481	LEFT FRONT DOOR SURFACE PAINT	7.0	
	LABOUR COST - PAINT		
	TIME(PAINT)	72.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	102.0	+450.00
	Total Paintwork Labour	10.2HRS	\$469.20
	MATERIAL COST - PAINT		Cost Price
	New Part Painting		\$108.36
	New Part Painting - Plastic K1R Material-Constant Main Work Metal		\$45.26 \$38.60
			\$28.60 \$41.08
	Surface-/Blend Paint Material-Const Main Work Plastic		\$41.08 \$9.00
			\$9.00 \$232.30
	Total Excluding Pearlescent Uplift Pearlescent Uplift @ 0.0%		\$232.30 \$0.00
	Total Paint Material Cost		\$0.00 \$232.30
DARTO	i otal Pallit material Cost		\$232.3U

PARTS

					Price Valid	: 01/06/2015
Guide N	lo.Qty	Description	Part Number	Supplier	Bet.	Price (\$)
431	1	BADGE	204 817 0616		0%	80.00*

Claim Reference: SNM18D02196C01 **Full Report - V1 Assessment Number: SH000219 Registration: SKA1849B** Printed: 07/05/2018 11:44 **Version: CHINATAI/2**

Date Calculated: 07/05/2018 04:44

471	1	BONNET	204 880 1057 64	0%	1,080.00*
283	1	FRONT BUMPER COVER	204 880 0940 9999	0%	950.00*
405	1	FRONT GRILLE	204 880 0023 9744	0%	430.00*
350	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS	0%	35.00*
1001	1	FRT LWR CROSSMEMBER	207 620 1600	0%	280.00*
349	1	FRT/CTR IMPACT DAMP	204 885 0037	0%	115.00*
303	1	L/F BUMPER COVER	204 885 2223	0%	80.00 *
311	1	L/F BUMPER MOULDING	204 885 0721	0%	80.00*
637	1	L/F FOG LAMP	251 820 0756	0%	190.00*
365	1	L/F INNER SENSOR	000 905 2402	0%	180.00*
361	1	L/F OUTER SENSOR	000 905 2402	0%	180.00*
765	1	L/F RAIL	204 881 0106	0%	30.00*
1179	1	L/F UPP REINF	204 620 0991	0%	190.00*
839	1	L/F W-HOUSE CVR FRT	204 690 5730	0%	135.00*
741	1	L/F WING	204 880 1318	0%	580.00*
811	1	L/F WING BADGE	204 817 7220	0%	55.00 *
789	1	L/F WING CLAMP KIT	USE SINGLE PARTS	0%	25.00*
785	1	L/F WING MOULDING	204 690 3162	0%	40.00*
577	1	L/HEADLAMP COVER	204 826 1324	0%	165.00 *
561	1	LEFT HEADLAMP ASSY	204 906 5303	0%	650.00*
312	1	R/F BUMPER MOULDING	204 885 0821	0%	80.00 *
508	1	R/SPRING ELEMENT	204 880 0227	0%	10.00*
f: OEM P	arts		Sub Total		\$5,640.00
g: Origin	al		Total Parts		\$5,640.00
L . C	م مر ما ام	1			

h: Secondhand p: Parallel x: Exchange

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras			
Description		Betterment	Price
WHEEL ALIGNMENT	SPECIALIST	0%	\$65.00
ELECTRICAL WORK	SPECIALIST		\$40.00
ECU DIAGNOSTIC	SPECIALIST	0%	\$180.00
		Total Extras	\$285.00
Final Calculation			
Total Parts			\$5,640.00
Labour			
Total Panel/Mechanical		\$	736.00
Total Paintwork		\$	469.20
Total Labour		·	\$1,205.20
Additional Costs			
Corr Prot Materials External			\$0.00
Corr Prot Materials Internal			\$0.00
Cost of Specialist		\$	285.00
Total of Additional Costs		·	\$285.00
Total Paint/Material Costs			\$232.30
Repair Costs Excludes GST			\$7,362.50
Deductions			
Deduction for Excess (Fixed	d)	-\$1,	250.00
Total Deductions	•		-\$1,250.00
Grand Total Excludes GST (After De	eduction)		\$6,112.50

Claim Reference: SNM18D02196C01 Full Report - V1
Assessment Number: SH000219 Registration: SKA1849B

Version: CHINATAI/2 Printed: 07/05/2018 11:44

Date Calculated: 07/05/2018 04:44

GST @ 7 % \$427.88 Grand Total Includes GST (After Deduction) \$6,540.38

Assessment Notes