

INS. CASE OWNER:

MMS Chew

CC 4, LCR1800 8253

Dj 339

LEK:

DOA:

Surveyor:

ABT

DOI:

ASSIGNMENT

14/5/18

Date / Time:

3/5/2018

Registered in Merimen:

7/5/2018

Pre-assign / CCU / FTE



Insured Vehicle No.:

SLH 4376E

Name of Insured:

UPP P/L

Insured Tel No.:

HP:

Excess Sec II :SS

D.O.A: 2/5/2018

Is driver the owner?

(YES / NO)

Nature of Accident:

If NO, Driver Name / Age:

Jumrat Bon Bimal

Driver Tel No.:

(V/L: YES / NO)

Claim No.:

719889196456

Policy No.:

999999966

Make / Model:

7. PHUS

Place of Accident:

Hungary Ave 3 Pandan

OI GIA REPORT: YES / NO ; TP GIA REPORT: YES / NO

Insured Liability: % Final ? Yes / No

SHA 2202X



INSRS:

WSP:

Tel:

Liability:

RMKS:

chunni



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

Date/ Time

3/16
July

SHA 2202X - X; SLH 4376E - X

08/06/18

TO REQ CCTV FROM TP
Jumrat 4/3 26 0001 - with 15 mg
J

18-6-18

FOR MANDATE

RECEIVED 18 JUN 2018

RECEIVED 03 AUG 2018

STAGE

DATE / PIC

Non-Reporting ltr (1st):

Non-Reporting ltr (2nd):

Non-Reporting ltr (Final):

Notification ltr (if non-pickup):

Call OI:

JOY 5-6-18

After call ltr to OI:

Documentation Check List: Handler Typist

Notification ltr (if non-pickup)

X

After call ltr to OI:

Authorisation To Act:

Release Voucher:

Final Repair Bill:

Car Rental Invoice:

Towing Invoice:

LTA / GIA:

Medical Bill:

PIR:

Mandate/Reject Instruction:

LOD

Payment Breakdown Form:

Post-Repair Photos:

Others:

PRELIMINARY ADVICE Date/Time:

Sent By:

FINALIZATION

Date/Time:

Confirm with:

Confirm by:

Repair Cost:

S\$

days)

Reduction:

%

Email

Call

FINAL SETTLEMENT

Date/Time:

Confirm with:

Email

Call

Final Liability:

%

100

(Assessed)

BOLA S/N No.:

NIL

If NO or B 28, Ass. Lia:

Repair Cost:

S\$

27,820

Loss of Rental (LOR):

S\$

1,808

(16 days)

113

VIDEO

OLD BEAT RED LIGHT

Loss of Use (LOU):

S\$

3

x 16 days)

Loss of Income (LOI):

S\$

800s

50 x 16 days)

LOR only

LOU only

LOR + LOU

LOR + LOI

[Tick only one]

GIA/LTA Search

S\$

7.45

Medical:

S\$

Disbursement:

S\$

(e.g. Tow/ Independent)

Legal Cost

S\$

Total:

S\$

30,435.45

Global Sum S\$: 30,435

FINAL PAYMENT

Date/Time:

Confirm with:

Email

Call

Payee 1:

S\$

30,435

Name 1:

CHUNNI MOTOR WORKS PTE LTD

Payee 2: (Strike if N.A.)

S\$

X

Name 2:

X

Payee 3: (Strike if N.A.)

S\$

X

Name 3:

X

1) Claim status: Normal/Reject/Private Settle

2) Report Format:

3) Survey fee:

3/8/18

REF:

Rep 8253/Pho3

ASSIGNMENT

ROE 2022 April

Form _____ Date _____

Estimated Cost _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV _____

To inspect Vehicle No. _____

at Workshop/road _____

at _____

Insured _____


Policy No. _____

Claims No. _____

Sum Insured _____ Excess _____

(Client's Record) _____

Make of Veh. _____

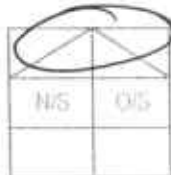

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Est. or Market Value:

IDAC/Accident Report Consistent? Yes or No

GIA / PR Seen Consistent? Yes or No

Est. Repairs 15 g days Res: Yes or No

Lash Signs 20 % 3 Val Yes or No

CA / REV / REP. / 24 HRS

Date: Person Contacted:

Vehicle IN / OUT

Vehicle SHA 2202X Vt Page 2014 April

Type: M/Car / M/Cycle / Bus / Van / Lorry / Car / Prime Mover /

Truck / Trailer or

Make Hyundai I40 1685

Colour Blue A/R Insured / Std / NI / NA

Qty/Assembly 402875 T/Ratio Insured / Std / NI / NA

Engine D4FDEU410016

C/A KMHLB41UMEU052532

Gen. Cond. Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brakes: In order / Jammed / Leaked / Burnt or

Mod: W / S/Rim / STD A/Rim or

Tyre Size: F: 205/60R16

R: — 11 —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Westlake

Front Rear

R/Bal S mm R/Bal S mm

L/Bal S mm L/Bal S mm

D.O.A 02/05/2018 D.O.I 14/05/2018

Survey held at Chuni AMK

Des. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop or

Rend

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

08/06/18 AIG SLH 4376E

Hyundai 4/5 20001- 15 days.

15 DAYS + WORKERS + D.O.A

R(\$24,668.14/499.)

Date/Time/To Pass to:

☐ Prel. Report☐ Final Report

To:

Date/Time/To Return to:

To:

Report Format:

Lump Sum / LB P: 45

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Handwritten:

Add Fee:

☐ Late Fee: \$☐ Insurance: \$☐ Extra Day: \$☐ Weekend: \$

1 2 3 4

1 2 3 4

1 2 3 4

1 2 3 4

TOTAL

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AIG ASIA PACIFIC INSURANCE PTE LTD

Ref : CC4/LCR18008253/Dha3

78 SHENTON WAY #08-16
CHARTIS BUILDINGS SINGAPORE 079120

Date : 07-05-2018



Code : LCR

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLH 4376E	Veh. Inspected	SHA 2202X
Policy No.		Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	07/05/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	02/05/2018	Inspection Date	14/05/2018
Survey held at	CHUNNI MOTOR WORK PTE LTD BLK 10 ANG MO KIO IND. PARK 2A, #03-19 AMK AUTOPOINT SINGAPORE 568047.		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

To survey by CLKK

CHUNNI MOTOR WORK PTE LTD**REPAIR ESTIMATE***

VEHICLE NO : SHA 2202X

DATE : 3.05.2018

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI i40

FAX : 6542 6039 AIG

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Bonnet <i>Bnc</i>			\$ 1,526.00	✓
	Bonnet Hinge (LH) <i>bt</i>			\$ 91.30	✓
	Bonnet Lock <i>bt</i>			\$ 50.90	✓
	Bonnet Absorber, LH <i>s/c</i>			\$ 73.90	X
	Bonnet Insulator <i>crushed</i>			\$ 243.00	✓
	Bonnet Insulator Clips <i>nc</i>			\$ 8.40	✓
	Radiator Grille <i>broken</i>			\$ 294.35	✓
	Radiator Grille H Emblem <i>broken</i>			\$ 113.65	✓
	Front Bumper Cover <i>Bnc</i>			\$ 562.30	✓
	Front Bumper Sponge <i>form</i>			\$ 142.20	✓
	Front Bumper Reinforcement <i>Bnc</i>			\$ 526.10	✓
	Front Bumper Grille (LH/RH) <i>cnt</i>		\$ 40.30	\$ 80.60	✓
	Front Bumper Centre Grille <i>disintegrated</i>			\$ 178.60	✓
	Front Bumper Centre Grille Top Garnish <i>cnt</i>		\$ 80.00	\$ 160.00	✓
	Front Bumper Bracket Top (LH/RH) <i>disintegrated</i>		\$ 22.40	\$ 44.80	✓
	Front Bumper Bracket (LH/RH) <i>disintegrated</i>		\$ 24.60	\$ 49.20	✓
	Front Bumper Retainer Mounting <i>disintegrated broken</i>		\$ 9.20	\$ 18.40	✓
	Headlamp Support Top Cover <i>crack</i>			\$ 398.00	✓
	Headlamp Support Panel Assy <i>broken</i>			\$ 1,067.50	✓
	Headlamp (LH/RH) <i>broken</i>		\$ 1,388.00	\$ 2,776.00	✓
	Headlamp Halogen Bulb (LH/RH) <i>s/c</i>		\$ 14.40	\$ 28.80	X
	Radiator <i>Z broken</i>			\$ 850.20	Z ✓
	Radiator Fan Blade, Cowling, Motor Assy <i>Z broken</i>			\$ 792.95	Z ✓
	Radiator Bracket (RH/LH) <i>leg</i>		\$ 6.50	\$ 13.00	X
	Radiator Hose Upper <i>disintegrated</i>			\$ 47.40	✓
	Radiator Hose Lower <i>s/c</i>			\$ 47.40	X
	Radiator Expansion Tank <i>s/c</i>			\$ 48.00	X
	Radiator Guard <i>broken</i>		\$ 35.00	\$ 70.00	✓
	Horn Unit (LH/RH) <i>disintegrated</i>		\$ 86.75	\$ 173.50	✓
	Horn Wire <i>then torn</i>			\$ 156.50	✓
	Front Fender (LH/RH) <i>s/c 1 Dented</i>		\$ 619.00	\$ 1,238.00	✓
	Front Fender Apron Panel (LH/RH) <i>N/S Bnc ops 1 Dented</i>		\$ 1,575.50	\$ 3,151.00	✓
	Front Fender Shield (LH/RH) <i>torn</i>		\$ 169.80	\$ 339.60	✓
	Air Flow Sensor <i>N/A</i>			\$ 633.35	X
	Air Cleaner Bottom Assy <i>crack</i>			\$ 325.00	Z ✓
	Aircon Condenser <i>Z bt</i>			\$ 1,137.35	Z ✓
	Aircon Suction & Liquid Hose <i>Z bt</i>			\$ 658.90	Z ✓
	Aircon Discharge Hose <i>Z bt</i>			\$ 233.30	Z ✓
	Aircon Compressor <i>not disintegrated</i>			\$ 2,857.55	X ✓
	Battery Tray <i>crack</i>			\$ 55.45	X ✓
	Wiper Panel Top Garnish <i>s/c</i>			\$ 91.20	X
	Wiper Container <i>broken</i>			\$ 61.90	✓
	Wiper Container Motor <i>Don</i>			\$ 65.90	✓

SHA 2202X

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Front Shock Absorber (Assy), LH HH			\$ 342.20 X
	Front Shock Absorber Mounting, LH HH			\$ 75.10 X
	Front Drive Shaft, LH HH distorted			\$ 1,069.55 X ✓
	Rack & Pinion Assy HH			\$ 2,184.00 X
	STG Tie End HH			\$ 69.50 X
	Stabilizer Bar HH			\$ 252.30 X
	Stabilizer Bar Bush, LH HH			\$ 16.10 X
	Stabilizer Bar Link, LH HH			\$ 81.70 X
	Stabilizer Bracket, LH HH			\$ 24.00 X
	Front Suspension Lower Arm, LH HH			\$ 715.10 X
	Front Chasis Member N/S Bent			\$ 1,575.85 ✓
	Knuckle Arm, LH HH			\$ 582.95 X
	Engine Under Cover torn			\$ 343.10 ✓
	Engine Crossmember HH distorted			\$ 2,236.90 X ✓
	Engine Mtg (Rear) Z HH			\$ 279.60 X
	Gearbox HH Down			\$ 14,808.00 X 4000/- S
	Gearbox Mounting HH			\$ 342.50 X
	Inter Cooler panicked			\$ 921.90 ✓
	Inter Cooler Mounting (2 PCS) S/C			\$ 25.90 X
	Hose B To Inter Cooler HH			\$ 229.70 X
	Hose C To Inter Cooler Inlet HH			\$ 113.30 X
	Pipe To Inter Cooler HH			\$ 167.05 X
	Pipe To Inter Cooler Outlet HH			\$ 244.55 X
	ABS Sensor HH			\$ 261.50 X
	Wiring-Engine dist crack			\$ 3,326.00 X ✓
	Wiring-FEM HH			\$ 168.00 X
		30019.10		
		24015.28		
	SUB TOTAL			\$ 51,937.80
	LESS 20%			\$ 10,387.56
	DISCOUNTED TOTAL			\$ 41,550.24
	Front Number Plate distorted			\$ 25.00 Nett ✓
	Front No Plate Trim Cover distorted			\$ 30.00 Nett ✓
	New Battery HH			\$ 207.00 Nett X
		40551-		
				\$ 262.00
	Labour Charge			
	Panel Beating			\$ 1,600.00 1200/-
	Spray Painting Charge			\$ 1,100.00 800/-
	Wiring Charge			\$ 50.00 30/-
	Towing Charge			\$ 50.00 HH
	Front Chassis Alignment Charge			\$ 180.00 150/-
	Remove/Refix Undercarriage (FRT)			\$ 200.00 HH
	FRT Wheel Alignment			\$ 80.00 HH
	Remove/Refix Aircon & Refill Gas			\$ 80.00 60/-
		22401-		
	TOTAL LABOUR			\$ 3,340.00
	ESTIMATE TOTAL			\$ 45,152.24
				30310.28
				Supp 2201.1
				32511.44
				115260001-

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

Chunni Motor Works Pte Ltd

115260001-

CHUNNI MOTOR WORK PTE LTD**REPAIR ESTIMATE***

VEHICLE NO : SHA 2202X (Supplementary)



DATE : 14.05.2018

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI i40

FAX : 6542 6039

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Air Cleaner Cover <i>11.4.14.14</i>			S 34.30
	Air Duct <i>broken</i>			S 206.05
	Air Duct B <i>broken</i>			S 261.95
	Fan Belt <i>turn</i>			S 155.00
	Fan Belt Idle Pulley <i>Dem</i>			S 189.50
	Actuator - Swirl Control <i>crack</i>			S 835.10
	Front Drive Shaft (RH) <i>disturb</i>			S 1,069.55
			2751.45	
			2201.16	
	SUB TOTAL			S 2,751.45
	LESS 20%			S 550.29
	DISCOUNTED TOTAL			S 2,201.16
	<div><div> 2 KK Ind </div><div>14/05/2018</div></div>			
			<div><div>UKK Auto Consultants hence notify the Repairer of the following:</div><div><ul style="list-style-type: none">• To resurvey before/after spray painting• To display damaged parts during resurvey• Parts prices are subject to confirmation• Third party survey is on a "Without Prejudice" basis• No illegal modification(s) is allowed• Supplementary item(s) must be resurveyed and subject to final approval from Insurance Company</div><div>Acknowledged by Repairer Signature: Date:</div></div>	
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.				

NAME
ADDRESS

Home Tel.:

VIN:

Registration: SHA 2202 X

Technician:

Mileage: 402876

Time Printed 14.5.18 3:34 PM

HYUNDAI I40

Front : Left

Actual	BEFORE	Specified Range
1°36'		-3°00' 3°00'
3°58'		-0°19' 5°41'
26°08'		-1°30' 1°30'
12°08'		
13°44'		

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	BEFORE	Specified Range
-0°35'		-3°00' 3°00'
4°03'		-0°19' 5°41'
-0°44'		-1°30' 1°30'
14°27'		
13°52'		

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	BEFORE	Specified Range
2°11'		-3°00' 3°00'
-0°05'		-3°00' 3°00'
-2°19'		-3°00' 3°00'
25°24'		-3°00' 3°00'

Rear : Left

Actual	BEFORE	Specified Range
-1°55'		-3°30' 2°30'
0°18'		-1°30' 1°30'

Camber
Toe

Rear : Right

Actual	BEFORE	Specified Range
-1°44'		-3°30' 2°30'
0°11'		-1°30' 1°30'

Rear

Cross Camber
Total Toe
Thrust Angle

Actual	BEFORE	Specified Range
-0°11'		-3°00' 3°00'
0°29'		-3°00' 3°00'
0°04'		-3°00' 3°00'

Your Ref : SLH 4376E
Our Ref : SHA 2202X

Cho Ark Goon c/o
CHUNNI MOTOR WORK PTE LTD
Blk 10 Ang Mo Kio Industrial Park 2A
#03-19 AMK AutoPoint
Singapore 568047

Date : 16/06/18

The Motor Claims Department

AIG c/o LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Ind Park
Singapore 408933

WITHOUT PREJUDICE

Dear Sir / Madam,

RE: ACCIDENT INVOLVING SHA 2202X/SLH 4376E On 02/05/2018

ALONG Hougang Ave 3 Twds Jln Eunus x Tampines Rd

I am the owner/hirer of motor vehicle/taxi, SHA 2202X, which was involved in the above-mentioned accident.

The motor vehicle/taxi was surveyed by your appointed appraiser at the premises of M/S CHUNNI MOTOR WORK PTE LTD. The accident was caused by your insured's negligent driving and or management of his vehicle. Therefore, I am claiming damages and losses sustained by me against you in connection with the accident based on the appraiser's recommendation.

Our claim is as follows:


1) Cost of Repair	S\$ 27,820.00
2) Loss of Rental	S\$ 2,373.00
3) Loss of Income	S\$ 1,050.00
4) GIA Report Fee	S\$
5) LTA Search Fee	S\$ 7.45
6) Survey Report Fee	S\$
	<u>S\$ 31,250.45</u>

We enclose herewith the following relevant supporting documents :

- a) Authorisation Letter
- b) Final repair bill(s)
- c) LTA Search
- d) GIA report(s)
- e) Insurance Certificate

Kindly look into the matter and revert as soon as possible. Thank you.

Yours faithfully



Attached CCTU OISC

Joy Irene (LKKAuto)

From: Chunni motor Work <chunnimw@yahoo.com.sg>
Sent: Tuesday, 31 July 2018 4:40 PM
To: Joy Irene (LKKAuto)
Cc: Admin A
Subject: Re: SHA 2202X ON 02.05.2018 / AIG SLH 4376E

Your Ref : SLH 4376 E (AIG)
Our Ref : SHA 2202 X (020518)

WITHOUT PREJUDICE

Dear Joy

Your email of 31-07-2018 refers.

Strictly on a without prejudice basis and without any admission of liability, we confirm settlement for our client, Cho Ark Goon's (Hirer of SHA 2202 X) property damage claim (Cost of repair, LTA search fee and the loss of rental & income during the period of repair) at a global sum of \$30,435.00.

Please note that the settlement reached is strictly for the aforesaid property damage claim only and is without prejudice to the relief driver of SHA 2202 X, Hong Chee Mun's rights to claim damage for his injury against your principals, M/s AIG Asia Pacific Insurance Pte Ltd and /or their insured, if any.

Kindly forward us your Release Voucher for our client's execution as soon as possible.

Thank you and have a nice day.

Best Regards
William
Claims Department

Chunni Motor Work Pte Ltd
10 Ang Mo Kio Industrial Park 2A
#03-19 AMK AutoPoint
Singapore 568047

Tel : 6483-6016 (Claims)

DISCLAIMER:

This email is intended solely for the person to whom it has been addressed.
It may contain confidential and/or legally privileged information.
If you are not the person for whom this e-mail was intended, or if this e-mail has reached you by mistake, please delete it immediately and inform us of the error and also be hereby notified that any use, distribution, transmission, printing, copying or dissemination of this information in any way or in any manner is strictly prohibited and may be unlawful. Internet communications may not be entirely secure or accurate as information could be intercepted, corrupted, lost, delayed or contain viruses.
Therefore, we do not accept liability for any errors or omissions in the content of this message or any delay in delivery which may arise as a result of Internet transmission or any modification.



Save the trees - Do you really need to print this e-mail?

On Tuesday, 31 July 2018, 2:36:56 PM SGT, Joy Irene (LKKAuto) <JoyIrene@lkkauto.com> wrote:

WITHOUT PREJUDICE

Dear William,

On without prejudice basis and without admission of liability, we are instructed by our principal to offer settlement at global sum \$ 30,435.00 (all-in).

Kindly confirm acceptance.

Thank you.

Best Regards,

Joy Irene | Case Handler

LKK Auto Consultants Pte Ltd

DID: 6841-2409 | email: joyirene@lkkauto.com | Fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

All contents of this email is intended strictly for the addressee(s) only. It may contain confidential and/or privileged information. If you are not the intended recipient (or have received this email in error) please notify the sender immediately and destroy this email. Any unauthorized copying, disclosure or distribution of the material in this email is strictly forbidden.

View Received Message

This mail is associated with :

***SHA2202X (7198891964SG)
[SLH4376E]**

TP
COMFORT TRANSPORTATION PTE LTD
May 2 2018 10:00PM
[LCR PTE LTD]
Chunni Motor Work Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (Express) (AIG_SG_EXPRESS), sent on 26/07/2018 16:31 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$30800.00) - SHA2202X - Claim Handler: Chew, Mavis

Approved:30800.00.

DOCUMENTS SUMMARY

There are no documents.

Joy Irene (LKKAuto)

From: Joy Irene (LKKAuto)
Sent: Tuesday, 5 June 2018 4:06 PM
To: Eileen, May Hwee Yap; 'Insurance LCR SG'
Cc: Admin A; Vivian Lau (LKKAuto); Hsiao Tong (LKKAuto)
Subject: ACCIDENT INVOLVING SLH 4376E (LCR) & SHA 2202X ON 02/05/2018 (22:00)
HOUGANG AVE 3 JUNCTION

05 June 2018

LION CITY RENTALS PTE LTD

Policy Holder

Your Ref: SLH 4376E
Our Ref: CC4/LCR18008253/Dja3

Dear Sir/Madam,

ACCIDENT INVOLVING SLH 4376E (LCR) & SHA 2202X ON 02/05/2018 (22:00) HOUGANG AVE 3 JUNCTION

We refer to the above accident where we are acting for AIG Asia Pacific Insurance Pte Ltd to resolve the claim against you and/or your authorized driver under the Auto Insurance policy taken up with them.

We have received a claim from **SLH 4376E** against your insurance policy.

Based on the information on hand, we are of the opinion that we cannot be absolved from liability. We will therefore proceed to negotiate for an amicable settlement with the Third Party.

Should you however wish to further discuss on the matter prior to our negotiations and settlement, please contact us within 10 days from the date of this letter.

Please call us if you have further queries.

Best Regards,
Joy Irene | Case Handler
LKK Auto Consultants Pte Ltd
DID: 6841-2409 | email: joyirene@lkkauto.com | Fax: 6741-4108
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

All contents of this email is intended strictly for the addressee(s) only. It may contain confidential and/or privileged information. If you are not the intended recipient (or have received this email in error) please notify the sender immediately and destroy this email. Any unauthorized copying, disclosure or distribution of the material in this email is strictly forbidden.

LETTER OF AUTHORITY

To Whom It May Concern :

ACCIDENT INVOLVING SHA 2202X/SLH 4376E

ALONG Hougang Ave 3 Twds Jln Eunox ON 02/05/2018
Tampines Rd

 
I, Cho Ark Goon, NRIC NO. S 0110587F of
Blk 215 Bishan Street 23 # 11-203 (S) 570215

Owner/hirer of motor vehicle Registration No SHA 2202X, insured by
India International Insurance Pte Ltd under Policy No. MCOM 0015

do hereby authorize M/s **Chunni Motor Work Pte Ltd** as my authorized representative to write,
negotiate and settle claim on my behalf in my claim against the owner and/or Motor Vehicle
Registration No. SLH 4376E in respect of the above mentioned accident. I also
hereby authorize that the agreed settlement sum (cost of repair, loss of use, earnings and rental,
Survey report fee, LTA fee & GIA report fee) be made in favour of my representative, M/s
Chunni Motor Work Pte Ltd and that the said payment be forwarded to them as full and final
discharge of my claim.

Dated : 02/05/2018

Signature :


(Company's chop if necessary)

RELEASE VOUCHER
(AIG Asia Pacific - Express Third Party Claim)

"We/I, CHUNNI MOTOR WORK PTE LTD ("the workshop") hereby confirm that we/I have reached an agreement with the appointed surveyor of AIG Asia Pacific Insurance Pte Ltd LKK AUTO CONSULTANTS PTE LTD (name of surveyor) with respect to the amount claimed for S\$30,435.00 (Global Sum) for vehicle no. SHA 2202X that was damaged pursuant to the accident which occurred on 02/05/2018 (date) along HOUGANG AVE 3 JUNCTION (location) involving vehicle no/s SLH 4376E. This is pursuant to the inspection conducted on 14/05/2018 (date) at "the workshop".

We/I confirm that we/I are/am authorized by the owner COMFORT TRANSPORTATION PTE LTD ("the third party claimant") of vehicle no SHA 2202X make the claim as set out in the above paragraph and we/I have full authority to settle the matter on his/her behalf in a manner that we/I deem fit. We/I enclose herein the letter of authority given by "the third party claimant".

We/I further confirm that we/I will indemnify AIG Asia Pacific Insurance Pte Ltd for all damages, loss and/or expense that they will or have already incurred in the event that "the third party claimant" after the above said agreement lodges a further claim against the former for any loss and expenses suffered pertaining to costs of repairs and/or rental and/or loss of use pursuant to the damage to SHA 2202X (vehicle no.) as a result of the accident.

We/I confirm that the agreement reached above is in full and final settlement of any claim of "the third party claimant" pursuant to the accident and that further this settlement is reached on a without prejudice and without admission of liability basis.

This agreement is subject to the application of Singapore law and the Singapore Courts have exclusive jurisdiction over any dispute arising out of the same.

Dated this 1 (day) of 5 (month) 2018 (year)



Signed by appointed surveyor

Chunni Motor Work Pte Ltd
Blk 10 Ang Mo Kio Industrial Park 2A
AMK Autopoint #02-19
Singapore 568047
Tel: 6542-7162 Fax: 6542-8039
Co. Reg. No: 200623110D

Signed by "the workshop" (with chop)

"The contents of this document apply to vehicle damages only. All personal injuries and damages arising therefrom are excluded from the ambit and application of this document."

CHUNNI MOTOR WORK
PTE LTD

TAX INVOICE

CHO ARK GOON APT BLK 215 BISHAN STREET 23 #11-203 SINGAPORE 570215	VEHICLE NO	DATE
	SHA 2202 X	11.06.2018
	MAKE	INVOICE NO
	HYUNDAI	8072
	MODEL	ACC DATE/TIME
	I40	02.05.2018 @ 22:10 HRS

Cost of Repair	\$ 26,000.00
Sub-total	\$ 26,000.00
Add : 7 % - GST	\$ 1,820.00
Total	<u>\$ 27,820.00</u>

(SINGAPORE DOLLARS: TWENTY SEVEN THOUSAND EIGHT HUNDRED AND TWENTY ONLY)



Our Ref: CT18050043

Date: 08 May 2018



TO WHOM IT MAY CONCERN

Dear Sir/Madam

ACCIDENT ON 02/05/2018 @ 22:10 hrs
ALONG HOUGANG AVE 3 TWDS JLN EUNOS X TAMPINES RD
INVOLVING SLH4376E

We refer to the above-mentioned accident and wish to inform that **Comfort Transportation Pte Ltd** is the registered owner of the taxi bearing vehicle registration number **SHA2202X** (the "Taxi"). The Taxi was hired to **CHO ARK GOON IC NO S0110587F** a registered hirer-operator of **Comfort Transportation Pte Ltd** at the time of occurrence of the aforementioned accident at a rental rate **\$113.00** per day (inclusive of GST).

Please be advised that the Taxi was insured with **India International Insurance Pte Ltd** on a third party basis at the material time of the accident.

We wish to confirm that the aforesaid hirer-operator had obtained our permission to undertake repairs for damage on the Taxi arising from the said accident with a motor workshop of his choice.

Please liaise with the said hirer-operator or his authorized workshop directly for settlement of claims with third party's insurance company in respect of the said accident.

Yours faithfully

Christine Tay
Assistant Manager, Fleet Safety

This is a computer generated letter. No signature is required.

Receipt

https://vrl.lta.gov.sg/ita/vrl/action/completePayment?FUNCTION_1...

Land Transport Authority
10 Sin Ming Drive
Singapore 575701
GST Registration No. : M4-0006529-2

Print Date/Time : 03 May 2018 / 10:36:32

Receipt Date/Time : 03 May 2018 / 10:36:32

Tax Invoice/Receipt

Receipt No. : ITNET-00000-180503-000580

Previous Receipt No. :

S/N	Item Description/ Business Transaction Reference No.	Amount Before GST (\$)	GST Amount (\$)	Amount After GST (\$)
Result of Insurance Enquiry - SLH4376E				
As at 02 May 2018/22:10:00				
Insurance Co: AIG ASIA PACIFIC INSURANCE PTE. LTD.				
1	Insurance Enquiry - SLH4376E Enquiry Fee 20180503103523216877	7.00	0.49	7.49
Sub-Total		7.00	0.49	7.49
Total Before Rounding		7.00	0.49	7.49
Rounding Difference				0.04
Total Amount Payable				7.45
Paid By				
	20180503103532848	Direct Debit: eNETS Debit (Internet Banking)		7.45
Total				7.45
Cash Change				0.00
Tendered Amount				7.45
Excess Refundable Amount				0.00

THANK YOU AND HAVE A NICE DAY!

Please ensure that all payments to the Authority are good and promptly settled by the payment service provider / financial institution. Otherwise, the transaction and receipt is considered void and late fee may apply.

Vehicle Insurance Particulars Enquiry

<https://vri.lta.gov.sg/lta/vri/action/insEnquiryPaymentAck?FUNCTI...>**Vehicle Insurance Particulars Result**

Vehicle No.	Incident Date/Time	Insurance Company Name
SLH4376E	02 May 2018 / 22:10:00	AIG ASIA PACIFIC INSURANCE PTE. LTD.

Print

OK

Save as PDF

...CLAIM SUBFOLDER...(Pending for Survey Report)

Express

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	08 May 2018 Edit Reg		03 May 2018 00:00 Edit Adj Rpt	S\$26,000.00 Edit Estimates	S\$26,000.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	--------------------------

CLAIM SUBFOLDER DETAILS [Created by adjuster]

Insured:	LCRF PTE LTD, Co. Reg. No.: 20164597K		
Main Claimant:	COMFORT TRANSPORTATION PTE LTD, Co. Reg. No.: 199303821R		
Vehicle Reg. No.:	SHA2202X	Date of Loss:	02/05/2018 22:00 - :59 [48 Months and 17 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / 7198891964SG	Policy/Cover Note No.:	(Comprehensive)
Vehicle Reg. No. (Insured):	SLH4376E	Policy No. (Claimant):	MCOM0015
		Excess:	
Repairer:	Chunni Motor Work Pte Ltd (HQ) Blk 10 Ang Mo Kio Industrial Park 2A, #03-19 AMK Autopoint, 568047 Ang Mo Kio - Tel: 6542 7162		
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (Express) - Tel: 65-6419-3000 ... [Handled by Chew, Mavis] Chew.Mavis@aig.com		
Claimant's Insurer:	India International Insurance Pte Ltd (HQ) - Tel: 63476100		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by BRYAN TANI] ... [Final Rpt due 16/05/2018]		

ASSOCIATED MAIL RECEIVED [View All](#) [Compose Case Mail](#)

- AIG_SG_EXPRESS (26/07/2018): Alert - Adj Mandate Approved (S\$30800.00) - SHA2202X - Claim Handler: Chew, Mavi...



















































ALL ASSOCIATED TASKS [View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)


















































 
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									



















































Claim Documents


















































 
*SHA2202X (7198891964SG)
[SLH4376E]
TP
COMFORT TRANSPORTATION PTE LTD
May 2 2018 10:00PM
[LCRF PTE LTD]
Chunni Motor Work Pte Ltd































Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser	
Video			1 per page <input type="checkbox"/> <input checked="" type="checkbox"/>	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	25/07/18 11:10	Video - Accident GREEN LIGHT IN TPV FAVOUR	Load MP4	<input type="checkbox"/>
Letters/Correspondences			1 per page <input type="checkbox"/> <input checked="" type="checkbox"/>	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	(Draft)	Third Party Express Settlement - Payment Breakdown	Edit	<input type="checkbox"/>
Photos/Images			3 per page <input type="checkbox"/> <input checked="" type="checkbox"/>	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	08/06/18 08:59	Front View Left	Load JPG	<input checked="" type="checkbox"/>
2	08/06/18 08:59	Front View Right	Load JPG	<input checked="" type="checkbox"/>
3	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
4	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
5	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
6	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
7	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
8	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
9	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
10	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
11	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
12	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
13	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
14	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
15	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
16	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
17	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
18	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
19	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
20	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
21	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
22	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
23	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
24	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
25	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
26	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
27	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
28	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
29	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>
30	08/06/18 08:59	General View	Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
31	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
32	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
33	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
34	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
35	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
36	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
37	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
38	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
39	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
40	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
41	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
42	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
43	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
44	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
45	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
46	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
47	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
48	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
49	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
50	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
51	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
52	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
53	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
54	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
55	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
56	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
57	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
58	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
59	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
60	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
61	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
62	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
63	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
64	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
65	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
66	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
67	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
68	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
69	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
70	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
71	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
72	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
73	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
74	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
75	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
76	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
77	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
78	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
79	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>
80	08/06/18 08:59	General View	 Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
81	08/06/18 08:59	Odometer Reading	 Load JPG	<input checked="" type="checkbox"/>
82	08/06/18 08:59	Chassis Number	 Load JPG	<input checked="" type="checkbox"/>
83	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
84	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
85	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
86	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
87	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
88	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
89	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
90	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
94	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
95	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
96	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
97	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
98	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
99	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
100	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
101	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
102	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
103	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
104	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
105	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
106	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
107	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
108	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
109	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
110	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
111	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
112	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
113	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
114	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
115	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
116	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
117	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
118	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
119	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
120	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
121	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
122	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
123	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
124	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
125	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
126	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
127	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
128	08/06/18 09:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
129	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
130	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
131	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
132	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
133	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
134	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
135	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
136	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
137	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
138	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
139	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
140	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
141	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
142	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
143	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
144	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
145	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
146	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
147	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
148	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
149	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
150	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
151	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
152	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
153	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
154	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
155	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
156	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
157	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
158	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
159	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
160	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
161	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
162	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
163	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
164	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
165	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
166	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
167	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
168	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
169	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
170	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
171	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
172	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
173	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
174	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
175	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
176	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
177	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
178	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
179	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
180	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
181	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
182	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
183	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
184	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
185	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
186	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
187	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
188	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
189	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
190	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
191	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
192	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
193	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
194	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
195	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
196	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
197	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
198	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
199	08/06/18 09:02	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
200	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
201	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
202	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
203	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
204	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
205	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
206	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
207	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
208	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
209	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
210	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
211	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
212	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
213	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
214	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
215	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
216	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
217	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
218	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
219	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
220	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
221	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
222	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
223	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
224	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
225	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
226	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
227	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
228	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
229	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
230	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
231	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
232	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
233	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
234	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
235	08/06/18 09:03	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
236	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
237	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
238	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
239	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
240	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
241	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
242	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
243	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
244	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
245	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
246	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
247	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
248	08/06/18 09:05	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	07/05/18 10:49	ACKNOWLEDGEMENT EMAIL TO AIG DD 03.05.2018	 Load PDF	
2	07/05/18 10:49	EMAIL PRS	 Load PDF	
3	07/05/18 10:49	TP ESTIMATE + TP GIA REPORT	 Load PDF	
4	27/05/18 09:34	TP ESTIMATE - MARKED	 Load PDF	
5	25/07/18 11:25	SUPPORTING CLAIM DOCUMENTS	 Load PDF	
6	06/08/18 13:48	WORKSHOP INVOICE	 Load PDF	
7	06/08/18 13:48	AUTHORISATION TO ACT FORM	 Load PDF	
8	06/08/18 13:48	Release Voucher	 Load PDF	
9	06/08/18 13:48	RENTAL RECEIPT	 Load PDF	
10	06/08/18 13:48	LTA SEARCH	 Load PDF	
11	06/08/18 13:48	LETTER TO OI	 Load PDF	
No	Finalized On	AIG Asia Pacific Insurance Pte. Ltd. (SG)	Thumbnail	Print
1	08/05/18 17:05	OI GIA REPORT	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)
<div style="border: 1px solid black; height: 40px; width: 100%;"></div>
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>

NOTE: TO BE COMPLETED BY SURVEYOR

TEAM _____

THIRD PARTY EXPRESS SETTLEMENT (PAYMENT BREAKDOWN)

Vehicle No:	SLH4376E (Insd veh)	Model:	HYUNDAI I40 1.7 L CRDI AT
	SHA2202X (TP veh)		ABS AIRBAG 4DR (A)
Date of Accident:	02/05/2018		

Global Sum Settlement	:	<input checked="" type="checkbox"/> [X] Yes	<input type="checkbox"/> [] No	
Repair Estimate	:	\$		50,668.14
Final Repair Cost	:	\$		30,435.00
Loss of Use	:	\$		16.00 days at \$50.00 per day
Rental (if any)	:	\$		16 days
LTA / GIA Search Fee	:	\$		
Others:	:	\$		
	:	\$		
Final Settlement Sum (Global Sum)	:	\$		30,435.00

Is Third Party Workshop GIA Registered? ☐ [] YES ☒ [X] NO (Kindly indicate below)

A) For Non GIA Registered Workshop: Agreed Liability ____ 100 ____ (%)

B) For GIA Registered Workshop: BOLA Applicable: Yes/ No BOLA Scenario No: ____

BOLA Liability: ____ (%) Assessed Liability (*): ____ (%)

** Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.*

Remarks _____

Payment Instruction: Payee's Breakdown			
1)	Chunni Motor Work Pte Ltd	: \$	30,435.00
2)		: \$	
3)		: \$	
4)		: \$	

JOANNE LEE KHANG MIN

06 Aug
2018

LKK Auto Consultants Pte Ltd

Date

Please attach all the supporting documents to the form.

(Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report; Medical Report/ Bill (if any))

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/LCR18008253/DJA3Q2

Date: 06/08/2018

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

Claimant Vehicle No : SHA2202X

Insured Vehicle No : SLH4376E

Date of Loss: 02/05/2018

Nature of Claim:

TP

Claim No: 7198891964SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHA2202X**

Make & Model: HYUNDAI I40, 1.7 L CRDI AT ABS AIRBAG 4DR (A) Engine No: D4FDEU410016

Reg. Date: 15/04/2014 (Man. Year: 2014)

Chassis No: KMHLB41UMEU052532

Colour: Blue

Odometer: 402875 km

Engine Capacity: 1685 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/60 R16

Rear Tyre Size:

205/60 R16

Front Left Side: West Lake 5 mm

Rear Left Side:

West Lake 5 mm

Front Right Side: West Lake 5 mm

Rear Right Side:

West Lake 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	44,013.40	30,271.44	13,741.96	31.22
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,340.00	2,240.00	1,100.00	32.93
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	47,353.40	32,511.44	14,841.96	31.34
Approved Total (Overridden) (S\$)		26,000.00		
(S\$)	47,353.40	26,000.00	21,353.40	45.09
+ GST 7.00/7.00% (S\$)	3,314.74	1,820.00	1,494.74	45.09
Nett Amount (S\$)	50,668.14	27,820.00	22,848.14	45.09
+ Loss of Use (16.0 x S\$50.00/day) (S\$)		800.00		
+ Car Rental (16.0 x S\$113.00/day) (S\$)		1,808.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		30,435.45		
Global Sum Settlement (S\$)		30,435.00		

INSPECTION

Date of Assignment: 03/05/2018

Date Inspected: 14/05/2018 Inspected At: Chunni Motor Work Pte Ltd (HQ)
Blk 10 Ang Mo Kio Industrial Park 2A, #03-
19 AMK Autopoint
Singapore 568047

Estimated Period of Repair: 15.0 days

Adjuster: BRYAN TANI

Manager: Joy Irene Bascao

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Buckled	1,526.00 FL	*1,526.00 FL
2	1		*BONNET HINGE (LH)	Bent	91.30 FL	*91.30 FL
3	1		*BONNET LOCK	Bent	50.90 FL	*50.90 FL
4	1		*BONNET ABSORBER ,LH	Serviceable	73.90 FL	*- FL
5	1		*BONNET INSULATOR	Crumpled	243.00 FL	*243.00 FL
6	1		*BONNET INSULATOR CLIPS	Necessary	8.40 FL	*8.40 FL
7	1		*RADIATOR GRILLE	Broken	294.35 FL	*294.35 FL
8	1		*RADIATOR GRILLE H EMBLEM	Broken	113.65 FL	*113.65 FL
9	1		*FRONT BUMPER COVER	Buckled	562.30 FL	*562.30 FL
10	1		*FRONT BUMPER SPONGE	Torn	142.20 FL	*142.20 FL
11	1		*FRONT BUMPER REINFORCEMENT	Buckled	526.10 FL	*526.10 FL
12	2		*FRONT BUMPER GRILLE (LH/RH)	Cut	80.60 FL	*80.60 FL
13	1		*FRONT BUMPER CENTRE GRILLE	Deformed	178.60 FL	*178.60 FL
14	2		*FRONT BUMPER CENTRE GRILLE TOP GARNISH	Cut	160.00 FL	*160.00 FL
15	2		*FRONT BUMPER BRACKET TOP (LH/RH)	Dislodged	44.80 FL	*44.80 FL
16	2		*FRONT BUMPER BRACKET (LH/RH)	Dislodged	49.20 FL	*49.20 FL
17	2		*FRONT BUMPER RETAINER MOUNTING	Broken	18.40 FL	*18.40 FL
18	1		*HEADLAMP SUPPORT TOP COVER	Cracked	398.00 FL	*398.00 FL
19	1		*HEADLAMP SUPPORT PANEL ASSY	Broken	1,067.50 FL	*1,067.50 FL
20	2		*HEADLAMP (LH/RH)	Broken	2,776.00 FL	*2,776.00 FL
21	2		*HEADLAMP HALOGEN BULB (LH/RH)	Serviceable	28.80 FL	*- FL
22	1		*RADIATOR	Broken	850.20 FL	*850.20 FL
23	1		*RADIATOR FAN BLADE ,COWLING ,MOTOR ASSY	Broken	792.95 FL	*792.95 FL
24	2		*RADIATOR BRACKET (RH/LH)	Repair	13.00 FL	*- FL
25	1		*RADIATOR HOSE UPPER	Deformed	47.40 FL	*47.40 FL
26	1		*RADIATOR HOSE LOWER	Serviceable	47.40 FL	*- FL
27	1		*RADIATOR EXPANSION TANK	Serviceable	48.00 FL	*- FL
28	2		*RADIATOR GUARD	Broken	70.00 FL	*70.00 FL
29	2		*HORN UNIT (LH/RH)	Dislodged	173.50 FL	*173.50 FL
30	1		*HORN WIRE	Torn	156.50 FL	*156.50 FL
31	2		*FRONT FENDER (LH/RH)	Buckled / Dented	1,238.00 FL	*1,238.00 FL
32	2		*FRONT FENDER APRON PANEL (LH/RH)	N/S Buckled / O/S Dented	3,151.00 FL	*3,151.00 FL
33	2		*FRONT FENDER SHIELD (LH/RH)	Torn	339.60 FL	*339.60 FL
34	1		*AIR FLOW SENSOR	Not Necessary	633.35 FL	*- FL
35	1		*AIR CLEANER BOTTOM ASSY	Cracked	325.00 FL	*325.00 FL
36	1		*AIRCON CONDENSER	Bent	1,137.35 FL	*1,137.35 FL
37	1		*AIRCON SUCTION & LIQUID HOSE	Bent	658.90 FL	*658.90 FL
38	1		*AIRCON DISCHARGE HOSE	Bent	233.30 FL	*233.30 FL
39	1		*AIRCON COMPRESSOR	Distorted	2,857.55 FL	*2,857.55 FL
40	1		*BATTERY TRAY	Cracked	55.45 FL	*55.45 FL
41	1		*WIPER PANEL TOP GARNISH	Serviceable	91.20 FL	*- FL
42	1		*WIPER CONTAINER	Broken	61.90 FL	*61.90 FL
43	1		*WIPER CONTAINER MOTOR	Damaged	65.90 FL	*65.90 FL
44	1		*FRONT SHOCK ABSORBER (ASSY) LH	Not Necessary	342.20 FL	*- FL
45	1		*FRONT SHOCK ABSORBER MOUNTING ,LH	Not Necessary	75.10 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
46	1		*FRONT DRIVE SHAFT ,LH	Distorted	1,069.55 FL	*1,069.55 FL
47	1		*RACK & PINION ASSY	Not Necessary	2,184.00 FL	*- FL
48	1		*STG TIE END	Not Necessary	69.50 FL	*- FL
49	1		*STABILIZER BAR	Not Necessary	252.30 FL	*- FL
50	1		*STABILIZER BAR BUSH ,LH	Not Necessary	16.10 FL	*- FL
51	1		*STABILIZER BAR LINK ,LH	Not Necessary	81.70 FL	*- FL
52	1		*STABILIZER BRACKET ,LH	Not Necessary	24.00 FL	*- FL
53	1		*FRONT SUSPENSION LOWER ARM ,LH	Not Necessary	715.10 FL	*- FL
54	1		*FRONT CHASIS MEMBER N/S	Bent	1,575.85 FL	*1,575.85 FL
55	1		*KNUCKLE ARM ,LH	Not Necessary	582.95 FL	*- FL
56	1		*ENGINE UNDER COVER	Torn	343.10 FL	*343.10 FL
57	1		*ENGINE CROSSMEMBER	Distorted	2,236.90 FL	*2,236.90 FL
58	1		*ENGINE MTG (REAR)	Not Necessary	279.60 FL	*- FL
59	1		*GEARBOX	Damaged	11,846.40 FS	*4,000.00 FS
60	1		*GEARBOX MOUNTING	Not Necessary	342.50 FL	*- FL
61	1		*INTER COOLER	Punctured	921.90 FL	*921.90 FL
62	2		*INTER COOLER MOUNTING	Serviceable	25.90 FL	*- FL
63	1		*HOSE B TO INTER COOLER	Not Necessary	229.70 FL	*- FL
64	1		*HOSE C TO INTER COOLER INLET	Not Necessary	113.30 FL	*- FL
65	1		*PIPE TO INTER COOLER	Not Necessary	167.05 FL	*- FL
66	1		*PIPE TO INTER COOLER OUTLET	Not Necessary	244.55 FL	*- FL
67	1		*ABS SENSOR	Not Necessary	261.50 FL	*- FL
68	1		*WIRING -ENGINE	Cracked	3,326.00 FL	*3,326.00 FL
69	1		*WIRING -FEM	Not Necessary	168.00 FL	*- FL
70	1		*FRONT NUMBER PLATE	Dislodged	25.00 FS	*25.00 FS
71	1		*FRONT NO PLATE TRIM COVER	Cracked	30.00 FS	*30.00 FS
72	1		*NEW BATTERY	Not Necessary	207.00 FS	*- FS
73	1		*AIR CLEANER COVER	Distorted	34.30 FL	*34.30 FL
74	1		*AIR DUCT	Broken	206.05 FL	*206.05 FL
75	1		*AIR DUCT B	Broken	261.95 FL	*261.95 FL
76	1		*FAN BELT	Torn	155.00 FL	*155.00 FL
77	1		*FAN BELT IDLE PULLEY	Damaged	189.50 FL	*189.50 FL
78	1		*ACTUATOR -SWIRL CONTROL	Cracked	835.10 FL	*835.10 FL
79	1		*FRONT DRIVE SHAFT (RH)	Distorted	1,069.55 FL	*1,069.55 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 51,989.65 36,825.55
 - List Item Discount on L Items 20.00/20.00% (\$\$) 7,976.25 6,554.11

Total Parts (\$\$) 44,013.40 30,271.44

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	1,600.00	1,200.00
2	SPRAY PAINTING CHARGE	New	1,100.00	800.00
3	WIRING CHARGE	New	50.00	30.00
4	TOWING CHARGE	New	50.00	0.00
5	FRONT CHASSIS ALIGNMENT CHARGE	New	180.00	150.00
6	REMOVE/REFIX UNDERCARRIAGE (FRT)	New	200.00	0.00
7	FRT WHEEL ALIGNMENT	New	80.00	0.00
8	REMOVE/REFIX AIRCON & REFILL GAS	New	80.00	60.00
Gross Labour Cost (S\$)			3,340.00	2,240.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >