







EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPRJ BTRRN	DISC QUNTY%	SALV AGE%	PART PRICE(NET)	AC (P)
<input type="checkbox"/>	40	1			Air Cond Fan Blade			Cut	75				75	R€
<input type="checkbox"/>	41	1			Air Cond Fan Motor			Cracked	170				170	R€
<input type="checkbox"/>	42	1			Air Duct			Deformed	50				50	R€
<input type="checkbox"/>	43	1			FRONT BUMPER LOWER GARNISH			Damaged	80				80	R€
<input type="checkbox"/>	44	1			RADIATOR TOP HOSE			Cut	25				25	R€
<input type="checkbox"/>	45	1			AIR COND HOSE (LIQUID)			Bent	180				180	R€
<input type="checkbox"/>	46	1			CONDENSER SIDE COVER LH			Deformed	22				22	R€
<input type="checkbox"/>	47	1			CONDENSER SIDE COVER RH			Deformed	22				22	R€
<input type="checkbox"/>	48	1			RADIATOR LOWER HOSE			Cut	25				25	R€

Labour

EDIT	SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	LABOUR R&R	LABOUR REPAIR	PAINT	ACTION (LABOUR)	COMMENT
<input type="checkbox"/>	1		Labour to carry out front repair.	600	0	0	Reviewing	
<input type="checkbox"/>	2		To check and reconnect all necessary wirings.	30	0	0	Reviewing	
<input type="checkbox"/>	3		To spray painting on front affected area.	600	0	0	Reviewing	

EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/ BTFR%	DISC OUNT%	SALV AGEN	PART PRICE(NET)	AC (PA)
<input type="checkbox"/>	11	1			Front Bumper			Deformed	220				220	R€
<input type="checkbox"/>	12	10			Front Bumper Clip			Necessary	1.5				15	R€
<input type="checkbox"/>	13	1			Front Bumper Side Retainer LH			Deformed	30				30	R€
<input type="checkbox"/>	14	1			Front Bumper Side Retainer RH			Necessary	30				30	R€
<input type="checkbox"/>	15	1			Front Bumpair Lower Grille			Deformed	70				70	R€
<input type="checkbox"/>	16	1			Front Bumper Towing Cover LH			Deformed	15				15	R€
<input type="checkbox"/>	17	1			Front Bumpair Towing Cover RH			Repair	0				0	R€
<input type="checkbox"/>	18	1			Front Number Plate Base			Deformed	45				45	R€
<input type="checkbox"/>	19	1			Fog Lamp LH			Serviceable	0				0	R€
<input type="checkbox"/>	20	1			Fog Lamp RH			Serviceable	0				0	R€
<input type="checkbox"/>	21	1			Fog Lamp Bracket LH			Serviceable	0				0	R€
<input type="checkbox"/>	22	1			Fog Lamp Bracket RH			Serviceable	0				0	R€
<input type="checkbox"/>	23	1			Front Bumper Foam			Deformed	45				45	R€
<input type="checkbox"/>	24	1			Front Bumper Reinforcement			Bent	120				120	R€



### Detailed Assessment

Inspection Date \*

05/15/2018



Total Loss

Yes No

Towing Charges

0

Voluntary Excess

0

Compulsory Excess

0

Young/Inexperienced/Unnamed Driver Excess

0

Other Excess

### Condition of Vehicle at time of survey

General condition

Good

Steering (Serviceable)

Yes No

Footbrake (Serviceable)

Yes No

Handbrake (Serviceable)

Yes No

Engine Modification

Yes No

Pre-accident condition

Good

### Tyre Condition

Spare wheel

Rear Tyre Size

205/65R16

Age of Tyres

Front Tyre Size

205/65R16



POST SURVEY INF...

CATEGORY Address type

FNOL INFORMATI... Residential

POST SURVEY INF...

CATEGORY Gender

FNOL INFORMATI... Male

POST SURVEY INF...

CATEGORY Marital status

FNOL INFORMATI... Married

POST SURVEY INF...

CATEGORY Identification #

FNOL INFORMATI... S6983775A

POST SURVEY INF...

CATEGORY

Make

POLICY INFORMAT... TOYOTA

DATE OF BIRTH

ASSESSMENT INFO... TOYOTA

FNOL INFORMATI... July 25, 1969

CATEGORY

Model

POLICY INFORMAT... PREVIA 2.4

AGE

ASSESSMENT INFO... PREVIA 8 SEATER

FNOL INFORMATI... 48

CATEGORY

Type

POLICY INFORMAT...

CATEGORY

ASSESSMENT INFO...

FNOL INFORMATI... Unknown

CATEGORY

Type of Paint

POLICY INFORMAT...

CATEGORY

ASSESSMENT INFO...

FNOL INFORMATI... Other

CATEGORY

Chassis No

POLICY INFORMAT... JTEGD52M107106038

CATEGORY

Driving Experience



Accelerated workshop survey

### Claim Handler

ANG Yvonne  
6568804461  
yvonne.ang@axa.com.sg

- Messages
- Assessment
- Invoices
- Metrics
- History
- Notes
- Documents

[Add](#)

### Additional Instructions

excess NIL Please confirm is Auto vehicle also pending estimate

CREATED USER	VERSION DATE	ESTIMATED AMOUNT	APPROVED AMOUNT	STATUS	SHARE	CLONE
--------------	--------------	------------------	-----------------	--------	-------	-------

User Portal	5/22/18 6:19 PM	5624	5624	Approved	<a href="#">Share</a>	<a href="#">Clone</a>
-------------	--------------------	------	------	----------	-----------------------	-----------------------

ANG Yvonne	5/14/18 11:53 AM			Open	<a href="#">Share</a>	<a href="#">Clone</a>
------------	---------------------	--	--	------	-----------------------	-----------------------



PULAN24@HOTMAIL.COM

Accelerated workshop survey

**Claim Handler**

ANG Yvonne  
6568804461  
yvonne.ang@axa.com.sg

Messages Invoices History Documents

Assessment Metrics Notes

Document Type

Additional Instructions  
excess NIL Please confirm is Auto vehicle also pending estimate

Document SubType

Upload Documents

NAME	TYPE	SUB-TYPE	AUTHOR	DATE UPLOADED
SKC7974Y INSD GIA REPORT	Letters and Correspondence	Workshop	RATAN BHOSALE Pragati	
Accident Statement	Reports & Statement		Merimen	
SKC 7974Y INSPECTION PHOTO.pdf	Evidence	Photos	LKK AUTO CONSULTANTS PTE LTD (OD)	July 17, 2018