

ASS. REC. BY:

REF: CS/CTU 8009185 / Dgbf2

Special Instruction:

Surveyor

B. J. G. M.

ASSIGNMENT (Office)

Maximin

From (Person): Sharon Hun

of CTL

Date/Time: 18/05/2018 3:15pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SHD 6732R

Insured: G8G 3519R

at Workshop m/s: Soon Hock

Tel:

of: Bldg 10 Park Ind Park 2A #D1-03

Policy No: Dmcvsn1749781700

Claim No: SNM1800243302

Sum Insured:

Excess:

Make of Veh:

D.O.A. 17/05/2018

(Client's Record)

CA / REV / REP. / REV 24 HRS Opt

H.O.D. Endorsement:

Date/Time: 21/05/2018 11:07am

Person Contacted: Lynn

Vehicle: D LOUPT

Date/Time	Action/Instruction (✓) Estimate
	SHD 6732R - X
	G8G 3519R - X

08/06/18

ASSIGNMENT

COE April 2024

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

Veh No: **SHD 6732R** Yr Regn: **2016 April**
 Type: M.Car / M.Cycle / Bus / Van / Lorry / **Truck** / Prime Mover /
 Truck / Trailer or _____
 Make: **Mercedes Benz E220** c.c. **2143**
 Colour: **White** A/C: Insured / Std / NI / NA
 Sp. Reading: **226884** T/Radio: Insured / Std / NI / NA
 Eng/No: **65192433255163**
 C/No: **WDD2120012B315500**
 Gen. Cond: **Good** / Fair / Poor / Burnt
 Steering: **Inter** / Jammed / Leaked / Burnt or
 Brake: **Inter** / Jammed / Leaked / Burnt or
 Modi: Nil / **S/Rim** / STD A/Rim or

<input checked="" type="checkbox"/>	<input type="checkbox"/>
N/S	O/S
<input type="checkbox"/>	<input type="checkbox"/>

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

Tyre Size: F: **225/55R16**
 R: **- " -**
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or **Westlake**

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: **9** days Res.: Yes or No
 Lum Sum: **20** % 3 Val: Yes or No

Front Rear
 R/Bal. **6** mm R/Bal. **6** mm
 L/Bal. **6** mm L/Bal. **6** mm
 D.O.A. **17/05/2018** D.O.I. **21/05/2018**
 Survey held at **Chunni AMK**

CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____
 Vehicle: IN / OUT

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or
N/S Front
 The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
08/06/18	China Taping GBG 3519R Jnanu 4S 195001 with 9 days of repair (CRD \$13033.35, 40%)

RECEIVED 08 JUN 2018

Date/Time, File Pass to? : Preli. Report
 : Final Report
 Date/Time, File Return to? _____

Days Of Repair: **9**
 Resurvey No. of Trip: **1**

Add Fee: Site Insp (\$)
 Interview (\$)
 Tech. Invs (\$)
 Weekend (\$)

Survey Fee:	220
Transportation:	
G + R5 SI	
Photos	
Others	
TOTAL	

Report Format: **TP**
 Lump Sum / LB1: (\$ **19500**)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD		Ref : CS/CTI18009185/Dqb	
3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Date : 21-05-2018	
		Code : CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBG 3519R	Veh. Inspected	SHD 6732R
Policy No.	DMCVSN1749781700	Coverage (\$)	0.00
Claim No.	SNM18D02483C02	Excess (\$)	0.00
Assign From	MERIMEN (SHARON HAN)	Assign Date	18/05/2018
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	17/05/2018	Inspection Date	21/05/2018
Survey held at	SOON HOCK MOTOR PTE LTD BLK 10 ANG MO KIO INDUSTRIAL PK 2A #01-05/06 AMK AUTOPOINT . SINGAPORE 568047		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	17 May 2018		18 May 2018 15:15 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	-----------------

CLAIM SUBFOLDER DETAILS		[Created by insurer]
Insured:		
Main Claimant:	COMFORT TRANSPORTATION PTE LTD	
Vehicle Reg. No.:	SHD6732R	Date of Loss: 17/05/2018 00:00 - :59
Claim Type:	TP / SNM18D02483C02	Policy/Cover Note No.: DMCVSN1749781700
Vehicle Reg. No. (Insured):	GBG3519R	Policy No. (Claimant):
		Excess: S\$0.00
Repairer:	Soon Hock Motor Pte Ltd (HQ) Bk 10 Ang Mo Kio Industrial Park 2A, #01-05/06 AMK Autopoint, 568047 Ang Mo Kio - Tel: 64836016	
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Sharon Han - 63896]	
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 30/05/2018]	
Adj Asg. Remarks:	EST \$31,536.15, ASSIGN HENRY NG AS SJE.	
ASSOCIATED MAIL RECEIVED		
		View All Compose Case Mail
There are no mail for this case.		
ALL ASSOCIATED TASKS		
		View All Search Tasks Create New Task Complete
Due Date	Priority	Type
Task Group	Subject	Handler
Assigned By	Completed On	Created On
Done?		
No results.		

21/05/2018 @ 11:05am
Lynn veh in

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	17/05/2018 12:02
Date Of Accident	17/05/2018 10:25
Exact Location Of Accident	UPPER COAST ROAD TWDS EAST COAST ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHD6732R
Insured/Policyholder	
Name Of Registered Owner	COMFORT TRANSPORTATION PTE LTD
Co Reg No	199303821R
Email Address	FLEETSAFETY@CDGTAXI.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-65508768
Vehicle Particulars	
Manufacturer	MERCEDES-BENZ
Model	MERC
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI
Insurance Company	
Name of Insurance Company	INDIA INTERNATIONAL INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	MCOM0015
Cover Note Number	
Driver	
Name of Driver	BAK KIAN LEONG (MAI JIAN LIANG)
NRIC No	S7440488E
Date Of Birth	05/12/1974
Occupation	OUTDOOR
Date Of Driving Pass	30/12/1996
Driving Experience	21 YEARS AND 4 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97410666
Fax Number	
Contact Number	
Email Address	TERFEL74@HOTMAIL.COM

Approximate Age 44
 Injuries Sustain CHEST
 Injured person in which vehicle? SHD8732K
 Were seat belts worn? YES
 Was this injured conveyed to hospital by ambulance? NO
 Address
 Postcode

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my Insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) Investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199303821R

Policyholder's Signature
Date & Time:


Bds

Driver's Signature
(If driver is not the policyholder)
Date & Time: 17.05.2018 @ 12:00 Hrs

R

Reporting Centre Personnel's Signature
Name: *Rubbini*
NRIC/FIN No.:

SKETCH PLAN

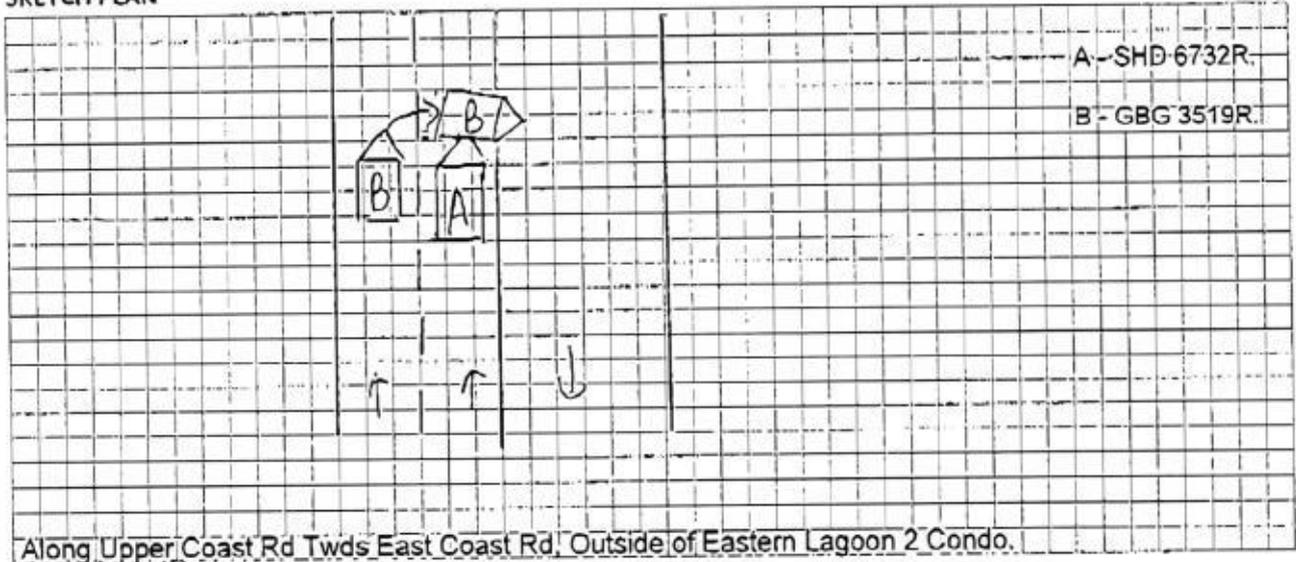

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 17.05.2018 at about 10:25 Hrs, I was travelling along Upper Coast Rd towards East Coast Rd with no passenger on board.

As I reached outside of Eastern Lagoon 2 Condo, a lorry (GBG 3519R) which was travelling on my left made a U-turn in a sudden manner. This resulted veh (B) to collide onto my taxi (A) front left portion.

As it took place so fast, I could not take evasive action to prevent the collision. Both of us then alighted and exchanged the particulars.

I had company video fixed in my taxi and photos taken at scene to support my claims.

The particulars of driver of veh (B) (GBG 3519R) as follows :

Mr. Chan Kok Leong. NRIC : S 1472900C. Hp : 8314 8582.

After the accident, I suffered pain on my chest and will consult doctor later on.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199303821R

Policyholder's Signature
Date & Time:

Bib
Driver's Signature
(If driver is not the policyholder)
Date & Time: 17.05.2018 @ 12:00 Hrs

Rubini
Reporting Centre Personnel's Signature
Name: Rubini
NRIC/FIN No.:

CHUNNI MOTOR WORK PTE LTD
REPAIR ESTIMATE*

To Subby by LKK

21/5/18
 - Alin Gony
 (2 Pgs)

VEHICLE NO : SHD 6732R

DATE : 17.05.2018

MAKE :

TEL : 6542 5119

MODEL : MERCEDES

FAX : 6542 6039

ChinaTaiping

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Bumper Assy, Frt broken		1409.45	\$ 1,890.50	✓
	Bumper Reinforcement, Frt to ✓		721.00	\$ 1,158.00	✓
	Bumper Bracket, Frt/LH broken			\$ 95.00	✓
	Bumper Absorber, Frt/LH to ✓ ✓			\$ 295.00	✓
	Bumper Frame, Frt/Centre broken ✓ crack			\$ 198.00	✓
	Bumper Frame, Frt/LH broken			\$ 39.45	✓
	Bumper Sponge, Frt/Centre ✓ NN			\$ 285.00	✓ X
	Bumper Sponge, Frt/LH broken			\$ 250.00	✓
	Bumper Sponge Extension, Frt/LH. broken			\$ 54.00	✓
	Bumper Grille, Frt/Centre ✓ S/C			\$ 290.50	✓ X
	Bumper Grille, Frt/LH ✓ Dam			\$ 240.50	✓
	Headlamp, LH/RH ^{N/S} broken o/s to crack	\$	2955.00 3,957.00	\$ 7,914.00	5910.00
	Head Lamp Bracket (LH) broken			\$ 300.00	✓
	Radiator Top Panel, Frt to ✓			\$ 330.50	✓
	Head Lamp Panel (LH) Bt.			\$ 480.00	✓
	Radiator Grille Crack			\$ 1,220.00	✓
	Radiator Grille Star Logo Nec			\$ 56.70	✓
	Radiator Grille Adjuster Bracket ✓ Dam			\$ 685.70	✓
	Bonnet Assy Suc		2267.43	\$ 2,850.60	✓
	Bonnet Mercedes Star Logo Nec			\$ 56.70	✓
	Bonnet Hinge (LH) van			\$ 285.50	X
	Bonnet Insulator NN			\$ 235.40	X
	Bonnet Centre Lock NN			\$ 95.00	X
	Bonnet Lock, Top ✓ ✓			\$ 94.00	✓
	Bonnet Lock Lower ✓ Dam			\$ 92.00	✓
	Bonnet Lock Brace Panel ✓ NN			\$ 64.80	X
	Fender, Frt/LH Suc			\$ 996.08	✓
	Fender Splashshield, Frt/LH(Front) dented			\$ 257.00	✓
	Fender Splashshield, Frt/LH (Rear) dented			\$ 263.00	✓
	Horn (Woofer) (LH) NN			\$ 228.00	X
	Radiator Assy ✓ ✓			\$ 1,345.00	✓
	Radiator Fan Blower Assy to crack mounty			\$ 1,385.40	✓
	Radiator Shroud to NN			\$ 1,225.60	X
	Radiator Air Baffle, Top NN			\$ 85.90	X
	Radiator Air Baffle, Lower NN			\$ 125.90	X
	Radiator Dowel Pin ✓ Nec			\$ 6.80	✓
	Radiator Mounting Lower NN			\$ 7.50	X
	Radiator Mounting Top ✓ Dam			\$ 10.85	✓
	Aircon Condenser ✓ ✓			\$ 1,235.80	✓
	Turbo Charger Air Cooler ✓ mounty crack			\$ 1,053.80	✓
	S/Absorber, Front LH to dented			\$ 944.00	X
	Strut, Frt/LH NN			\$ 604.00	X
	Steering Knuckle Arm, Frt/LH to dented			\$ 1,119.00	X
	Lower Arm Assy, Frt/LH to dented			\$ 661.05	X
	Top Arm Assy, Frt/LH to dented			\$ 479.15	X

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Torsion Bar Rod, Frt HH			\$ 105.60 X
	Torsion Bar Frt/LH HH			\$ 405.00 X
	SUB TOTAL			\$ 32,101.28
	LESS 10%			\$ 3,210.13
	DISCOUNTED TOTAL		24552.36	\$ 28,891.15
			22097.12	
	Head Lamp Bulb, LH both HH			\$ 25.00 Nett for X
	Labour Charge			
	Panel Beating			\$ 1,200.00 800/-
	Spray Painting Charge			\$ 900.00 600/-
	Wiring Charge			\$ 50.00 30/-
	Towing Charges			\$ 50.00 HH
	Tuff Kote			\$ 100.00 40/-
	Remove/Refix Undercarriage (FRT)		1710/-	\$ 200.00 HH 180/-
	FRT Wheel Alignment			\$ 120.00 HH 60/-
	TOTAL LABOUR			\$ 2,620.00
	ESTIMATE TOTAL			\$ 31,536.15
				23807.12
			Supp	650.70
				24457.82
				419500/-

21/05/2013 @ 1430h
 Not Antenna
 45mm & deys.
 9

 LKK Auto


LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature: _____
 Date: _____

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

32533.35

V, An Mo

CHUNNI MOTOR WORK PTE LTD
REPAIR ESTIMATE*

VEHICLE NO : SHD 6732R (Supplementary)
 MAKE :
 MODEL : MERCEDES

DATE : 22.05.2018
 TEL : 6542 5119
 FAX : 6542 6039

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Bonnet Stopper Spring X2 <i>Done N/S O/S</i>	<i>SVC</i>	S 385.00	\$ 770.00
	Wiper Tank <i>deformed</i>			\$ 338.00
	SUB TOTAL		723.00	\$ 1,108.00
	LESS 10%		650.70	\$ 110.80
	DISCOUNTED TOTAL			\$ 997.20

[Signature]
 24/05/2018
 LKK AD
[Signature]

LL

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

NAME
ADDRESS

Home Tel.:

VIN:

Registration: SHD 6732 R

Technician:

Mileage: 226884

Time Printed 21.5.18 3:21 PM

Mercedes-Benz 212 (E) Sedan Steel

Front : Left

Actual	BEFORE	Specified Range
11°47'		-1°07' -0°27'
6°23'		-5°30' 15°30'
-21°42'		-0°21' 555°14'
2°58'		
14°45'		
		-2°19' -1°19'

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	BEFORE	Specified Range
1°36'		-1°07' -0°27'
6°33'		-5°30' 15°30'
-0°04'		-0°21' 555°14'
11°03'		
12°39'		
		-2°19' -1°19'

Front

	Actual	BEFORE	Specified Range
Cross Camber	10°11'		-0°20' 0°20'
Cross Caster	-0°10'		-1°30' 1°30'
Cross SAI	-8°05'		
Total Toe	-21°47'		-0°41'
Cross Turn Diff.			

Rear : Left

Actual	BEFORE	Specified Range
-1°28'		-1°32' -0°32'
0°18'		-0°05' 0°25'

Camber
Toe

Rear : Right

Actual	BEFORE	Specified Range
-0°59'		-1°32' -0°32'
-0°14'		-0°05' 0°25'

Rear

	Actual	BEFORE	Specified Range
Cross Camber	-0°29'		-0°30' 0°30'
Total Toe	0°05'		0°05' 0°35'
Thrust Angle	0°16'		-0°15' 0°15'

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	17 May 2018		18 May 2018 15:15 Edit Adj Rpt	S\$19,500.00 Edit Estimates	S\$19,500.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	-, Co. Reg. No.: -								
Main Claimant:	COMFORT TRANSPORTATION PTE LTD								
Vehicle Reg. No.:	SHD6732R	Date of Loss:	17/05/2018 00:00 - :59 [25 Months and 9 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / SNM18D02483C02	Policy/Cover Note No.:	DMCVSN1749781700						
Vehicle Reg. No. (Insured):	GBG3519R	Policy No. (Claimant):							
		Excess:	S\$0.00						
Repairer:	Soon Hock Motor Pte Ltd (HQ) Blk 10 Ang Mo Kio Industrial Park 2A, #01-05/06 AMK Autopoint, 568047 Ang Mo Kio - Tel: 64836016								
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Sharon Han - 63896]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by BRYAN TANI] ... [Final Rpt due 30/05/2018]								
Adj Asg. Remarks:	EST \$31,536.15, ASSIGN HENRY NG AS SJE.								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SHD6732R (SNM18D02483C02)
 [GBG3519R]
 TP
COMFORT TRANSPORTATION PTE LTD
May 17 2018 12:00AM
 [-]
Soon Hock Motor Pte Ltd

Upload Documents | Upload Photos | Compose New Letter

View View in Browser ▾

Photos/Images			3 per page ▾	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	06/06/18 09:15	Front View Right	Load JPG	<input checked="" type="checkbox"/>
2	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
3	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
4	06/06/18 09:15	Front View Left	Load JPG	<input checked="" type="checkbox"/>
5	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
6	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
7	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
8	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
9	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
10	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
11	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
12	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
13	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
14	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
15	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
16	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
17	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
18	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
19	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
20	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
21	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
22	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
23	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
24	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
25	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
26	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
27	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
28	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
29	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
30	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
31	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
32	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
33	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
34	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>
35	06/06/18 09:15	General View	Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page ▼	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
36	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
37	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
38	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
39	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
40	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
41	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
42	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
43	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
44	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
45	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
46	06/06/18 09:15	General View	 Load JPG	<input checked="" type="checkbox"/>
47	06/06/18 09:18	General View	 Load JPG	<input checked="" type="checkbox"/>
48	06/06/18 09:18	Odometer Reading	 Load JPG	<input checked="" type="checkbox"/>
49	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
50	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
51	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
52	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
53	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
54	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
55	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
56	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
57	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
58	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
59	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
60	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
61	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
62	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
63	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
64	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
65	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
66	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
67	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
68	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
69	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
70	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
71	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
72	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
73	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
74	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
75	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
76	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
77	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
78	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
79	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
80	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
81	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
82	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
83	06/06/18 09:20	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
84	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
85	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
86	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
87	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
88	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
89	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
90	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
94	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
95	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
96	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
97	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
98	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
99	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
100	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
101	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
102	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
103	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
104	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
105	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
106	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
107	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
108	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
109	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
110	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
111	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
112	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
113	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
114	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
115	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
116	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
117	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
118	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
119	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
120	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
121	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
122	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
123	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
124	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
125	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
126	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
127	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
128	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
129	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
130	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
131	06/06/18 09:20	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
132	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
133	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
134	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
135	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
136	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
137	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
138	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
139	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
140	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
141	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
142	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
143	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
144	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
145	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
146	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
147	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
148	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
149	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
150	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
151	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
152	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
153	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
154	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
155	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
156	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
157	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
158	06/06/18 09:20	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
159	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
160	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
161	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
162	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
163	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
164	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
165	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
166	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
167	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
168	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
169	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
170	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
171	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
172	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
173	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
174	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
175	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
176	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
177	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
178	06/06/18 09:20	Finishing Photo	 Load JPG	<input checked="" type="checkbox"/>
179	06/06/18 09:20	Finishing Photo	Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
180	06/06/18 09:21	Finishing Photo	Load JPG	<input checked="" type="checkbox"/>
181	06/06/18 09:21	Finishing Photo	Load JPG	<input checked="" type="checkbox"/>
182	06/06/18 09:21	Finishing Photo	Load JPG	<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	China Taiping Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	18/05/18 15:14	REPAIR EST WITH TP GIA REPORT	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST

Reset Save Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CT118009185/DQBS2

Date: 11/06/2018

REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSN1749781700

Claimant Vehicle No: SHD6732R Insured Vehicle No: GBG3519R

Date of Loss: 17/05/2018 Nature of Claim: TP Claim No: SNM18D02483C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHD6732R**

Make & Model: MERCEDES-BENZ C180, 1.6 (A) Engine No: 65192433255163

Reg. Date: 08/04/2016 (Man. Year: 2015) Chassis No: WDD2120012B315500

Colour: White Odometer: 226884 km

Engine Capacity: 2143 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/55R16 Rear Tyre Size: 225/55R16

Front Left Side: West Lake 6 mm Rear Left Side: West Lake 6 mm

Front Right Side: West Lake 6 mm Rear Right Side: West Lake 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	29,913.35	22,747.82	7,165.53	23.95
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,620.00	1,710.00	910.00	34.73
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	32,533.35	24,457.82	8,075.53	24.82
Approved Total (Overridden) (S\$)		19,500.00		
Nett Amount (S\$)	32,533.35	19,500.00	13,033.35	40.06

INSPECTION

Date of Assignment: 18/05/2018

Date Inspected: 21/05/2018 Inspected At: Soon Hock Motor Pte Ltd (HQ)
Blk 10 Ang Mo Kio Industrial Park 2A, #01-05/06 AMK
Autopoint
Singapore 568047

Estimated Period of Repair: 9.0 days

Adjuster: BRYAN TANI

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but

https://singapore.merimen.com/claims/index.cfm?fusebox=MTRadjuster&fuseaction=gen_printprt&caseid=709649&extid=272731&CFID=35252898&CFTOKEN=3

any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS**Reference**

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 11 Jun 2018)
Parts: 143	MERCEDES-BENZ C180 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SHD6732R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER ASSY, FRT	Broken	1,890.50 FL	*1,409.45 FL
2	1		*BUMPER REINFORCEMENT, FRT	Bent	1,158.00 FL	*721.00 FL
3	1		*BUMPER BRACKET, FRT/LH	Broken	95.00 FL	*95.00 FL
4	1		*BUMPER ABSORBER, FRT/LH	Bent	295.00 FL	*295.00 FL
5	1		*BUMPER FRAME, FRT/CENTRE	Cracked	198.00 FL	*198.00 FL
6	1		*BUMPER FRAME, FRT/LH	Broken	39.45 FL	*39.45 FL
7	1		*BUMPER SPONGE, FRT/CENTRE	Not Necessary	285.00 FL	*- FL
8	1		*BUMPER SPONGE, FRT/LH	Broken	250.00 FL	*250.00 FL
9	1		*BUMPER SPONGE EXTENSION, FRT/LH	Broken	54.00 FL	*54.00 FL
10	1		*BUMPER GRILLE, FRT/CENTRE	Serviceable	290.50 FL	*- FL
11	1		*BUMPER GRILLE, FRT/LH	Damaged	240.50 FL	*240.50 FL
12	2		*HEADLAMP, LH/RH	N/s Broken / O/s Cracked	7,914.00 FL	*5,910.00 FL
13	1		*HEAD LAMP BRACKET (LH)	Broken	300.00 FL	*300.00 FL
14	1		*RADIATOR TOP PANEL, FRT	Bent	330.50 FL	*330.50 FL
15	1		*HEAD LAMP PANEL (LH)	Bent	480.00 FL	*480.00 FL
16	1		*RADIATOR GRILLE	Cracked	1,220.00 FL	*1,220.00 FL
17	1		*RADIATOR GRILLE STAR LOGO	Necessary	56.70 FL	*56.70 FL
18	1		*RADIATOR GRILLE ADJUSTER BRACKET	Damaged	685.70 FL	*685.70 FL
19	1		*BONNET ASSY	Buckled	2,850.60 FL	*2,267.43 FL
20	1		*BONNET MERCEDES STAR LOGO	Necessary	56.70 FL	*56.70 FL
21	1		*BONNET HINGE (LH)	Repair	285.50 FL	*- FL
22	1		*BONNET INSULATOR	Not Necessary	235.40 FL	*- FL
23	1		*BONNET CENTRE LOCK	Not Necessary	95.00 FL	*- FL
24	1		*BONNET LOCK, TOP	Bent	94.00 FL	*94.00 FL
25	1		*BONNET LOCK LOWER	Damaged	92.00 FL	*92.00 FL
26	1		*BONNET LOCK BRACE PANEL	Not Necessary	64.80 FL	*- FL
27	1		*FENDER, FRT/LH	Buckled	996.08 FL	*996.08 FL
28	1		*FENDER SPLASHIELD, FRT/LH (FRONT)	Deformed	257.00 FL	*257.00 FL
29	1		*FENDER SPLASHIELD, FRT/LH (REAR)	Deformed	263.00 FL	*263.00 FL
30	1		*HORN (WOOFER) (LH)	Not Necessary	228.00 FL	*- FL
31	1		*RADIATOR ASSY	Bent	1,345.00 FL	*1,345.00 FL
32	1		*RADIATOR FAN BLOWER ASSY	Mtg Cracked	1,385.40 FL	*1,385.40 FL
33	1		*RADIATOR SHROUD	Not Necessary	1,225.60 FL	*- FL
34	1		*RADIATOR AIR BAFFLE, TOP	Not Necessary	85.90 FL	*- FL
35	1		*RADIATOR AIR BAFFLE, LOWER	Not Necessary	125.90 FL	*- FL
36	1		*RADIATOR DOWEL PIN	Necessary	6.80 FL	*6.80 FL
37	1		*RADIATOR MOUNTING LOWER	Not Necessary	7.50 FL	*- FL
38	1		*RADIATOR MOUNTING TOP	Damaged	10.85 FL	*10.85 FL
39	1		*AIRCON CONDENSER	Bent	1,235.80 FL	*1,235.80 FL
40	1		*TURBOR CHARGER AIR COOLER	Mtg Cracked	1,053.80 FL	*1,053.80 FL
41	1		*S/ABSORBER, FRONT LH	Distorted	944.00 FL	*944.00 FL
42	1		*STRUR, FRT/LH	Not Necessary	604.00 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
43	1		*STEERING KNUCKLE ARM, FRT/LH	Distorted	1,119.00 FL	*1,119.00 FL
44	1		*LOWER ARM ASSY, FRT/LH	Distorted	661.05 FL	*661.05 FL
45	1		*TOP ARM ASSY, FRT/LH	Distorted	479.15 FL	*479.15 FL
46	1		*TORSION BAR ROD, FRT	Not Necessary	105.60 FL	*- FL
47	1		*TORSION BAR FRT/LH	Not Necessary	405.00 FL	*- FL
48	1		*HEAD LAMP BUB, LH	Not Necessary	25.00 FS	*- FS
49	1		*BONNET STOPPER SPRING	N/S Damaged / O/s Serviceable	770.00 FL	*385.00 FL
50	1		*WIPER TANK	Deformed	338.00 FL	*338.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	33,234.28	25,275.36
- List Item Discount on L Items 10.00/10.00% (S\$)	3,320.93	2,527.54
Total Parts (S\$)	29,913.35	22,747.82

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING.	New	1,200.00	800.00
2	SPRAY PAINTING CHARGE.	New	900.00	600.00
3	WIRING CHARGE.	New	50.00	30.00
4	TOWING CHARGES.	New	50.00	0.00
5	TUFF KOTE.	New	100.00	40.00
6	REMOVE / REFIX UNDERCARRIAGE (FRT)	New	200.00	180.00
7	FRT WHEEL ALIGNMENT.	New	120.00	60.00
			Gross Labour Cost (S\$)	2,620.00
				1,710.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >