

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC3/AIG18009620/K1RS3Q2

**Date:** 09/03/2021

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1700058113

**Claimant**  
**Vehicle No :** SHC8247S **Insured Vehicle No :** SLS5221D

Date of Loss: 25/05/2018 Nature of Claim: TP Claim No: 2809962978SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHC8247S	Engine No:	HIDDEN
Make & Model:	HYUNDAI I40, 1.7 D (A)	Chassis No:	KMHLB41UMGU075427
Reg. Date:	16/07/2015 (Man. Year: 2015)	Odometer:	387009 km
Colour:	Blue		
Engine Capacity:	1685 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Engine Modification:	No	Pre-accident Condition:	

### CONDITION OF TYRES

Front Tyre Size:	205/60R16	Rear Tyre Size:	205/60R16
Front Left Side:	West Lake 7 mm	Rear Left Side:	West Lake 7 mm
Front Right Side:	West Lake 7 mm	Rear Right Side:	West Lake 7 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	2,674.12	2,080.76	593.36	22.19
Miscellaneous Items	0.00	0.00	0.00	
Labour	530.00	400.00	130.00	24.53
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (S\$)</b>	<b>3,204.12</b>	<b>2,480.76</b>	<b>723.36</b>	<b>22.58</b>
<b>+ GST 7.00/7.00% (S\$)</b>	224.29	173.65	50.64	22.58
<b>Nett Amount (S\$)</b>	<b>3,428.41</b>	<b>2,654.41</b>	<b>774.00</b>	<b>22.58</b>
<b>+ Loss of Use (1.5 x S\$50.00/day) (S\$)</b>		75.00		
<b>+ Car Rental (1.5 x S\$115.00/day) (S\$)</b>		172.50		
<b>+ Doc/Search Fee (S\$)</b>		7.49		
<b>Nett Liability (S\$)</b>		<b>2,909.40</b>		
<b>Global Sum Settlement (S\$)</b>		<b>2,900.00</b>		

### INSPECTION

Date of Assignment: 25/05/2018

Date Inspected: 25/05/2018 Inspected At:

ComfortDelGro Engineering Pte Ltd  
(Loyang)  
59 Loyang Drive  
Singapore 508969

Estimated Period of Repair: 2.0 days

---

**Adjuster:** KALVIN ANG WEI KUN**Manager:** Jaslin Kok Chin Yi

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*RADIATOR GRILLE	Cracked	1,480.00 FL	*1,480.00 FL
2	1		*FRONT BUMPER COVER	Deformed	1,052.20 FL	*1,052.20 FL
3	1		*FRONT BUMPER SPONGE	Serviceable	142.20 FL	*- FL
4	1		*FRONT BUMPER REINFORCEMENT	Serviceable	526.10 FL	*- FL
5	2		*FRONT BUMPER BRACKET TOP (LH/RH)	Serviceable	44.80 FL	*- FL
6	2		*FRONT BUMPER SIDE BRACKET (LH/RH)	Serviceable	28.60 FL	*- FL
7	1		*FRONT NUMBER PLATE	Cracked	25.00 FS	*25.00 FS
8	1		*FRONT NO PLATE TRIM COVER	Cracked	30.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$\$)</b>	<b>3,328.90</b>	<b>2,587.20</b>
<b>- List Item Discount on L Items 20.00/20.00% (\$\$)</b>	654.78	506.44
<b>Total Parts (\$\$)</b>	<b>2,674.12</b>	<b>2,080.76</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b><u>Labour Items</u></b>				
1	PANEL BEATING	New	280.00	200.00
2	SPRAY PAINTING CHARGE	New	250.00	200.00
<b>Gross Labour Cost (\$)</b>			<b>530.00</b>	<b>400.00</b>

Report was unsubmitted during this print-out.

**< END OF ESTIMATES >**