

ASS. RSC. BY:

REF: CG/SPF18010365/Gthb22

Special Instruction:

QUIN/IN

EQ

ASSIGNMENT (Office)

From (Person): Perry He of SPF Date/Time: 06062018 938am

Estimated Cost: Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MY / CS

To Inspect Vehicle No: QX 230A Insured:

at Workshop m/s Indeco Tel:

of 39 Dehu Lane 12

Policy No: Claim No: HDMSPFETQ173200218

Sum Insured: Excess:

Make of Veh: D.O.A.

(Client's Record)

CA / REV / REP. / REV 24 HRS 07062018

Date/Time: Person Contacted: Vehicle IN / OUT

Date/Time: Action/Instruction (✓) Estimate

QX 230A - X

11/6/18 @ 3.52pm revert to Perry by email.

Parts cost \$3276.86

man hour - 78.

WVH110 *xml*

REF: 8PF

ASSIGNMENT

From: Date: 7/6/18
Estimated Cost:
☒ OD / ☐ TP / ☐ WS / ☐ TP RES / ☐ OD RES / ☐ EVA / ☐ INV / ☐ MV
To inspect Vehicle No: QX 230A
at Workshop no: Indeco
of: 39 Defu Lane 12
Insured:
Policy No:
Claims No:
Sum Insured: Excess: 784
(Client's Record)
Make of Veh:

(Policy Condition)
Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S
	☒

Bal. or Market Value:
IDAC Accident Report: Consistent? : Yes or No
GIA / FR. Seen: Consistent? : Yes or No
Est. Repairs: days Res: Yes or No
Lump Sum: % 3 Val: Yes or No
CA / ☒ REV / REP. / 24 HRS
Date: Person Contacted: Vehicle: IN / OUT

Veh No: QX 230A Yr Regn: -
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or Police car.
Make: Toyota Altis CC 1598
Colour: white A/C Insured / Std / NI / NA
Sp Reading: 208936 T/Radio: Insured / Std / NI / NA
Eng/No:
C/No: MRO538EE106101210
Gen. Cond: ☒ Good / Fair / Poor / Burnt
Steering: ☒ In order / Jammed / Leaked / Burnt or
Brake: ☒ In order / Jammed / Leaked / Burnt or
Mod: Nil / ☒ R/Rim / STD A/Rim or
Tyre Size: F: 195/65 R15
R: "
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or FALKEN
Front: R/Bal. 5 mm L/Bal. 5 mm
Rear: R/Bal. 5 mm L/Bal. 5 mm
D.O.A. D.O.I. 07-06-18
Survey held at: WS 3:30pm
Des. of Damages: Frt / ☒ Rear / O/S / N/S / U/C / Rooftop or
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time: 07/6 Action / Instruction: confirmed 78 Hrs with Anson (85114276)

RECEIVED 25 JUN 2018

How/When File Pass to? ☐ : Prelim. Report
25/6 Typist ☒ : Final Report
Date/Time File Return to?

Days Of Repair:
Resurvey No. of Trip:

Add Fee: ☐ Site Insp \$
☐ Interview \$
☐ Tech. Insps \$
☐ Wheel and \$

Survey Fee:
Transportation:
Photog:
Lunch:

Report Format: DD
Lump Sum / LB: \$

280
280

Catherine Chong (LKK Auto)

From: Perry HE (SPF) <Perry_HE@spf.gov.sg>
Sent: Wednesday, 6 June, 2018 9:38 AM
To: assignments
Cc: Wei Yea LIM (SPF); Kwee Huat TAN (SPF); Kim Pang CHAY (SPF); Ai Phing (LKKAuto); Shiau Chan (LKKAuto); Veron Chen (LKKAuto); Janice Lee (LKKAuto)
Subject: Appraisal Services for SPF vehicle at INDECO - HOMSPFETQ17300218 - QX230A

Hi Catherine and Ashley,

Please provide Appraisal Service (Parts and Labour-man hours) for the following SPF vehicle at INDECO

Vehicle No: QX230A

Parts:

REAR WINDSCREEN
REAR WINDSCREEN MOULDING
RHR FENDER
RHR FENDER INNER SHIELD
LHR FENDER
LHR FENDER INNER SHIELD
FENDER INNER SHIELD CLIPS
BOOT LID
BOOT LID HINGE RH
BOOT LID HINGE LH
BOOT LOCK
BOOT LOCK CATCH
LOGO
BOOT LAMP RH
BOOT LAMP LH
BOOT CHROME MOULDING
BOOT WEATHER STRIP
TAILLAMP RH
TAILLAMP LH
TAILLAMP LOWER BRACKET RH
TAILLAMP LOWER BRACKET LH
REAR BUMPER
REAR BUMPER RETAINER RH (LONG)
REAR BUMPER RETAINER RH (SHORT)
REAR BUMPER RETAINER LH (LONG)
REAR BUMPER RETAINER LH (SHORT)
REAR BUMPER CLIP
REAR BUMPER REINFORCEMENT
REAR BUMPER REINFORCEMENT BRACKET RH
REAR BUMPER REINFORCEMENT BRACKET LH
REAR END PANEL
REAR END PANEL GARNISH
SPARE TYRE BOARD
TAILLAMP PANEL LH
TAILLAMP PANEL RH
REVERSE SENSOR

WHEEL ALIGNMENT
INNER SEAL TAPE
SEALANT
REAR NUMBER PLATE

Labour:

TO REPLACE REAR WINDSCREEN – 4 hrs
TO REPLACE AND RESPRAY LHR FENDER – 8hrs
TO REPLACE AND RESPRAY RHR FENDER - 8 hrs
TO REPLACE AND RESPRAY BOOT LID – 6hrs
TO REPLACE AND RESPRAY REAR END PANEL – 6 hrs
TO REPLACE AND RESPRAY REAR BUMPER – 5 hrs
TO REPAIR AND RESPRAY LHR DOOR – 5 hrs
TO REPAIR AND RESPRAY SPARE TYRE PANEL – 5 hrs
TO REPAIR AND RESPRAY LHR WHEEL HOUSE – 4 hrs
TO REPAIR AND RESPRAY RHR WHEEL HOUSE – 4 hrs
TO REMOVE AND REPLACE REAR SEAT FRAME,PAD,COVER – 4 hrs
TO REMOVE AND REPLACE PETROL TANK – 2 hrs
TO REMOVE AND REFIX UPHOISTERY AND SEAT TO ASSIST WORK – 3 hrs
TO ALIGN, REPAIR AND RESPRAY REAR CHASSIS,SUB MEMBER – 6 hrs
TO REMOVE AND REFIX REAR AXLE AND UNDERCARRIAGE TO ASSIST WORK – 3 hrs
TO PERFORM 4 WHEEL ALIGNMENT – 1 hr
TO REPAIR AND RESPRAY FRT BUMPER – 6hrs
TO REPLACE AND REWIRE NEW SENSOR AND DRILL SENSOR HOLE ON NEW BUMPER – 1
hr

Perry He Junyun
Contract Management Engineer
Automotive Engineering & Management Division
Police Logistics Department
Singapore Police Force
DID: (65) 6478 4869 | HP: (65) 9191 5725



HOME TEAM
TRANSFORMATION 2025
One Home, One Team
Building Our Future Together

WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, do not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Chapter 213). Please notify the sender immediately if you receive this in error."

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Monday, 11 June 2018 3:52 PM
To: Perry HE (SPF); assignments
Cc: Wei Yea LIM (SPF); Kwee Huat TAN (SPF); Kim Pang CHAY (SPF); SUR
Subject: RE: Appraisal Services for SPF vehicle at INDECO - HOMSPFETQ17300218 - QX230A
Attachments: QX230A photo.pdf; QX 230A.xls

Dear Perry,

Please find the attached of QX 230A.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #01-25 | S(408933)

From: Perry HE (SPF) [mailto:Perry_HE@spf.gov.sg]
Sent: Wednesday, 6 June 2018 9:38 AM
To: assignments <assignments@lkkauto.com>
Cc: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Ai Phing (LKKAUTO) <aiphing@lkkauto.com>; Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>; Veron Chen (LKKAUTO) <veronchen@lkkauto.com>; Janice Lee (LKKAUTO) <JaniceLee@lkkauto.com>
Subject: Appraisal Services for SPF vehicle at INDECO - HOMSPFETQ17300218 - QX230A

Hi Catherine and Ashley,

Please provide Appraisal Service (Parts and labour-man hours) for the following SPF vehicle at INDECO

Vehicle No: QX230A

Parts:

REAR WINDSCREEN
REAR WINDSCREEN MOULDING
RHR FENDER
RHR FENDER INNER SHIELD
LHR FENDER
LHR FENDER INNER SHIELD
FENDER INNER SHIELD CLIPS
BOOT LID
BOOT LID HINGE RH
* BOOT LID HINGE LH
BOOT LOCK
* BOOT LOCK CATCH
* LOGO
* BOOT LAMP RH
* BOOT LAMP LH
BOOT CHROME MOULDING



**Scope Of Work
Home Team Agency**

SCOPE OF WORK

To provide labour, materials, transportation, tools and parts and others deemed necessary to carry out the following repairs:

CONTRACTOR :	Indeco Engineers Pte Ltd	VEH TYPE :		UNIT :	G DIV
VEH NO :	QX230A	FRC		REPAIR TYPE:	ACCIDENT
VEH MAKE/MODEL	TOYOTA ALTIS		Mileage:	208936	

Reference No.
MHA/SPF/2018/06-0011 1100006591

S/N	PARTS DESCRIPTION	PART COST (\$)	QTY	Mark Up Rate	Parts Cost Per Unit After Mark Up (\$)	Total Parts Cost Per Unit After Mark Up (\$)
1	Scope Of Repairs					
1.1	REAR WINDSCREEN / Sm	350.00	1	18%	413.00	413.00
1.2	REAR WINDSCREEN MOULDING / Acc	40.00	1	18%	47.20	47.20
1.3	RHR FENDER Repair X	320.00	1	18%	377.60	377.60
1.4	RHR FENDER INNER SHIELD X NN	18.00	1	18%	21.24	21.24
1.5	LHR FENDER / Bul	320.00	1	18%	377.60	377.60
1.6	LHR FENDER INNER SHIELD / M's	18.00	1	18%	21.24	21.24
1.7	FENDER INNER SHIELD CLIPS / Acc	1.00	12	18%	1.18	14.16
1.8	BOOT LID / Bul	250.00	1	18%	295.00	295.00
1.9	BOOT LID HINGE RH /	22.00	1	18%	25.96	25.96
1.10	BOOT LID HINGE LH /	22.00	1	18%	25.96	25.96
1.11	BOOT LOCK / BT	38.00	1	18%	44.84	44.84
1.12	BOOT LOCK CATCH / BT	10.00	1	18%	11.80	11.80
1.13	LOGO / Acc	20.00	1	18%	23.60	23.60
1.14	BOOT LAMP RH / CFA	48.00	1	18%	56.64	56.64
1.15	BOOT LAMP LH / SCR	48.00	1	18%	56.64	56.64
1.16	BOOT CHROME MOULDING / CFA	75.00	1	18%	88.50	88.50
1.17	BOOT WEATHER STRIP / Tm	45.00	1	18%	53.10	53.10
1.18	TAILLAMP RH / CFA	130.00	1	18%	153.40	153.40
1.19	TAILLAMP LH / CFA	130.00	1	18%	153.40	153.40
1.20	TAILLAMP LOWER BRACKET RH / BT	22.00	1	18%	25.96	25.96
1.21	TAILLAMP LOWER BRACKET LH / BT	22.00	1	18%	25.96	25.96
1.22	REAR BUMPER / RL	155.00	1	18%	182.90	182.90
1.23	REAR BUMPER RETAINER RH (LONG) /	25.00	1	18%	29.50	29.50
1.24	REAR BUMPER RETAINER RH (SHORT) /	20.00	1	18%	23.60	23.60
1.25	REAR BUMPER RETAINER LH (LONG) /	25.00	1	18%	29.50	29.50
1.26	REAR BUMPER RETAINER LH (SHORT) /	20.00	1	18%	23.60	23.60
1.27	REAR BUMPER CLIP /	1.00	10	18%	1.18	11.80
1.28	REAR BUMPER REINFORCEMENT / BT	45.00	1	18%	53.10	53.10
1.29	REAR BUMPER REINFORCEMENT BRACKET RH / BT	30.00	1	18%	35.40	35.40
1.30	REAR BUMPER REINFORCEMENT BRACKET LH / BT	30.00	1	18%	35.40	35.40
1.31	REAR END PANEL / Bul	175.00	1	18%	206.50	206.50
1.32	REAR END PANEL GARNISH / RL	65.00	1	18%	76.70	76.70
1.33	SPARE TYRE BOARD / CFA RL	115.00	1	18%	135.70	135.70
1.34	TAILLAMP PANEL LH / Bul	40.00	1	18%	47.20	47.20
1.35	TAILLAMP PANEL RH / Bul	40.00	1	18%	47.20	47.20
1.36	REVERSE SENSOR / DM	200.00	1	18%	236.00	236.00
1.37	WHEEL ALIGNMENT / Acc	60.00	1	18%	70.80	70.80
2	Additional Services					
2.1	INNER SEAL TAPE / Acc	30.00	1	18%	35.40	35.40
2.2	SEALANT /	20.00	2	18%	23.60	47.20
2.3	REAR NUMBER PLATE / SCR	30.00	1	18%	35.40	35.40
Remarks:					Parts Total:	\$ 3,675.70

3276.86

S/N	LABOUR DESCRIPTION	Man-Hour Rate (\$)	Man-Hour Qty	Total Man-Hour Cost (\$)
1	Scope Of Repairs			
1.1	TO REPLACE REAR WINDSCREEN	53.80	4	215.20
1.2	TO REPLACE AND RESPRAY LHR FENDER	53.80	8	430.40
1.3	TO REPLACE AND RESPRAY RHR FENDER	53.80	8	430.40
1.4	TO REPLACE AND RESPRAY BOOT LID	53.80	6	322.80
1.5	TO REPLACE AND RESPRAY REAR END PANEL	53.80	6	322.80
1.6	TO REPLACE AND RESPRAY REAR BUMPER	53.80	5	269.00
1.7	TO REPAIR AND RESPRAY LHR DOOR	53.80	5	269.00
1.8	TO REPAIR AND RESPRAY SPARE TYRE PANEL	53.80	5	269.00
1.9	TO REPAIR AND RESPRAY LHR WHEEL HOUSE	53.80	4	215.20
1.10	TO REPAIR AND RESPRAY RHR WHEEL HOUSE	53.80	4	215.20
1.11	TO REMOVE AND REPLACE REAR SEAT FRAME,PAD,COVER	53.80	4	215.20
1.12	TO REMOVE AND REPLACE PETROL TANK	53.80	2	107.60
1.13	TO REMOVE AND REFIX UPHOISTERY AND SEAT TO ASSIST WORK	53.80	3	161.40
1.14	TO ALIGN, REPAIR AND RESPRAY REAR CHASSIS,SUB MEMBER	53.80	6	322.80
1.15	TO REMOVE AND REFIX REAR AXLE AND UNDERCARRIAGE TO ASSIST WORK	53.80	3	161.40
1.16	TO PERFORM 4 WHEEL ALIGNMENT	53.80	1	53.80
1.17	TO REPAIR AND RESPRAY FRT BUMPER	53.80	6	322.80
1.18	TO REPLACE AND REWIRE NEW SENSOR AND DRILL SENSOR HOLE ON NEW BUMPER	53.80	1	53.80
2	Additional Services			

Verification of Scope of Work					
Contractor QC		Vetted By:		Approved By:	
Name:		Name:		Name:	
Date:		Date:		Date:	
Sign:		Sign:		Sign:	
Verification of Completed Repairs					
Contractor QC		Home Team QC / Fleet Manager / Appointed Surveyor		Home Team Contract / Fleet Manager	
Name:		Name:		Name:	
Date:		Date:		Date:	
Sign:		Sign:		Sign:	

All completed repairs must be verified by Home Team Contract Manager / Fleet Manager before payment can be made

Caro Qian - 82880282.

part by part.

before paint photos.

Excess : TBA

M. + Authorised.

07/6/18.

LH Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	REAR WINDSCREEN	1	SMASHED	\$413.00	\$413.00	
1.2	REAR WINDSCREEN MOULDING	1	NECESSARY	\$47.20	\$47.20	
1.3	RHR FENDER	1	REPAIR	\$377.60		
1.4	RHR FENDER INNER SHIELD	1	NOT NECESSARY	\$21.24		
1.5	LHR FENDER	1	BUCKLED	\$377.60	\$377.60	
1.6	LHR FENDER INNER SHIELD	1	MISSING	\$21.24	\$21.24	
1.7	FENDER INNER SHIELD CLIPS	12	NECESSARY	\$1.18	\$14.16	
1.8	BOOT LID	1	BUCKLED	\$295.00	\$295.00	
1.9	BOOT LID HINGE RH	1	BENT	\$25.96	\$25.96	
1.10	BOOT LID HINGE LH	1	BENT	\$25.96	\$25.96	
1.11	BOOT LOCK	1	BENT	\$44.84	\$44.84	
1.12	BOOT LOCK CATCH	1	BENT	\$11.80	\$11.80	
1.13	LOGO	1	NECESSARY	\$23.60	\$23.60	
1.14	BOOT LAMP RH	1	CRACKED	\$56.64	\$56.64	
1.15	BOOT LAMP LH	1	SCRACKED	\$56.64	\$56.64	
1.16	BOOT CHROME MOULDING	1	CRACKED	\$88.50	\$88.50	
1.17	BOOT WEATHER STRIP	1	TWISTED	\$53.10	\$53.10	
1.18	TAILLAMP RH	1	CRACKED	\$153.40	\$153.40	
1.19	TAILLAMP LH	1	CRACKED	\$153.40	\$153.40	
1.20	TAILLAMP LOWER BRACKET RH	1	BENT	\$25.96	\$25.96	
1.21	TAILLAMP LOWER BRACKET LH	1	BENT	\$25.96	\$25.96	
1.22	REAR BUMPER	1	DEFORMED	\$182.90	\$182.90	
1.23	REAR BUMPER RETAINER RH (LONG)	1	NECESSARY	\$29.50	\$29.50	
1.24	REAR BUMPER RETAINER RH (SHORT)	1	NECESSARY	\$23.60	\$23.60	
1.25	REAR BUMPER RETAINER LH (LONG)	1	NECESSARY	\$29.50	\$29.50	
1.26	REAR BUMPER RETAINER LH (SHORT)	1	NECESSARY	\$23.60	\$23.60	
1.27	REAR BUMPER CLIP	10	NECESSARY	\$1.18	\$11.80	
1.28	REAR BUMPER REINFORCEMENT	1	BENT	\$53.10	\$53.10	
1.29	REAR BUMPER REINFORCEMENT BRACKET LH	1	BENT	\$35.40	\$35.40	
1.30	REAR BUMPER REINFORCEMENT BRACKET RH	1	BENT	\$35.40	\$35.40	
1.31	REAR END PANEL	1	BUCKLED	\$206.50	\$206.50	
1.32	REAR END PANEL GARNISH	1	DEFORMED	\$76.70	\$76.70	

1.33	SPARE TYRE BOARD	1	CRACKED	\$135.70	\$135.70	
1.34	TAILLAMP PANEL LH	1	BUCKLED	\$47.20	\$47.20	
1.35	TAILLAMP PANEL RH	1	BUCKLED	\$47.20	\$47.20	
1.36	REVERSE SENSOR	1	DAMAGED	\$236.00	\$236.00	
1.37	WHEEL ALIGNMENT	1	NECESSARY	\$70.80	\$70.80	
2						
2.1	INNER SEAL TAPE	1	NECESSARY	\$35.40	\$35.40	
2.2	SEALANT	2	NECESSARY	\$23.60	\$47.20	
2.3	REAR NUMBER PLATE	1	SCRACKED	\$35.40	\$35.40	
3	LABOUR					
3.1	TO REPLACE REAR WINDSCREEN					4
3.2	TO REPLACE AND RESPRAY LHR FENDER					8
3.3	TO REPLACE AND RESPRAY RHR FENDER					6
3.4	TO REPLACE AND RESPRAY BOOT LID					6
3.5	TO REPLACE AND RESPRAY REAR END PANEL					6
3.6	TO REPLACE AND RESPRAY REAR BUMPER					5
3.7	TO REPLACE AND RESPRAY LHR DOOR					5
3.8	TO REPLACE AND RESPRAY SPARE TYRE PANEL					5
3.9	TO REPLACE AND RESPRAY LHR WHEEL HOUSE					4
3.10	TO REPLACE AND RESPRAY RHR WHEEL HOUSE					4
3.11	TO REMOVE AND REPLACE REAR SEAT FRAME, PAD, COVER					4
3.12	TO REMOVE AND REPLACE PETROL TANK					2
3.13	TO REMOVE AND REFIX UPHOISTERY AND SEAT TO ASSIST WORK					3
3.14	TO ALIGN, REPAIR AND RESPRAY REAR CHASSIS, SUB MEMBER					5
3.15	TO REMOVE AND REFIX REAR AXLE AND UNDERCARRIAGE TO ASSIST TO WORK					3
3.16	TO PERFORM 4 WHEEL ALIGNMENT					1
3.17	TO REPAIR AND RESPRAY FRT BUMPER					6
3.18	TO REPLACE AND REWIRE NEW SENSOR AND DRILL SENSOR HOLE ON NEW BUMPER					1
COSTING		TOTAL PARTS COST			\$3,276.86	
		TOTAL MAN-HOUR				78



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTOMOTIVE ENGINEERING & MGT DIVISION Ref : CS/SPF18010365/Gtbe2

ACCIDENT CLAIM SECTION
(SINGAPORE POLICE FORCE)
1 MOUNT PLEASANT ROAD
BLK 8 OLD POLICE ACADEMYSINGAPORE 298333

Date : 02-07-2018



Code : SPF

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	QX 230A
Policy No.		Coverage (\$)	0.00
Claim No.	HOMSPFETQ17300218	Excess (\$)	0.00
Assign From	PERRY HE	Assign Date	06/06/2018

2. Vehicle Particulars & Condition

Make & Model	TOYOTA ALTIS	c.c	1598
Engine No.	HIDDEN	Year of Reg.	2008
Chassis No.	MR053ZEE106101210	Colour	WHITE
Odometer	208936	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	FALKEN	5 mm
L/H Front Tyre	195/65 R15	FALKEN	5 mm
R/H Rear Tyre	195/65 R15	FALKEN	5 mm
L/H Rear Tyre	195/65 R15	FALKEN	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date		Inspection Date	07/06/2018
Survey held at	INDECO ENGINEERS PTE LTD 39 DEFU LANE 12 . SINGAPORE 539139		

5a. Remarks

--

Registration No. QX 230A

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	REAR WINDSCREEN	1	SMASHED	\$413.00	\$413.00	
1.2	REAR WINDSCREEN MOULDING	1	NECESSARY	\$47.20	\$47.20	
1.3	RHR FENDER	1	REPAIR	\$377.60		
1.4	RHR FENDER INNER SHIELD	1	NOT NECESSARY	\$21.24		
1.5	LHR FENDER	1	BUCKLED	\$377.60	\$377.60	
1.6	LHR FENDER INNER SHIELD	1	MISSING	\$21.24	\$21.24	
1.7	FENDER INNER SHIELD CLIPS	12	NECESSARY	\$1.18	\$14.16	
1.8	BOOT LID	1	BUCKLED	\$295.00	\$295.00	
1.9	BOOT LID HINGE RH	1	BENT	\$25.96	\$25.96	
1.10	BOOT LID HINGE LH	1	BENT	\$25.96	\$25.96	
1.11	BOOT LOCK	1	BENT	\$44.84	\$44.84	
1.12	BOOT LOCK CATCH	1	BENT	\$11.80	\$11.80	
1.13	LOGO	1	NECESSARY	\$23.60	\$23.60	
1.14	BOOT LAMP RH	1	CRACKED	\$56.64	\$56.64	
1.15	BOOT LAMP LH	1	SCRACKED	\$56.64	\$56.64	
1.16	BOOT CHROME MOULDING	1	CRACKED	\$88.50	\$88.50	
1.17	BOOT WEATHER STRIP	1	TWISTED	\$53.10	\$53.10	
1.18	TAILLAMP RH	1	CRACKED	\$153.40	\$153.40	
1.19	TAILLAMP LH	1	CRACKED	\$153.40	\$153.40	
1.20	TAILLAMP LOWER BRACKET RH	1	BENT	\$25.96	\$25.96	
1.21	TAILLAMP LOWER BRACKET LH	1	BENT	\$25.96	\$25.96	
1.22	REAR BUMPER	1	DEFORMED	\$182.90	\$182.90	

1.23	REAR BUMPER RETAINER RH (LONG)	1	NECESSARY	\$29.50	\$29.50	
1.24	REAR BUMPER RETAINER RH (SHORT)	1	NECESSARY	\$23.60	\$23.60	
1.25	REAR BUMPER RETAINER LH (LONG)	1	NECESSARY	\$29.50	\$29.50	
1.26	REAR BUMPER RETAINER LH (SHORT)	1	NECESSARY	\$23.60	\$23.60	
1.27	REAR BUMPER CLIP	10	NECESSARY	\$1.18	\$11.80	
1.28	REAR BUMPER REINFORCEMENT	1	BENT	\$53.10	\$53.10	
1.29	REAR BUMPER REINFORCEMENT BRACKET LH	1	BENT	\$35.40	\$35.40	
1.30	REAR BUMPER REINFORCEMENT BRACKET RH	1	BENT	\$35.40	\$35.40	
1.31	REAR END PANEL	1	BUCKLED	\$206.50	\$206.50	
1.32	REAR END PANEL GARNISH	1	DEFORMED	\$76.70	\$76.70	
1.33	SPARE TYRE BOARD	1	CRACKED	\$135.70	\$135.70	
1.34	TAILLAMP PANEL LH	1	BUCKLED	\$47.20	\$47.20	
1.35	TAILLAMP PANEL RH	1	BUCKLED	\$47.20	\$47.20	
1.36	REVERSE SENSOR	1	DAMAGED	\$236.00	\$236.00	
1.37	WHEEL ALIGNMENT	1	NECESSARY	\$70.80	\$70.80	
2						
2.1	INNER SEAL TAPE	1	NECESSARY	\$35.40	\$35.40	
2.2	SEALANT	2	NECESSARY	\$23.60	\$47.20	
2.3	REAR NUMBER PLATE	1	SCRACKED	\$35.40	\$35.40	
3	LABOUR					
3.1	TO REPLACE REAR WINDSCREEN					4
3.2	TO REPLACE AND RESPRAY LHR FENDER					8
3.3	TO REPLACE AND RESPRAY RHR FENDER					6
3.4	TO REPLACE AND RESPRAY BOOT LID					6
3.5	TO REPLACE AND RESPRAY REAR END PANEL					6
3.6	TO REPLACE AND RESPRAY REAR BUMPER					5
3.7	TO REPLACE AND RESPRAY LHR DOOR					5
3.8	TO REPLACE AND RESPRAY SPARE TYRE PANEL					5
3.9	TO REPLACE AND RESPRAY LHR WHEEL HOUSE					4
3.10	TO REPLACE AND RESPRAY RHR WHEEL HOUSE					4
3.11	TO REMOVE AND REPLACE REAR SEAT FRAME, PAD, COVER					4
3.12	TO REMOVE AND REPLACE PETROL TANK					2

3.13	TO REMOVE AND REFIX UPHOISTERY AND SEAT TO ASSIST WORK					3
3.14	TO ALIGN, REPAIR AND RESPRAY REAR CHASSIS, SUB MEMBER					5
3.15	TO REMOVE AND REFIX REAR AXLE AND UNDERCARRIAGE TO ASSIST TO WORK					3
3.16	TO PERFORM 4 WHEEL ALIGNMENT					1
3.17	TO REPAIR AND RESPRAY FRT BUMPER					6
3.18	TO REPLACE AND REWIRE NEW SENSOR AND DRILL SENSOR HOLE ON NEW BUMPER					1
COSTING		TOTAL PARTS COST			\$3,276.86	
		TOTAL MAN-HOUR				78

Registration No. QX 230A

Vehicle Inspected By

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.