

ASS. REC. BY:

REF: CS/MSG18010465/Urd3 72
Special Instruction:Surveyor:
Menimen

Marius

ASSIGNMENT (Office)

From (Person):

Chhia nyuk pui

of

MSG

Date/Time: 07/6/2018 @ 4:34 pm

Estimated Cost:

Bill to:

OD (TP) WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SKX 4104B

Insured:

YN 7665 R

at Workshop m/s

Precise Auto

Tel:

6745 7367

of

No. 1, Kaki Bkt Ave 6 # 02-34/36

Policy No:

2868 1686 MKC

Claim No:

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

26/01/2018

CA / REV / REP. / REV 24 HRS

lap?

H.O.D. Endorsement:

Date/Time:

9:00am @ 8/6/18

Person Contacted:

Aine

Vehicle IN/OUT

Date/Time

Action/Instruction (✓) Estimate

SKX 4104B - X

YN 7665R - CC3/MSG18001607/Svbe2

D.O.A: 21/01/2018

18/6/18

Revert pending estimate from repairer email thm menimen

21/6/18

Revert thm menimen

REF: M81G

ASSIGNMENT

From:

Date:

14/06/2018

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKX 4104B

at Workshop m/s

Preeise Auto

of No. 1, Kaki Bukit Ave 6 # 02-34/36

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:


(Client's Record)

11 am @ owner waiting

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

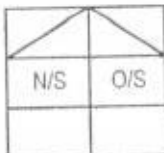

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS (up)

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SKX 4104B

Yr Regn:

7109

Type: M Car / M Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

(A)

Make:

Toyota Corolla Altis c.c. 1598

Colour:

Grey

A/C: Insured / Std / NI / NA

Sp. Reading

243345

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

MR 2532EE106149060

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 195/65 R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIS / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

mm

R/Bal.

mm

L/Bal.

mm

L/Bal.

mm

D.O.A.

26/1/18

D.O.I.

14/6/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S R.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

door, rocker panel als alc. 27A 10989
anody estimate.28/8/18 confirmed L/S \$1300 with yan hong
Red: \$3175.50, 20%.

RECEIVED 03 SEP 2018

Date/Time: File Pass to?



: Prel. Report

1) typist



: Final Report

Date/Time: File Return to?

2)

Days Of Repair:

3

Resurvey No. of Trip:

2

Survey Fee:

Transportation

S + RS \$

Photos

Others

TOTAL

Report Format:

P

Lump Sum / L/S: (\$

1300

Add Fee:



: Site Insp (\$



Interview (\$



Tech. Invs (\$



Weekend (\$

150
10

160

 


LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MSIG INSURANCE (SINGAPORE) PTE LTD			Ref : CS/MSG18010465/Urd3	
16 RAFFLES QUAY #24-01 HONG LEONG BLDG SINGAPORE 048581			Date : 08-06-2018	
			Code : MSG	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 7665R	Veh. Inspected	SKX 4104B	
Policy No.	28681686MKC	Coverage (\$)	0.00	
Claim No.	560649	Excess (\$)	0.00	
Assign From	MERIMEN (CHHIA NYUK PUI)	Assign Date	08/06/2018	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	26/01/2018	Inspection Date		
Survey held at	PRECISE AUTO SERVICE NO.1 KAKI BUKIT AVE 6 #02-34/36 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Chhia Nyuk Pui

Date: 03 Sep 2018

Preliminary Advice

Insured Vehicle No	: YN7665R	Accident Date	: 26/01/2018
TP Vehicle No	: SKX4104B	Assignment Date	: 07/06/2018
Make	: TOYOTA COROLLA ALTIS	Est. Duration of Repair	: 3.00
Date of Inspection	: 14/06/2018		
Inspection At	: PRECISE AUTO SERVICE (HQ) NO 1 KAKI BUKIT AVE 6, #02-34/36 SINGAPORE 417883		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages n/s front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	4,475.50
Revised Amount	:S\$	1,563.73
Check Items (Estimated)	:S\$	0.00
Total	:S\$	1,563.73

Lump Sum Repair	:S\$
-----------------	------

Total Loss Consideration

New for Old Value	:S\$
Pre-Accident Value	:S\$
COE / PARF Rebate	:S\$
Salvage Value	:S\$
Margin for Repair	:S\$

Remarks

- () The vehicle is economical/not economical for repair.
- (X) The above survey was conducted on a 'without prejudice' basis.

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Jun 2018		07 Jun 2018 16:34 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	SINMAH POULTRY PROCESSING (S) PTE LTD, Co. Reg. No.: 199100209N		
Main Claimant:	LIM SENG GUAN, ID: S2633528J		
Vehicle Reg. No.:	SKX4104B	Date of Loss:	26/01/2018 00:00 - :59 [102 Months and 20 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP	Policy/Cover Note No.:	28681686MKC Coverage: 12/02/2017 - 11/02/2018
Vehicle Reg. No. (Insured):	YN7665R	Policy No. (Claimant):	
		Excess:	
Repairer:	Precise Auto Service (HQ) No 1 Kaki Bukit Ave 6, #02-34/36, 417883 Kaki Bukit - Tel: 67457367		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Chhia Nyuk Pui - 6594 2521]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 08/06/2018]		
Adj Asg. Remarks:	on WP. Liability unclear. Non Reporting.		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Print Sent Message

This mail is associated with :

***SKX4104B (560649)**

[YN7665R]

TP

LIM SENG GUAN

Jan 26 2018 12:00AM

[SINMAH POULTRY PROCESSING (S) PTE LTD]

Precise Auto Service

From LKK Auto Consultants Pte Ltd (LKK_HQ), sent on 18/06/2018 14:12 PM.
To nyukupi_chhia@sg.msig-asia.com
CC sur@lkkauto.com
Subject SKX4104B (560649)

Dear Sir,

Please be informed that we have inspected the vehicle **SKX 4104B** on 14/06/2018.

We are still pending estimate from repairer.

Thank you.

Regards,
Jannice

PRECISE AUTO SERVICE

NO 1 KAKI BUKIT AVE 6 #02-34/36 SINGAPORE 417883

TEL : 67457367 FAX : 68413390

Date: 05/06/18 @ 4:15pm

M/s MSIG Insurance (Singapore) Pte Ltd

By Fax 6827 7809 Only

16 Raffles Quay

#24-01 Hong Leong Building

Singapore 048581

Dear Sirs

ACCIDENT BETWEEN VEHICLE NO: SKX 4104 B AND VEHICLE NO.
YN 766SR ON 26-01-18 @ 1330 hrs AT Car Park BDB 45, Lot 43,
Blk 539 Bedok North St 3.

We refer to the above matter.


We are the appointed repair workshop of vehicle no. SKX 4104B

We understand that you are the insurer of vehicle no. YN 766SR

The owner of vehicle no. SKX 4104B has authorised us to carry out the repairs to his vehicle which was damaged by your insured's vehicle. The owner intends to make a claim against your insured and/or insured's authorised driver for the accident which is caused wholly and/or contributed by your insured and/or your insured's authorised driver's negligence.

We hereby give you notice of the accident and an opportunity to inspect the damaged to the vehicle prior to the commencement of the repairs.

Kindly take note that we hereby give you 2 days' notice to conduct a pre-repair inspection of vehicle no. SKX 4104B at my premises.

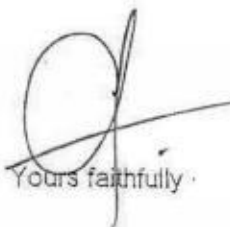

Yours faithfully

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	3528J
Vehicle Details	
Vehicle No.:	SKX4104B
Vehicle to be Exported:	No
Intended De-registration Date:	14 Jun 2018
Vehicle Make:	TOYOTA
Vehicle Model:	COROLLA ALTIS 1.6 AUTO
Primary Colour:	Silver
Manufacturing Year:	2009
Engine No.:	3ZZ4908045
Chassis No.:	MR053ZEE106149060
Maximum Power Output:	80.0 kW (107 bhp)
Open Market Value:	\$17,500.00
Original Registration Date:	06 Jul 2009
First Registration Date:	06 Jul 2009
Transfer Count:	1
Actual ARF Paid:	\$17,500.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	05 Jul 2019
PARF Rebate Amount:	\$9,625.00
Intended COE Rebate Details	
COE Expiry Date:	05 Jul 2019
COE Category:	A - Car (1600cc & below)
COE Period(Years):	10
QP Paid:	\$12,899.00
COE Rebate Amount:	\$1,364.00
Total Rebate Amount:	\$10,989.00

The information contained herein is correct as at 14 Jun 2018

OK

PRECISE AUTO SERVICE

NO. 1 KAKI BUKIT AVE 6 #02-34/36 SINGAPORE 417883

TEL : 67457367 FAX : 68413390

CO. REG. NO. : 35766600C GST REG. NO. : 35766600C

Not Allowed
this

1/5 * 1300
3 day.

16-08-18

Date Of Accident : 26-01-18

OUR REF : SKX 4104B/T/18

LIM SENG GUAN

Blk 507 Bedok North Ave 3

#13-355

Singapore 460507

marcus

Date in/out : 23/07/18 to 24/07/18

LKK Auto Consultants hereby notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Part prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

ESTIMATE BILL ON VEH. NO. : SKX 4104B edged by Repairer

VEH. MODEL : TOYOTA VIOS Signature:

CHASSIS NO: MR053ZEE106149060

LIST ITEM

Front Bumper Fascia

7.5 381.10

Front Bumper Side Retainer LH 62.10

Sub 132.25

Front Bumper Clips 45.00

10pcs @ 12.90 129.00

Fog Lamp LH

11 372.85 X

Fog Lamp Cover

11 121.10 X

Head Lamp LH 770.10

CM 2,816.35

Air Cleaner Resonator

11 281.35 X

1258.3
943.72

4,234.00
1,058.50
3,175.50

Less Discount 25%:

LABOUR CHARGE

To check wiring system

20 50.00

To respray affected areas

300 700.00

To renew damaged parts, straighten & repair front support panel, front LH fender & aligned all parts

400 550.00

Total : 4,475.50
GST 7% : 313.29
AMOUNT DUE : 4,788.79

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG18010465/URD3N2

Date: 04/09/2018

REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	28681686MKC
Claimant Vehicle No :	SKX4104B	Insured Vehicle No :	YN7665R
Date of Loss:	26/01/2018	Nature of Claim:	TP
		Claim No:	560649

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKX4104B	Engine No:	3ZZ4908045
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 (A)	Chassis No:	MR053ZEE106149060
Reg. Date:	06/07/2009 (Man. Year: 2009)	Odometer:	243345 km
Colour:	Grey		
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65R15	Rear Tyre Size:	195/65R15
Front Left Side:	Michelin 5 mm	Rear Left Side:	Michelin 5 mm
Front Right Side:	Michelin 5 mm	Rear Right Side:	Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	3,175.50	943.72	2,231.78	70.28
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,300.00	720.00	580.00	44.62
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	4,475.50	1,663.72	2,811.78	62.83
Approved Total (Overridden) (S\$)		1,300.00		
(S\$)	4,475.50	1,300.00	3,175.50	70.95
+ GST 7.00/7.00% (S\$)	313.29	91.00	222.29	70.95
Nett Amount (S\$)	4,788.79	1,391.00	3,397.79	70.95

INSPECTION

Date of Assignment:	07/06/2018	
Date Inspected:	14/06/2018	Inspected At: Precise Auto Service (HQ) No 1 Kaki Bukit Ave 6, #02-34/36 Singapore 417883

Estimated Period of Repair: 3.0 days

Adjuster: MARCUS CHUA

Manager: Janice Lee Si Hua

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 04 Sep 2018)
Parts: 143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SKX4104B)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER FASCIA	Distorted	381.10 FL	*381.10 FL
2	1		*FRONT BUMPER SIDE RETAINER LH	Bent	132.25 FL	*62.10 FL
3	10		*FRONT BUMPER CLIPS	Necessary	129.00 FL	*45.00 FL
4	1		*FOG LAMP LH	Not Necessary	372.85 FL	*- FL
5	1		*FOG LAMP COVER	Not Necessary	121.10 FL	*- FL
6	1		*HEAD LAMP LH	Cracked	2,816.35 FL	*770.10 FL
7	1		*AIR CLEANER RESONATOR	Not Necessary	281.35 FL	*- FL
					Sub Total (S\$)	4,234.00
					- List Item Discount on L Items 25.00/25.00% (S\$)	1,058.50
					Total Parts (S\$)	3,175.50
						943.72

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING SYSTEM	New	50.00	20.00
2	TO RESPRAY AFFECTED AREAS	New	700.00	300.00
3	TO RENEW DAMAGED PARTS,STRAIGHTEN & REPAIR FRONT SUPPORT PANEL,FRONT LH FENDER & ALIGNED ALL PARTS	New	550.00	400.00
Gross Labour Cost (\$\$)			1,300.00	720.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >