

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

#### **TAX INVOICE**

LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555 INV No. AC2004961

INV Date 16/07/2020

Reference CC4/LPC18010987/T1ds3n2

Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SKU 7487S

Insured Veh. SKL 737P

Claim No. 18/18/VP05/020663

Policy No. Z18VP05018777

Accident Date 08/06/2018

Inspection Date 19/06/2018

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

**LKK Auto Consultants Pte Ltd** 

HYN



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Affiliated to Federation Internationale Des Experts En Automobile				
LONF	PAC INSURANCE	BHD	Ref : CC4/LPC18010987/T1ds3n2	
	BEACH ROAD 04/07 THE CONC	OURSESINGAPORE 199555	Date: 16-07-2020 Code: LPC2	
1.		Policy Particulars	:- THIRD PARTY CLAIM	
	Insured Veh.	SKL 737P	Veh. Inspected	SKU 7487S
	Policy No.	Z18VP05018777	Coverage (\$)	0.00
	Claim No.	18/18/18/VP05/020663	Excess (\$)	0.00
	Assign From	GERALD	Assign Date	18/06/2018
2.		Vehicle Partic	culars & Condition	
	Make & Model	HONDA VEZEL	c.c	1496
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	RU11100788	Colour	WHITE
	Odometer	81483	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3.		Condition	ons of Tyres	
		Size	Make	Balance
	R/H Front Tyre	225/45 R17	CONTINENTAL	6 mm
	L/H Front Tyre	225/45 R17	CONTINENTAL	6 mm
	R/H Rear Tyre	225/45 R17	CONTINENTAL	6 mm
	L/H Rear Tyre	225/45 R17	CONTINENTAL	6 mm
4.		Description	on of Damages	
	THE VEHICLE SU	STAINED DAMAGES AT THE REA	AR PORTION.	
	DAMAGES SEE D	ETAILS.		
5.		General	Information	
	Accident Date	08/06/2018	Inspection Date	19/06/2018
	Survey held at	1 SOON LEE ST #05-22		
	Repairer	SINCERE LEAD AUTOMOTIVE		
5a.		Re	emarks	
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			REPAIRS.
5b.	<b>5b.</b> Estimate Days of Repair			
	ESTIMATED NORI	MAL PERIOD FOR REPAIR:	5 Working Days	



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKU 7487S

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR WINDSCREEN GLASS	NOT NECESSARY	1,186.00	-
1	REAR WINDSCREEN MOULDING	NECESSARY	140.00	140.00
1	REAR TAILGATE	BENT	1,583.50	1,100.90
2	REAR TAILGATE DAMPER	NOT NECESSARY	420.00	-
2	REAR TAILGATE HINGE	NOT NECESSARY	110.00	-
1	REAR TAILGATE INNER BOARD	NOT NECESSARY	638.00	-
1	REAR TAILGATE TOP SPOILER	NOT NECESSARY	820.00	-
2	REAR TAILGATE LAMP	NOT NECESSARY	560.00	-
1	REAR TAILGATE LOCK	NOT NECESSARY	210.00	-
1	REAR TAILGATE LOGO	NECESSARY	32.00	32.00
1	REAR TAILGATE OUTER GARNISH	NOT NECESSARY	187.00	-
1	REAR TAILGATE OUTER HANDLE	NOT NECESSARY	187.00	-
1	REAR TAILGATE RUBBER	CUT	195.00	195.00
1	REAR TAILGATE 'HONDA' EMBLEM	NECESSARY	75.00	75.00
1	REAR TAILGATE 'VEZEL' EMBLEM	NECESSARY	75.00	75.00
1	REAR TAILGATE 'HYBRID' EMBLEM	NECESSARY	76.00	76.00
1	REAR WIPER ARM	NOT NECESSARY	80.00	-
1	REAR WIPER MOTOR	NOT NECESSARY	310.00	-
2	REAR TAILLAMP	NOT NECESSARY	1,500.00	-
1	REAR TAILLAMP PANEL	NOT NECESSARY	155.00	-
1	REAR TAILLAMP WIRENESS	NOT NECESSARY	296.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	675.90	-
1	REAR END PANEL INNER GARNISH	TO REPAIR SEE LABOUR	128.90	-
1	REAR END PANEL SENSOR	NOT NECESSARY	115.60	-
1	REAR BUMPER	DEFORMED	936.10	762.70
2	REAR BUMPER REFLECTOR	NOT NECESSARY	362.00	-
2	REAR BUMPER SIDE RETAINER	NECESSARY	88.00	88.00
1	REAR BUMPER CORNER LH	DEFORMED	230.00	230.00
1	REAR SPARE TYRE PANEL	NOT NECESSARY	1,145.70	-

Report Ref No. CC4/LPC18010987/T1ds3n2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	REAR SPARE TYRE BOARD	NOT NECESSARY	240.00	-
1	REAR EXHAUST SILENCER	NOT NECESSARY	990.00	-
1	REAR EXHAUST SILENCER MOUNTING	NOT NECESSARY	23.50	-
1	REAR EXHAUST SILENCER CENTRE PIPE	NOT NECESSARY	1,056.30	-
	LESS 20% DISCOUNT		-2,965.50	-554.92
			11,862.00	2,219.68
	SPECIAL NETT ITEMS			
1	REAR NUMBER PLATE (SN)	NECESSARY	50.00	45.00
1	REAR NUMBER PLATE LAMP (SN)	NOT NECESSARY	84.00	-
1	REAR WEEK END SEAL (SN)	NECESSARY	20.00	20.00
1	SET REAR REVERSE SENSOR (SN)	NOT WORKING	280.00	200.00
1	SET REAR REVERSE CAMERA (SN)	NOT NECESSARY	480.00	-
1	REAR THIRD BRAKE LIGHT (SN)	NOT NECESSARY	210.00	-
1	REAR WINDSCREEN SEALANT GUM (SN)	NECESSARY	60.00	60.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	30.00
1	SET REAR TAILGATE INNER BOARD CLIP (SN)	NOT NECESSARY	100.00	-
			1,364.00	355.00
	LABOUR			
	TO DISCONNECT AND RECONNECT ,CHECK ELECTRICAL WIRING ,HARNESS WIRES,SOCKETS ,REPLACE DAMAGED PARTS.		200.00	30.00
	TO REMOVE AND REFIT INNER TRIMS ,INNER GARNISHES ,TO FACILITATE THE REPAIRS.		150.00	60.00
	TO REMOVE AND REFIT REAR BUMPER SENSOR .		120.00	30.00
	TO REMOVE AND REFIT REAR WINDSCREEN GLASS .		180.00	120.00
	TO REMOVE AND REFIT ,STRAIGHTEN AND RE-ADJUST EXHAUST PIPE AND REPLACE REAR EXHAUST SILENCER AND MOUNTINGS.	NOT NECESSARY	110.00	-
	TO REMOVE AND REPLACE THE ABOVE DAMAGED PARTS ,STRAIGHTEN ,KNOCK OUT ,REALIGN AND REPAIR INCLUDING CUT AND WELD BODY PANELS.TO RE-ADJUST TO THE ORIGINAL POSITION USING POWER TOOLS.INCLUSIVE OF THE REPAIR OF REAR END PANEL INNER GARNISH AND REAR END PANEL.		1,500.00	600.00

Report Ref No. CC4/LPC18010987/T1ds3n2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

3,300.00

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	TO SPRAY PAINT ON THE REPLACED AND REPAIRED PARTS, PREPARE SPRAY SUCH AS MASKING TAPE THE UNAFFECTED AREAS WITH PAPER, CLEANING AND SANDING OF SURFACES, FINAL POLISHING AND WAXING ARE ALSO AVAILABLE.		1,000.00	600.00
	TO APPLY UNDERCOATING ON THE REPAIRED AND REPLACED PANELS FOR RUST PROTECTION .		160.00	40.00
	SEND VEHICLE TO LTA TO REPLACE OPC PLATE.		120.00	60.00
			3,540.00	1,540.00
	GRAND TOTAL		16,766.00	4,114.68

Report Ref No. CC4/LPC18010987/T1ds3n2

**RECOMMENDED COST OF LUMP SUM REPAIRS** 

(TO ITS PRE-ACCIDENT CONDITION)

**MOHAMAD TAUFIKH** 

M.MATAI, AMSAE-A

**HO LEONG CHUAN** 

**Automotive Assessor** 

**Automotive Assessor** 

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R


### PHOTOGRAPHS FOR VEHICLE NO. SKU 7487S

### INSPECTION







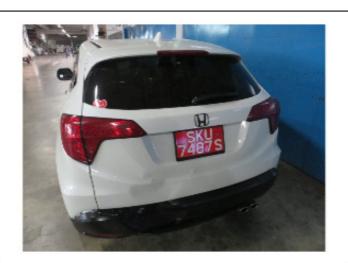








51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315







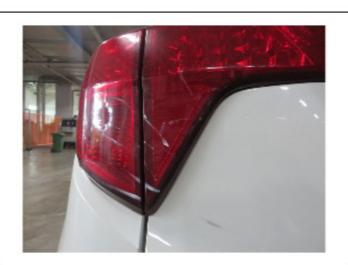








51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

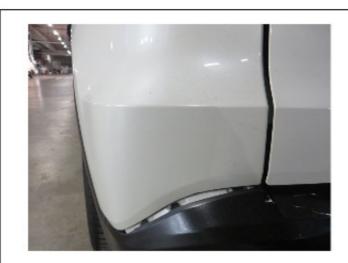














51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315






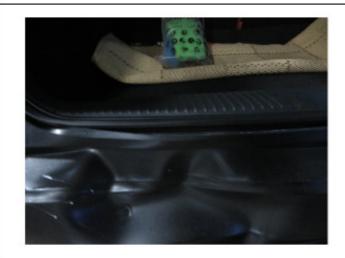





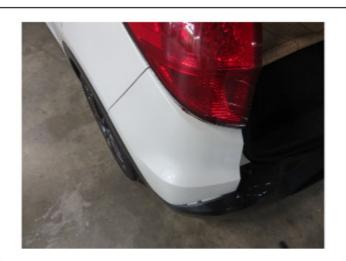



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315



