

22/03/2003

ASS. REC BY:

REF:

CG/SPF 18011274/Vrbez

Special Instruction:

Survivor

ASSIGNMENT (Office)

From (Person):

Lim Wei Yea

of

SPF

Date/Time:

20062018 1:33pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

QX 1017T

Insured:

at Workshop m/s

\* SMRT

Tel:

of

60 Woodlands Ind Park Rd

Policy No:

Claim No:

HOMSP FETQ17300218

Sum Insured:

Excess:

Make of Veh:

D.O.A.

(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

Person Contacted:

Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
27/6/18	Report to Wei Yea
4/7/18	Check with Wei Yea, he said we can submit report accordingly
	Parts: \$3580.00, man - Hour - 30 hour.

REF: SPF

## ASSIGNMENT

From: Date: 21/06/2018

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: QX 1017T

at Workshop m/s: SMRT

of

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:


(Client's Record)

Make of Veh:

Mr. Kung

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

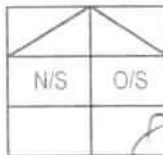

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Lump Sum: % 3 Val.: Yes or No

CA ☒ REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: QX 1017T Yr Regn: /

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai Elantra C/C

Colour: multicolour A/C: Insured / Std / NI / NA

Sp. Reading: 98806 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: KMHDH41CMEU085167

Gen. Cond: Good / Fair / ☒ Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: ☒ Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55 R16

R: 205/55 R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Falken

Front

Rear

R/Bal. 6 mm R/Bal. 6 mm

L/Bal. 6 mm L/Bal. 6 mm

D.O.A. D.O.I. 25/6/2018

Survey held at 2B Sungai Kadut Dr

Des. of Damages: Frt / ☒ Rear / ☒ O/S / NIS / UIC / Rooftop or

Rear O/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

RECEIVED 04 JUL 2018

Date/Time: File Pass to?

☐ : Preli. Report1) *typed*  
Date/Time: File Return to?☐ : Final Report

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

) \$ + RS \$

) Photos

) Others

)

TOTAL

Report Format :

Lump Sum / I.B.I: (\$)

Add Fee: ☐ Site Insp (\$)☐ Interview (\$)☐ Tech. Invs (\$)☐ Weekend (\$)

280

280

## Catherine Chong (LKK Auto)

---

**From:** Wei Yea LIM (SPF) <LIM\_Wei\_Yea@spf.gov.sg>  
**Sent:** Wednesday, 20 June, 2018 1:33 PM  
**To:** assignments  
**Cc:** Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); Perry HE (SPF); Bernard SEAH (SPF); 'Ai Phing (LKKAuto)'; 'Shiau Chan (LKKAuto)'; 'Veron Chen (LKKAuto)'  
**Subject:** Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ17300218 (QX1017T)  
**Attachments:** QX1017T.XLSX

Hi Catherine,

Please provide Appraisal Services for the following SPF vehicles at SMRT Automotive Services:

- QX 1017T

In attached, please find the list of recommended Parts and Labour man-hours, for the repairs of this vehicle.

Kindly contact the following SMRT personnel for viewing of the damaged vehicle:

- Mr Kong Sew Kui
- Mr Jason Yeo

Thank you and best regards,

WeiYea LIM

Contract Management

AEMD, Police Logistics Department

Singapore Police Force

DID: (65) 6478 4844



**HOME TEAM**  
TRANSFORMATION 2025  
One Home, One Team  
Building Our Future Together

**WARNING:** "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
<b>1</b>	<b>MATERIALS</b>					
1.1	REAR BUMPER	1	DAMAGED	\$460.00	\$460.00	
1.2	REAR RH BUMPER RETAINER	1	CRACKED	\$25.00	\$25.00	
1.3	REAR RH BUMPER REFLECTOR	1	CRACKED	\$30.00	\$30.00	
1.4	REAR BUMPER LOWER TRIM	1	CRACKED	\$250.00	\$250.00	
1.5	REVERSE SENSOR	1	SHORT CIRCUIT	\$200.00	\$200.00	
1.6	REAR END PANEL	1	DENTED	\$385.00	\$385.00	
1.7	RHS TAIL LAMP	1	BROKEN	\$365.00	\$365.00	
1.8	REAR RH PANEL	1	REPAIR	\$1,770.00		
1.9	RHS AIR DUCT	1	DEFORMED	\$30.00	\$30.00	
1.10	BOOT LID COVER	1	DAMAGED	\$1,670.00	\$1,670.00	
1.11	CAR BOOT RUBBER SEAL	1	BENT	\$80.00	\$80.00	
1.12	CAR BOOT INNER TRIM	1	DEFORMED	\$85.00	\$85.00	
<b>2</b>	<b>LABOUR</b>					
2.1	REAR BUMPER					6
	REMOVE & REPLACE REAR BUMPER					
	REMOVE & REPLACE REAR RH BUMPER RETAINER					
	REMOVE & REPLACE REAR RH BUMPER REFLECTOR					
	REMOVE & REPLACE REAR BUMPER LOWER TRIM					
	REMOVE & REPLACE REVERSE SENSOR					
	WIRING FOR REVERSE SENSOR					
	PUTTY & SPRAY PAINT FOR REAR COMPLETE BUMPER					
2.2	REAR END PANEL & RHS AIR DUCT					10
	REMOVE & REPLACE REAR END PANEL					
	REMOVE & REPLACE RHS AIR DUCT					
2.30	REAR RH PANEL					6
	REMOVE & REPAIR REAR RH PANEL					
	PUTTY & SPRAY PAINT FOR REAR RH PANEL					
2.40	CAR BOOT					8
	REMOVE & REPLACE BOOT LID COVER					
	REMOVE & REPLACE CAR BOOT RUBBER SEAL					
	REMOVE & REPLACE CAR BOOT INNER TRIM					
	PUTTY & SPRAY PAINT FOR BOOT LID COVER					
COSTING		TOTAL PARTS COST			\$3,580.00	
		TOTAL MAN-HOUR				30

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
<b>1</b>	<b>MATERIALS</b>					
1.1	REAR BUMPER	1	DAMAGED	\$460.00	\$460.00	
1.2	REAR RH BUMPER RETAINER	1	CRACKED	\$25.00	\$25.00	
1.3	REAR RH BUMPER REFLECTOR	1	CRACKED	\$30.00	\$30.00	
1.4	REAR BUMPER LOWER TRIM	1	CRACKED	\$250.00	\$250.00	
1.5	REVERSE SENSOR	1	SHORT CIRCUIT	\$200.00	\$200.00	
1.6	REAR END PANEL	1	DENTED	\$385.00	\$385.00	
1.7	RHS TAIL LAMP	1	BROKEN	\$365.00	\$365.00	
1.8	REAR RH PANEL	1	REPAIR	\$1,770.00		
1.9	RHS AIR DUCT	1	DEFORMED	\$30.00	\$30.00	
1.10	BOOT LID COVER	1	DAMAGED	\$1,670.00	\$1,670.00	
1.11	CAR BOOT RUBBER SEAL	1	BENT	\$80.00	\$80.00	
1.12	CAR BOOT INNER TRIM	1	DEFORMED	\$85.00	\$85.00	
<b>2</b>	<b>LABOUR</b>					
2.1	REAR BUMPER					6
	REMOVE & REPLACE REAR BUMPER					
	REMOVE & REPLACE REAR RH BUMPER RETAINER					
	REMOVE & REPLACE REAR RH BUMPER REFLECTOR					
	REMOVE & REPLACE REAR BUMPER LOWER TRIM					
	REMOVE & REPLACE REVERSE SENSOR					
	WIRING FOR REVERSE SENSOR					
	PUTTY & SPRAY PAINT FOR REAR COMPLETE BUMPER					
2.2	REAR END PANEL & RHS AIR DUCT					10
	REMOVE & REPLACE REAR END PANEL					
	REMOVE & REPLACE RHS AIR DUCT					
2.30	REAR RH PANEL					6
	REMOVE & REPAIR REAR RH PANEL					
	PUTTY & SPRAY PAINT FOR REAR RH PANEL					
2.40	CAR BOOT					8
	REMOVE & REPLACE BOOT LID COVER					
	REMOVE & REPLACE CAR BOOT RUBBER SEAL					
	REMOVE & REPLACE CAR BOOT INNER TRIM					
	PUTTY & SPRAY PAINT FOR BOOT LID COVER					
<b>COSTING</b>		<b>TOTAL PARTS COST</b>			<b>\$3,580.00</b>	
		<b>TOTAL MAN-HOUR</b>				<b>30</b>



**Scope Of Work**  
**Home Team Agency**

**SCOPE OF WORK**

**1 To provide labour, materials, transportation, tools and parts and others deemed necessary to carry out the following repairs:**

CONTRACTOR:	SMRT	VEH TYPE:	ERC	UNIT:	WOODLANDS EAST NPC	Reference No.	1017/SPF/4W/18/06/15
VEH NO:	QX1017T	REPAIR TYPE:	ACCIDENT				
VEH MAKE/MODEL:	HYUNDAI ELANTRA	ODOMETER:	98806			ILMS No.	1100006729

S/N	PARTS DESCRIPTION	PART COST (\$)	QTY	Mark Up Rate	Parts Cost Per Unit After Mark Up (\$)	Total Parts Cost Per Unit After Mark Up (\$)
<b>1</b>	<b>Scope Of Repairs</b>					
1.1	Rear Bumper ✓DMG	\$460.00	1		460.00	460.00
1.2	Rear RH Bumper Retainer ✓CRK	\$25.00	1		25.00	25.00
1.3	Rear RH Bumper Reflector ✓CRK	\$30.00	1		30.00	30.00
1.4	Rear Bumper Lower Trim ✓CRK	\$250.00	1		250.00	250.00
1.5	Reverse Sensor ✓SC	\$200.00	1		200.00	200.00
1.6	Rear End Panel ✓DT	\$385.00	1		385.00	385.00
1.7	RHS Tail Lamp ✓GR	\$365.00	1		365.00	365.00
1.8	Rear RH Panel R	\$1,770.00	1		1770.00	1770.00
1.9	RHS Air Duct ✓Deform	\$30.00	1		30.00	30.00
1.10	Boot Lid Cover ✓DMG	\$1,670.00	1		1670.00	1670.00
1.11	Car Boot Rubber Seal ✓BT	\$80.00	1		80.00	80.00
1.12	Car Boot Inner Trim ✓Deform	\$85.00	1		85.00	85.00
<b>2</b>	<b>Additional Services</b>					
2.1	NA	\$0.00	0	0%	0.00	0.00
<b>Remarks:</b>					<b>Parts Total:</b>	<b>\$ 5,350.00</b>

S/N	LABOUR DESCRIPTION	Man-Hour Rate (\$)	Man-Hour Qty	Total Man-Hour Cost (\$)
<b>1</b>	<b>Scope Of Repairs</b>			
1.1	<b>Rear Bumper:</b>		6 ✓	0.00
	Remove & Replace Rear Bumper			
	Remove & Replace Rear RH Bumper Retainer			
	Remove & Replace Rear RH Bumper Reflector			
	Remove & Replace Rear Bumper Lower Trim			
	Remove & Replace Reverse Sensor			
	Wiring for Reverse Sensor			
	Putty & Spray Paint for Rear Complete Bumper (2 colour)			
1.2	<b>Rear End Panel &amp; RHS Air Duct:</b>		10 ✓	0.00
	Remove & Replace Rear End Panel			
	Remove & Replace RHS Air Duct			
1.3	<b>Rear RH Panel: repair</b>		6 ✓	0.00
	Remove & Replace Rear RH Panel			
	Putty & Spray Paint for Rear RH Panel (3 colours)			
1.4	<b>Car Boot:</b>		8 ✓	0.00
	Remove & Replace Boot Lid Cover			
	Remove & Replace Car Boot Rubber Seal			
	Remove & Replace Car Boot Inner Trim			
	Putty & Spray Paint for Boot Lid Cover (2 colours)			
	<b>SUB-TOTAL</b>		<b>32</b>	<b>0.00</b>
<b>2</b>	<b>Additional Services</b>			
2.1	Towing Service From Station to Workshop (SOR 8)	138.60	1	138.60
2.2	Return Service From Workshop to Station (SOR 7)	44.10	1	44.10
	<b>SUB-TOTAL</b>		<b>2</b>	<b>182.70</b>
	<b>Labour Total:</b>			<b>\$ 182.70</b>
	<b>GRAND TOTAL :</b>			<b>\$ 5,532.70</b>
	<b>Total sum billed under SOR only :</b>			<b>\$ 182.70</b>
	<b>Total sum billed under CVR only :</b>			<b>\$ 5,350.00</b>
<b>Contractor shall complete the entire repair within <u>14</u> working days upon vehicle collection date . (Include parts awaiting time)</b>				

<b>Verification of Scope of Work</b>					
<b>Contractor QC</b>		<b>Verified By</b>		<b>Approved By</b>	
Name:	KONG SEW KUI	Name:		Name:	
Date:	18.06.2018	Date:		Date:	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTOMOTIVE ENGINEERING & MGT DIVISION Ref : CS/SPF18011274/Vrbe2

ACCIDENT CLAIM SECTION  
(SINGAPORE POLICE FORCE)  
1 MOUNT PLEASANT ROAD  
BLK 8 OLD POLICE ACADEMYSINGAPORE 298333

Date : 10-07-2018



Code : SPF

## 1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	QX 1017T
Policy No.		Coverage (\$)	0.00
Claim No.	HOMSPFETQ17300218	Excess (\$)	0.00
Assign From	LIM WEI YEA	Assign Date	20/06/2018

## 2. Vehicle Particulars & Condition

Make & Model	HYUNDAI ELANTRA	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	KMHDH41CMEU085167	Colour	MULTI COLOUR
Odometer	98806	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	POOR		

## 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	FALKEN	6 mm
L/H Front Tyre	205/55 R16	FALKEN	6 mm
R/H Rear Tyre	205/55 R16	FALKEN	6 mm
L/H Rear Tyre	205/55 R16	FALKEN	6 mm

## 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.
--

## 5. General Information

Accident Date		Inspection Date	25/06/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

## 5a. Remarks

--

Registration No. QX 1017T

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
<b>1</b>	<b>MATERIALS</b>					
1.1	REAR BUMPER	1	DAMAGED	\$460.00	\$460.00	
1.2	REAR RH BUMPER RETAINER	1	CRACKED	\$25.00	\$25.00	
1.3	REAR RH BUMPER REFLECTOR	1	CRACKED	\$30.00	\$30.00	
1.4	REAR BUMPER LOWER TRIM	1	CRACKED	\$250.00	\$250.00	
1.5	REVERSE SENSOR	1	SHORT CIRCUIT	\$200.00	\$200.00	
1.6	REAR END PANEL	1	DENTED	\$385.00	\$385.00	
1.7	RHS TAIL LAMP	1	BROKEN	\$365.00	\$365.00	
1.8	REAR RH PANEL	1	REPAIR	\$1,770.00		
1.9	RHS AIR DUCT	1	DEFORMED	\$30.00	\$30.00	
1.10	BOOT LID COVER	1	DAMAGED	\$1,670.00	\$1,670.00	
1.11	CAR BOOT RUBBER SEAL	1	BENT	\$80.00	\$80.00	
1.12	CAR BOOT INNER TRIM	1	DEFORMED	\$85.00	\$85.00	
<b>2</b>	<b>LABOUR</b>					
2.1	REAR BUMPER					6
	REMOVE & REPLACE REAR BUMPER					
	REMOVE & REPLACE REAR RH BUMPER RETAINER					
	REMOVE & REPLACE REAR RH BUMPER REFLECTOR					
	REMOVE & REPLACE REAR BUMPER LOWER TRIM					
	REMOVE & REPLACE REVERSE SENSOR					



	WIRING FOR REVERSE SENSOR					
	PUTTY & SPRAY PAINT FOR REAR COMPLETE BUMPER					
2.2	REAR END PANEL & RHS AIR DUCT					10
	REMOVE & REPLACE REAR END PANEL					
	REMOVE & REPLACE RHS AIR DUCT					
2.30	REAR RH PANEL					6
	REMOVE & REPAIR REAR RH PANEL					
	PUTTY & SPRAY PAINT FOR REAR RH PANEL					
2.40	CAR BOOT					8
	REMOVE & REPLACE BOOT LID COVER					
	REMOVE & REPLACE CAR BOOT RUBBER SEAL					
	REMOVE & REPLACE COR BOOT INNER TRIM					
	PUTTY & SPRAY PAINT FOR BOOT LID COVER					
COSTING		TOTAL PARTS COST			\$3,580.00	
		TOTAL MAN-HOUR				30

Registration No. QX 1017T

Vehicle Inspected By

YEANG WAI KEEN

*Automotive Assessor*

ADRIAN LING WAI PING

*B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI*

*Licensed Appraiser*

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.