

**Charn's Customcraft  
1010 Bukit Merah Lane 3  
Singapore 159724**

**Claim Reference:**  
**Assessment Number: CC000002**  
**Version: CHARNCUS/1**  
**Date Calculated: 20/06/2018 08:18**

**Full Report - V1**  
**Registration: SJX3261Z**  
**Printed: 20/06/2018 15:19**

---

**Summary Information**

**Claim**

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Sharon Lee	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

**Vehicle Details**

**Vehicle**

Manufacturer:	HONDA
Model:	Civic
Sub Model:	BASE MODEL
Model Sheet Number:	H48 01
Registration:	SJX3261Z
Registration Month:	
Registration Year:	
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

**Model Specs**

FROM MODEL 2010	AIR CONDITIONING
RADIATOR DENSO	FOG LAMPS
HEADLAMP WASHERS	PAINTED DOOR HANDLES
PAINTED DOOR MIRRORS	LEATHER STRG WHEEL
RR PARK DIST CONTROL	1.6 LTR 92KW VTEC
HYDRAULIC SERVO	TYRES 205/55 VR 16
WHEELS 6.5J X 16 ALU	TWO COAT METALLIC
PREPARE OFF VEHICLE	

**Vehicle Condition**



**Vehicle Status**

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection: 20/06/2018
Place of Inspection:	
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:
Damage Areas:	Direction of Impact:

## Charn's Customcraft

**Claim Reference:**  
**Assessment Number: CC000002**  
**Version: CHARNCUS/1**  
**Date Calculated: 20/06/2018 08:18**

**Full Report - V1**  
**Registration: SJX3261Z**  
**Printed: 20/06/2018 15:19**

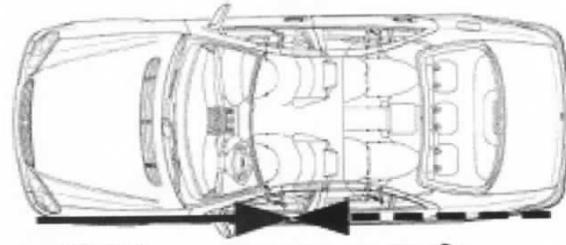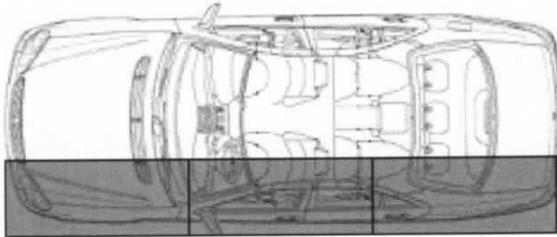

Primary Impact →  
 Secondary Impact - - - - - →

### Addresses

### Cost Summary

Total Labour	\$1,827.00
Total Paint/Material	\$274.06
Total Parts	\$2,232.36
Total of Additional Costs	\$60.00
Excess:	TBA
Grand Total Exc GST:	\$4,393.42
7 % GST:	\$307.54
Grand Total Inc GST:	\$4,700.96

### Repair Information

#### LABOUR

**Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR**  
**Price/Dent = \$45.00/HR**

#### Repair /

#### Guide Number Repair Details

		WU	Cost Price (\$)
42700-SNA)	R + R LEFT FRONT WHEEL	2.0	9.00
42700-SNA)	FIT AND BALANCE LEFT FRONT TYRE (WHEEL REMOVED)	5.0	22.50
NN	FRONT BUMPER R&R / NEW PARTS	25.0*	112.50
NN	L/F HEADLAMP CPL R&R / NEW PARTS	9.0*	40.50
NN	L/F WING R&R / NEW PARTS	15.0*	67.50
NN	L/DOOR MIRROR R&R / NEW PARTS	10.0*	45.00
NN	REAR BUMPER R&R / NEW PARTS	10.0*	45.00
1481	REPAIR LEFT FRONT DOOR	30.0*	135.00
1781	REPAIR L/R DOOR	20.0*	90.00
3481	REPAIR L/R SIDE PANEL	50.0*	225.00

#### LABOUR COST

<b>Total Work Units</b>	<b>176.0</b>	
<b>Corrosion Protection External Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
<b>Corrosion Protection Internal Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
<b>Sub Total</b>	<b>17.6HRS</b>	<b>\$792.00</b>
<b>Paint Labour</b>	<b>23.0HRS</b>	<b>\$1,035.00</b>
<b>Total Labour</b>	<b>40.6HRS</b>	<b>\$1,827.00</b>

#### PAINT WORK

**Time Basis 10 WU = 1 HR. Price = \$45.00/HR**

#### Guide Number Description

		WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
741	L/F WING NEW PART PAINTING	30.0*	
283	FRONT BUMPER NEW PART PAINT K1R	25.0*	

**Charn's Customcraft**

**Claim Reference:**  
**Assessment Number: CC000002**  
**Version: CHARNCUS/1**  
**Date Calculated: 20/06/2018 08:18**

**Full Report - V1**  
**Registration: SJX3261Z**  
**Printed: 20/06/2018 15:19**

1737	L/DOOR MIRROR NEW PART PAINT K1R	<b>10.0*</b>	
2583	REAR BUMPER NEW PART PAINT K1R	<b>30.0*</b>	
1481	LEFT FRONT DOOR REPAIR PAINTING >50%	<b>30.0*</b>	
1781	L/R DOOR REPAIR PAINTING >50%	<b>30.0*</b>	
3481	L/R SIDE PANEL REPAIR PAINTING >50%	<b>75.0*</b>	
<b>LABOUR COST - PAINT</b>			
	<b>TIME(PAINT)</b>	<b>230.0</b>	
	Preparation Work Multi Layer Paint	<b>0.0</b>	
	<b>Total Work Units (10WU/HR)</b>	<b>230.0</b>	
	<b>Total Paintwork Labour</b>	<b>23.0HRS</b>	<b>\$1,035.00</b>
<b>MATERIAL COST - PAINT</b>			
	<b>New Part Painting</b>		<b>\$23.22</b>
	<b>New Part Painting - Plastic K1R</b>		<b>\$125.94</b>
	<b>Material-Constant Main Work Metal</b>		<b>\$28.60</b>
	<b>Repair Painting</b>		<b>\$87.30</b>
	<b>Material-Const Main Work Plastic</b>		<b>\$9.00</b>
	<b>Total Excluding Pearlescent Uplift</b>		<b>\$274.06</b>
	<b>Pearlescent Uplift @ 0.0%</b>		<b>\$0.00</b>
	<b>Total Paint Material Cost</b>		<b>\$274.06</b>

**PARTS**

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER	71101SNBG50ZB		0% <i>scd</i>	<b>195.00*</b>
1737	1	L/DOOR MIRROR	76250SNBY21ZA		0% <i>repair</i>	<b>345.00*</b>
561	1	L/F HEADLAMP CPL	33151SNBD51		0% <i>scd</i>	<b>190.00*</b>
319	1	L/F UPP BUMPER BRKT	71190SNB000		0% <i>new</i>	<b>10.00*</b>
7201	1	L/F WHEEL	08W16TR0604	<i>s/n 300</i>	0% <i>scd</i>	<b>750.00*TR6</b>
741	1	L/F WING	60261SNB000ZZ		0% <i>repair</i>	<b>160.00*</b>
2619	1	L/R BUMPER BRACKET	71598SNAA01		0% <i>new</i>	<b>13.00*</b>
841	1	L/WHEELHOUSE SHELL	74151SNAA10		0% <i>?</i>	<b>50.00*</b>
2583	1	REAR BUMPER	71501SNB010ZB		0% <i>repair</i>	<b>195.00*</b>
f: OEM Parts			Sub Total			<b>\$1,908.00</b>
g: Original			Mark Up From Cost	(15 %)		<b>\$286.20</b>
h: Secondhand			Sundry Parts	(2 %)		<b>\$38.16</b>
p: Parallel			<b>Total Parts</b>			<b>\$2,232.36</b>
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

**Extras**

Description	SPECIALIST	Betterment	Price
ALIGNMENT		0%	\$60.00
<b>Total Extras</b>			<b>\$60.00</b>

**Final Calculation**

<b>Total Parts</b>		<b>\$2,232.36</b>
<b>Labour</b>		
Total Panel/Mechanical	\$792.00	
Total Paintwork	\$1,035.00	
<b>Total Labour</b>		<b>\$1,827.00</b>
<b>Additional Costs</b>		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$60.00	
<b>Total of Additional Costs</b>		<b>\$60.00</b>