

Ah Lim Motor Company
10 Ang Mo Kio Industrial
Park 2A
#01-09 AMK Autopoint
Singapore 568047

SURVEYOR COPY

Claim Reference:
Assessment Number: AH000851
Version: AHLIM001/1

Full Report - V1
Registration: SJX9519S
Printed: 03/07/2018 17:20

Summary Information

Claim

| | | | |
|-----------------------|------------------------------|----------------------------|-----|
| Location: | Singapore (SG) | Currency: | SGD |
| Printed by: | Ahlim ahlim | Date of Incident: | |
| Authorisation Status: | Interim | Able to Authorise Repairs: | TBA |
| Work Provider: | AXA Insurance S'pore Pte Ltd | Repairs Authorised: | TBA |

| | |
|-------------------|------------------------|
| Claim Reference: | Estimated Repair Time: |
| Policy Number: | Quote Due Date: |
| Other Reference: | Actual Repair Days: |
| Third Party: | Parts Ordered Date: |
| Insured Amount: | Hire Car Start: |
| Under Warranty: | Hire Car End: |
| Warranty Expired: | Vehicle Collected: |

Vehicle Details

Vehicle

| | |
|---------------------|-------------------------|
| Manufacturer: | LEXUS |
| Model: | GS 300/350/430/450h/460 |
| Sub Model: | 300 |
| Model Sheet Number: | 2415 01 |
| Registration: | SJX9519S |
| Registration Month: | July |
| Registration Year: | 2010 |
| VIN Number: | JTHBH96S505068309 |
| Manufacture Year: | 2010 |
| Odometer: | Not Known |
| Colour: | |
| Engine Number: | 3GR0281127 |
| Fuel Level: | % |

Model Specs

| | |
|-------------------|----------------------|
| PARK PILOT SYSTEM | 3.0 LTR 183 KW |
| TWO COAT METALLIC | PAINTING OFF VEHICLE |

Vehicle Condition

Vehicle Status


Pre-Accident Condition:
Steering:

Brakes Pedal Travel:
Place of Inspection:
Pre-Accident Damage:

Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

Severity of Impact:
Vehicle Status on
Inspection:



Date of Inspection: 03/07/2018

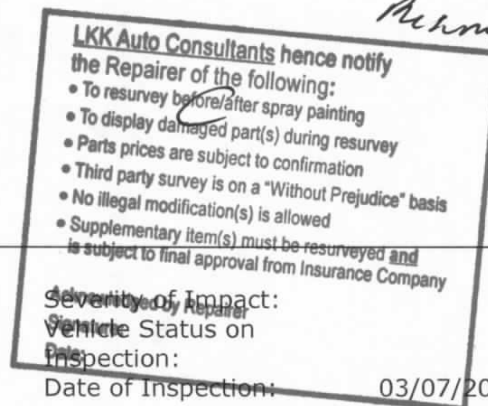

Ah Lim Motor Company

Claim Reference:
Assessment Number: AH000851
Version: AHLIM001/1

Full Report - V1
Registration: SJX9519S
Printed: 03/07/2018 17:20

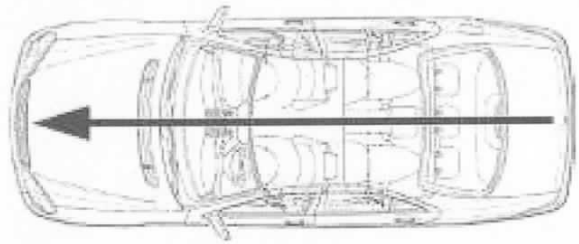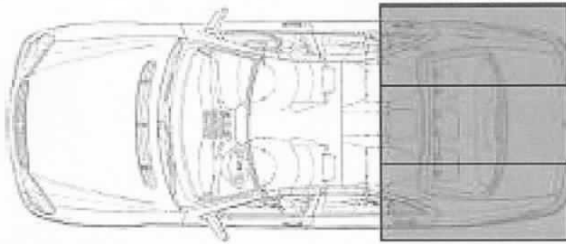

Addresses

Cost Summary

| | |
|---------------------------|------------|
| Total Labour | \$1,233.00 |
| Total Paint/Material | \$242.86 |
| Total Parts | \$4,445.90 |
| Total of Additional Costs | \$355.00 |
| Excess: | TBA |
| Grand Total Exc GST: | \$6,276.76 |
| 7 % GST: | \$439.37 |
| Grand Total Inc GST: | \$6,716.13 |

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
 Price/Dent = \$45.00/HR

Repair /

Guide Number Repair Details

| | | WU | Cost Price (\$) |
|-----------|---|----------|-----------------|
| B290 | RENEW END PANEL (BUMPER REMOVED) INCLUDES: R + R BOOT FLOOR CARPET AND ALL TRIMS IN THE REPAIR SECTION | 42.0 | 189.00 |
| B350 | R + R BOOTLID | 5.0 | 22.50 |
| B360) | RENEW BOOTLID (REMOVED) INCLUDES: CONVERT ATTACHED PARTS, RENEW IF NECESSARY | 5.0 | 22.50 |
| B410 | R + R REAR BUMPER INCLUDES: R + R BOOT TRIMS | 6.0 | 27.00 |
| B420) | RENEW REAR BUMPER (REMOVED) | 1.0 | 4.50 |
| B420) | RENEW REAR BUMPER REINFORCEMENT | 2.0 | 9.00 |
| NO NUMBER | R + R LEFT REAR BUMPER BRACKET | 1.0 | 4.50 |
| NO NUMBER | R + R RIGHT REAR BUMPER BRACKET | 1.0 | 4.50 |
| B407) | RENEW LEFT TAILLAMP | 1.0 | 4.50 |
| B407) | RENEW RIGHT TAILLAMP | 1.0 | 4.50 |
| 3481 | REPAIR L/R SIDE PANEL | 10 20.0* | 90.00 |
| 3482 | REPAIR R/R SIDE PANEL | 10 20.0* | 90.00 |
| 3901 | REPAIR REAR FLOOR PANEL | 20.0* ? | 90.00 |

LABOUR COST

Total Work Units

Sub Total

Paint Labour

Total Labour

125.0

12.5HRS

14.9HRS

27.4HRS

\$562.50

670.50

\$1,233.00

PAINT WORK

Guide Number Description

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

WU

Cost Price (\$)



Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000851

Version: AHLIM001/1

Full Report - V1

Registration: SJX9519S

Printed: 03/07/2018 17:20

| | | |
|------|-------------------------------------|------|
| | - TWO COAT METALLIC | |
| | - PAINTING OFF VEHICLE | |
| 2711 | REAR PANEL NEW PART PAINTING | 21.0 |
| 2583 | REAR BUMPER REPAIR PAINT PLASTIC | 16.0 |
| 2931 | BOOTLID REPAIR PAINTING >50% | 26.0 |
| 3481 | L/R SIDE PANEL REPAIR PAINTING >50% | 23.0 |
| 3482 | R/R SIDE PANEL REPAIR PAINTING >50% | 23.0 |
| 3901 | REAR FLOOR PANEL SURFACE PAINT | 11.0 |

LABOUR COST - PAINT

| | |
|------------------------------------|---------|
| TIME(PAINT) | 120.0 |
| Preparation Main Work Metal | 21.0 |
| Preparation Comp. Work Plastic | 8.0 |
| Preparation Work Multi Layer Paint | 0.0 |
| Total Work Units (10WU/HR) | 149.0 |
| Total Paintwork Labour | 14.9HRS |

MATERIAL COST - PAINT

| | |
|------------------------------------|----------|
| New Part Painting | \$25.30 |
| Surface-/Blend Paint | \$38.10 |
| Repair Painting | \$95.60 |
| Repair Painting Plastic | \$53.06 |
| Material-Const Main Work Metal | \$18.10 |
| Material-Const Comp. Work Plastic | \$12.70 |
| Total Excluding Pearlescent Uplift | \$242.86 |
| Pearlescent Uplift @ 0.0% | \$0.00 |
| Total Paint Material Cost | \$242.86 |

PARTS

Price Valid: 01/06/2015

| Guide No. | Qty | Description | Part Number | Supplier | Bet. | Price (\$) | |
|---------------|-----|---------------------|------------------|----------|------|------------|---|
| 2583 | 1 | REAR BUMPER | 52159 30935 | | 0% | 450.00* | ✓ |
| 2605 | 1 | L/R BUMPER LID | 52162 30902 | | 0% | 15.00* | ? |
| 2607 | 1 | L/R INN BUMPER BRKT | 52158 30081 | | 0% | 50.00* | ? |
| 2608 | 1 | R/R INN BUMPER BRKT | 52157 30061 | | 0% | 50.00* | ? |
| 2623 | 1 | REAR BUMPER REINF | 52023 30290 | | 0% | 240.00* | ? |
| 2625 | 1 | REAR BUMPER DAMPER | 52615 30261 | | 0% | 80.00* | ✓ |
| 2650 | 1 | RR BUMPER CLAMP KIT | USE SINGLE PARTS | | 0% | 36.00* | ✓ |
| 2711 | 1 | REAR PANEL | 58307 30754 | | 0% | 320.00* | ? |
| 2931 | 1 | BOOTLID | 64401 30B20 | | 0% | 320.00* | ✓ |
| 2977 | 1 | BOOT/TAILGATE LOCK | 64650 50010 | | 0% | 480.00* | ✓ |
| 2979 | 1 | BOOTLID TRIM | 76801 30141A0 | | 0% | 550.00* | ✓ |
| 3013 | 1 | BADGE LEXUS | 75441 30421 | | 0% | 40.00* | ✓ |
| 3015 | 1 | BADGE LEXUS | 90975 02079 | | 0% | 40.00* | ✓ |
| 3017 | 1 | BADGE GS 300 | 75443 30480 | | 0% | 45.00* | ✓ |
| 3281 | 1 | L/R MARKER LAMP | 81561 30A31 | | 0% | 385.00* | ✓ |
| 3282 | 1 | R/R MARKER LAMP | 81551 30A41 | | 0% | 385.00* | ✓ |
| 3403 | 1 | L/R INNER LAMP | 81591 30271 | | 0% | 100.00* | ? |
| 3404 | 1 | R/R INNER LAMP | 81581 30331 | | 0% | 100.00* | ? |
| 4985 | 1 | END PANEL TRIM | 58387 30170C0 | | 0% | 180.00* | ? |
| f: OEM Parts | | Sub Total | | | | \$3,866.00 | |
| g: Original | | Total Parts | | | | \$4,445.90 | |
| h: Secondhand | | | | | | | |
| p: Parallel | | | | | | | |
| x: Exchange | | | | | | | |

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER



Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000851

Version: AHLIM001/1

Full Report - V1

Registration: SJX9519S

Printed: 03/07/2018 17:20

Extras

| Description | | Betterment | Price |
|----------------|------------|------------|----------|
| REVERSE SENSOR | SPECIALIST | 0% | \$200.00 |
| NUMBER PLATE | SPECIALIST | | \$35.00 |
| CHK WIRING | SPECIALIST | 0% | \$40.00 |
| REINSTALL | SPECIALIST | | \$80.00 |
| TRIM&GARN | | | |

Total Extras \$355.00

Final Calculation

Total Parts \$4,445.90

Labour

| | |
|------------------------|----------|
| Total Panel/Mechanical | \$562.50 |
| Total Paintwork | \$670.50 |

Total Labour \$1,233.00

Additional Costs

| | |
|------------------------------|----------|
| Corr Prot Materials External | \$0.00 |
| Corr Prot Materials Internal | \$0.00 |
| Cost of Specialist | \$355.00 |

Total of Additional Costs \$355.00

Total Paint/Material Costs \$242.86

Grand Total Excludes GST \$6,276.76

GST @ 7 % **\$439.37**

Grand Total Includes GST \$6,716.13

Assessment Notes

