

CC Vale

CC 4, AXA 180 12348, U fa32

Surveyor:

MARCUS

DOI:

ASSIGNMENT

6/7/18

Date / Time:

Registered in Merimen:

5/7/18

4/7/18

Pre-assign / CCU / FTE



Insured Vehicle No.:

SHD 151 G

Name of Insured:

TRANS. CAB SERVICES P/L

Insured Tel No.:

HP:

Excess Sec II :SS

5,000.00

D.O.A:

23/6/18

Is driver the owner?

(YES / NO)

Nature of Accident:

If NO, Driver Name / Age:

POH TECK PENG

Driver Tel No.:

(V/L: YES / NO)

YN 4790 G

Claim No.:

C0474010

Policy No.:

PL680520

Make / Model:

A. Latitude.

Place of Accident:

BUKIT TIMAH ROAD

OI GIA REPORT: YES / NO ; TP GIA REPORT: YES / NO

Insured Liability:

%

Final ? Yes / No



INSRS:

WSP:

Tel:

Liability:

RMKS:

one uri



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

Date / Time		STAGE	DATE / PIC
10/7/18	YN 4790 G	Non-Reporting ltr (1st):	
10/7/18	SHD 151 G	Non-Reporting ltr (2nd):	
		Non-Reporting ltr (Final):	
		Notification ltr (if non-pickup):	
		Call OI:	
		After call ltr to OI:	8/7/18 h/p-mul
		Documentation Check List: Handler	Typist
		Notification ltr (if non-pickup)	
		After call ltr to OI:	✓
		Authorisation To Act:	
		Release Voucher:	
		Final Repair Bill:	
		Car Rental Invoice:	
		Towing Invoice	
		LTA / GIA :	
		Medical Bill:	
		PIR:	
		Mandate/Reject Instruction:	
		LOD	
		Payment Breakdown Form:	
		Post-Repair Photos:	
		Others:	

PRELIMINARY ADVICE Date/Time: 9/7 Sent By: Hm

FINALIZATION	Date/Time:	Confirm with:	Confirm by:
Repair Cost:	S\$ 11,650.00 (12 days)	Reduction: 47.59 %	Email <input type="checkbox"/> Call <input type="checkbox"/>
FINAL SETTLEMENT	Date/Time:	Confirm with:	Email <input type="checkbox"/> Call <input type="checkbox"/>
Final Liability:	% 80-100 (Agreed / Assessed)	BOLA S/N No. : 15	If NO or B 28, Ass. Lia :
Repair Cost:	S\$		
Loss of Rental (LOR):	S\$ (days)		
Loss of Use (LOU):	S\$ (\$ x days)		
Loss of Income (LOI):	S\$ (\$ x days)		
LOR only <input type="checkbox"/> LOU only <input type="checkbox"/> LOR + LOU <input type="checkbox"/> LOR + LOI <input type="checkbox"/>			
GIA/LTA Search	S\$		
Medical:	S\$		
Disbursement:	S\$ (e.g. Tow/ Independent)		
Legal Cost	S\$		
Total:	S\$	Global Sum S\$:	
FINAL PAYMENT	Date/Time:	Confirm with:	Email <input type="checkbox"/> Call <input type="checkbox"/>
Payee 1:	S\$	Name 1:	
Payee 2: (Strike if N.A.)	S\$	Name 2:	
Payee 3: (Strike if N.A.)	S\$	Name 3:	

CONFIRMED 27/5/19

1) Claim status: Normal/Reject/Private Settle

2) Report Format: WP

3) Survey fee:

4250.00

(08/11/13) wef

REF:

ASS. REC. BY: MORIS

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: YN 4790Gat Workshop m/s Spark Car Careof 320

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

 Remark: The veh had commenced its
 repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 42k

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 12 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

2112 30008

Vehicle: IN / OUT

Date: _____ Person Contacted: rep 8kVeh No: YN 4790G Yr Regn: 1213

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or (A)Make: ISUZU NJR8X c.c. 2999Colour: multi colour A/C: Insured / Std / NI / NASp. Reading: 63861 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: NJR857030594Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 195/75R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front 5 Rear 5/5R/Bal. _____ mm R/Bal. 5/5 mmL/Bal. 5 mm L/Bal. 5/5 mmD.O.A. 23/6/18 D.O.I. 6/7/18

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rt n/s

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

92285918 Johari 5 yrs. only. L1A
inform Johari not more than. until 11/9/12

1/12/11, 650.00 (2011/05/22/47.50%)

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Report Format: _____

Lump Sum / I.B.I. (\$) _____

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

...CLAIM SUBFOLDER...(New Assignment)

B! Midnight/Investigation

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	04 Jul 2018		05 Jul 2018 14:19 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	TRANS-CAB SERVICES PTE LTD, Co. Reg. No.: 200303878K		
Main Claimant:	SBS TRANSIT DTL PTE LTD, Co. Reg. No.: 201202781W		
Vehicle Reg. No.:	YN4790G	Date of Loss:	23/06/2018 00:00 - :59
Claim Type:	TP / C0474010	Policy/Cover Note No.:	P1680520 (Third Party Only)
Vehicle Reg. No. (Insured):	SHD151G	Policy No. (Claimant):	
		Excess:	S\$5,000.00
Repairer:	Spark Car Care @ Ubi (HQ) 320 UBI ROAD 3, 408649 Ubi - Tel:		
Handling Insurer:	AXA Insurance Pte Ltd (HQ) - Tel: 6338 7288 ... [Handled by Cynthia Loh - 68804843]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 16/07/2018]		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- AXA_SG (05/07/2018): WP / New TP Assignment - C0474010/P1680520

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date Priority Type Task Group Subject Handler Assigned By Completed On Created On Done?

No results.

1-03pm @ 6/7/18
person @ johari
vehicle in



Commonwealth Engineering

320 UBI ROAD 3 SINGAPORE 408649

ACCIDENT REPAIR ESTIMATES

Our Ref:

Type of Claim : TPVehicle No. : YN4790CMake & Model : ISUZU/NJR85AUE6W-3.0 DYear of Manufacture : 2013Chassis No. : NJR857030594Ins Company : AXAEngine No. : 4JJ1381184Excess : Policy No. : COVER NOTE NO.98035Date of Accident : 6/23/2018Time of Accident : 13:34Suggested Days of Repair :

In-house Vehicle Assessor

Repair EstimatesCase Owner : JOHARISignature : Parts (a) Cost / List Price Items \$-Plus/Less \$-Total of Cost / List \$-(b) Nett Price Items \$14,293.60Less 15% \$2,144.04Total of Nett Item \$12,149.60(c) Special Nett Items \$150.00Total Parts Cost (Appendix A) \$12,149.60Labour (Appendix B) \$5,060.00Total Repair Cost \$17,209.60

Contact No

6848 5726 - Jasmine Chng

Ubi_cr@sparkcarcare.com

LNK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

The above total will be subjected to 7% G.S.T.

*Not Authorized*Name of Surveyor : Morris LimCompany : SPKSurvey conducted on : 6/7/18 at Spn.**Remarks By Surveyor**

(a) The repair of this vehicle is authorized / is not authorized until further notice.

(b) Recommended Days of Repair : 12 day(s)

(c) Resurvey : Required / Not Required

(d) Excess : \$ (e) Signature of surveyor : Date:

Spark Car Care

ComfortDelGro Engineering Pte Ltd
320 UBI ROAD 3 SINGAPORE 408649
TEL :68438723/68438736 Fax:67436072

Spare Parts

Vehicle No : YN4790C Case Owner : JOHARI

Make & Model : ISUZU/NJR85AUE6W-3.0 D Year Manufacture : 2013

Chassis No : NJR857030594 Engine No : 4JJ1381184

Sales Order : _____ Supplier : _____

Order By : _____ Type of Claim : TP

S/No	Part Description	QTY	Cost Price	List Price	Nett Price	S/N
1	FRONT WINDSCREEN	1		\$1,645.00	Cnc ✓	
2	FRONT WINDSCREEN RUBBER	1		\$142.80	me ✓	
3	FRONT WINDSCREEN RUBBER LOWER	1		\$142.80	me ✓	
4	FRONT WINDSCREEN SIDE GARNISH RH	1		\$25.50	me ✓	
5	FRONT WINDSCREEN SIDE GARNISH LH	1		\$25.50	me ✓	
6	FRONT PANEL	1		\$720.00	side ✓	
7	FRONT PANEL ISUZU WORDING	1		\$120.00	me ✓	
8	FRONT PANEL LH SIDE	1		\$279.00	Cnc/Cnc ✓	
9	FRONT PANEL LH SIDE TOP COVER	1		\$47.60	me ✓	
10	FRONT HEAD LAMP LH	1		\$441.00	sup ✓	
11	FRONT HEAD LAMP RH	1		\$447.00	holder ✓	
12	FRONT HEAD LAMP BRACKET LH	1			? X	
13	FRONT SIDE LAMP LH	1		\$153.00	sup ✓	
14	FRONT SIDE LAMP RH	1		\$153.00	me ✓	
15	FRONT BUMPER	1		\$546.00	me ✓	
16	FRONT BUMPER BRACKET LH	1		\$153.00	sup ✓	
17	FOG LAMP LH	1		\$285.00	? X	
18	FOG LAMP BRACKET LH	1		\$98.00	? X	
19	LHF DOOR LOCK CYLINDER OUTER	1		\$80.00	me X	
20	LHF DOOR LOCK CYLINDER OUTER	1		\$80.00	me X	
21	LHF DOOR LOCK	1		\$198.00	me/Jo ✓	
22	LHF DOOR RUBBER	1		\$98.00	me ✓	
23	LHF DOOR TRIM BOARD	1		\$342.00	me/c.g ✓	
24	LHF DOOR GLASS	1		\$402.00	Sheld ✓	
25	LHF DOOR POWER WINDOW MOTOR	1		\$288.00	? X	
26	LHF DOOR POWER WINDOW REGULATOR	1		\$142.80	? Dmg ✓	
27	LHF DOOR POWER WINDOW SWITCH	1		\$204.00	? X	
28	LHF DOOR INNER LOCK LEVER	1		\$32.00	? X	
29	LHF DOOR GLASS INNER MOULDING	1		\$99.00	me ✓	
30	LHF DOOR GLASS OUTER MOULDING	1		\$99.00	me ✓	

Note: If any of the quoted parts are recommended to be repaired, then an additional labour charge will be charged accordingly under supplementary.

7484

Spark Car Care

ComfortDelGro Engineering Pte Ltd
320 UBI ROAD 3 SINGAPORE 408649
TEL :68438723/68438736 Fax:67436072

Spare Parts

Vehicle No : YN4790CCase Owner : JOHARIMake & Model : ISUZU/NJR85AUE6W-3.0 DYear Manufacture : 2013Chassis No : NJR857030594Engine No : 4JJ1381184Sales Order : 0Supplier : 0Order By : 0Type of Claim : TP

S/No	Part Description	QTY	Cost Price	List Price	Nett Price	S/N
31	LHF DOOR GLASS FRONT CHANNEL	1		\$102.00	? Best ✓	
32	LHF DOOR GLASS REAR CHANNEL	1		\$51.00	? nn X	
33	LHF DOOR GLASS CHANNEL RUBBER	1		\$112.20	? nn X	
34	LHF DOOR OUTER GARNISH	1		\$185.00	? nn X	
35	LHF DOOR SIDE SIGNAL	1		\$91.80	? nn X ✓ cracked	
36	LHF DOOR GARNISH (AT DOOR LOWER)	1		\$100.30	? ✓ Deformed	
37	LHF DOOR HINGE TOP	1		\$119.00	? ✓ Best	
38	LHF DOOR HINGE BOTTOM	1		\$119.00	? ✓	
39	LHF DOOR CHECKER	1		\$66.30	? X nn	
40	LHF DOOR CATCH	1		\$42.50	? X nn	
41	LHF A-PILLER RUBBER	1		\$150.00	? X nn	
42	LHF A - PILLER PANEL	1		\$1,425.00	? X nn	
43	LHF A- PILLER PANEL BOTTOM	1			? X nn	
44	LHF CANTER PILLER LOWER GARNISH	1		\$172.00	? X nn Deformed	
45	LHF WHEEL HOUSE	1			? X nn	
46	LHF DOOR SPECKER	1		\$75.00	? X nn	
47	FRONT DASHBOARD	1		\$1,170.00	? ✓ cracked	
48	LHF STEP PANEL	1		\$210.00	? X nn	
49	LHF DOOR STEP GARNISH	1		\$172.50	? X nn	
50	AIR CON CONDENSER	1		\$450.00	? X nn	
51	AIRCON CONDENSER BRACKET	2		\$270.00	? X nn	
52	AIR CON CONDENSER FAN MOTOR	1		\$320.00	? X nn	
53	AIR CON CONDENSER FAN MOTOR BLADE	1		\$95.00	? X nn	
54	AIR CON CONDENSER FAN MOTOR HOUSING	1		\$280.00	? ✓ cracked	
55	AIR CON COIL	1		\$340.00	? X nn	
56	AIR CON COIL HOUSING	1		\$1,358.00	? X nn	
57	AIR CON BLOWER MOTOR	1		\$570.00	? X nn	
58	AIR CON BLOWER MOTOR HOUSING	1			? X nn	
59	AIR CON VALVE	1		\$115.00	? X nn	
60	AIR CON DRYER	1		\$98.00	? X nn	

Note: If any of the quoted parts are recommended to be repaired, then an additional labour charge will be charged accordingly under supplementary.

823-9.60

03/07/2018

133P6-71

5:24 PM

Spark Car Care

ComfortDelGro Engineering Pte Ltd
320 UBI ROAD 3 SINGAPORE 408649

TEL :68438723/68438736 Fax:67436072

Spare Parts

Vehicle No : YN4790C Case Owner : JOHARI

Make & Model : ISUZU/NJR85AUE6W-3.0 D Year Manufacture : 2013

Chassis No : NJR857030594 Engine No : 4JJ1381184

Sales Order : 0 Supplier : 0

Order By : 0 Type of Claim : TP

S/No	Part Description	QTY	Cost Price	List Price	Nett Price	S/N
61	NUMBER PLATE (FRONT)	1			\$45.00	<i>sep</i>
62	IU BRACKET	1			\$25.00	<i>rev</i>
63	INNER SEAL <i>Sealant</i>	1			\$80.00	<i>rev</i>
64		0				
65		0			<i>450</i>	
66		0				
67		0				
68		0				
69		0				
70		0				
71		0				
72		0				
73		0				
74		0				
75		0				
76		0				
77		0				
78		0				
79		0				
80		0				
81		0				
82		0				
83		0				
84		0				
85		0				
86		0				
87		0				
88		0				
89		0				
90		0				

Note: If any of the quoted parts are recommended to be repaired, then an additional labour charge will be charged accordingly under supplementary.

Spark Car Care

ComfortDelGro Engineering Pte Ltd
320 UBI ROAD 3 SINGAPORE 408649
Tel: 68438723/68438736 FAX : 67436072

Labour

Vehicle No. : YN4790C Case Owner : JOHARI
Make & Model : ISUZU / NJR857030594 Year of Manufacture :

S/No	Labour Description	Estimated Price	Adjusted Price
	To disconnect and check electrical wiring, wire socket, etc, remove and reinstall damage parts, test and retify for function.	\$120.00	30
			\$120.00
	To remove and replace A/C condenser and A/C system as well as refill A/C gas and replace A/C fan motor complet.	\$280.00	100
			\$120.00
	To remove and replace front windscreen.	\$180.00	100
			\$120.00
	To remove and replace font dashboard	\$320.00	180
			\$220.00
	To dismantle and transfer door, fittings and mechanis to new door facilitate repair (LHF)	\$280.00	60
			\$280.00
	To remove and reinstall wiper compartment such wiper motor and wiper blades.	\$200.00	150
			\$50.00
	Cut & weld , front outer panel , LHF A- pillar , LHF wheel housing and step panel.	\$1,500.00	1400
	Knock & repair front inner penal.	\$450.00	
			100.00
	To remove and reinstall front passanger seat , carpet ,roof linning or upholstery to facilitate repairs	\$280.00	80
			1200.00
	Putty and spray paint , front inner panel , outer panel , A- pillar LHF , wheel house LHF , step panel LHF and front door LHF.	\$1,450.00	1100
		540	
		18596.31	
		22238.28	

Note: The above estimate of repair is based on visual assessment of the external affected areas. Any additional damages observed during the course of repair will be quote accordingly as a supplementary.

Supplementary

VEHICLE NO.: YN4790C
 MAKE: ISUZU/NJR85AUE6W-3.0 D
 MODEL:
 YEAR OF MAKE: 2013
 CHASSIS NO.: NJR857030594

0

PAGE 1

COST / LIST

S/N	Parts Description	PART NUMBE	Qty	Remarks	
				COST	LIST
1	FRONT LH DOOR LOCK CYLINDER OUTER <i>2nd</i>		1	✓	\$80.00
2	FRONT LH DOOR POWER WINDOW MOTOR <i>2nd</i>		1	✓	\$230.00
3	FRT PANEL & LHF DOOR STICKER <i>new</i>		1	✓	\$104.00
4	FRONT LH DOOR <i>Buckled</i>		1	✓	\$779.00
5	FOG LAMP LH <i>reached</i>		1	✓	\$292.00
6	FRT LH DOOR GLASS REAR CHANNEL <i>3rd 2nd</i>		1	✓	\$65.00
7	FRT LH DOOR GLASS CHANNEL RUBBER <i>2nd</i>		1	✓	\$84.00
8	FRONT GRILLE <i>Missing</i>		1	✓	\$373.00
9	FRT LH HOUSING UNDERSHIELD <i>new crimped</i>		1	✓	\$114.00
10	FRT LH A- PILLAR PLASTIC <i>new 2nd</i>		1	✓	\$75.00
11	LH CONER SQUARE CLIPS <i>?</i>		2	✓	\$20.80
12	LH CONER COVER ROUND BASE CLIPS <i>new</i>		3	✓	\$23.40
13	FRONT PANEL TOP CLIPS		4	✓	\$24.00
14	FRONT PANEL BOTTOM CLIPS		2	✓	\$8.00
15	LH MIRROR STAY CAP <i>Missing</i>		1	✓	\$15.00
16	LH HEADLAMP LOWER RUBBER <i>Missing</i>		1	✓	\$19.00
17	LH ROUND SIDE MIRROR <i>new new</i>		1	X	\$50.00
18	BIG AIR CON BLOWER MOTOR <i>Cracked</i>		1	✓	\$1,261.00
19	FRT DOOR SIDE LAMP BASE <i>cracked</i>		1	✓	\$21.00
20					
21					
22					
23					
24					
25					
26					
27					
28					
29					
30					

→ not before
no 6.9.

(A)

→ not before

638.70
800
3092.49

Spark Car Care

ComfortDelGro Engineering Pte Ltd
320 UBI ROAD 3 SINGAPORE 408649
Tel: 68438723/68438736 FAX : 67436072

Labour

Vehicle No. : YN4790C
Make & Model : ISUZU / NJR857030594

Case Owner :
Year of Manufacture :

: JOHARI
: 2013

S/No	Labour Description	Estimated Price	Adjusted Price
	To disconnect and check electrical wiring, wire socket, etc, remove and reinstall damage parts, test and rectify for function.	\$120.00	\$30.00
	To remove and replace A/C condenser and A/C system as well as refill A/C gas and replace A/C fan motor complet.	\$280.00	\$120.00
	To remove and replace front windscreen.	\$180.00	\$120.00
	To remove and replace front dashboard	\$320.00	\$220.00
	To dismantle and transfer door, fittings and mechanisms to new door facilitate repair (LHF)	\$280.00	\$80.00
	To remove and reinstall wiper compartment such wiper motor and wiper blades.	\$200.00	\$50.00
	Cut & weld , front outer panel , LHF A- pillar , LHF wheel housing and step panel. Knock & repair front inner panel.	\$1,500.00	\$1,400.00
	To remove and reinstall front passenger seat , carpet , roof lining or upholstery to facilitate repairs	\$280.00	\$100.00
	Putty and spray paint , front inner panel , outer panel , A- pillar LHF , wheel house LHF , step panel LHF and front door LHF.	\$1,450.00	\$1,200.00
*	To knock , repair & straighten left hand front A pillar , wheelhouse , floor panel & affected areas.	\$550.00	300

Note: The above estimate of repair is based on visual assessment of the external affected areas. Any additional damages observed during the course of repair will be quote accordingly as a supplementary.

Spark Car Care
ComfortDelGro Engineering Pte Ltd

Addendum Sheet Pg. 1

GENERAL INSURANCE ASSOCIATION OF SINGAPORE RECORDS MANAGEMENT CENTRE

IMPORTANT NOTE: Please submit the completed Addendum form to the same Authorised Reporting Centre with whom you submitted the Original Report.

ADDENDUM

(A) PARTICULARS OF PERSON MAKING THE AMENDMENTS:

Original Report No : _____ Vehicle Registration No : YN 4790 L
Name(as shown in NRIC): _____
(*Vehicle Driver / Vehicle Owner) (*) Please delete as appropriate
NRIC/Passport No : _____
Address : _____
Contact (Tel) : _____ (H/P) : _____
(Email) : _____
Date of Accident : _____ Time of Accident : _____
Place of Accident : _____
Insurance Company : _____

(B) ADDITIONAL INFORMATION / AMENDMENTS:

I have made a report on the above mentioned accident and would like to include additional information or make the following amendments:

3rd party changed OD recovery.

SBS Transit DTL Pte. Ltd.
Power & Electrical Services Dept
Gall Batu Downtown Line MRT Depot
650 Woodlands Road
Singapore 77730
Date: _____

[Signature]
5/9/18

10 Anson Road #06-10 International Plaza Singapore 079903 Phone : +65 6224 0010 Fax : +65 6224 0030
Operating Hours : Monday to Friday 9am to 5pm

Poh Kin (LKKAUTO)

From: Poh Kin (LKKAUTO)
Sent: Saturday, 8 September 2018 12:53 PM
To: 'claims'
Cc: Hsiao Tong (LKKAUTO); 'carrisalee@ava-ins.com'; 'icewong@ava-ins.com'; 'foonghon@ava-ins.com'
Subject: ROAD TRAFFIC ACCIDENT INVOLVING VEHICLE NOS. SHD 151G AND YN 4790G ALONG BUKIT TIMAH ROAD ON 23.06.2018

08/09/2018

Trans-Cab Taxi
Singapore

Dear Sir/Madam,

Our Ref: CC4/AXA18012348/Ufa3
Your Ref: SHD 151G

ROAD TRAFFIC ACCIDENT INVOLVING VEHICLE NOS. SHD 151G AND YN 4790G ALONG BUKIT TIMAH ROAD ON 23.06.2018

We refer to the above subject matter. We write to inform you that we are the loss adjuster appointed by your motor insurer, AXA Insurance Pte Ltd to deal with the third party Property Damage claim against your policy.

We have received a claim from M/s ComfortDelgro Engineering Pte Ltd, acting on behalf of the owner of YN 4790G against your motor insurance policy.

Based on the accident report, accident scenario, it was reported that your vehicle had collided to Third Party vehicle YN 4790G while changing lane. As such, liability is down against us.

We also wish to advise that there is an excess of **S\$5,000.00** attached with Third Party Claims. Please be informed that you shall be liable for the excess following any settlement of the third party claim.

As Insurers, AXA shall proceed to deal with the claim(s) subject to the merits of the case and according to the rights afforded under the policy. Should you not be seeking the protection of your policy and seek to take conduct of third party claim(s) arising from this incident, at your own cost and defence, please reply to us within 7 days from the date of this letter. Your intent must be formally expressed to AXA and acknowledged by AXA.

Your full co-operation in the handling of the claim is required and kindly submit the following **if not provided at AXA's reporting centre**. The list below is not all inclusive and further document may be required:

- Police report, Police Investigation result, appeal against the Traffic Police offence and status (if any)
- Driver's driving license or foreign driving license (if any)
- Coloured photographs of accident scene (if any)

- Coloured photographs of damage to all vehicles involved (if any)
- Video footage of accident (if any)
- Statement and/or police report from independent witness(es) (if any)
- If you or your passenger(s) are filing a claim against any of the involved Third Party(s), you are to keep us informed of your legal representative(s) and the status of the claim.

To protect your interest(s) in the handling of this claim, please do not discuss liability with any of the Third Party(s) and/or their legal representatives, or make any compromise or settlement without our prior knowledge and consent. If you receive any correspondence or legal document such as a Writ of Summons in connection with this accident, please forward it to AXA immediately. You may email it to cst@axa.com.sg / pohkin@lkkauto.com or deliver it by hand to our Customer Care Centre.

This letter should **not** be regarded as a waiver by AXA of their rights to repudiate any claim because of any breach of policy terms and conditions you and/or your authorised driver may have committed.

In the event of receiving and handling of any third party injury claim(s), AXA shall keep you informed of the final indemnity upon conclusion of the matter(s).

If you need any clarification, please do not hesitate to contact us at 6841 2132 or email us at pohkin@lkkauto.com.

Please quote the claim reference when you contact us that we can assist you more effectively.

Best Regards,

Poh Kin, Chong (Mr) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6841-2132 | email: pohkin@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



Auto
Consultants
Pte Ltd

Save the Earth. Print only when necessary.

This e-mail contain confidential and privileged material, and are for the sole use of the intended recipient. Use or distribution by an unintended recipient is prohibited, and may be a violation of law. If you believe that you received this e-mail in error, please do not read this e-mail or any attached items. Please delete the e-mail and all attachments, including any copies thereof, and inform the sender that you have deleted the e-mail, all attachments and any copies thereof. Thank you.

...CLAIM SUBFOLDER...(Pending for Survey Report)

BI Proceed Direct Settlement

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	04 Jul 2018		05 Jul 2018 14:19 Edit Adj Rpt	S\$11,650.00 Edit Estimates	S\$11,650.00 View Rpt		Pending for Survey Report Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	TRANS-CAB SERVICES PTE LTD, Co. Reg. No.: 200303878K		
Main Claimant:	SBS TRANSIT DTL PTE LTD, Co. Reg. No.: 201202781W		
Vehicle Reg. No.:	YN4790G	Date of Loss:	23/06/2018 00:00 - :59 [53 Months and 24 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / C0474010	Policy/Cover Note No.:	P1680520 (Third Party Only)
Vehicle Reg. No. (Insured):	SHD151G	Policy No. (Claimant):	M493107
		Excess:	S\$5,000.00
Repairer:	ComfortDelGro Engineering Pte Ltd (Ubi) 320 UBI ROAD 3, 408649 Ubi - Tel:		
Handling Insurer:	AXA Insurance Pte Ltd (HQ) - Tel: 6338 7288 ... [Handled by Vale Oh - 6880 4897]		
Claimant's Insurer:	India International Insurance Pte Ltd (HQ) - Tel: 63476100		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Final Rpt due 16/07/2018]		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- AXA_SG (30/08/2018): TP settlement - C0474010/P1680520
- AXA_SG (28/08/2018): PLS UPDATE TP MATTER IS UNDER INVESTIGATION-VO
- AXA_SG (14/07/2018): Re: Direct Settlement - Accident Involving SHD151G (OI : AXA - C0474010) and YN4...
- AXA_SG (05/07/2018): WP / New TP Assignment - C0474010/P1680520

ALL ASSOCIATED TASKS
































 



[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)



























 
















Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

2

Claim Documents

***YN4790G (C0474010)**
[SHD151G]
TP
SBS TRANSIT DTL PTE LTD
Jun 23 2018 12:00AM
[TRANS-CAB SERVICES PTE LTD]
ComfortDelGro Engineering Pte Ltd

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser ▼	
Photos/Images			3 per page ▼	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
2	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
3	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
4	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
5	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
6	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
7	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
8	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
9	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
10	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
11	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
12	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
13	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
14	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
15	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
16	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
17	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
18	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
19	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
20	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
21	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
22	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
23	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
24	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
25	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
26	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
27	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
28	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
29	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
30	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
31	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
32	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
33	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
34	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
35	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page ▼	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
36	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
37	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
38	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
39	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
40	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
41	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
42	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
43	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
44	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
45	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
46	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
47	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
48	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
49	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
50	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
51	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
52	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
53	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
54	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
55	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
56	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
57	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
58	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
59	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
60	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
61	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
62	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
63	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
64	03/06/19 16:09	General View	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page ▼	<input checked="" type="checkbox"/>
No	Finalized On	AXA Insurance Pte Ltd (HQ)	Thumbnail	Print
1	04/07/18 09:24	EMAIL_ABS	 Load PDF	
2	04/07/18 09:24	ESTIMATE_ABS	 Load PDF	
3	04/07/18 09:24	GIA SHD151G INSD_ABS	 Load PDF	
4	04/07/18 09:24	GIA YN4790G TP_ABS	 Load PDF	
5	28/08/18 17:01	STATEMENT	 Load PDF	
6	31/01/19 14:12	TP LOD	 Load PDF	
7	07/02/19 09:26	TP SR	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	09/07/18 12:05	Immediate Advice	 Load PDF	
2	09/07/18 12:14	LKK SURVEY PHOTO-1	 Load PDF	
3	09/07/18 12:14	LKK SURVEY PHOTO-2	 Load PDF	
4	09/07/18 12:14	LKK SURVEY PHOTO-3	 Load PDF	
5	10/07/18 12:02	TP ESTIMATE - MARKED	 Load PDF	
6	26/03/19 09:19	Letter to OI	 Load PDF	
7	26/03/19 09:19	TP convert to OD claim	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST

[Reset](#) [Save](#) [Print](#)

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AXA18012348/UFA3S2

Date: 03/06/2019

REFERENCE

Handling Insurer:	AXA Insurance Pte Ltd	Policy No:	P1680520
Claimant Vehicle No :	YN4790G	Insured Vehicle No :	SHD151G
Date of Loss:	23/06/2018	Nature of Claim:	TP
		Claim No:	C0474010

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	YN4790G	Engine No:	4JJ1381184
Make & Model:	ISUZU NJR85AUE6W, 3.0 D (M)	Chassis No:	NJR857030594
Reg. Date:	30/12/2013 (Man. Year: 2013)	Odometer:	63861 km
Colour:	Multi-colour		
Engine Capacity:	2999 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	195/75R15	Rear Tyre Size:	195/75R15 (D)
Front Left Side:	Yokohama 5 mm	Rear Left Side:	Yokohama 5/5 mm
Front Right Side:	Yokohama 5 mm	Rear Right Side:	Yokohama 5/5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,628.78	10,975.43	5,653.35	34.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,610.00	3,620.00	1,990.00	35.47
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	22,238.78	14,595.43	7,643.35	34.37
Approved Total (Overridden) (S\$)		11,650.00		
(S\$)	22,238.78	11,650.00	10,588.78	47.61
+ GST 7.00/7.00% (S\$)	1,556.71	815.50	741.21	47.61
Nett Amount (S\$)	23,795.49	12,465.50	11,329.99	47.61

INSPECTION

Date of Assignment:	05/07/2018	
Date Inspected:	06/07/2018	Inspected At: ComfortDelGro Engineering Pte Ltd (Ubi) 320 UBI ROAD 3 Singapore 408649
Estimated Period of Repair:	12.0 days	

Adjuster: MARCUS CHUA

Manager: Chong Poh Kin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but

any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 03 Jun 2019)	
Parts:	N/A	ISUZU NJR85AUE6W 3.0 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for YN4790G)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*FRONT WINDSCREEN (CONSISTENT)	Cracked	1,645.00 FN	*1,645.00 FN
2	1	*FRONT WINDSCREEN RUBBER (CONSISTENT)	Necessary	142.80 FN	*142.80 FN
3	1	*FRONT WINDSCREEN RUBBER LOWER (CONSISTENT)	Necessary	142.80 FN	*142.80 FN
4	1	*FRONT WINDSCREEN SIDE GARNISH RH (CONSISTENT)	Not Necessary	25.50 FN	*- FN
5	1	*FRONT WINDSCREEN SIDE GARNISH LH (CONSISTENT)	Not Necessary	25.50 FN	*- FN
6	1	*FRONT PANEL (CONSISTENT)	Badly Dented	720.00 FN	*720.00 FN
7	1	*FRONT PANEL ISUZU WORDING (CONSISTENT)	Necessary	120.00 FN	*120.00 FN
8	1	*FRONT PANEL LH SIDE (CONSISTENT)	Cut / Cracked	279.00 FN	*279.00 FN
9	1	*FRONT PANEL LH SIDE TOP COVER (CONSISTENT)	Missing	47.60 FN	*47.60 FN
10	1	*FRONT HEAD LAMP LH (CONSISTENT)	Broken	441.00 FN	*441.00 FN
11	1	*FRONT HEAD LAMP RH (CONSISTENT)	Holder Cracked	447.00 FN	*447.00 FN
12	1	*FRONT HEAD LAMP BRACKET LH (NPA) (CONSISTENT)	Not Necessary	0.00 FN	*- FN
13	1	*FRONT SIDE LAMP LH (CONSISTENT)	Broken	153.00 FN	*153.00 FN
14	1	*FRONT SIDE LAMP RH (CONSISTENT)	Cracked	153.00 FN	*153.00 FN
15	1	*FRONT BUMPER (CONSISTENT)	Distorted	546.00 FN	*546.00 FN
16	1	*FRONT BUMPER BRACKET LH (CONSISTENT)	Bent	153.00 FN	*153.00 FN
17	1	*FOG LAMP LH (CONSISTENT)	Not Necessary	285.00 FN	*- FN
18	1	*FOG LAMP BRACKET LH (CONSISTENT)	Not Necessary	98.00 FN	*- FN
19	1	*LHF DOOR LOCK CYLINDER OUTER (CONSISTENT)	Not Necessary	80.00 FN	*- FN
20	1	*LHF DOOR LOCK CYLINDER OUTER (CONSISTENT)	Not Necessary	80.00 FN	*- FN
21	1	*LHF DOOR LOCK (CONSISTENT)	Twisted / Jammed	198.00 FN	*198.00 FN
22	1	*LHF DOOR RUBBER (CONSISTENT)	Torn	98.00 FN	*98.00 FN
23	1	*LHF DOOR TRIM BOARD (CONSISTENT)	Deformed / Cracked	342.00 FN	*342.00 FN
24	1	*LHF DOOR GLASS (CONSISTENT)	Shattered	402.00 FN	*402.00 FN
25	1	*LHF DOOR POWER WINDOW MOTOR (CONSISTENT)	Not Necessary	288.00 FN	*- FN
26	1	*LHF DOOR POWER WINDOW REGULATOR (CONSISTENT)	Damaged	142.80 FN	*142.80 FN
27	1	*LHF DOOR POWER WINDOW SWITCH (CONSISTENT)	Not Necessary	204.00 FN	*- FN
28	1	*LHF DOOR INNER LOCK LEVER (CONSISTENT)	Not Necessary	32.00 FN	*- FN
29	1	*LHF DOOR GLASS INNER MOULDING (CONSISTENT)	Bent	99.00 FN	*99.00 FN
30	1	*LHF DOOR GLASS OUTER MOULDING (CONSISTENT)	Bent	99.00 FN	*99.00 FN
31	1	*LHF DOOR GLASS FRONT CHANNEL (CONSISTENT)	Bent	102.00 FN	*102.00 FN
32	1	*LHF DOOR GLASS REAR CHANNEL (CONSISTENT)	Not Necessary	51.00 FN	*- FN
33	1	*LHF DOOR GLASS CHANNEL RUBBER (CONSISTENT)	Not Necessary	112.20 FN	*- FN
34	1	*LHF DOOR OUTER GARNISH (CONSISTENT)	Not Necessary	185.00 FN	*- FN
35	1	*LHF DOOR SIDE SIGNAL (CONSISTENT)	Buckled	91.80 FN	*91.80 FN
36	1	*LHF DOOR GARNISH (AT DOOR LOWER) (CONSISTENT)	Deformed	100.30 FN	*100.30 FN
37	1	*LHF DOOR HINGE TOP (CONSISTENT)	Bent	119.00 FN	*119.00 FN
38	1	*LHF DOOR HINGE BOTTOM (CONSISTENT)	Bent	119.00 FN	*119.00 FN
39	1	*LHF DOOR CHECKER (CONSISTENT)	Not Necessary	66.30 FN	*- FN
40	1	*LHF DOOR CATCH (CONSISTENT)	Not Necessary	42.50 FN	*- FN
41	1	*LHF A-PILLAR RUBBER (CONSISTENT)	Not Necessary	150.00 FN	*- FN
42	1	*LHF A-PILLAR PANEL (CONSISTENT)	Not Necessary	1,425.00 FN	*- FN

Report was unsubmitted during this print-out.

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
43	1	*LHF A-PILLAR PANEL BOTTOM (CONSISTENT) (NPA)	Not Necessary	0.00 FN	*- FN
44	1	*LHF CANTER PILLAR LOWER GARNISH (CONSISTENT)	Deformed	172.00 FN	*172.00 FN
45	1	*LHF WHEEL HOUSE (NPA) (CONSISTENT)	Not Necessary	0.00 FN	*- FN
46	1	*LHF DOOR SPECKER (CONSISTENT)	Not Necessary	75.00 FN	*- FN
47	1	*FRONT DASHBOARD (CONSISTENT)	Cracked	1,170.00 FN	*1,170.00 FN
48	1	*LHF STEP PANEL (CONSISTENT)	No such part	210.00 FN	*- FN
49	1	*LHF DOOR STEP GARNISH (CONSISTENT)	Cracked	172.50 FN	*172.50 FN
50	1	*AIR CON CONDENSER (CONSISTENT)	Bent / Punctured	450.00 FN	*450.00 FN
51	2	*AIRCON CONDENSER BRACKET (CONSISTENT)	Not Necessary	270.00 FN	*- FN
52	1	*AIR CON CONDENSER FAN MOTOR (CONSISTENT)	Not Necessary	320.00 FN	*- FN
53	1	*AIR CON CONDENSER FAN MOTOR BLADE (CONSISTENT)	Not Necessary	95.00 FN	*- FN
54	1	*AIR CON CONDENSER FAN MOTOR HOUSING (CONSISTENT)	Cracked	280.00 FN	*280.00 FN
55	1	*AIR CON COIL (CONSISTENT)	Not Necessary	340.00 FN	*- FN
56	1	*AIR CON COIL; HOUSING (CONSISTENT)	Not Necessary	1,358.00 FN	*- FN
57	1	*AIR CON BLOWER MOTOR (CONSISTENT)	Not Necessary	570.00 FN	*- FN
58	1	*AIR CON BLOWER MOTOR HOUSING (NPA) (CONSISTENT)	Not Necessary	0.00 FN	*- FN
59	1	*AIR CON VALVE (CONSISTENT)	Not Necessary	115.00 FN	*- FN
60	1	*AIR CON DRYER (CONSISTENT)	Not Necessary	98.00 FN	*- FN
61	1	*NUMBER PLATE (FRONT) (CONSISTENT)	Bent	45.00 FS	*45.00 FS
62	1	*IU BRACKET (CONSISTENT)	Necessary	25.00 FS	*25.00 FS
63	1	*INNER SEAL SEALANT (CONSISTENT)	Necessary	80.00 FS	*80.00 FS
64	1	*FRONT LH DOOR LOCK CYLINDER OUTER (CONSISTENT)	Damaged	80.00 FN	*80.00 FN
65	1	*FRONT LH DOOR POWER WINDOW MOTOR (CONSISTENT)	Damaged	230.00 FN	*230.00 FN
66	1	*FRT PANEL & LHF DOOR STICKER (CONSISTENT)	Necessary	104.00 FN	*104.00 FN
67	1	*FRONT LH DOOR (CONSISTENT)	Buckled	779.00 FN	*779.00 FN
68	1	*FOG LAMP LH (CONSISTENT)	Cracked	292.00 FN	*292.00 FN
69	1	*FRT LH DOOR GLASS REAR CHANNEL (CONSISTENT)	Damaged	65.00 FN	*65.00 FN
70	1	*FRT LH DOOR GLASS CHANNEL RUBBER (CONSISTENT)	Damaged	84.00 FN	*84.00 FN
71	1	*FRONT GRILLE (CONSISTENT)	Missing	373.00 FN	*373.00 FN
72	1	*FRT LH HOUSING UNDERSHIELD (CONSISTENT)	Crumpled	114.00 FN	*114.00 FN
73	1	*FRT LH A-PILLAR PLASTIC (CONSISTENT)	Deformed	75.00 FN	*75.00 FN
74	2	*LH CORNER SQUARE CLIPS (CONSISTENT)	Necessary	20.80 FN	*20.80 FN
75	3	*LH CORNER COVER ROUND BASE CLIPS (CONSISTENT)	Necessary	23.40 FN	*23.40 FN
76	4	*FRONT PANEL TOP CLIPS (CONSISTENT)	Necessary	24.00 FN	*24.00 FN
77	2	*FRONT PANEL BOTTOM CLIPS (CONSISTENT)	Necessary	8.00 FN	*8.00 FN
78	1	*LH MIRROR STAY CAP (CONSISTENT)	Missing	15.00 FN	*15.00 FN
79	1	*LH HEADLAMP LOWER RUBBER (CONSISTENT)	Missing	19.00 FN	*19.00 FN
80	1	*LH ROUND SIDE MIRROR (CONSISTENT)	Not Necessary	50.00 FN	*- FN
81	1	*BIG AIR CON BLOWER MOTOR (CONSISTENT)	Cracked	1,261.00 FN	*1,261.00 FN
82	1	*FRT DOOR SIDE LAMP BASE (CONSISTENT)	Cracked	21.00 FN	*21.00 FN

F=Franchise part, S=SpcNett, N=NettItemDisc.

Sub Total (S\$)	19,536.80	12,885.80
- Nett Item Discount on N Items 15.00/15.00% (S\$)	2,908.02	1,910.37
Total Parts (S\$)	16,628.78	10,975.43

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO DISCONNECT AND CHECK ELECTRICAL WIRING, WIRE SOCKETS, ETC, REMOVE AND REINSTALL DAMAGE PARTS, TEST AND RECTIFY FOR RUNCTON.	New	120.00	30.00
2	TO REMOVE AND REPLACE A/C CONDENSER AND A/C SYSTEM AS WELL AS REFILL A/C GAS AND REPLACE A/C FAN MOTOR COMPLET.	New	280.00	120.00
3	TO REMOVE AND REPLACE FRONT WINDSCREEN.	New	180.00	120.00
4	TO REMOVE AND REPLACE FRONT DASHBOARD.	New	320.00	220.00
5	TO DISMANTLE AND TRANSFER DOOR, FITTINGS AND MECHANIS TO NEW DOOR FACILITATE REPAIR (LHF).	New	280.00	80.00
6	TO REMOVE AND REINSTALL WIPER COMPARTMENT SUCH WIPER MOTOR AND WIPER BLADES.	New	200.00	50.00
7	CUT & WELD, FRONT OUTER PANEL, LHF A-PILLAR, LHF A-PILLAR, LHF WHEEL HOUSING AND STEP PANEL. }	New	1,500.00	1,400.00
8	KNOCK & REPAIR FRONT INNER PANEL. }	New	450.00	0.00
9	TO REMOVE AND REINSTALL FRONT PASSENGER SEAT, CARPET, ROOF LINING OR UPHOLSTERY TO FACILITATE REPAIRS.	New	280.00	100.00
10	PUTTY AND SPRAY PAINT, FRONT INNER PANEL, OUTER PANEL, A-PILLAR LHF, WHEEL HOUSE LHF, STEP PANEL LHF AND FRONT DOOR LHF.	New	1,450.00	1,200.00
11	TO KNOCK, REPAIR & STRAIGHTEN LEFT HAND FRONT A PILLAR, WHEELHOUSE, FLOOR PANEL & AFFECTED AREAS.	New	550.00	300.00
Gross Labour Cost (S\$)			5,610.00	3,620.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >