PROGRESSIVE AUTOMOTIVE PTE LTD BLK 3022A UBI ROAD 1 #01-45/46

SINGAPORE 408716 Email: progauto@progauto.

Claim Reference: TP 0718 - 5146 Assessment Number: PA001579

Version: PROGRESS/1

Date Calculated: 14/07/2018 07:12

Full Report - V1 Registration: SLN9823S

Printed: 14/07/2018 14:13

Summary Information

Claim

Location: Printed by:

Authorisation Status: Work Provider:

Claim Reference: Policy Number: Other Reference:

Third Party: Insured Amount: Under Warranty: Warranty Expired: Singapore (SG) Wayne Lim

Interim

AXA Insurance S'pore Pte Ltd

TP 0718 - 5146

TP 0718 - 5146

Currency: Date of Incident: Able to Authorise Repairs: TBA

Repairs Authorised: Estimated Repair Time:

Ouote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

SGD

TBA

12/07/2018

Not Adored
when
20/7/18
when belonger
The

Vehicle Details

Vehicle Manufacturer:

Model: Sub Model:

Model Sheet Number: Registration:

Registration Month:

Registration Year:

VIN Number: Manufacture Year:

Odometer:

Colour:

Steering:

Engine Number: Fuel Level:

Vehicle Status

Vehicle Condition

Pre-Accident Condition:

Brakes Pedal Travel: Place of Inspection:

Pre-Accident Damage:

Elantra BASE MODEL 3092 01 SLN9823S

HYUNDAI

May 2017

KMHD841CMHU366490

2017 Not Known

G4FGGU042123

Model Specs

FROM 06/2016 LED HEADLAMP LED TAILLAMPS

1.6 LTR 94 KW START & STOP SYSTEM TYRES 195/65 HR 15

EMISSION STD EURO 6 TWO COAT METALLIC

AUTO AIR CON

HEADLAMP LEVELLING REARVIEW CAMERA

7-SPEED DCT

TYRE PRESSURE SENSOR WHEELS 6J X 15 ALLOY

ESP

PREPARE OFF VEHICLE

LKK Auto Consultants hence notify the Repairer of the following: To resurvey before/after spray painting

To display damaged part(s) during resurvey

· Parts prices are subject to confirmation

Third party survey is on a "Without Prejudice" basis

. No illegal modification(s) is allowed

Severity of Imparetmentary item(s) must be resurveyed and Vehicle Status of bject to final approval from Insurance Company

Inspection Date of Inspection:

Acknowledged by Repairer 13/07/2018

Date:

Tyres Condition:

Tread Depth LHF: Tread Depth LHR:

Damage Areas:

Tread Depth RHF: Tread Depth RHR: Direction of Impact:

Audatex System Using Manufacturer Times


PROGRESSIVE AUTOMOTIVE PTE LTD


Claim Reference: TP 0718 - 5146 Assessment Number: PA001579

Version: PROGRESS/1

Date Calculated: 14/07/2018 07:12

Full Report - V1 Registration: SLN9823S Printed: 14/07/2018 14:13

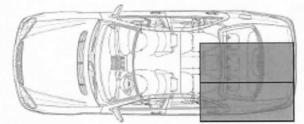

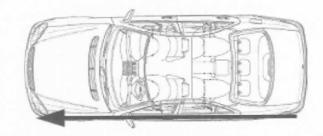

Addresses

Repairer

Name: PROGRESSIVE

Address : Post Code :

Cost Summary

Total Labour	\$1,003.50
Total Paint/Material	\$148.85
Total Parts	\$1,312.15
Total of Additional Costs	\$242.00
Excess:	TBA
Grand Total Exc GST:	\$2,706.50
7 % GST:	\$189.46
Grand Total Inc GST:	\$2,895.96

Repair Information

LABOUR	Time Basis 10 WU	Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR Price/Dent = \$45.00/HR			
Repair /					
Guide Number	Repair Details	WU	Cost	Price (\$)	
86821R00	R + R LEFT REAR WHEELHOUSE SHELL	3.0		13.50	
86821R0R	R + R RIGHT REAR WHEELHOUSE SHELL	3.0		13.50	
86520R00	RENEW REAR BUMPER	9.0		40.50	
	INCLUDES: R + R OUTER TAIL LAMPS AND NECESSARY ATTACHED PARTS				
81750R00	R + R BOOTLID TRIM	2.0		9.00	
87200R00	RENEW BADGE "HYUNDAI"	2.0		9.00	
87400R00 ZAX	RENEW TYPE BADGE BOOTLID	3.0		13.50	
92405R00)	R + R LEFT INNER TAILLAMP	1.0		4.50	
NO NUMBER	RENEW REAR CLOSING PANEL	50.0		225.00	
NO NUMBER	DETACH + REFIT EXHAUST SYSTEM	1.0		4.50	
NO NUMBER	R + R L/R WHEEL	1.0		4.50	
NO NUMBER	R + R R/R WHEEL	1.0		4.50	
2931	REPAIR BOOTLID	20.0*	21	90.00 🗶	
2953	REPAIR L/BOOTLID HINGE	5.0*	11	22.50 📈	
2954	REPAIR R/BOOTLID HINGE	5.0*	11	22.50	
3485	REPAIR L/R OUT QTR PANEL	20.0*	71 1	90.00	
5922	CHECK V-BELT				
LAB	OUR COST				
	Total Work Units	126.0			
	Corrosion Protection External Labour	0.0HRS		0.00	
	Corrosion Protection Internal Labour	0.0HRS		0.00	
	Sub Total	12.6HRS		\$567.00	
	Paint Labour	9.7HRS		\$436.50	

PROGRESSIVE AUTOMOTIVE PTE LTD

Claim Reference: TP 0718 - 5146 Assessment Number: PA001579

Version: PROGRESS/1

Date Calculated: 14/07/2018 07:12

Full Report - V1 Registration: SLN9823S

Printed: 14/07/2018 14:13

Total Labour	22.3HRS	\$1,003.50
Total Eabour		

PAINT WORK	Tir	ne Basis 10 WU = 1 HR. Price	= \$45.00/HR
Guide Numbe	er Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
2640	REAR BUMPER SUPPORT SURFACE PAIN	T 5.0	
2711	REAR PANEL NEW PART PAINTING	23.0	
2583	REAR BUMPER NEW PART PAINT K1R	8.0	
2931	BOOTLID REPAIR PAINTING <50%	13.0	
3485	L/R OUT QTR PANEL REPAIR PAINTING	<50% 14.0	
3572	R/R LAMP FRAME SURFACE PAINT	4.0	
LA	BOUR COST - PAINT		
	TIME(PAINT)	67.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	97.0	
	Total Paintwork Labour	9.7HRS	\$436.50
MA	TERIAL COST - PAINT		Cost Price
	New Part Painting		\$28.60
	New Part Painting - Plastic K1R		\$35.42
	Material-Constant Main Work Metal		\$28.60
	Surface-/Blend Paint		\$8.47
	Repair Painting		\$38.76
	Material-Const Main Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$148.85
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$148.85

PARTS

				Pr	ice Va	alid: 01/	06/2015
lo.Qty	Description	Part Number	Supplier		Bet.	P	rice (\$)
1	BADGE "HYUNDAI"	86321F2000			0%	nu	18.00*
1	L/R BUMPER BRACKET	86613F2000			0%		
1	L/R INNER LAMP	92403F2110			0%		195.00*
1	L/R OUTER LAMP	92401F2110			0%	1500	195.00*
1	L/R REFLECTOR	92405F2000			0%	cm	22.00*
1	MANUFACTURER BADGE	86320F2000			0%	no	25.00*
1	R/R BUMPER BRACKET	86614F2000			0%		28.00* フ
1	REAR BUMPER	86611F2000			0%	5-6	190.00*
1	REAR BUMPER SPOILER	86612F2000			0%	Tul	120.00*
1	REAR BUMPER SUPPORT	86631F2020			0%		140.00*7
1	REAR PANEL	69100F2000			0%	1	165.00*X
1	RR BUMPER CLAMP KIT	USE SINGLE PARTS			0%	in	15.00*
Parts		Sub Total					,141.00
nal		Mark Up From	m Cost	(15%)			171.15
ndhand		Sundry Parts	3	(Fixed)			\$0.00
lel		Total Parts				\$1	,312.15
	No. Qty 1 1 1 1 1 1 1 1 1 1 ndhand lel	1 BADGE "HYUNDAI" 1 L/R BUMPER BRACKET 1 L/R INNER LAMP 1 L/R OUTER LAMP 1 L/R REFLECTOR 1 MANUFACTURER BADGE 1 R/R BUMPER BRACKET 1 REAR BUMPER 1 REAR BUMPER SPOILER 1 REAR BUMPER SUPPORT 1 REAR PANEL 1 RR BUMPER CLAMP KIT Parts nal ndhand lel	1 BADGE "HYUNDAI" 86321F2000 1 L/R BUMPER BRACKET 86613F2000 1 L/R INNER LAMP 92403F2110 1 L/R OUTER LAMP 92401F2110 1 L/R REFLECTOR 92405F2000 1 MANUFACTURER BADGE 86320F2000 1 R/R BUMPER BRACKET 86614F2000 1 REAR BUMPER 86611F2000 1 REAR BUMPER SPOILER 86612F2000 1 REAR BUMPER SUPPORT 86631F2020 1 REAR BUMPER SUPPORT 86631F2020 1 REAR PANEL 69100F2000 1 REAR PANEL 69100F2000 1 RR BUMPER CLAMP KIT USE SINGLE PARTS Parts Sub Total Mark Up From Sundry Parts Total Parts	1 BADGE "HYUNDAI" 86321F2000 1 L/R BUMPER BRACKET 86613F2000 1 L/R INNER LAMP 92403F2110 1 L/R OUTER LAMP 92401F2110 1 L/R REFLECTOR 92405F2000 1 MANUFACTURER BADGE 86320F2000 1 R/R BUMPER BRACKET 86614F2000 1 REAR BUMPER 86611F2000 1 REAR BUMPER SPOILER 86612F2000 1 REAR BUMPER SUPPORT 86631F2020 1 REAR BUMPER SUPPORT 86631F2020 1 REAR PANEL 69100F2000 1 REAR PANEL 69100F2000 1 RR BUMPER CLAMP KIT USE SINGLE PARTS Parts Sub Total Mark Up From Cost Sundry Parts Total Parts	No.Qty Description Part Number Supplier 1 BADGE "HYUNDAI" 86321F2000 1 L/R BUMPER BRACKET 86613F2000 1 L/R INNER LAMP 92403F2110 1 L/R OUTER LAMP 92401F2110 1 L/R REFLECTOR 92405F2000 1 MANUFACTURER BADGE 86320F2000 1 R/R BUMPER BRACKET 86614F2000 1 REAR BUMPER 86611F2000 1 REAR BUMPER SPOILER 86612F2000 1 REAR BUMPER SUPPORT 86631F2020 1 REAR BUMPER SUPPORT 86631F2020 1 REAR PANEL 69100F2000 1 RR BUMPER CLAMP KIT USE SINGLE PARTS Parts Parts Output Mark Up From Cost (15 %) Sundry Parts (Fixed) Total Parts	No.Qty Description Part Number Supplier Bet. 1 BADGE "HYUNDAI" 86321F2000 0% 1 L/R BUMPER BRACKET 86613F2000 0% 1 L/R INNER LAMP 92403F2110 0% 1 L/R OUTER LAMP 92401F2110 0% 1 L/R REFLECTOR 92405F2000 0% 1 MANUFACTURER BADGE 86320F2000 0% 1 R/R BUMPER BRACKET 86614F2000 0% 1 REAR BUMPER 86611F2000 0% 1 REAR BUMPER SPOILER 86631F2020 0% 1 REAR BUMPER SUPPORT 86631F2020 0% 1 REAR PANEL 69100F2000 0% 1 RR BUMPER CLAMP KIT USE SINGLE PARTS 0% Parts Sub Total Mark Up From Cost (15 %) Sundry Parts (Fixed) Total Parts	1 BADGE "HYUNDAI" 86321F2000 0%

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

PROGRESSIVE AUTOMOTIVE PTE LTD

Claim Reference: TP 0718 - 5146 **Assessment Number: PA001579**

Version: PROGRESS/1

Date Calculated: 14/07/2018 07:12

Full Report - V1 Registration: SLN9823S

Printed: 14/07/2018 14:13

Description		Betterment		Price
AUDATEX FEE	SPECIALIST	0%		\$42.00
REAR SENSOR	SPECIALIST			\$200.00 2
		Total Extras		\$242.00
Final Calculation				
Total Parts				\$1,312.15
Labour				
Total Panel/Mechanical			\$567.00	
Total Paintwork			\$436.50	
Total Labour				\$1,003.50
Additional Costs				
Corr Prot Materials Exte	ernal		\$0.00	
Corr Prot Materials Inte	rnal		\$0.00	
Cost of Specialist			\$242.00	
Total of Additional Costs				\$242.00
Total Paint/Material Costs				\$148.85
Grand Total Excludes GST				\$2,706.50
GST @ 7 %				\$189.46
Grand Total Includes GST				\$2,895.96

Assessment Notes