

**K.KIM HIN AUTO PTE LTD**  
**160 Sin Ming Drive**  
**#02-20 Sin Ming AutoCity**  
**Singapore 575722**

**Claim Reference:**  
**Assessment Number: KKHA0013**  
**Version: K.KIMHIN/1**  
**Date Calculated: 28/08/2018 06:51**

**Full Report - V1**  
**Registration: SLE6877D**  
**Printed: 28/08/2018 13:52**

### Summary Information

#### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SANDRA KHONG	Date of Incident:	23/07/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

#### Vehicle Details

##### Vehicle

Manufacturer:	mitsubishi
Model:	Lancer
Sub Model:	EX
Model Sheet Number:	G39 57
Registration:	SLE6877D
Registration Month:	July
Registration Year:	2016
VIN Number:	JMYSRCY1AGU005619
Manufacture Year:	2016
Odometer:	Not Known
Colour:	
Engine Number:	4A92CJ4834
Fuel Level:	%

##### Model Specs



FROM 09/2016	AIR CONDITIONING
XENON HEADLAMPS	FOG LAMPS
DAYTIME RUNNING LIGH	HEADLAMP WASHERS
RADIAT GRILLE SPORT	FRONT MUDFLAPS
HEAD AIRBAG	1.6 LTR 85/86/91KW
6-SPEED GEARBOX	TYRE PRESSURE SENSOR
HEIGHT CONTROL	STABILITY PROGRAM
PASSENGER AIRBAG	ANTI LOCK BRAKES
DRIVER AIRBAG	KNEE AIRBAG
SIDE AIRBAGS	4-DOOR SALOON
FRONT SKIRT	PREPARE OFF VEHICLE
THREE COAT PEARL	

#### Vehicle Condition

##### Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	24/07/2018
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:
Damage Areas:	Direction of Impact:

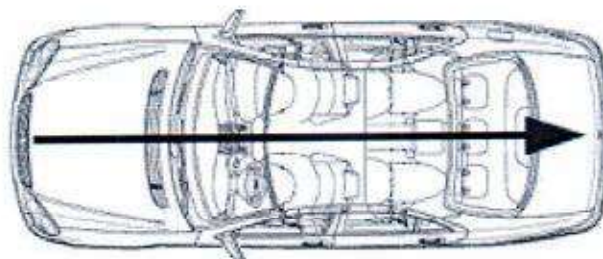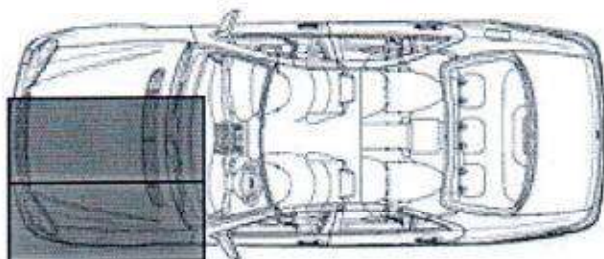

**K.KIM HIN AUTO PTE LTD****Claim Reference:****Assessment Number: KKHA0013****Version: K.KIMHIN/1****Date Calculated: 28/08/2018 06:51****Full Report - V1****Registration: SLE6877D****Printed: 28/08/2018 13:52****Addresses****Repairer**

Name : K.KIM HIN AUTO PTE LTD

Address :

160 SIN MING DRIVE

#02-20

SIN MING AUTOCITY

Post Code : 575722

Email Address : service@kkimhin.com.sg

**Cost Summary**

Total Labour	\$1,368.00
Total Paint/Material	\$354.97
Total Parts	\$2,844.53
Total of Additional Costs	\$42.00
Excess:	TBA
Grand Total Exc GST:	\$4,609.50
7 % GST:	\$322.67
Grand Total Inc GST:	\$4,932.17

**Repair Information****LABOUR****Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR****Price/Dent = \$0.00/HR****Repair /****Guide Number Repair Details**

		<b>WU</b>	<b>Cost Price (\$)</b>
NO NUMBER	PREPARATION TIME	2.0	9.00
514110 10	R + R FRONT BUMPER	8.0	36.00
514121 10)	R + R ATTACHED PARTS OF THE BUMPER (BUMPER WITH FRONT FOG LAMPS)	14.0	63.00
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT (BUMPER REMOVED)	3.0	13.50
425110 00	R + R BONNET	4.0	18.00
425111 10)	RENEW BONNET (REMOVED)	2.0	9.00
	INCLUDES: R + R ATTACHED PARTS, ALIGN BONNET		
425141 10	R + R BONNET LOCK	3.0	13.50
422022 10)	R + R L/F WING	12.0	54.00
	INCLUDES: R + R HEADLAMP AND WHEELARCH TRIM		
422025 10)	R + R R/WING SPLASH SHIELD	4.0	18.00
NO NUMBER	ADJUST HEADLAMPS	2.0	9.00
9852	READ OUT FAULT MEM AFTER REP	30.0*	135.00
1017	REPAIR FRT UPP LOCK CARRIER	20.0*	90.00
1481	REPAIR LEFT FRONT DOOR	10.0*	45.00



# K.KIM HIN AUTO PTE LTD

Claim Reference:  
 Assessment Number: KKHA0013  
 Version: K.KIMHIN/1  
 Date Calculated: 28/08/2018 06:51

Full Report - V1  
 Registration: SLE6877D  
 Printed: 28/08/2018 13:52

## LABOUR COST

Total Work Units	114.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour -	0.0HRS	0.00
Sub Total	11.4HRS	\$513.00
Paint Labour	19.0HRS	\$855.00
Total Labour	30.4HRS	\$1,368.00

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- THREE COAT PEARL		
340	FRT BUMPER REINF SURFACE PAINT	4.0	
341	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	24.0	
741	L/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	13.0	
1481	LEFT FRONT DOOR REPAIR PAINTING >50%	25.0	
284	FRONT BUMPER COVER SURFACE PAINT	9.0	
	ADD/WORK FOR 3-COAT PAINTING		
345	CTR BUMPER BRACKET SURFACE PAINT	4.0	
472	BONNET SURFACE PAINT	10.0	
	ADD/WORK FOR 3-COAT PAINTING		
742	R/F WING SURFACE PAINT	6.0	
743	L/F WING SURFACE PAINT	5.0	
	ADD/WORK FOR 3-COAT PAINTING		
744	R/F WING SURFACE PAINT	5.0	
	ADD/WORK FOR 3-COAT PAINTING		
1010	FRT LWR CROSSMEMBER SURFACE PAINT	5.0	
1017	FRT UPP LOCK CARRIERSURFACE PAINT	4.0	
1019	L/F PANEL SURFACE PAINT	4.0	
1020	R/F PANEL SURFACE PAINT	4.0	
1175	L/F W-HOUSE CONN PNLSURFACE PAINT	4.0	
1187	L/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
1188	R/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
1497	LEFT FRONT DOOR SURFACE PAINT	7.0	
	ADD/WORK FOR 3-COAT PAINTING		

## LABOUR COST - PAINT

TIME(PAINT)	155.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	5.0	
Total Work Units (10WU/HR)	190.0	
Total Paintwork Labour	19.0HRS	\$855.00

## MATERIAL COST - PAINT

New Part Painting	\$98.04
New Part Painting - Plastic K1R	\$64.94
Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$109.93
Repair Painting	\$35.16
Material-Const Main Work Plastic	\$9.00



# K.KIM HIN AUTO PTE LTD

Claim Reference:

Assessment Number: KKHA0013

Version: K.KIMHIN/1

Date Calculated: 28/08/2018 06:51

Full Report - V1

Registration: SLE6877D

Printed: 28/08/2018 13:52

Total Excluding Pearlescent Uplift	\$354.97
Pearlescent Uplift @ 0.0%	\$0.00
<b>Total Paint Material Cost</b>	<b>\$354.97</b>

## PARTS

Guide No. Qty		Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER COVER	6400C075		0%	430.00*
295	1	L/DAYTIME HEADLAMP	8312A045		0%	330.00*
313	1	LWR RADIATOR GRILLE	6402A399		0%	55.00*
340	1	FRT BUMPER REINF	6400A832		0%	60.00*
341	1	FRT BUMPER SUPPORT	6400C639		0%	300.00*
350	6	FRT BUMPER CLAMP KIT	MS100224		0%	10.00*
351	1	L/LOWER AIR GRILLE	8321A089		0%	30.00*
355	1	L/F BUMPER BRACKET	6400F549		0%	13.00*
410	1	GRILLE	7450A780		0%	150.00*
471	1	BONNET	5900A209		0%	370.00*
561	1	L/F HEADLAMP CPL	8301C345		0%	400.00*
741	1	L/F WING	5220G043		0%	270.00*
789	18	L/F WING CLAMP KIT	MS100222		0%	8.00*
1000	1	FRT BUMPER RIVET	\$1.50 @ 15PCS		0%	22.50*
1000	1	L/F WING T I/4 GARNI	Renew		0%	25.00*
f: OEM Parts		Sub Total				\$2,473.50
g: Original		Mark Up From Cost		(15 %)		\$371.03
h: Secondhand		Sundry Parts		(Fixed)		\$0.00
p: Parallel		<b>Total Parts</b>				<b>\$2,844.53</b>
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

## Extras

Description	Betterment	Price
AUDATEX FEE	0%	\$42.00
SPECIALIST		
<b>Total Extras</b>		<b>\$42.00</b>

## Final Calculation

<b>Total Parts</b>	<b>\$2,844.53</b>
<b>Labour</b>	
Total Panel/Mechanical	\$513.00
Total Paintwork	\$855.00
<b>Total Labour</b>	<b>\$1,368.00</b>
<b>Additional Costs</b>	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$42.00
<b>Total of Additional Costs</b>	<b>\$42.00</b>
<b>Total Paint/Material Costs</b>	<b>\$354.97</b>
<b>Grand Total Excludes GST</b>	<b>\$4,609.50</b>
GST @ 7 %	\$322.67
<b>Grand Total Includes GST</b>	<b>\$4,932.17</b>

## Assessment Notes

**Claim Reference:**

**Assessment Number: KKHA0013**

**Version: K.KIMHIN/1**

**Date Calculated: 28/08/2018 06:51**

---

**Full Report - V1**

**Registration: SLE6877D**

**Printed: 28/08/2018 13:52**