

Claim Reference:
Assessment Number: GS001714
Version: LKKAUTOC/2
Date Calculated: 27/08/2018 07:35

Full Report - V1
Registration: SLH5509H
Printed: 27/08/2018 14:36

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	05/08/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:	OD	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	Wish
Sub Model:	BASE MODEL
Model Sheet Number:	YCW 01
Registration:	SLH5509H
Registration Month:	January
Registration Year:	2010
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

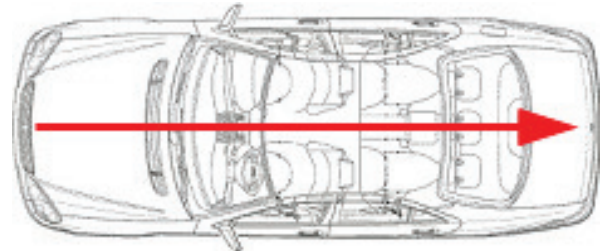
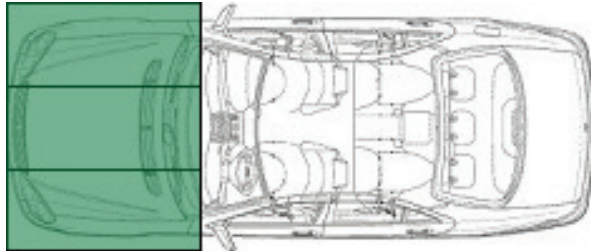
Model Specs

FROM 08/2009	AIR CONDITIONING
1.8 LTR 95 KW	TWO COAT METALLIC
PREPARE OFF VEHICLE	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	06/08/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

**Addresses****Cost Summary**

Total Labour	\$490.50
Total Paint/Material	\$130.70
Total Parts	\$2,414.50
Total of Additional Costs	\$50.00
Excess:	TBA
Grand Total Exc GST:	\$3,085.70
7 % GST:	\$216.00
Grand Total Inc GST:	\$3,301.70

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR

Price/Dent = \$0.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
810151A	ADJUST HEADLAMP	3.0	13.50
531011)	R + R L/F WING	5.0	22.50
	INCLUDES: R + R FRONT BUMPER, HEADLAMP AND WHEELHOUSE COVER		
531011)	RENEW LEFT FRONT WING	1.0	4.50
	INCLUDES: TRANSFER ATTACHED PARTS		
520011)	RENEW FRONT BUMPER (REMOVED)	6.0	27.00
	INCLUDES: REQUIRED ATTACHED PARTS REMOVE AND REFIT		
810051)	R + R RIGHT HEADLAMP	7.0	31.50
530051)	TRANSFER ATTACHED PARTS FROM BONNET	3.0	13.50
530051)	RENEW BONNET	1.0	4.50
	INCLUDES: R + R OR RENEW ATTACHED PARTS		
NO NUMBER	R + R LANDING PANEL SUPPORT	2.0	9.00
883151)	R + R CONDENSER	8.0	36.00
	(FRONT BUMPER REMOVED)		
	INCLUDES: DRAIN + REFILL AIR CONDITIONING		
	DOES NOT INCLUDE: DETACH + REFIT RADIATOR		
NO NUMBER	DETACH + REFIT RADIATOR	4.0	18.00

LABOUR COST**Total Work Units**

40.0

Corrosion Protection External Labour

0.0HRS

0.00

Corrosion Protection Internal Labour

0.0HRS

0.00

Sub Total

4.0HRS

\$180.00

Paint Labour

6.9HRS

\$310.50

Total Labour

10.9HRS

\$490.50

Claim Reference:

Full Report - V1

Assessment Number: GS001714

Registration: SLH5509H

Version: LKKAUTOC/2

Printed: 27/08/2018 14:36

Date Calculated: 27/08/2018 07:35

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	15.0	
741	L/F WING NEW PART PAINTING	10.0	
1018	LOCK CARRIER STRUT SURFACE PAINT	4.0	
742	R/F WING SURFACE PAINT	6.0	
1481	LEFT FRONT DOOR SURFACE PAINT	9.0	
LABOUR COST - PAINT			
	TIME(PAINT)	44.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	69.0	
	Total Paintwork Labour	6.9HRS	\$310.50
MATERIAL COST - PAINT			Cost Price
	New Part Painting		\$64.50
	Material-Constant Main Work Metal		\$28.60
	Surface-/Blend Paint		\$37.60
	Total Excluding Pearlescent Uplift		\$130.70
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$130.70

PARTS

					Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
1000	1	2PCS BONNET HINGES	Renew		0%	60.00*
1000	1	4PCS GRILLE CLIPS	Renew		0%	8.00*
1000	1	8PC SUPPORT TOP	GARNISH CLIPS		0%	16.00*
471	1	BONNET	53301 68012		0%	280.00*
4465	1	CONDENSER	88460 21040		0%	290.00*
281	1	FRONT BUMPER	52119 68061A0		0%	220.00*
340	1	FRONT BUMPER SUPPORT	52021 68010		0%	95.00*
341	1	FRT BUMPER ABSORBER	52611 68020		0%	50.00*
350	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		0%	20.00*
410	1	GRILLE	53111 68030		0%	85.00*
317	1	L/F BUMPER BRACKET	52116 68020		0%	28.00*
561	1	L/F HEADLAMP	81170 68040		0%	330.00*
741	1	L/F WING	53802 68010		0%	220.00*
789	1	L/F WING CLAMP KIT	USE SINGLE PARTS		0%	20.00*
1018	1	LOCK CARRIER STRUT	53208 68010		0%	50.00*
431	1	MANUFACTURER BADGE	75341 68040		0%	30.00*
318	1	R/F BUMPER BRACKET	52115 68020		0%	28.00*
298	1	R/F BUMPER COVER	52127 68040		0%	35.00*
562	1	R/F HEADLAMP	81130 68040		0%	330.00*
f: OEM Parts		Sub Total				\$2,195.00
g: Original		Mark Up From Cost (10 %)				\$219.50
h: Secondhand		Total Parts				\$2,414.50
p: Parallel						
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Claim Reference:

Full Report - V1

Assessment Number: GS001714

Registration: SLH5509H

Version: LKKAUTOC/2

Printed: 27/08/2018 14:36

Date Calculated: 27/08/2018 07:35

Description		Betterment	Price
AIRCON COOLANT	SPECIALIST	0%	\$50.00
		Total Extras	\$50.00
Final Calculation			
Total Parts			\$2,414.50
Labour			
Total Panel/Mechanical		\$180.00	
Total Paintwork		\$310.50	
Total Labour			\$490.50
Additional Costs			
Corr Prot Materials External		\$0.00	
Corr Prot Materials Internal		\$0.00	
Cost of Specialist		\$50.00	
Total of Additional Costs			\$50.00
Total Paint/Material Costs			\$130.70
Grand Total Excludes GST			\$3,085.70
GST @ 7 %			\$216.00
Grand Total Includes GST			\$3,301.70

Assessment Notes