51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

408933

Claim Reference: SHB8083C Assessment Number: MSIG0030

Version: LKKAUTOC/7

Date Calculated: 27/08/2018 10:08

Full Report - V1 Registration: SHB8083C Printed: 27/08/2018 17:08

SGD

TBA

18/08/2018

Summary Information

Claim

Location: Singapore (SG)
Printed by: LKK AUTO
Authorisation Status: Interim

Work Provider: MSIG Insurance

(Singapore) Pte

Claim Reference: SHB8083C

Policy Number:
Other Reference:
Third Party:
Insured Amount:
Under Warranty:
Warranty Expired:

Pte Estimated Repair Time:

Currency:

Date of Incident:

Repairs Authorised:

Able to Authorise Repairs: TBA

Quote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

Vehicle Details

Vehicle

Manufacturer: KIA Model: Optima

Sub Model:
Model Sheet Number:
Registration:
Registration Month:
Registration Year:

BASE MODEL
2836 01
SHB8083C
November
2015

VIN Number:

Odometer:

Colour:

Engine Number:

Fuel Level: %

Model Specs

FROM 05/2015 BASECOAT CLEAR PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Severity of Impact: Steering: Vehicle Status on

Not Known

Inspection:

Brakes Pedal Travel: Date of Inspection: 21/08/2018

Place of Inspection: Pre-Accident Damage:

Tyres Condition:


Tread Depth LHF: Tread Depth RHF: Tread Depth RHR: Damage Areas: Tread Depth RHR: Direction of Impact:


51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SHB8083C Full Report - V1 **Registration: SHB8083C Assessment Number: MSIG0030**

Version: LKKAUTOC/7 Printed: 27/08/2018 17:08

Date Calculated: 27/08/2018 10:08

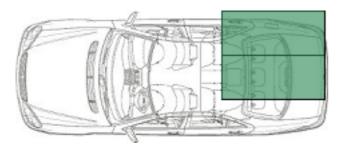

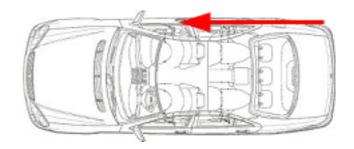

Addresses

Cost	Summa	rv
------	-------	----

Total Labour	\$1,000.00
Total Paint/Material	\$152.51
Total Parts	\$2,252.25
Total of Additional Costs	\$458.00
Excess:	TBA
Grand Total Exc GST:	\$3,862.76
7 % GST:	\$270.39
Grand Total Inc GST:	\$4,133,15

Repair Information

LABOUR	Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
--------	--

		Price/Dent = \$50.00/HR	
Repair /			
Guide Numbe	er Repair Details	WU	Cost Price (\$)
87755R00	R + R R/SILL TRIM	3.0	15.00
86520R00	RENEW REAR BUMPER (REMOVED)	11.0	55.00
86630R00)	R + R REAR BUMPER CARRIER	4.0	20.00
87111R00	REAR SCREEN R + R	22.0	110.00
	INCLUDES: REAR SEAT BACKREST AND ALL		
	REQUIRED TRIMS REMOVE AND REFIT		
69200R00)	R + R BOOTLID	5.0	25.00
NO NUMBER	R + R BOOT LID BADGE	2.0	10.00
NO NUMBER	RENEW R/R SIDE PANEL	72.0	360.00
85875R00)	R + R R/R SILL MOULDING	1.0	5.00
68869R00)	R + R R/LOAD COMPARTMENT TRIM	1.0	5.00
85710R00	R + R BOOT CARPET	2.0	10.00
68869R0B)	R + R L/- AND R/BOOT TRIM (ADD)	2.0	10.00
LAI	BOUR COST		
	Total Work Units	125.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	12.5HRS	\$625.00
	Paint Labour	7.5HRS	\$375.00
	Total Labour	20.0HRS	\$1,000.00

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$50.00/HR		
Guide Nu	mber Description	WU	Cost Price (\$)	
	- PREPARE OFF VEHICLE			
	- BASECOAT CLEAR			
3486	R/R OUTER SIDE PANELNEW PART PAINTIN	G 31.0		
2583	REAR BUMPER NEW PART PAINT K1R	14.0		

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SHB8083C Full Report - V1
Assessment Number: MSIG0030 Registration: SHB8083C

Version: LKKAUTOC/7 Printed: 27/08/2018 17:08

Date Calculated: 27/08/2018 10:08

LABOUR COST - PAINT		
TIME(PAINT)	45.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	75.0	
Total Paintwork Labour	7.5HRS	\$375.00
MATERIAL COST - PAINT		Cost Price
New Part Painting		\$44.55
New Part Painting - Plastic K1R		\$70.36
Material-Constant Main Work Metal		\$28.60
Material-Const Main Work Plastic		\$9.00
Total Excluding Pearlescent Uplift		\$152.51
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$152.51

PARTS

					Price Valid	d: 01/06/2015
Guide No	o. Qty	Description	Part Number	Supplier	Bet.	Price (\$)
3169	1	LWR REAR WINDOW MLDG	871302T000		0%	87.00*
2642	1	R/R C-MEMBER BRACKET	866422T500		0%	54.00*
3288	1	R/R OUTER LAMP	924122T510		0%	421.00*
3486	1	R/R OUTER SIDE PANEL	715042TC00		0%	1,205.00 F
3414	1	R/R REFLECTOR	924062T500		0%	46.00*
3015	1	REAR BADGE	863202T500		0%	29.00*
2583	1	REAR BUMPER	866112T500		0%	696.00*
2644	1	REAR BUMPER DAMPER	866202T500		0%	114.00*
2770	1	REAR BUMPER SPOILER	866122T500		0%	206.00*
2640	1	REAR BUMPER SUPPORT	866312T500		0%	607.00*
3160	1	REAR SCREEN BOND KIT	ZK20063001A		0%	0.00 G
3163	1	REAR SCREEN FIX SET	USE SINGLE PARTS		0%	0.00 F
3173	2	REAR SCREEN SPACER	871143K000		0%	0.00 G
3171	10	REAR SCREEN SUPPORTS	861143D000		0%	0.00 G
f: OEM Pa	irts		Saving			\$103.31
g: Origina	al		Sub Total			\$3,465.00
h: Second	dhand		Deduction from	om RRP	(35 %)	-\$1,212.75
p: Paralle	1		Total Parts			\$2,252.25

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

_				
_	v	+,	-	_
ᆫ	л	u	a	3

x: Exchange

 Description		Betterment	Price
REAR BUMPER CLIPS S	PECIALIST	0%	\$48.00
REVERSE SENSOR S	PECIALIST		\$200.00
SEALANT S	PECIALIST	0%	\$50.00
REAR FENDER S STICKER	PECIALIST		\$60.00
BOOTLID STICKER S	PECIALIST	0% Total Extras	\$100.00 \$458.00

Final Calculation

Total Parts \$2,252.25 Labour

Total Panel/Mechanical

\$625.00

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SHB8083C Full Report - V1
Assessment Number: MSIG0030 Registration: SHB8083C

Version: LKKAUTOC/7 Printed: 27/08/2018 17:08

Date Calculated: 27/08/2018 10:08

Total Paintwork	\$375.00	
Total Labour	\$1	,000.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$458.00	
Total of Additional Costs		\$458.00
Total Paint/Material Costs		\$152.51
Grand Total Excludes GST	\$3	3,862.76
GST @ 7 %		\$270.39
Grand Total Includes GST	<u> </u>	,133.15

Assessment Notes