

ASS. REC. BY:

REF:

ADA/

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / DWS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

03

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

24/8

File pass to Catherine

US\$4350.00 (Rdp 77,228.42 / 94 67%)

Veh No:

SHC 51454

Yr Regn:

01, 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Renault Longitude c.c.

1995

Colour:

M. White / Red

A/C: Insured / Std / NI / NA

Sp. Reading

369189

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

VF/ABL 15AUC 278147

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F: Giti 215/60R16

R: Falken

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

R/Bal.

S

mm

Rear

R/Bal.

7

mm

L/Bal.

S

mm

L/Bal.

7

mm

D.O.A.

20/8/18

D.O.I.

23/8/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or N/S FRT

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

\$ - RS. \$

Fuels

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AXA INSURANCE PTE LTD		Ref : CC3/ASM18015413/Keb3		
8 SHENTON WAY #24-01 AXA TOWERSINGAPORE 068811		Date : 24-08-2018		
		Code : ASM		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJV 4419R	Veh. Inspected	SHC 5145Y	
Policy No.		Coverage (\$)	0.00	
Claim No.	S8M00SSH	Excess (\$)	0.00	
Assign From		Assign Date	24/08/2018	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	20/08/2018	Inspection Date	23/08/2018	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5145Y**AAD1808-178***Not Authorized
L/Sing &*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHC 5145Y

VF1ABL15AUC276147

RENAULT

LATITUDE

20.8.2018

AXA

		PART		LIST	
1	1	BUMPER COVER FRT	\$	<i>Buclum</i> 1,259.42	✓
2	1	BUMPER SPOILER FRT	\$	<i>my</i> 181.75	✓
3	1	BUMPER ABSORBER FRT	\$	<i>Sh</i> 394.68	✓
4	1	BUMPER RETAINER FRT LH	\$	<i>cm</i> 151.41	✓
5	1	BUMPER SUPPORT FRT	\$	<i>Sh</i> 123.88	✓
6	1	BUMPER RETAINER FRT RH	\$	<i>Sh</i> 150.77	✓
7	1	BUMPER SUPPORT FRT	\$	<i>Sh</i> 123.88	✓
8	1	BUMPER UNDERTRAY FRT	\$	<i>cm</i> 472.83	✓
9	1	BUMPER GRILLE LOWER FRT	\$	<i>Sh</i> 266.80	} X
10	1	BUMPER FOG LAMP GRILLE LH	\$	<i>Sh</i> 207.21	
11	1	BUMPER FOG LAMP GRILLE RH	\$	<i>Sh</i> 207.21	
12	1	BUMPER BEAM FRT	\$	<i>R</i> 914.08	
13	1	TOW COVER FRT	\$	<i>Sh</i> 28.61	
14	1	RADIATOR GRILLE	\$	<i>Sh</i> 1,707.78	
15	1	RADIATOR GRILLE BADGE 'RENAULT'	\$	<i>Sh</i> 225.36	
16	1	RADIATOR GRILLE FRAME	\$	<i>Sh</i> 1,353.75	
17	1	FRAME FULL SUPPORT PANEL	\$	<i>Sh</i> 615.90	
18	1	FRAME FULL SUPPORT BRACKET	\$	<i>R</i> 89.79	
19	1	FRONT BRACE PANEL	\$	<i>R</i> 177.22	
20	1	HORN	\$	<i>Sh</i> 314.17	
21	1	HORN BRACKET	\$	<i>R</i> 40.45	
22	1	HEADLAMP LH	\$	<i>cm</i> 1,184.43	✓
23	1	HEADLAMP RH	\$	<i>Sh</i> 1,184.43	✓
24	1	HEADLAMP PANEL FRT LH	\$	<i>R</i> 152.15	✓
25	1	HEADLAMP PANEL FRT RH	\$	<i>R</i> 152.15	✓
26	1	BONNET	\$	<i>R</i> 1,941.63	✓
27	1	BONNET INSULATOR	\$	<i>Sh</i> 405.73	✓
28	1	BONNET STRUT LH	\$	<i>Sh</i> 88.61	✓

Trans-cab Auto Services Pte Ltd**AAD1808-178**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5145Y

29	1	BONNET STRUT RH	\$	88.61	
30	1	BONNET HINGE LH	\$	348.31	
31	1	BONNET HINGE RH	\$	348.31	
32	1	BONNET LOCK	\$	305.48	
33	1	BONNET CABLE	\$	119.19	
34	1	BONNET CABLE COVER	\$	161.03	
35	1	BONNET SEAL OUTER	\$	92.36	
36	1	BONNET SEAL INNER	\$	157.28	
37	1	FENDER PANEL FRT LH	\$	783.83	✓
38	1	WHEELARCH FRT LH	\$	278.84	✓
39	1	FENDER BRACKET LOWER LH	\$	15.79	X
40	1	FENDER INSULATOR LH	\$	130.84	X
41	1	FENDER INSULATOR RH	\$	130.84	X
42	1	WIPER RESERVOIR	\$	348.25	X
43	1	WIPER RESERVOIR NECK	\$	136.11	X
44	1	WIPER RESERVOIR MOTOR	\$	270.06	X
45	1	AIR CLEANER LOWER	\$	271.26	✓
46	1	AIR CLEANER HOSE	\$	76.14	
47	1	BASE BATTERY TRAY	\$	363.40	
48	1	AIR CLEANER BOX	\$	464.20	
49	1	TURBO DUCT	\$	1,027.80	
50	1	A/C HEATER VALVE	\$	484.50	
51	1	SUBFRAME OUTER FRT	\$	2,652.45	
52	1	SUBFRAME BRACKET OUTER LH	\$	92.36	
53	1	ENGINE UNDERTRAY	\$	564.98	
54	1	A/C CONDENSER	\$	2,020.37	
55	1	A/C CONDENSER GARNISH LH UPPER	\$	39.67	
56	1	A/C CONDENSER GARNISH RH UPPER	\$	39.67	
57	1	A/C CONDENSER GARNISH LH	\$	58.81	
58	1	A/C CONDENSER GARNISH RH	\$	59.60	
59	1	A/C PIPE CONDENSER TO COMPRESSOR	\$	208.39	
60	1	A/C PIPE CONDENSER TO EXPENSION VALVE	\$	658.72	
61	1	A/C PIPE COMPRESSOR	\$	334.29	
62	1	A/C PIPE	\$	658.72	
63	1	A/C COMRPRESSOR	\$	2,684.61	
77	1	AIR COOLER	\$	792.60	
78	1	AIR INTERCOOLER HOSE (LONG)	\$	1,014.13	
79	1	AIR INTERCOOLER HOSE (Short)	\$	375.14	

Trans-cab Auto Services Pte Ltd**AAD1808-178**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5145Y

80	1	TRANSMISSION COOLER	\$	Sin	1,219.30	
81	1	TRANSMISSION COOLER PAD	\$	Sin	17.96	
82	1	RADIATOR	\$	Sin	1,202.20	
83	2	RADIATOR STUD UPPER	\$	Sin	14.41	
84	2	RADIATOR BUSH UPPER	\$	Sin	50.12	
85	2	RADIATOR MTG LOWER	\$	Sin	55.85	
86	1	RADAITOR FAN COWLING	\$	Sin	820.54	
87	1	RADIATOR FAN MOTOR LH	\$	Sin	967.36	
88	1	RADIATOR FAN MOTOR RH	\$	Sin	1,479.46	
89	1	RADIATOR TANK	\$	Sin	324.62	
90	1	RADIATOR HOSE UPPER	\$	Sin	240.56	
91	1	RADIATOR HOSE LOWER	\$	Sin	491.18	
92	1	RADIATOR TANK HOSE	\$	Sin	61.18	
93	1	AUTO COMPUTER	\$	nn	5,032.17	?
94	1	INJECTION COMPUTER	\$	nn	4,706.30	?
95	1	RHD HYDRAULIC POWER(ROCK&PINION)	\$	Sin	5,154.52	X
96	1	STEERING PUMP ELECTRIC L70Y	\$	nn	2,306.90	?
97	1	STEERING PINION RACK L70Y	\$	Sin	4,413.11	X
98	1	DOOR PANEL FRT LH	\$	nn	2,844.66	X
99	1	LOWER ARM LH L70Y	\$	Sin	685.76	X
100	1	KUNCKLE ARM LH L70Y	\$	Sin	846.98	X
101	1	ABSORBER FRT LH L70Y	\$	Sin	360.54	X
102	1	AIR CLEANER BOX	\$	Sin	464.20	X
103	1	AIR CLEANER HOSE	\$	Sin	175.85	X
104	1	DOOR HARNESS WIRE LH	\$	nn	2,670.00	?
105	1	DOOR MIRROR ASSY LH	\$	Sin	1,483.40	X
106	1	DOOR PANEL FRT LH	\$	Repealer	2,844.66	X
TOTAL			\$		70,862.14	
10%			\$		7,086.21	
			\$		63,775.92	66336.03

Specical Nett

1	1SET	RADIATOR GRILLE FRAME CLIP	\$	nn	52.00	X
2	1SET	BUMPER CLIP FRT	\$	nn	66.00	✓
3	1	BUMPER BRACKET CLIP FRT LH	\$	nn	12.00	X
4	1	BUMPER SUPPORT CLIP FRT LH	\$	nn	10.50	X
5	1	BUMPER BRACKET CLIP FRT RH	\$	nn	12.00	X

Trans-cab Auto Services Pte Ltd**AAD1808-178**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5145Y

6	1	BUMPER SUPPORT CLIP FRT RH	\$	nn	10.50	}
7	1	TOW COVER FRT	\$	sn	14.50	
8	1SET	RADAIOR GRILLE SCREW	\$	nn	16.00	
9	1SET	BUMPER GRILLE LOWER CLIP	\$	nn	69.00	
10	1SET	FRAME FULL SUPPORT PANEL CLIP	\$	nn	70.00	
11	2	FRAME FULL SUPPORT PANEL NUT	\$	nn	20.00	
12	2	FRAME FULL SUPPORT PANEL STUD	\$	nn	30.00	
13	1	Windscreen moulding	\$	nn	100.00	
14	1SET	Front licence plate with holder	\$	sn	80.00	
15	1	Front left tyre	\$	sn	330.00	
16	1	Front left tyre rim	\$	sn	380.00	}
17	1	FRONT DOOR STICKER 'Trans-cab'	\$	nn	80.00	
18	1	FRONT DOOR STICKER 'Chassis'	\$	nn	50.00	

TOTAL	\$	1,402.50
TOTAL PARTS	\$	65,178.42

LABOUR

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same	\$	5,400.00	500
Towing Fees.	\$	120.00	50
To apply paint protection system (PPS) maintain and enhancement	\$	nn 380.00	X
Putty and spray painting of the affected portion.	\$	6,000.00	660
To rust-proofing of the affected areas.	\$	170.00	30
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	nn 380.00	X
To check steering geometry and computer wheel alignment	\$	nn 220.00	X

Trans-cab Auto Services Pte Ltd**AAD1808-178**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5145Y

To transfer of tire, rim and on wheel balancing.	\$	na	170.00 X
To Check Electrical Lighting Concerned.	\$		170.00 2d
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	na	380.00 X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	na	380.00 X
To lift-up engine with gear box and refit.	\$	na	440.00 X
To remove and renew power steering pump, oil cooler pipe and final checking and testing.	\$	na	440.00 X
To remove and refit air bag system and reset.	\$	na	480.00 X
To drop diesel tank, pipes, hoses to facilitate bodywork repair, final checking and testing.	\$	na	380.00 X
To vacuum, replace, refix and recharge air condenser	\$	na	380.00 X
To replace, refix and top up coolant for radiator	\$	na	170.00 X
To vacuum, replace, refix and recharge Air Intercooler	\$	na	170.00 X
To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.	\$	na	170.00 X

TOTAL \$ 16,400.00**Over All Total \$ 81,578.42****Repair Days (LUMP SUM)****20 DAYS**
3day
84138.63

- LKK Auto Consultants hereby certify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "With a Good Repair" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



Service Request Details

Claim

S8M00SSH

Reference

None 

Loss Date

August 20, 2018

Request Date

August 24, 2018

Due Date

August 31, 2018

Vendor Name

LKK AUTO CONSULTANTS PTE LTD (TP)

Type of Loss

Third Party Vehicle Damage

Services

Pending verification - Direct Settlement

*Kenneth
Trans Cab*

Actions

Next Step

Agree to perform service

Decline Work

Accept Work

Vehicle Information

Incident Vehicle Registration #

SHC5145Y

Make

TPVD RENAULT

Model
LATITUDE-2.0 L (A)

Service Address

...

Primary Contact/Insured

WAHBA S MOHAMED
BLK 772 PASIR RIS STREET 71, #06-366, 510772, Singapore
93865262
SADATWAHBA@GMAIL.COM

Claim Handler

ANG Richard

richard.angbs@axa.com.sg

Additional Instructions

- Messages
- Invoices
- History
- Documents
- Assessment
- Metrics
- Notes
-

New Message

Asher Sng (LKKAuto)

From: Asher Sng (LKKAuto)
Sent: Tuesday, 16 October 2018 3:27 PM
To: Ng Wai Yin; claims@transcab.com.sg
Cc: jasminetan@transcab.com.sg
Subject: ACCIDENT INVOLVING SHC 5145Y & SJV 4419R ON 20/08/2018
Attachments: OI SKETCH PLAN.pdf

'WITHOUT PREJUDICE'
SAVE AS TO COSTS

Your Ref: SHC 5145Y
Our Ref: CC3/ASM18015413/Keb3

Dear Sirs,

ACCIDENT INVOLVING SHC 5145Y & SJV 4419R ON 20/08/2018

We refer to the above matter.

Please be informed that liability is unclear for this matter. Our insured driver reported that your client encroach into his path and collided onto our insured vehicle. Enclosed herewith in this email is a copy of our insured's accident report for your perusal.

We are in a course of investigating into the circumstances of the accident. After verifying further with our OI we will revert with our opinion on the cause of the accident. Kindly do not refer to any party for legal assistance until you heard further from us.

Meanwhile, we would like to request a copy of video footage/witness statement/scene photos(if any) in order for us to look into the matter.

We shall revert upon hearing from you.

Thank You.

Best Regards,

Asher Sng | Case Handler

LKK Auto Consultants Pte Ltd

phone: 6841-6051 | email: ashersng@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Report Remarks Entry - CC3/ASM18015413/Kfb3

Remarks

Remarks

Add

Remarks 1	By	On
☐ SHC 5145Y : SJV 4419R	LSP	24/8/2018 2:37:08 PM
☐ EST : \$ --- SUR : KSC --- WKSP :TRANS-CAB AUTO SERVICES PTE LTD	LSP	24/8/2018 2:37:17 PM
☐ Claim S8M00SSH	LSP	27/8/2018 3:04:41 PM
☐ Services Pending verification - Direct Settlement	LSP	27/8/2018 3:04:46 PM
☐ 8/27/18 2:59 PM ANG Richard----- Pls obtain video footage from TP. Thank you.	LSP	27/8/2018 3:04:58 PM
☐ IA UPLOADED IN VIEWS	LSP	27/8/2018 3:05:41 PM
☐ FILE PASS TO ASHER	LSP	28/8/2018 9:19:56 AM
☐ FILE REVIEW: LIABILITY UNCLEAR.	SRY	16/10/2018 3:11:26 PM
☐ Email wsp to request for evidence.	SRY	16/10/2018 3:11:47 PM
☐ 8/27/18 2:59 PM ANG Richard---- Pls obtain video footage from TP. Thank you.	LSP	20/11/2018 10:10:30 AM
☐ 12/2/18 12:57 PM ANG Richard-Pls advise if TP has video footage. TY.	LSP	3/12/2018 12:35:37 PM
☐ REC'D TP SIGNED LOD & ATA***PASS TO ASHER	STU	28/5/2019 4:24:56 PM
☐ FILE TRANSFER TO POH KIN WITH LOD	SRY	3/6/2019 5:55:29 PM
☐ 6/8/19 8:37 AM ANG Richard-----Pls reject TP claim & submit ur invoice if any. TY.-----HI. pls reject TP claim as their driver was charged by Traffic Police for inconsiderate driving. TY.	LSP	10/6/2019 9:26:11 AM
☐ 7/2/19 9:18 PM ANG Richard ---Re:Pls submit ur invoice if any. TY.	LSP	3/7/2019 9:12:08 AM

English (default) ▼

LKK AUTO CONSULTANTS PTE LTD (TP) ▼



SERVICE REQUESTS

MESSAGES

CLAIMS

<<

Pls reject TP claim & submit ur invoice if any. TY.

Type

🔔 Question

Message

HI, pls reject TP claim as their driver was charged by Traffic Police for inconsiderate driving. TY.

Reply



SINGAPORE
POLICE FORCE

Traffic Police
10 Ulu Arealan 3
Singapore 408565
Tel: +65 6547 0000
Fax: +65 6547 4883
www.police.gov.sg

Our Ref : TP/IP/58153/2018
Date : 21 MAY 2019

S MOHAMED WAHBA
BLK 664A PUNGGOL DRIVE
#04-202
SINGAPORE 821664

Dear Sir/Madam

ROAD TRAFFIC ACCIDENT INVOLVING SHC 5145 Y AND SJV 4410 R ALONG BALESTIER ROAD ON 20/08/2018 AT ABOUT 4.40PM

I refer to the above accident.

Please be informed that we have completed our investigations which revealed that the driver of **SHC 5145 Y** had committed an offence of **Inconsiderate Driving under Section 65(b) of the Road Traffic Act Chapter 276**. Action has been initiated against the driver for the said offence.

Yours faithfully

**HEAD INVESTIGATION
TRAFFIC POLICE
SINGAPORE POLICE FORCE**

This is a computer-generated letter. No signature is required.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AXA INSURANCE PTE LTD

Ref : CC3/ASM18015413/Kfb3s2

8 SHENTON WAY #24-01
AXA TOWERS SINGAPORE 068811

Date : 09-07-2019



ATTN: RICHARD ANG

Code : ASM

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJV 4419R	Veh. Inspected	SHC 5145Y
Policy No.	GA044066	Coverage (\$)	0.00
Claim No.	S8M00SSH	Excess (\$)	0.00
Assign From	RICHARD ANG	Assign Date	23/08/2018

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	VF1ABL15AUC276147	Colour	METALLIC WHITE / RED
Odometer	369169	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60R16	GITI	8 mm
L/H Front Tyre	215/60R16	GITI	8 mm
R/H Rear Tyre	215/60R16	FALKEN	7 mm
L/H Rear Tyre	215/60R16	FALKEN	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	20/08/2018	Inspection Date	23/08/2018
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	3 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5145Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT (CONSISTENT)	BUCKLED / CRACKED	1,259.42	1,259.42
1	BUMPER SPOILER FRT (CONSISTENT)	MISSING	181.75	181.75
1	BUMPER ABSORBER FRT (CONSISTENT)	SERVICEABLE	394.68	-
1	BUMPER RETAINER FRT LH (CONSISTENT)	CRACKED	151.41	151.41
1	BUMPER SUPPORT FRT (CONSISTENT)	SERVICEABLE	123.88	-
1	BUMPER RETAINER FRT RH (CONSISTENT)	SERVICEABLE	150.77	-
1	BUMPER SUPPORT FRT (CONSISTENT)	SERVICEABLE	123.88	-
1	BUMPER UNDERTRAY FRT (CONSISTENT)	CRACKED	472.83	472.83
1	BUMPER GRILLE LOWER FRT (CONSISTENT)	SERVICEABLE	266.80	-
1	BUMPER FOG LAMP GRILLE LH (CONSISTENT)	SERVICEABLE	207.21	-
1	BUMPER FOG LAMP GRILLE RH (CONSISTENT)	SERVICEABLE	207.21	-
1	BUMPER BEAM FRT (CONSISTENT)	TO REPAIR SEE LABOUR	914.08	-
1	TOW COVER FRT (CONSISTENT)	SERVICEABLE	28.61	-
1	RADIATOR GRILLE (CONSISTENT)	SERVICEABLE	1,707.78	-
1	RADIATOR GRILLE BADGE 'RENAULT' (CONSISTENT)	SERVICEABLE	225.36	-
1	RADIATOR GRILLE FRAME (CONSISTENT)	SERVICEABLE	1,353.75	-
1	FRAME FULL SUPPORT PANEL (CONSISTENT)	SERVICEABLE	615.90	-
1	FRAME FULL SUPPORT BRACKET (CONSISTENT)	TO REPAIR SEE LABOUR	89.79	-
1	FRONT BRACE PANEL (CONSISTENT)	TO REPAIR SEE LABOUR	177.22	-
1	HORN (CONSISTENT)	SERVICEABLE	314.17	-
1	HORN BRACKET (CONSISTENT)	TO REPAIR SEE LABOUR	40.45	-
1	HEADLAMP LH (CONSISTENT)	CRACKED	1,184.43	1,184.43
1	HEADLAMP RH (CONSISTENT)	SERVICEABLE	1,184.43	-
1	HEADLAMP PANEL FRT LH (CONSISTENT)	TO REPAIR SEE LABOUR	152.15	-
1	HEADLAMP PANEL FRT RH (CONSISTENT)	TO REPAIR SEE LABOUR	152.15	-
1	BONNET (CONSISTENT)	TO REPAIR SEE LABOUR	1,941.63	-

Report Ref No. CC3/ASM18015413/Kfb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET INSULATOR (CONSISTENT)	SERVICEABLE	405.73	-
1	BONNET STRUT LH (CONSISTENT)	SERVICEABLE	88.61	-
1	BONNET STRUT RH (CONSISTENT)	SERVICEABLE	88.61	-
1	BONNET HINGE LH (CONSISTENT)	TO REPAIR SEE LABOUR	348.31	-
1	BONNET HINGE RH (CONSISTENT)	TO REPAIR SEE LABOUR	348.31	-
1	BONNET LOCK (CONSISTENT)	TO REPAIR SEE LABOUR	305.48	-
1	BONNET CABLE (CONSISTENT)	SERVICEABLE	119.19	-
1	BONNET CABLE COVER (CONSISTENT)	SERVICEABLE	161.03	-
1	BONNET SEAL OUTER (CONSISTENT)	SERVICEABLE	92.36	-
1	BONNET SEAL INNER (CONSISTENT)	SERVICEABLE	157.28	-
1	FENDER PANEL FRT LH (CONSISTENT)	BENT	783.83	783.83
1	WHEELARCH FRT LH (CONSISTENT)	CRACKED	278.84	278.84
1	FENDER BRACKET LOWER LH (CONSISTENT)	SERVICEABLE	15.79	-
1	FENDER INSULATOR LH (CONSISTENT)	SERVICEABLE	130.84	-
1	FENDER INSULATOR RH (CONSISTENT)	SERVICEABLE	130.84	-
1	WIPER RESERVOIR (CONSISTENT)	SERVICEABLE	348.25	-
1	WIPER RESERVOIR NECK (CONSISTENT)	SERVICEABLE	136.11	-
1	WIPER RESERVOIR MOTOR (CONSISTENT)	SERVICEABLE	270.06	-
1	AIR CLEANER LOWER (CONSISTENT)	CRACKED	271.26	271.26
1	AIR CLEANER HOSE (CONSISTENT)	SERVICEABLE	76.14	-
1	BASE BATTERY TRAY (CONSISTENT)	SERVICEABLE	363.40	-
1	AIR CLEANER BOX (CONSISTENT)	SERVICEABLE	464.20	-
1	TURBO DUCT (CONSISTENT)	SERVICEABLE	1,027.80	-
1	A/C HEATER VALVE (CONSISTENT)	SERVICEABLE	484.50	-
1	SUBFRAME OUTER FRT (CONSISTENT)	SERVICEABLE	2,652.45	-
1	SUBFRAME BRACKET OUTER LH (CONSISTENT)	SERVICEABLE	92.36	-
1	ENGINE UNDERTRAY (CONSISTENT)	SERVICEABLE	564.98	-
1	A/C CONDENSER (CONSISTENT)	SERVICEABLE	2,020.37	-
1	A/C CONDENSER GARNISH LH UPPER (CONSISTENT)	SERVICEABLE	39.67	-
1	A/C CONDENSER GARNISH RH UPPER (CONSISTENT)	SERVICEABLE	39.67	-
1	A/C CONDENSER GARNISH LH (CONSISTENT)	SERVICEABLE	58.81	-

Report Ref No. CC3/ASM18015413/Kfb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	A/C CONDENSER GARNISH RH (CONSISTENT)	SERVICEABLE	59.60	-
1	A/C PIPE CONDENSER TO COMPRESSOR (CONSISTENT)	SERVICEABLE	208.39	-
1	A/C PIPE CONDENSER TO EXPENSION VALVE (CONSISTENT)	SERVICEABLE	658.72	-
1	A/C PIPE COMPRESSOR (CONSISTENT)	SERVICEABLE	334.29	-
1	A/C PIPE (CONSISTENT)	SERVICEABLE	658.72	-
1	A/C COMPRESSOR (CONSISTENT)	SERVICEABLE	2,684.61	-
1	AIR COOLER (CONSISTENT)	SERVICEABLE	792.60	-
1	AIR INTERCOOLER HOSE (LONG) (CONSISTENT)	SERVICEABLE	1,014.13	-
1	AIR INTERCOOLER HOSE (SHORT) (CONSISTENT)	SERVICEABLE	375.14	-
1	TRANSMISSION COOLER (CONSISTENT)	SERVICEABLE	1,219.30	-
1	TRANSMISSION COOLER PAD (CONSISTENT)	SERVICEABLE	17.96	-
1	RADIATOR (CONSISTENT)	SERVICEABLE	1,202.20	-
2	RADIATOR STUD UPPER (CONSISTENT)	SERVICEABLE	14.41	-
2	RADIATOR BUSH UPPER (CONSISTENT)	SERVICEABLE	50.12	-
2	RADIATOR MTG LOWER (CONSISTENT)	SERVICEABLE	55.85	-
1	RADIATOR FAN COWLING (CONSISTENT)	SERVICEABLE	820.54	-
1	RADIATOR FAN MOTOR LH (CONSISTENT)	SERVICEABLE	967.36	-
1	RADIATOR FAN MOTOR RH (CONSISTENT)	SERVICEABLE	1,479.46	-
1	RADIATOR TANK (CONSISTENT)	SERVICEABLE	324.62	-
1	RADIATOR HOSE UPPER (CONSISTENT)	SERVICEABLE	240.56	-
1	RADIATOR HOSE LOWER (CONSISTENT)	SERVICEABLE	491.18	-
1	RADIATOR TANK HOSE (CONSISTENT)	SERVICEABLE	61.18	-
1	AUTO COMPUTER (CONSISTENT)	NOT NECESSARY	5,032.17	-
1	INJECTION COMPUTER (CONSISTENT)	NOT NECESSARY	4,706.30	-
1	RHD HYDRAULIC POWER (ROCK & PINION) (CONSISTENT)	SERVICEABLE	5,154.52	-
1	STEERING PUMP ELECTRIC L70Y (CONSISTENT)	NOT NECESSARY	2,306.90	-
1	STEERING PINION RACK L70Y (CONSISTENT)	SERVICEABLE	4,413.11	-
1	DOOR PANEL FRT LH (CONSISTENT)	TO REPAIR SEE LABOUR	2,844.66	-
1	LOWER ARM LH L70Y (CONSISTENT)	SERVICEABLE	685.76	-
1	KNUCKLE ARM LH L70Y (CONSISTENT)	SERVICEABLE	846.98	-
1	ABSORBER FRT LH L70Y (CONSISTENT)	SERVICEABLE	360.54	-

Report Ref No. CC3/ASM18015413/Kfb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIR CLEANER BOX (CONSISTENT)	SERVICEABLE	464.20	-
1	AIR CLEANER HOSE (CONSISTENT)	SERVICEABLE	175.85	-
1	DOOR HARNESS WIRE LH (CONSISTENT)	NOT NECESSARY	2,670.00	-
1	DOOR MIRROR ASSY LH (CONSISTENT)	SERVICEABLE	1,483.40	-
1	DOOR PANEL FRT LH (CONSISTENT)	REPEATED	2,844.66	-
	LESS 10% DISCOUNT		-7,370.68	-458.38
			66,336.13	4,125.39
	SPECIAL NETT ITEMS			
1	SET RADIATOR GRILLE FRAME CLIP (SN) (CONSISTENT)	NOT NECESSARY	52.00	-
1	SET BUMPER CLIP FRT (SN) (CONSISTENT)	NECESSARY	66.00	66.00
1	BUMPER BRACKET CLIP FRT LH (SN) (CONSISTENT)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT LH (SN) (CONSISTENT)	NOT NECESSARY	10.50	-
1	BUMPER BRACKET CLIP FRT RH (SN) (CONSISTENT)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT RH (SN) (CONSISTENT)	NOT NECESSARY	10.50	-
1	TOW COVER FRT (SN) (CONSISTENT)	SERVICEABLE	14.50	-
1	SET RADIATOR GRILLE SCREW (SN) (CONSISTENT)	NOT NECESSARY	16.00	-
1	SET BUMPER GRILLE LOWER CLIP (SN) (CONSISTENT)	NOT NECESSARY	69.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN) (CONSISTENT)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN) (CONSISTENT)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN) (CONSISTENT)	NOT NECESSARY	30.00	-
1	WINSCREEN MOULDING (SN) (CONSISTENT)	NOT NECESSARY	100.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN) (CONSISTENT)	SERVICEABLE	80.00	-
1	FRONT LEFT TYRE (SN) (CONSISTENT)	SERVICEABLE	330.00	-
1	FRONT LEFT TYRE RIM (SN) (CONSISTENT)	SERVICEABLE	380.00	-
1	FRONT DOOR STICKER 'TRANS-CAB' (SN) (CONSISTENT)	NOT NECESSARY	80.00	-
1	FRONT STICKER 'CHASSIS' (SN) (CONSISTENT)	NOT NECESSARY	50.00	-
			1,402.50	66.00

Report Ref No. CC3/ASM18015413/Kfb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF BUMPER BEAM FRT, FRAME FULL SUPPORT BRACKET, FRONT BRACE PANEL, HORN BRACKET, HEADLAMP PANEL FRT LH, HEADLAMP PANEL FRT RH, BONNET, BONNET HINGE LH, BONNET HINGE RH, BONNET LOCK AND DOOR PANEL FRT LH.		5,400.00	500.00
	TOWING FEES.		120.00	50.00
	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT.	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	660.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHE, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK.	NOT NECESSARY	380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO LIFT-UP ENGINE WITH GEAR BOX AND REFIT.	NOT NECESSARY	440.00	-
	TO REMOVE AND RENEW POWER STEERING PUMP, OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO REMOVE AND REFIT AIR BAG SYSTEM AND RESET.	NOT NECESSARY	480.00	-
	TO DROP DIESEL TANK, PIPES, HOSES TO FACILITATE BODYWORK REPAIR, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR CONDENSER.	NOT NECESSARY	380.00	-
	TO REPLACE, REFIX AND TOP UP COOLANT FOR RADIATOR.	NOT NECESSARY	170.00	-
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR INTERCOOLER.	NOT NECESSARY	170.00	-

Report Ref No. CC3/ASM18015413/Kfb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			16,400.00	1,260.00
GRAND TOTAL			84,138.63	5,451.39
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,350.00

Report Ref No. CC3/ASM18015413/Kfb3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report in whole or in part, does so at his or her own risk.