

ASS. REC. BY

REF

es/MSG18015546/Drd302

Special Instructions

Surveyor's
Signature

Bryen

ASSIGNMENT (Office)

From (Person):

Lionel Tan

of

MSG

Date/Time

27/8/18 @ 10:16am

Estimated Cost:

Bill to:

OD / (TP) WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHA 7094H

Insured:

SGV 7341X

at Workshop m/s

Chunni Motor

Tel:

65425119

of

Blk 10 AMK # 01-05/06

Policy No:

B29073975Mcy

Claim No:

568187

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

21/8/2018

CA / REV / REP. / REV 24 HRS

(up)

H.O.D. Endorsement:

Date/Time:

10:57am @ 27/8/18

Person Contacted:

Lynn

Vehicle

IN / OUT

| Date/Time | Action/Instruction (✓) Estimate | |
|-----------|-------------------------------------|-----------------|
| | SHA 7094H - NSI INC 11015342 / H191 | DOA: 1/5/11 |
| | SGV 7341X - NA MSG 17018075 / K1 | DOA: 01/05/2017 |
| | Revert 1A Hiu Menmen | |

ASSIGNMENT

00B April 2022

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / RM / MV
 Techno / Vehicle No: _____
 at Workshop no: _____
 of: _____
 Insured: _____
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

Bal. of Market Value

IDAC Accident Report Consistent? : Yes or No

GIA / PR Seen Consistent? : Yes or No

Est. Repairs: 16 ~~12~~ days Res: Yes or No

Lum Sum: 20 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: **SHA 7094H** Yr/Bgn: **2014 / April**
 Type: **MCar / MCycle / Bus / Van / Lorry / Car / Prime Mover /**
 Truck / Trailer or
 Make: **Hyundai I40** CC: **1685**
 Color: **Blue** AB: Insured / Std / H / IA
 Sp. Reading: **551184** IRadio: Insured / Std / H / IA
 Engine: **D4FDDU391403**
 Chassis: **KMHLB41UMBU053905**
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Good / Jammed / Leaked / Burnt or
 Brake: Good / Jammed / Leaked / Burnt or
 Mod: Al / S/Rim / STD A/Rim or
 Tyre Size: F: **205/60 R16**
 R: **- 11 -**

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Westlake

Front

Rear

R/Bal: **5** mmR/Bal: **5** mmL/Bal: **5** mmL/Bal: **5** mmD.O.A. **21/08/2018**D.O.L. **27/08/2018**

Survey held at

Chennai AMIC

Dist. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Front & Rear

The UIC / Chassis frame / Body Structure affected due to collision.



Date / Time Action / Instruction

25/10/18 **MSIG 36V 7341X**
Hyundai 4S 27000/- with 16 days of rep
Red: \$ 12,978.32, 32%.

RECEIVED 25 OCT 2018

Date/Time, File Name for

1) **typist**

Date/Time, File Name for

2)

Report Format :

TPLump Sum ~~12,978.32~~ (\$) **27,000.00**

Prel. Report



Final Report

Days Of Repair: **16**Resurvey No. of Trip: **2**

Add Fee:



Site Insp (\$)



Interview (\$)



Tech Insp (\$)



Weekend (\$)

Survey Fee

Transportation

5 x 100 = 500

Photo

Other

250**10****260**

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

| Case | Notified | Est Submitted | Adj Assigned | Adj Rpt | Adj Submitted | Ins Auth'ed | Status |
|------|-------------|---------------|--|---------|---------------|-------------|--|
| Main | 24 Aug 2018 | | 27 Aug 2018 10:16 Assign | | | | New Assignment Cancel Case |

| Main | Reference | Claim Details | Documents | Show All | | | | | |
|---|--|------------------------|---|--------------------------|---------|-------------|--------------|------------|-------|
| CLAIM SUBFOLDER DETAILS [Created by insurer] | | | | | | | | | |
| Insured: | JACOBS DOUWE EGBERTS RTL SCC SG PTE. LTD., Co. Reg. No.: 200821994H | | | | | | | | |
| Main Claimant: | COMFORT TRANSPORTATION PTE LTD, Co. Reg. No.: 199303821R | | | | | | | | |
| Vehicle Reg. No.: | SHA7094H | Date of Loss: | 21/08/2018 07:00 - :59 [52 Months and 4 Days From LTA Reg Date (Man Yr)] | | | | | | |
| Claim Type: | TP / 568187 | Policy/Cover Note No.: | B29073975MCY (Comprehensive) Coverage: 01/04/2018 - 31/12/2018 | | | | | | |
| Vehicle Reg. No. (Insured): | SGV7341X | Policy No. (Claimant): | | | | | | | |
| | | Excess: | S\$500.00 | | | | | | |
| Repairer: | Chunni Motor Work Pte Ltd - Amk (HQ) Blk 10 #01-05/06, AMK Autopoint, 568047 Ang Mo Kio - Tel: 64836016 | | | | | | | | |
| Handling Insurer: | MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Lionel Tan Tian Pei - 6643 1307] | | | | | | | | |
| Adjuster: | LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 28/08/2018] | | | | | | | | |
| Driver/Custodian (Insured): | NG SAY GUAN (54 / Male), NRIC: S1618169B | | | | | | | | |
| Adj Asg. Remarks: | LIABILITY : CLEAR Survey Location : SOON HOCK MOTOR #01-05/06 Please appoint LKK AUTO CONSULTANTS PTE LTD to conduct the survey . Kindly contact the workshop directly @ 6483 6016 to arrange for survey . | | | | | | | | |
| ASSOCIATED MAIL RECEIVED View All Compose Case Mail | | | | | | | | | |
| There are no mail for this case. | | | | | | | | | |
| ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete | | | | | | | | | |
| Due Date | Priority | Type | Task Group | Subject | Handler | Assigned By | Completed On | Created On | Done? |
| No results. | | | | | | | | | |

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Lionel Tan Tian Pei

Date: 25 Oct 2018

Preliminary Advice

| | | | |
|--------------------|---|-------------------------|--------------|
| Insured Vehicle No | : SGV7341X | Accident Date | : 21/08/2018 |
| TP Vehicle No | : SHA7094H | Assignment Date | : 27/08/2018 |
| Make | : HYUNDAI I40 | Est. Duration of Repair | : 16.00 |
| Date of Inspection | : 27/08/2018 | | |
| Inspection At | : CHUNNI MOTOR WORK PTE LTD - AMK (HQ) BLK 10 #01-05/06, AMK AUTOPOINT SINGAPORE 568047 | | |

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front and rear portion and parts claimed are consistent to the accident.

| | | |
|-----------------------------|------|-----------|
| Repairer's Estimate (Gross) | :S\$ | 39,978.32 |
| Revised Amount | :S\$ | 33,816.08 |
| Check Items (Estimated) | :S\$ | 0.00 |
| Total | :S\$ | 33,816.08 |
| Lump Sum Repair | :S\$ | 27,000.00 |

Total Loss Consideration

| | |
|--------------------|------|
| New for Old Value | :S\$ |
| Pre-Accident Value | :S\$ |
| COE / PARF Rebate | :S\$ |
| Salvage Value | :S\$ |
| Margin for Repair | :S\$ |

Remarks

- () The vehicle is economical/not economical for repair.
- (X) The above survey was conducted on a 'without prejudice' basis.

MCD818108220 / ComfortDelGro Engineering Pte Ltd - Loyang
 ENTRY DATE & TIME: 21/08/2018 11:55
 SUBMITTED BY: Huang XiaoYan

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

| | |
|----------------------------|---------------------------|
| Date Of Report | 21/08/2018 11:55 |
| Date Of Accident | 21/08/2018 07:40 |
| Exact Location Of Accident | PIE(TUAS) BF KALLANG EXIT |
| Country/State of Loss | SINGAPORE |

DETAILS OF OWN VEHICLE

| | |
|--|---------------------------------------|
| Vehicle Registration Number | SHA7094H |
| Insured/Policyholder | |
| Name Of Registered Owner | COMFORT TRANSPORTATION PTE LTD |
| Co Reg No | 199303821R |
| Email Address | FLEETSAFETY@CDGTAXI.COM.SG |
| Mobile Phone No | |
| Alternative Phone No | OFFICE-65508768 |
| Vehicle Particulars | |
| Manufacturer | HYUNDAI |
| Model | I40 |
| Exact Purpose for which vehicle was being used at time of accident | |
| Are you claiming under your own insurance policy for repair to your vehicle? | NO |
| If No, Please state action to be taken | THIRD PARTY |
| Vehicle Category | TAXI |
| Insurance Company | |
| Name of Insurance Company | INDIA INTERNATIONAL INSURANCE PTE LTD |
| Type Of Coverage | THIRD PARTY FIRE AND/OR THEFT |
| Fleet Policy | YES |
| Policy Number | MCOM0015 |
| Cover Note Number | |
| Driver | |
| Name of Driver | KOH LEE THIAM |
| NRIC No | S6804250Z |
| Date Of Birth | 20/01/1968 |
| Occupation | OUTDOOR |
| Date Of Driving Pass | 18/02/1989 |
| Driving Experience | 29 YEARS AND 6 MONTHS |
| Gender | MALE |
| Mobile Number | (LOCAL) +65-91050264 |
| Fax Number | |
| Contact Number | |
| Email Address | NOEMAIL |

Address BLK 604 BEDOK RESERVOIR ROAD #03-598
 Postcode 470604
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OTHER - TAXI DRIVER
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident CHAIN COLLISION
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 2
 Passenger 1
 NAME: : -
 GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

PLS REFER TO ATTACHED

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? YES
 Remarks/ Reasons: -
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SGV7341X
 Vehicle Make/Model/Colour
 Details Of Properties
 Vehicle Category PRIVATE CAR
 Name of Driver NG SAY GUAN
 NRIC/Passport Number S1618169B
 Contact Number
 Address
 Postcode
 Insurance Company Name MSIG INSURANCE (SINGAPORE) PTE. LTD.
 Nature Of Damage FRT

No. Of Passenger (Including Driver) ,

DETAILS OF OTHER VEHICLE PROPERTY 2

| | |
|-------------------------------------|-------------|
| Vehicle Registration Number | SLE7334Y |
| Vehicle Make/Model/Colour | |
| Details Of Properties | |
| Vehicle Category | PRIVATE CAR |
| Name of Driver | FENG XIA |
| NRIC/Passport Number | G1450995Q |
| Contact Number | |
| Address | |
| Postcode | |
| Insurance Company Name | |
| Nature Of Damage | REAR |
| No. Of Passenger (Including Driver) | |

IMPORTANT NOTICE.

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the Information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199203321R

许利添

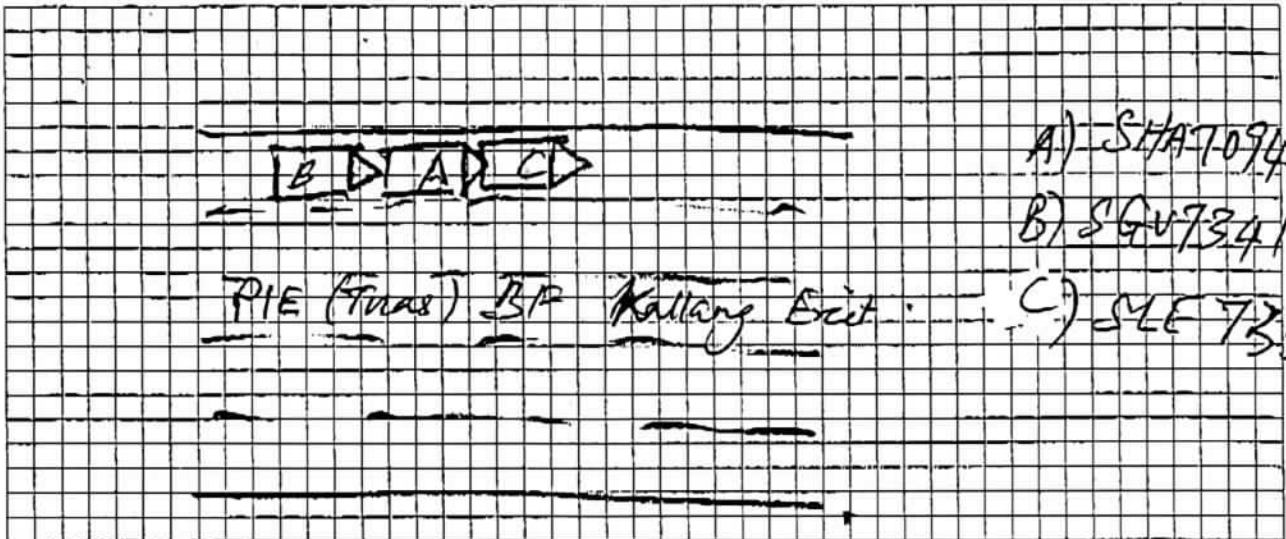
S. M. Morthy
CEO
21/8/18

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 21/8/18 at about 0740h while driving (Veh A) straight ahead towards the Kallang Exit, collided on the rear of Veh B and Veh C collided on the rear of my vehicle ~~within~~ within a few seconds.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 193203321R

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

| Qty | Parts Description/ Labour | Type | Unit Price | Amount |
|-----|---|----------------|-----------------|--------------|
| | Bonnet <i>brk</i> | | | \$ 2,174.90 |
| | Bonnet Hinge (LH/RH) <i>st</i> | | \$ 91.30 | \$ 182.60 |
| | Bonnet Moulding <i>NS</i> | | | \$ 126.25 |
| | Bonnet Lock <i>st</i> | | | \$ 50.90 |
| | Bonnet Absorber <i>SVC</i> | | \$ 73.90 | \$ 147.80 |
| | Bonnet Insulator <i>st</i> | | | \$ 243.00 |
| | Bonnet Insulator Clips <i>HL</i> | | | \$ 8.40 |
| | Radiator Grille <i>broken</i> | | | \$ 294.35 |
| | Radiator Grille H Emblem <i>broken</i> | | | \$ 113.65 |
| | Front Bumper Cover <i>broken</i> | | | \$ 562.30 |
| | Front Bumper Sponge <i>7 torn</i> | | | \$ 142.20 |
| | Front Bumper Reinforcement <i>7 broken</i> | | | \$ 526.10 |
| | Front Bumper Grille (LH/RH) <i>deformed</i> | | \$ 40.30 | \$ 80.60 |
| | Front Bumper Centre Grille <i>broken</i> | | | \$ 178.60 |
| | Front Bumper Centre Grille Top Garnish <i>deformed</i> | <i>missing</i> | \$ 80.00 | \$ 160.00 |
| | Front Bumper Bracket Top (LH/RH) <i>SVC</i> | | \$ 22.40 | \$ 44.80 |
| | Front Bumper Bracket (LH/RH) <i>SVC</i> | | \$ 24.60 | \$ 49.20 |
| | Headlamp Support Top Cover <i>deformed</i> | | | \$ 398.00 |
| | Headlamp Support Panel Assy <i>7 Deformed</i> | | | \$ 1,067.50 |
| | Headlamp (LH/RH) <i>broken</i> | | \$ 1,388.00 | \$ 2,776.00 |
| | Headlamp Halogen Bulb (LH/RH) <i>HL</i> | | \$ 14.40 | \$ 28.80 |
| | Radiator <i>7 st</i> | | | \$ 850.20 |
| | Radiator Fan Blade, Cowling, Motor Assy <i>7 broken</i> | | | \$ 792.95 |
| | Aircon Condenser <i>7 st</i> | | | \$ 1,137.35 |
| | Frt Safety Belt (Assy) (LH/RH) <i>actuated</i> | | \$ 572.65 | \$ 1,145.30 |
| | Inter Cooler <i>7 st</i> | | | \$ 921.90 |
| | Airbag Complete <i>actuated</i> | | | \$ 2,948.50 |
| | Airbag Control Module <i>actuated</i> | | | \$ 1,894.00 |
| | Steering Angle Assy <i>HL actuated</i> | | | \$ 1,150.60 |
| | Sensor Assy Impact -Frt Impact <i>HL</i> | | | \$ 1,180.50 |
| | Airbag Sensor <i>actuated</i> | | \$ 580.00 | \$ 1,160.00 |
| | | | <i>20959.90</i> | \$ 22,537.25 |
| | | | | \$ 4,507.45 |
| | | | <i>16767.92</i> | \$ 18,029.80 |
| | | | | |
| | Front Number Plate <i>broken</i> | | | \$ 25.00 |
| | Front No Plate Trim Cover <i>broken</i> | | <i>55.00</i> | \$ 30.00 |
| | | | | \$ 55.00 |
| | | | | |

SHA 7094H

| Qty | Parts Description/ Labour | Type | Unit Price | Amount |
|-----|--|------|------------|---------------------|
| | Labour Charge | | | |
| | Panel Beating | | | \$ 1,500.00 800/- |
| | Spray Painting Charge | | | \$ 1,000.00 600/- |
| | Wiring Charge | | | \$ 50.00 30/- |
| | Tuff Kote | | | \$ 100.00 40/- |
| | Towing Charge | | | \$ 60.00 10/- |
| | Remove/Refix Aircon & Refill Gas | | | \$ 150.00 80/- |
| | Remove/Refix Dashboard | | 1750.00 | \$ 450.00 200/- |
| | Remove/Refix Fuse Box | | | \$ 180.00 10/- |
| | Re-programme Air Bag & Safety Belt System | | | \$ 550.00 200/- |
| | TOTAL LABOUR | | | \$ 4,040.00 |
| | Boot Lid <i>Replaced</i> | | | \$ 2,174.90 ✓ |
| | Boot Lid Rubber <i>changed</i> | | | \$ 115.80 ✓ |
| | Boot Lid Hinge (LH/RH) <i>new</i> | \$ | 178.10 | \$ 356.20 X |
| | Boot Lid Lock Upper <i>1st</i> | | | \$ 137.90 ✓ |
| | Boot Lid Lock Lower <i>1st</i> | | | \$ 31.70 X |
| | Boot Lid 'H' Emblem <i>huc</i> | | | \$ 27.20 ✓ |
| | Boot Lid CRDI Plate <i>huc</i> | | | \$ 41.00 ✓ |
| | Boot Lid Lamp (LH/RH) <i>crack</i> | \$ | 556.80 | \$ 1,113.60 ✓ |
| | Bootlid Moulding <i>cut</i> | | | \$ 85.00 ✓ |
| | Bootlid i40 Emblem <i>huc</i> | | | \$ 41.00 ✓ |
| | Bootlid Lower Garnish <i>cut</i> | | | \$ 398.00 ✓ photo |
| | Rear Bumper <i>crack</i> | | | \$ 603.60 ✓ |
| | Rear Bumper Reinforcement <i>2 crack</i> | | | \$ 504.35 ✓ |
| | Rear Bumper Sponge <i>2 turn</i> | | | \$ 143.40 ✓ |
| | Rear Bumper Under Cover <i>changed</i> | | | \$ 225.00 ✓ |
| | Tail Lamp (RH) <i>crack</i> | | | \$ 565.60 ✓ |
| | Rear Panel <i>Replaced</i> | | | \$ 592.30 ✓ |
| | Rear Panel Lower Panel <i>Replaced</i> | | | \$ 495.50 ✓ photo |
| | Spare Tyre Holder <i>huc</i> | | | \$ 28.80 X |
| | Spare Tyre Panel <i>huc</i> | | | \$ 900.50 X |
| | Spare Tyre Panel Cushion <i>huc</i> | | | \$ 209.05 X |
| | Rear Towing Hook <i>huc</i> | | | \$ 94.60 X |
| | Exhaust Pipe Insulator, RH <i>2 huc</i> | | | \$ 58.55 ✓ X |
| | Exhaust Silencer, RH <i>1st</i> | | 13014.95 | \$ 954.00 ✓ |
| | Exhaust Pipe Hanger, RH <i>SVC</i> | | | \$ 58.55 X |
| | Rear Fender With Housing (RH) <i>Replaced</i> | | 10411.96 | \$ 4,736.80 ✓ |
| | Rear Windscreen Moulding <i>huc</i> | | | \$ 60.00 ✓ |
| | SUB TOTAL | | | \$ 14,752.90 |
| | LESS 20% | | | \$ 2,950.58 |
| | DISCOUNTED TOTAL | | | \$ 11,802.32 |
| | Boot Lid Comfort Logo & Tel No. Sticker <i>huc</i> | | | \$ 30.00 Nett ✓ |
| | Rear Windscreen Sealant <i>huc</i> | | 76.00 | \$ 46.00 Nett ✓ |
| | | | | \$ 76.00 |

SHA 7094H

| Qty | Parts Description/ Labour | Type | Unit Price | Amount |
|-----|--|------|------------|------------------|
| | Labour Charge | | | |
| | Panel Beating | | | S 1,400.00 800/- |
| | Spray Painting Charge | | | S 1,200.00 700/- |
| | Wiring Charge | | | S 50.00 30/- |
| | Tuff Kote | | | S 100.00 40/- |
| | Remove/Refix Cushion & Upholstery Rear | | | S 80.00 60/- |
| | Remove/Refix Rear Windscreen Glass | | | S 100.00 80/- |
| | | | 1710/- | |
| | TOTAL LABOUR | | | S 2,930.00 |
| | ESTIMATE TOTAL | | | S 36,933.12 |
| | 27/08/2018 @ 1400h | | | 39,978.32 |
| | N/A Antenn | | | 30770.88 |
| | 2/sum | | | 990.40 |
| | <u>T ryan</u> | | Supp | 2054.80 |
| | LKK Auto | | | 33816.08 |
| | | | L/S | 27000/- |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |

CHUNNI MOTOR WORK PTE LTD**REPAIR ESTIMATE***

VEHICLE NO : SHA 7094H (Supplementary)

DATE : 28.08.2018

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI i40

FAX : 6542 6039

| Qty | Parts Description/ Labour | Type | Unit Price | Amount |
|--|---|------|------------|-------------|
| | Front Fender (LH/RH) <i>Denier</i> | | \$ 619.00 | \$ 1,238.00 |
| | | | | \$ 1,238.00 |
| | SUB TOTAL | | | \$ 1,238.00 |
| | LESS 20% | | | \$ 247.60 |
| | DISCOUNTED TOTAL | | | \$ 990.40 |
| | <i>01/09/2018</i> <i>mya</i> <i>200 Ant</i> <i>8</i> | | | |
| This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. | | | | |

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

...CLAIM SUBFOLDER...(Pending for Survey Report)

| CLAIM SUBFOLDER TRACKING | | | | | | | |
|--------------------------|-------------|---------------|--|---|---|-------------|---|
| Case | Notified | Est Submitted | Adj Assigned | Adj Rpt | Adj Submitted | Ins Auth'ed | Status |
| Main | 24 Aug 2018 | | 27 Aug 2018 10:16 Edit Adj Rpt | S\$27,000.00 Edit Estimates | S\$27,000.00 View Rpt | | Pending for Survey Report Cancel Case |

| Main | Reference | Claim Details | Documents | Show All |
|------|-----------|---------------|-----------|----------|
|------|-----------|---------------|-----------|----------|




































| CLAIM SUBFOLDER DETAILS | | [Created by insurer] |
|-----------------------------|--|---|
| Insured: | JACOBS DOUWE EGBERTS RTL SCC SG PTE. LTD., Co. Reg. No.: 200821994H | |
| Main Claimant: | COMFORT TRANSPORTATION PTE LTD, Co. Reg. No.: 199303821R | |
| Vehicle Reg. No.: | SHA7094H | Date of Loss: 21/08/2018 07:00 - :59 [52 Months and 4 Days From LTA Reg Date (Man Yr)] |
| Claim Type: | TP / 568187 | Policy/Cover Note No.: B29073975MCY (Comprehensive) Coverage: 01/04/2018 - 31/12/2018 |
| Vehicle Reg. No. (Insured): | SGV7341X | Policy No. (Claimant): |
| | | Excess: S\$500.00 |
| Repairer: | Chunni Motor Work Pte Ltd - Amk (HQ) Blk 10 #01-05/06, AMK Autopoint, 568047 Ang Mo Kio - Tel: 64836016 | |
| Handling Insurer: | MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Lionel Tan Tian Pei - 6643 1307] | |
| Adjuster: | LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by BRYAN TANI] ... [Final Rpt due 26/09/2018] | |
| Driver/Custodian (Insured): | NG SAY GUAN (54 / Male), NRIC: S1618169B | |
| Adj Asg. Remarks: | LIABILITY : CLEAR Survey Location : SOON HOCK MOTOR #01-05/06 Please appoint LKK AUTO CONSULTANTS PTE LTD to conduct the survey . Kindly contact the workshop directly @ 6483 6016 to arrange for survey . | |


















































| ASSOCIATED MAIL RECEIVED | View All | Compose Case Mail |
|----------------------------------|--------------------------|-----------------------------------|
| There are no mail for this case. | | |



















































| ALL ASSOCIATED TASKS <input type="checkbox"/> | | | | | | | | | | View All | Search Tasks | Create New Task | Complete |
|---|----------|------|------------|---------|---------|-------------|--------------|------------|-------|--------------------------|------------------------------|---------------------------------|--------------------------|
| Due Date | Priority | Type | Task Group | Subject | Handler | Assigned By | Completed On | Created On | Done? | | | | |
| No results. | | | | | | | | | | | | | |

















































 

Claim Documents






































 




 

*SHA7094H (568187)
 [SGV7341X]
 TP
 COMFORT TRANSPORTATION PTE LTD
 Aug 21 2018 7:00AM
 [JACOBS DOUWE EGBERTS RTL SCC SG PTE. LTD.]
 Chunni Motor Work Pte Ltd - Amk

| Upload Documents Upload Photos Compose New Letter | | | View View in Browser | |
|---|-----------------|-----------------------------------|--|-------------------------------------|
| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 1 | 25/10/18 09:51 | Adjuster Immediate Advice |  Load HTM | |
| Photos/Images | | | 3 per page | <input checked="" type="checkbox"/> |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 1 | 20/10/18 15:57 | Rear View Left |  Load JPG | <input checked="" type="checkbox"/> |
| 2 | 20/10/18 15:57 | Rear View Right |  Load JPG | <input checked="" type="checkbox"/> |
| 3 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 4 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 5 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 6 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 7 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 8 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 9 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 10 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 11 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 12 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 13 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 14 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 15 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 16 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 17 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 18 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 19 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 20 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 21 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 22 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 23 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 24 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 25 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 26 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 27 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 28 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 29 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 30 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 31 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 32 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 33 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 34 | 20/10/18 15:57 | General View |  Load JPG | |

| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
|--------------------|----------------|-----------------------------------|--|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| | | General View | | <input checked="" type="checkbox"/> |
| 35 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 36 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 37 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 38 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 39 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 40 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 41 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 42 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 43 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 44 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 45 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 46 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 47 | 20/10/18 15:57 | Front View Right |  Load JPG | <input checked="" type="checkbox"/> |
| 48 | 20/10/18 15:57 | Front View Left |  Load JPG | <input checked="" type="checkbox"/> |
| 49 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 50 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 51 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 52 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 53 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 54 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 55 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 56 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 57 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 58 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 59 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 60 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 61 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 62 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 63 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 64 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 65 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 66 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 67 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 68 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 69 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 70 | 20/10/18 15:57 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 71 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 72 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 73 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 74 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 75 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 76 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 77 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 78 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 79 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 80 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 81 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 82 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 83 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |

| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
|--------------------|----------------|-----------------------------------|--|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 84 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 85 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 86 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 87 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 88 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 89 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 90 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 91 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 92 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 93 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 94 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 95 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 96 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 97 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 98 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 99 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 100 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 101 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 102 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 103 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 104 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 105 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 106 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 107 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 108 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 109 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 110 | 20/10/18 15:58 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 111 | 20/10/18 15:58 | Odometer Reading |  Load JPG | <input checked="" type="checkbox"/> |
| 112 | 20/10/18 15:58 | Chassis Number |  Load JPG | <input checked="" type="checkbox"/> |
| 113 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 114 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 115 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 116 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 117 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 118 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 119 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 120 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 121 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 122 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 123 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 124 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 125 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 126 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 127 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 128 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 129 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 130 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 131 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 132 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 133 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |

| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
|--------------------|----------------|-----------------------------------|--|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 134 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 135 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 136 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 137 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 138 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 139 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 140 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 141 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 142 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 143 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 144 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 145 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 146 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 147 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 148 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 149 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 150 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 151 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 152 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 153 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 154 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 155 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 156 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 157 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 158 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 159 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 160 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 161 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 162 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 163 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 164 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 165 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 166 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 167 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 168 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 169 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 170 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 171 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 172 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 173 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 174 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 175 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 176 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 177 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 178 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 179 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 180 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 181 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 182 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 183 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |

| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
|--------------------|-----------------|---|--|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 184 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 185 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 186 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 187 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 188 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 189 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 190 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 191 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 192 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 193 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 194 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 195 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 196 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 197 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 198 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 199 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 200 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 201 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 202 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 203 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 204 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 205 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 206 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 207 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 208 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 209 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 210 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 211 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 212 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 213 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 214 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 215 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 216 | 20/10/18 15:59 | Reinspection Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 217 | 20/10/18 16:00 | Finishing Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 218 | 20/10/18 16:00 | Finishing Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 219 | 20/10/18 16:00 | Finishing Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 220 | 20/10/18 16:00 | Finishing Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 221 | 20/10/18 16:00 | Finishing Photo |  Load JPG | <input checked="" type="checkbox"/> |
| 222 | 20/10/18 16:00 | Finishing Photo |  Load JPG | <input checked="" type="checkbox"/> |
| Documentation | | | 1 per page | <input checked="" type="checkbox"/> |
| No | Finalized On | MSIG Insurance (Singapore) Pte. Ltd. (HQ) | Thumbnail | Print |
| 1 | 24/08/18 13:10 | TPD SHA7094H GIA REPORT |  Load PDF | |
| 2 | 24/08/18 13:10 | OI SGV7341X GIA REPORT |  Load PDF | |
| 3 | 24/08/18 13:10 | TPD SHA7094H - ESTIMATE REPAIR |  Load PDF | |
| 4 | 24/08/18 16:18 | Reply email from TP workshop & appoint LKK AUTO |  Load PDF | |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 1 | 05/11/18 10:15 | Supplementary |  Load PDF | |

Documents Checklist

DOCUMENTS CHECKLIST

ResetSavePrint

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To:

☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG18015546/DRD3E2

Date: 05/11/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. Policy No: B29073975MCY
 Claimant Vehicle No : SHA7094H Insured Vehicle No : SGV7341X
 Date of Loss: 21/08/2018 Nature of Claim: TP Claim No: 568187

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHA7094H**
 Make & Model: HYUNDAI I40, 1.7 L CRDI AT ABS AIRBAG 4DR (A) Engine No: D4FDDU391403
 Reg. Date: 17/04/2014 (Man. Year: 2014) Chassis No: KMHLB41UMEU053905
 Colour: Blue Odometer: 551184 km
 Engine Capacity: 1685 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/60 R16 Rear Tyre Size: 205/60 R16
 Front Left Side: West Lake 5 mm Rear Left Side: West Lake 5 mm
 Front Right Side: West Lake 5 mm Rear Right Side: West Lake 5 mm

The above values represent the remaining tyre treads depth

| COST OF CLAIMS | Repairer's | Adjuster's | Difference | Diff % |
|--|------------------|------------------|------------------|--------------|
| Parts | 33,008.32 | 30,356.08 | 2,652.24 | 8.04 |
| Miscellaneous Items | 0.00 | 0.00 | 0.00 | |
| Labour | 6,970.00 | 3,460.00 | 3,510.00 | 50.36 |
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| Calculated Gross Total (S\$) | 39,978.32 | 33,816.08 | 6,162.24 | 15.41 |
| Approved Total (Overridden) (S\$) | | 27,000.00 | | |
| (S\$) | 39,978.32 | 27,000.00 | 12,978.32 | 32.46 |
| + GST 7.00/7.00% (S\$) | 2,798.48 | 1,890.00 | 908.48 | 32.46 |
| Nett Amount (S\$) | 42,776.80 | 28,890.00 | 13,886.80 | 32.46 |

INSPECTION

Date of Assignment: 27/08/2018
 Date Inspected: 27/08/2018 Inspected At: Chunni Motor Work Pte Ltd - Amk (HQ)
 Blk 10 #01-05/06, AMK Autopoint
 Singapore 568047
 Estimated Period of Repair: 16.0 days

Adjuster: BRYAN TANI

Manager: Janice Lee Si Hua

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

| | | |
|----------------------|--|--|
| Part Source: | MRM-SG | Version: 1.0 (Last Synchronised: 05 Nov 2018) |
| Parts: | 143 | HYUNDAI I40 1.7 L CRDI AT ABS AIRBAG 4DR (A) (Catalogue:Merimen Singapore 1.0) |
| Labour: | Repairer's | (Price-denominated Standard List) |
| Print Code: | (Unsubmitted, no print-code for SHA7094H) | |
| Validity: | These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page | |
| Further Info: | Items/values not in reference catalogue are prefixed with an asterisk *. | |

Recommended Parts

| No. | Qty | Part No. Particulars | Condition | Repairer's | Amount |
|-----|-----|--|--------------------|-------------|--------------|
| 1 | 1 | *BONNET | Buckled | 2,174.90 FL | *2,174.90 FL |
| 2 | 2 | *BONNET HINGE (LH/RH) | Bent | 182.60 FL | *182.60 FL |
| 3 | 1 | *BONNET MOULDING | No such part | 126.25 FL | *- FL |
| 4 | 1 | *BONNET LOCK | Bent | 50.90 FL | *50.90 FL |
| 5 | 2 | *BONNET ABSORBER | Serviceable | 147.80 FL | *- FL |
| 6 | 1 | *BONNET INSULATOR | Bent | 243.00 FL | *243.00 FL |
| 7 | 1 | *BONNET INSULATOR CLIPS | Necessary | 8.40 FL | *8.40 FL |
| 8 | 1 | *RADIATOR GRILLE | Broken | 294.35 FL | *294.35 FL |
| 9 | 1 | *RADIATOR GRILLE H EMBLEM | Broken | 113.65 FL | *113.65 FL |
| 10 | 1 | *FRONT BUMPER COVER | Broken | 562.30 FL | *562.30 FL |
| 11 | 1 | *FRONT BUMPER SPONGE | Torn | 142.20 FL | *142.20 FL |
| 12 | 1 | *FRONT BUMPER REINFORCEMENT | Broken | 526.10 FL | *526.10 FL |
| 13 | 2 | *FRONT BUMPER GRILLE (LH/RH) | Deformed | 80.60 FL | *80.60 FL |
| 14 | 1 | *FRONT BUMPER CENTRE GRILLE | Broken | 178.60 FL | *178.60 FL |
| 15 | 2 | *FRONT BUMPER CENTRE GRILLE TOP GARNISH | Deformed / Missing | 160.00 FL | *160.00 FL |
| 16 | 2 | *FRONT BUMPER BRACKET TOP (LH/RH) | Serviceable | 44.80 FL | *- FL |
| 17 | 2 | *FRONT BUMPER BRACKET (LH/RH) | Serviceable | 49.20 FL | *- FL |
| 18 | 1 | *HEADLAMP SUPPORT TOP COVER | Deformed | 398.00 FL | *398.00 FL |
| 19 | 1 | *HEADLAMP SUPPORT PANEL ASSY | Dented | 1,067.50 FL | *1,067.50 FL |
| 20 | 2 | *HEADLAMP (LH/RH) | Broken | 2,776.00 FL | *2,776.00 FL |
| 21 | 2 | *HEADLAMP HALOGEN BULB (LH/RH) | Not Necessary | 28.80 FL | *- FL |
| 22 | 1 | *RADIATOR | Bent | 850.20 FL | *850.20 FL |
| 23 | 1 | *RADIATOR FAN BLADE, COWLING, MOTOR ASSY | Broken | 792.95 FL | *792.95 FL |
| 24 | 1 | *AIRCON CONDENSER | Bent | 1,137.35 FL | *1,137.35 FL |
| 25 | 2 | *FRT SAFETY BELT (ASSY) (LH/RH) | Activated | 1,145.30 FL | *1,145.30 FL |
| 26 | 1 | *INTER COOLER | Bent | 921.90 FL | *921.90 FL |
| 27 | 1 | *AIRBAG COMPLETE | Activated | 2,948.50 FL | *2,948.50 FL |
| 28 | 1 | *AIRBAG CONTROL MODULE | Activated | 1,894.00 FL | *1,894.00 FL |
| 29 | 1 | *STEERING ANGLE ASSY | Activated | 1,150.60 FL | *1,150.60 FL |
| 30 | 1 | *SENSOR ASSY IMPACT - FRT IMPACT | Not Necessary | 1,180.50 FL | *- FL |
| 31 | 2 | *AIRBAG SENSOR | Activated | 1,160.00 FL | *1,160.00 FL |
| 32 | 1 | *FRONT NUMBER PLATE | Broken | 25.00 FS | *25.00 FS |
| 33 | 1 | *FRONT NO PLATE TRIM COVER | Broken | 30.00 FS | *30.00 FS |
| 34 | 1 | *BOOT LID | Dented | 2,174.90 FL | *2,174.90 FL |
| 35 | 1 | *BOOT LID RUBBER | Deformed | 115.80 FL | *115.80 FL |
| 36 | 2 | *BOOT LID HINGE (LH/RH) | Repair | 356.20 FL | *- FL |
| 37 | 1 | *BOOT LID LOCK UPPER | Bent | 137.90 FL | *137.90 FL |
| 38 | 1 | *BOOT LID LOCK LOWER | Repair | 31.70 FL | *- FL |
| 39 | 1 | *BOOT LID H EMBLEM | Necessary | 27.20 FL | *27.20 FL |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|-----|-----|----------|--|---------------|-------------|--------------|
| 40 | 1 | | *BOOT LID CRDI PLATE | Necessary | 41.00 FL | *41.00 FL |
| 41 | 2 | | *BOOT LID LAMP (LH/RH) | Cracked | 1,113.60 FL | *1,113.60 FL |
| 42 | 1 | | *BOOTLID MOULDING | Cut | 85.00 FL | *85.00 FL |
| 43 | 1 | | *BOOTLID I40 EMBLEM | Necessary | 41.00 FL | *41.00 FL |
| 44 | 1 | | *BOOTLID LOWER GARNISH | Cut | 398.00 FL | *398.00 FL |
| 45 | 1 | | *REAR BUMPER | Cracked | 603.60 FL | *603.60 FL |
| 46 | 1 | | *REAR BUMPER REINFORCEMENT | Cracked | 504.35 FL | *504.35 FL |
| 47 | 1 | | *REAR BUMPER SPONGE | Torn | 143.40 FL | *143.40 FL |
| 48 | 1 | | *REAR BUMPER UNDER COVER | Deformed | 225.00 FL | *225.00 FL |
| 49 | 1 | | *TAIL LAMP (RH) | Cracked | 565.60 FL | *565.60 FL |
| 50 | 1 | | *REAR PANEL | Dented | 592.30 FL | *592.30 FL |
| 51 | 1 | | *REAR PANEL LOWER PANEL | Dented | 495.50 FL | *495.50 FL |
| 52 | 1 | | *SPARE TYRE HOLDER | Not Necessary | 28.80 FL | *- FL |
| 53 | 1 | | *SPARE TYRE PANEL | Not Necessary | 900.50 FL | *- FL |
| 54 | 1 | | *SPARE TYRE PANEL CUSHION | Not Necessary | 209.05 FL | *- FL |
| 55 | 1 | | *REAR TOWING HOOK | Not Necessary | 94.60 FL | *- FL |
| 56 | 1 | | *EXHAUST PIPE INSULATOR, RH | Not Necessary | 58.55 FL | *- FL |
| 57 | 1 | | *EXHAUST SILENCER, RH | Bent | 954.00 FL | *954.00 FL |
| 58 | 1 | | *EXHAUST PIPE HANGER, RH | Serviceable | 58.55 FL | *- FL |
| 59 | 1 | | *REAR FENDER WITH HOUSING (RH) | Dented | 4,736.80 FL | *4,736.80 FL |
| 60 | 1 | | *REAR WINDSCREEN MOULDING | Necessary | 60.00 FL | *60.00 FL |
| 61 | 1 | | *BOOT LID COMFORT LOGO & TEL NO. STICKER | Necessary | 30.00 FS | *30.00 FS |
| 62 | 1 | | *REAR WINDSCREEN SEALANT | Necessary | 46.00 FS | *46.00 FS |
| 63 | 2 | | *FRONT FENDER (LH/RH) | Dented | 1,238.00 FL | *1,238.00 FL |
| 64 | 2 | | *HORN UNIT (LH/RH) | Torn | 147.60 FL | *147.60 FL |
| 65 | 1 | | *HORN WIRE | Broken | 156.50 FL | *156.50 FL |
| 66 | 1 | | *AIR CLEANER ASSY | Broken | 118.60 FL | *118.60 FL |
| 67 | 1 | | *AIR DUCT | Broken | 134.60 FL | *134.60 FL |
| 68 | 1 | | *AIR FLOW SENSOR | Broken | 502.20 FL | *502.20 FL |
| 69 | 1 | | *ACTUATOR - SWIRL CONTROL | Broken | 814.60 FL | *814.60 FL |
| 70 | 1 | | *FRONT SAFETY BELT ADJUSTER, LH | Activated | 285.50 FL | *285.50 FL |
| 71 | 1 | | *SOLENOID VALVE | Broken | 408.90 FL | *408.90 FL |

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$) 41,227.65 37,912.35
 - List Item Discount on L Items 20.00/20.00% (S\$) 8,219.33 7,556.27

Total Parts (S\$) 33,008.32 30,356.08

| |
|---|
| Report was unsubmitted during this print-out. |
|---|

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

| No | Particulars | Lab.Type | Repairer's | Amount |
|---------------------------------|---|----------|-----------------|-----------------|
| Labour Items | | | | |
| 1 | PANEL BEATING | New | 2,900.00 | 1,600.00 |
| 2 | SPRAY PAINTING CHARGE | New | 2,200.00 | 1,300.00 |
| 3 | WIRING CHARGE | New | 100.00 | 60.00 |
| 4 | TUFF KOTE | New | 200.00 | 80.00 |
| 5 | TOWING CHARGE | New | 60.00 | 0.00 |
| 6 | REMOVE / REFIX AIRCON & REFILL GAS | New | 150.00 | 80.00 |
| 7 | REMOVE / REFIX DASHBOARD | New | 450.00 | 0.00 |
| 8 | REMOVE / REFIX FUSE BOX | New | 180.00 | 0.00 |
| 9 | RE-PROGRAMME AIR BAG & SAFETY BELT SYSTEM | New | 550.00 | 200.00 |
| 10 | REMOVE / REFIX CUSHION & UPHOLSTERY REAR | New | 80.00 | 60.00 |
| 11 | REMOVE / REFIX REAR WINDSCREEN GLASS | New | 100.00 | 80.00 |
| Gross Labour Cost (\$\$) | | | 6,970.00 | 3,460.00 |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >