

Transfer Fee Enquiry

Page 1 of 1

> Back to OneMotoring

Enquire Transfer Fee


Vehicle Details			
Vehicle No.:	SKM5578T		
Vehicle Type:	P10 - Passenger Motor Car		
Vehicle Attachment 1:	No Attachment		
Vehicle Scheme:	Normal		
Vehicle Make:	MERCEDES BENZ		
Vehicle Model:	CLA200 (R18)		
Chassis No.:	WDD1173432N072156		
Propellant:	Petrol		
Engine No.:	27091030346394		
Engine Capacity:	1595 cc		
Maximum Power Output:	115.0 kW (154 bhp)		
Maximum Laden Weight:	1920 kg		
Unladen Weight:	1430 kg		
Year Of Manufacture:	2014		
Original Registration Date:	14 Mar 2014		
Lifespan Expiry Date:	-		
COE Category:	A - Car (1600cc & below)		
Quota Premium:	\$76,889.00		
COE Expiry Date:	13 Mar 2024		
Road Tax Expiry Date:	13 Sep 2018		
PARF Eligibility Expiry Date:	13 Mar 2024		
Inspection Due Date:	13 Mar 2019		
Intended Transfer Date:	16 May 2018		
CO2 Emission:	129.00 (g/km)		
CEV/VES Rebate Utilised Amount:	\$10,000.00		
CO Emission:	-		
HC Emission:	-		
NOx Emission:	-		
PM Emission:	-		
Late renewal fee(s) will be imposed if road tax / lay up has expired. Please use Enquire Road Tax Payable for fee(s) payable.			
Road tax, including Over Payment (if any), of a vehicle will follow the vehicle to the new registered owner when its ownership is being transferred.			
Amount Payable			
	Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
Transfer Fee:	25.00	-	25.00
Total Amount Payable:			25.00

You may print this page for reference.

OK

Print

Accident Photo

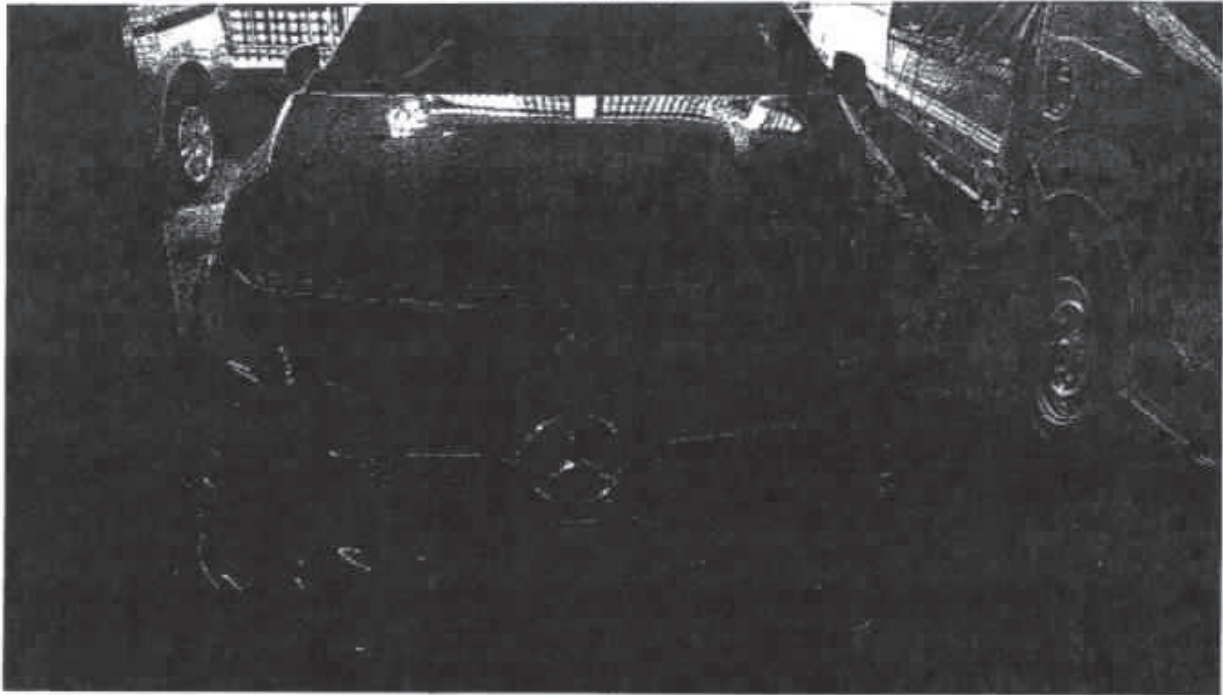

Accident Photo




Accident Photo



Accident Photo




Accident Photo

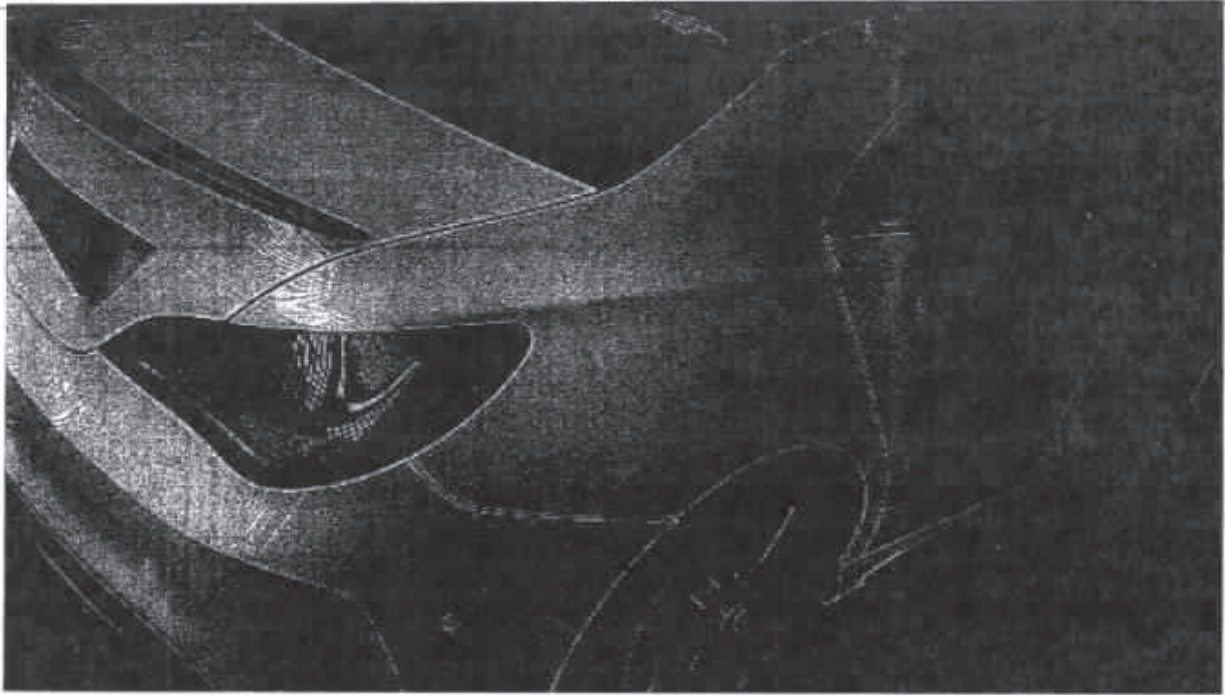


Accident Photo



Accident Photo

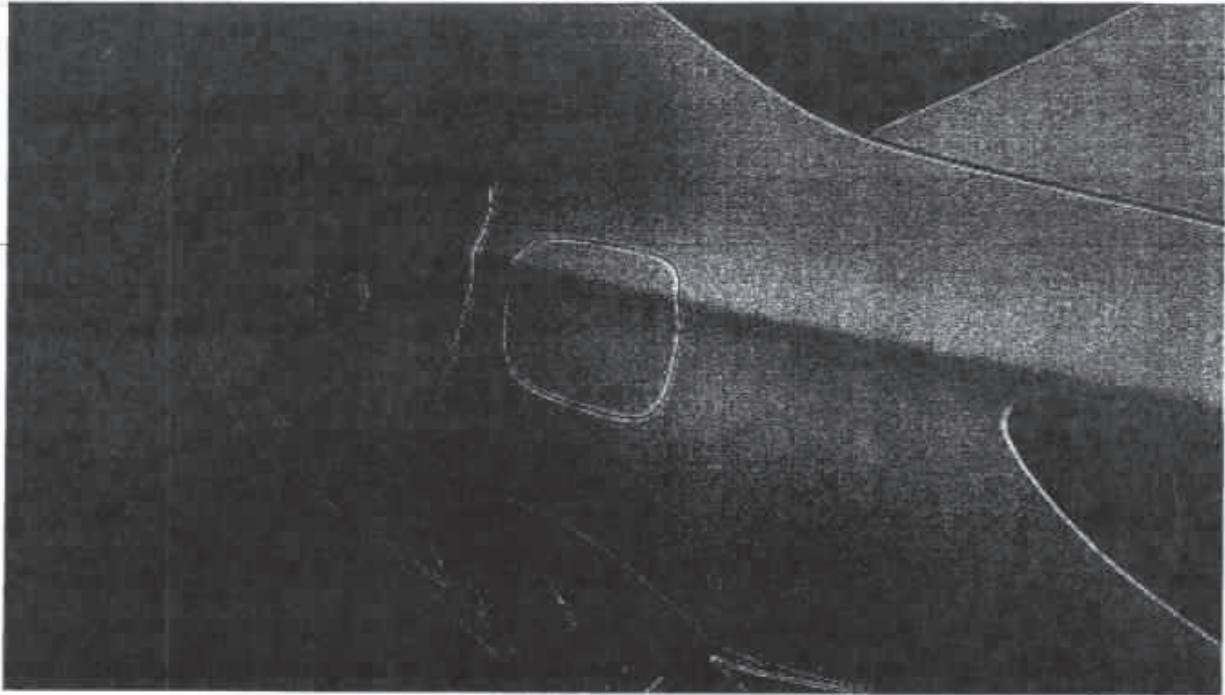


REPORTING MILEAGE

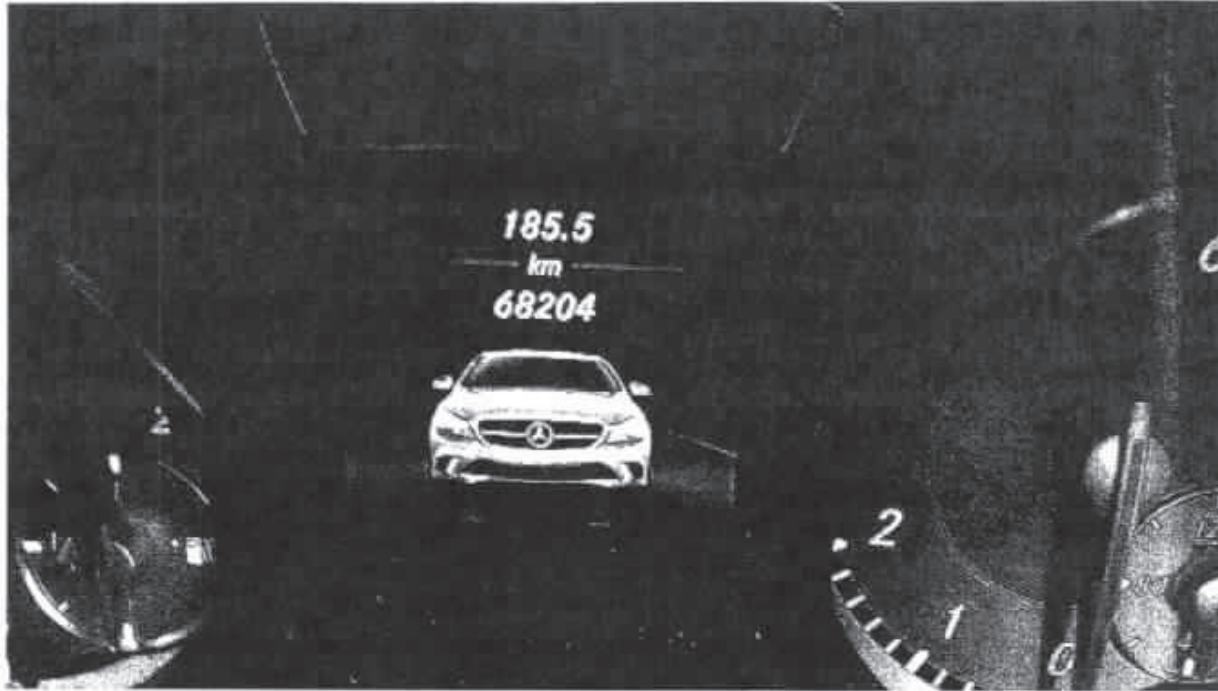

Accident Photo



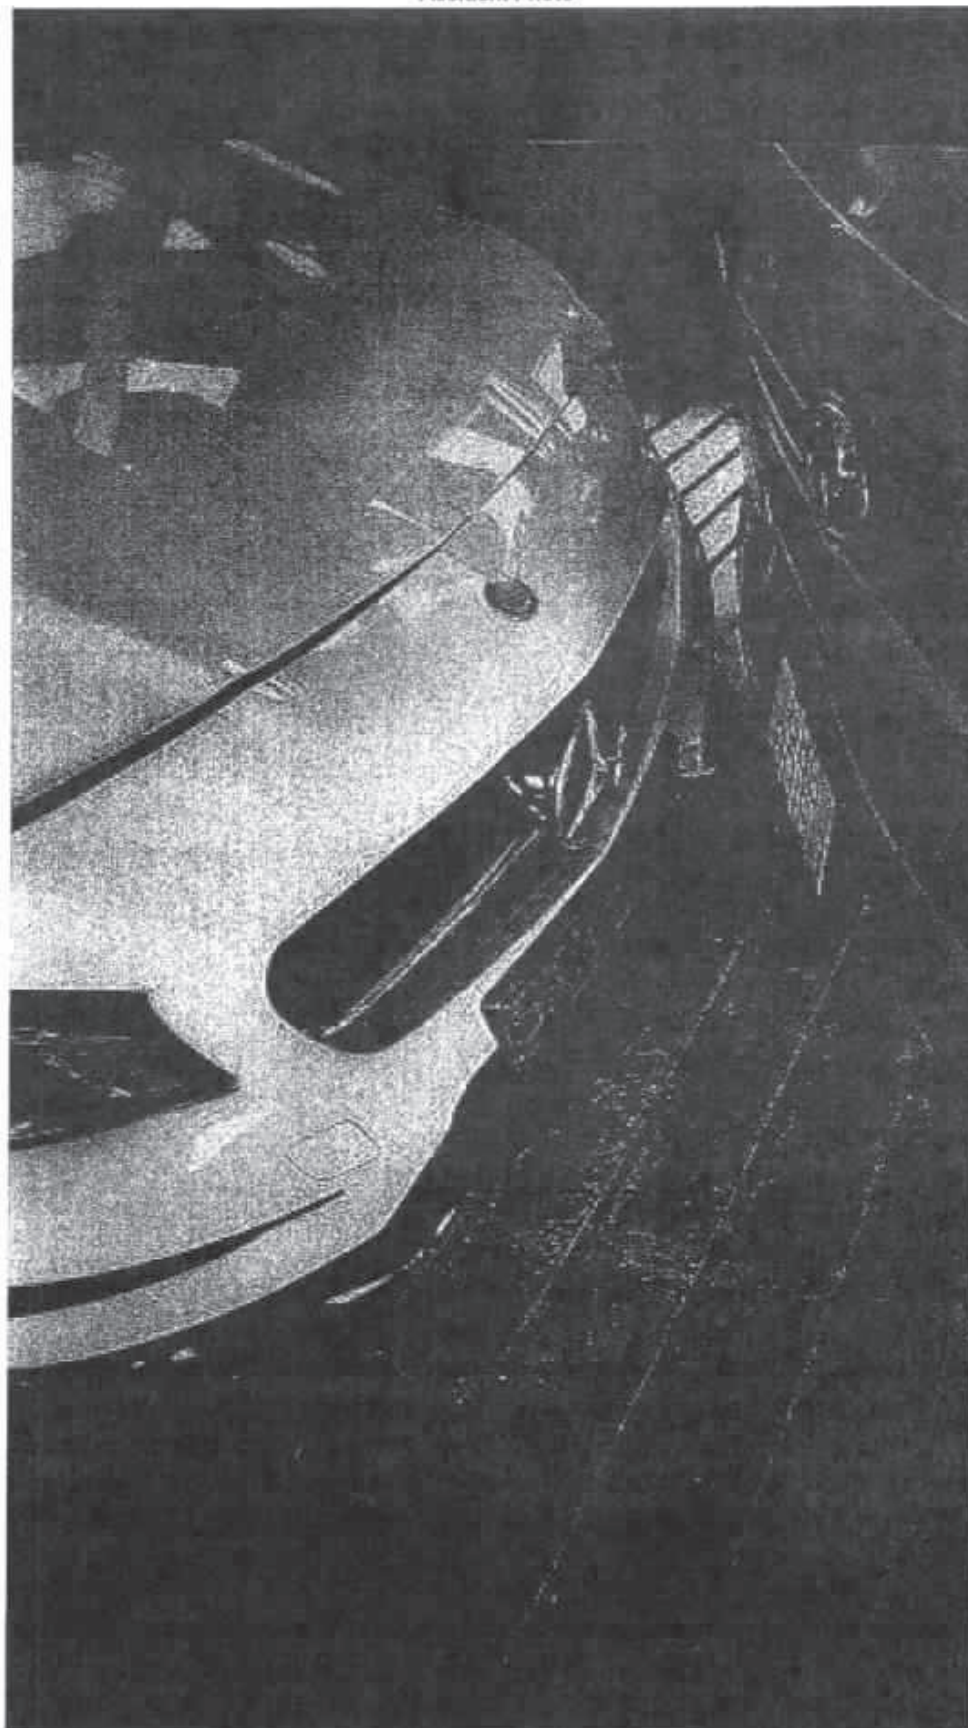

Accident Photo



Enquire Vehicle & Owner Information (Vehicle No. GBG8019J As At 14 May 2018 / 14:25:00)**Law Firm Search Details**

Search Reason: Insurance claim in relation to traffic accident
Law Firm Case No.: PD/DL/1800769

Current Owner Details

Owner ID Type: Limited Liability Partnership
Owner ID: T17LL2299G
Owner Name: HL GENERAL CONSTRUCTION LLP
Registered Address Type: Private Residential (Condo Apt or House) / Shopping / Office Complexes
Registered Block/House No.: 785
Registered Street Name: CHOA CHU KANG DRIVE
Registered Unit No.: # 16 - 223
Registered Building Name: -
Registered Postal Code: 680785

Current Vehicle Details

Vehicle No.: GBG8019J
Make Description/Model: TOYOTA / DYNA 150 5MT
Insurance Company Name: CHINA TAIPING INSURANCE (SINGAPORE) PTE LTD



Thank you

Satwant Singh S/o Sarban Singh has successfully logged out.

Your last login date and time was 15 May 2018, 16:12:37.

To return to ONE.MOTORING, please click [here](#)

For security reasons, please **CLEAR YOUR CACHE** after each session.

Session Transaction History

S/N	Asset Type	Asset ID	Asset Owner ID	Transaction Type	Transaction Amount (\$)
1	Vehicle	GBG8019J	-	18.19 Enquire Veh Owner Info (Others) by Law Firm	7.49

AUTOCLINIC PTE LTD

48 TOH GUAN ROAD EAST #02-136 Enterprise Hub Singapore 608586
TEL: 6686 2511 FAX: 6686 2509 Email: info@autoclinicgroup.com.sg
RCB NO:201801145H

M/S : KHOO AH PENG

Claim No:

No: SOA1800007

Date: 24 Jul 2018

Policy No:

ATTN:

Your Ref No: 1

Chassis No:

Claim Type: Third Party

Engine No:

Accident Date:

Reg. Date:

Final Repair Bill

Description	Quantity	List Price	Amount
		<u>S\$</u>	<u>S\$</u>
Others			
1 FINAL REPAIR COST FOR SKM5578T	1 SET	41,575.00	
		41,575.00	41,575.00
Total			S\$ 41,575.00

TOTAL: SINGAPORE DOLLAR FORTY ONE THOUSAND FIVE HUNDRED SEVENTY FIVE ONLY

For AUTOCLINIC PTE LTD


AUTHORISED SIGNATURE

INVOICE

KHOO AH PENG
C/O Autoclinic Pte Ltd
48 Toh Guan Rd East
#02-136 Singapore 608586

Vehicle No. : SKM5578T
Accident Date : 14-05-2018

Invoice No. : 21652
Invoice Date : 20-07-2018
Payment Term : 30 days Credit

<u>SERVICE DESCRIPTION</u>	<u>QTY</u>	<u>AMOUNT (S\$)</u>
Inspection Fee	1	820.00
Transport	1	50.00
Photographs	94	94.00
INVOICE AMOUNT		964.00

This is a computer generated INVOICE. No signature required.
Cheque should be made payable to 'INFINITI APPRAISAL SERVICE'.

KHOO AH PENG
c/o Autoclinic Pte Ltd
48 Toh Guan Rd East
#02-136 Singapore 608586

VEHICLE DAMAGE INSPECTION REPORT

CLAIM REFERENCE

Our Ref. No.	: 21749	Claim Type	: Third Party
Accident Date	: 14-05-2018		
Survey Date	: 15-05-2018		
Report Date	: 20-07-2018		

DESCRIPTION AND IDENTIFICATION OF VEHICLE

Vehicle No.	: SKM5578T	Chassis No.	: WDD1173432N072156
Registration Date	: 14-03-2014	Engine No.	: 27091030346394
Make	: MERCEDES BENZ	Engine Cap.	: 1595
Model	: CLA200 (R18)	Transmission	: Automatic
		Colour	: White

CONDITION OF VEHICLE AT THE TIME OF SURVEY

Foot Brake	: Serviceable	Steering	: Serviceable
Hand Brake	: Serviceable	Modification	: None
Odometer	: 68204		

<u>TYRES</u>	<u>SIZE</u>	<u>MAKE</u>	<u>BALANCE</u>
FRONT RH	225/40 R18	GOODYEAR	5 mm
FRONT LH	225/40 R18	GOODYEAR	5 mm
REAR RH	225/40 R18	GOODYEAR	5 mm
REAR LH	225/40 R18	GOODYEAR	5 mm

SURVEY CONDUCTED PLACE

AUTOCLINIC PTE LTD
48 Toh Guan Rd E
#02-136
Singapore 608586

INSPECTION SUMMARY

Workshop Estimate	: S\$ 41575.00
Our Recommendation	: S\$ 32981.80
Estimated Repair Period	: 20 working days

We have not authorised repairs. This survey was carried out on without prejudice basis.

INFINITI APPRAISAL SERVICE

RECOMMENDED SPARE PARTS

SKM5578T-14052018

#	Qty	Parts Description	Condition	Repairer's Estimate (\$\$)	Our Adjustment (\$\$)
LIST ITEM					
1	1	Front Bumper	Deform	1445.00	1445.00 ✓
2	1	Towing Eye, Cover	Cut	77.00	77.00 ✓
3	2	Headlamp Cleaning Device, Left & Right	Cut	220.00	220.00 ✓
4	2	Spring Element	Necessary	16.00	16.00 ✓
5	2	Mounting Rail Left & Right	Necessary	276.00	276.00 X N
6	2	Cover Bumper Area Left & Right	Necessary	96.00	96.00 ✓
7	2	Blind Rivet Fastening Cover Left & Right	Necessary	12.00	12.00 ✓
8	2	Blind Rivet Fastening Cover Left And Right	Necessary	12.00	12.00 ✓
9	4	Tapping Screw Bumper & Fender 6.3 X 19	Necessary	16.00	16.00 ✓
10	4	Spring Nut Bumper & Fender O, 5-2, 5mm	Necessary	24.00	24.00 ✓
11	1	Brand Logo	Necessary	66.00	66.00 ✓
12	4	Fastening, Panel To Support 6.5 X 18	Necessary	24.00	24.00 X N
13	1	Bumper Cover At Bottom	Crack	330.00	330.00 ✓
14	3	Bumper (sheet Metal Screw) 4.8 X 19	Necessary	21.00	21.00 ✓
15	3	Bumper (clip) 4, 8	Necessary	18.00	18.00 ✓
16	2	Front Bumper (spring Nut)	Necessary	12.00	12.00 ✓
17	2	Bumper On Fender 4.8 X 13 (tapping Screw)	Necessary	12.00	12.00 ✓
18	1	Cover Bumper Area	Necessary	93.00	93.00 ✓
19	1	Cover Bumper Area Grille Center	Crack	185.00	185.00 ✓
20	1	Parktronic System	Cut	157.00	157.00 X N
21	2	Distance Sensor Outside Left & Right	Cut	390.00	390.00 ✓
22	4	Distance Sensor Inside Left & Right	2 Piece	780.00	390.00 ✓
23	6	Decoupling Ring	Necessary	54.00	54.00 ✓
24	1	Impact Absorber Bumper Front Center	Crack	144.00	144.00 ✓
25	1	Impact Absorber Right Front Bumper	Crack	61.00	61.00 ✓
26	1	Fixture Front	Necessary	70.00	70.00 ✓
27	1	Radar Sensor Distronic	Serviceable	1110.00	0.00 ✓
28	1	Cover Trim	Cut	58.00	58.00 ✓
29	3	Fillister Head Screw Ornamental Cover To Bumper 5 X 18	Necessary	12.00	12.00 ✓
30	1	Air Duct (top Left)	Crack	51.00	51.00 ✓
31	1	Air Duct (top Right)	Crack	51.00	51.00 ✓
32	1	Air Duct (bottom)	Crack	75.00	75.00 ✓
33	1	Beam	Dent	638.00	638.00 ✓
34	2	Bumper Left & Right	Necessary	36.00	36.00 ✓
35	2	Screw Support To Carrier, Left & Right M5 X 18	Necessary	12.00	12.00 ✓
36	2	Fillister Head Screw Bracing To Support	Necessary	12.00	12.00 ✓
37	2	Fillister Head Screw Support To Carrier, Right	Necessary	12.00	12.00 ✓
38	5	Fillister Head Screw Bumper To Support Top	Necessary	30.00	30.00 X N
39	2	Bolt W Flange Carrier At Front, Left & Right M8x25	Necessary	14.00	14.00 ✓
40	2	Fillister Hd Screw Carrier To Crossmember, Left & Right	Necessary	12.00	12.00 ✓
41	2	Hexagon Head Bolt Carrier Top To Longitudinal M6x19	Necessary	12.00	12.00 ✓
42	2	Sealing Lip	Necessary	24.00	24.00 ✓
43	1	Air Duct Left	Necessary	42.00	42.00 ✓
44	1	Air Duct Right	Necessary	42.00	42.00 ✓

INFINITI APPRAISAL SERVICE
RECOMMENDED SPARE PARTS

SKM5578T-14052018

#	Qty	Parts Description	Condition	Repairer's Estimate (\$\$)	Our Adjustment (\$\$)
45	1	Bracket	Necessary	55.00	55.00
46	1	Support	Necessary	60.00	60.00
47	1	Cover, Central Left	Necessary	74.00	74.00
48	1	Cover, Central Right	Necessary	74.00	74.00
49	1	Radiator Cross Member	Dent	407.00	407.00
50	2	Hexalobular Bolt M8x12	Necessary	12.00	12.00
51	2	Absorber	Crack	170.00	170.00
52	4	Hexalobular Bolt Absorber	Necessary	72.00	72.00
53	2	Hexalobular Bolt M8x12	Necessary	12.00	12.00
54	2	Connecting Carrier Bottom Left & Right	Necessary	136.00	136.00
55	4	Hexalobular Bolt Front Bottom M8x40	Necessary	24.00	24.00
56	4	Hexalobular Bolt At Side M8x65	Necessary	28.00	28.00
57	1	Cross Member Front	Dent	323.00	323.00
58	2	Absorber Left & Right	Crack	324.00	324.00
59	2	Threaded Plate Absorber	Necessary	24.00	24.00
60	4	Fillister Head Screw Absorber At Left & Right	Necessary	24.00	24.00
61	6	Bolt & Washer Assy Absorber To Longitudinal At Lh & Rh	Necessary	174.00	174.00
62	1	Air Flow Serration Left	Cut	55.00	55.00
63	1	Air Flow Serration Right	Cut	55.00	55.00
64	1	Mercedes Star	Necessary	133.00	133.00
65	1	Beam Mercedes Star	Necessary	81.00	81.00
66	2	Beam	Necessary	296.00	296.00
67	1	Ornamental Trim Central Left	Cut	81.00	81.00
68	1	Ornamental Trim Central Right	Cut	81.00	81.00
69	1	Beam Frame	Dent	1110.00	1110.00
70	1	Headlamp Unit Left	Crack	2312.00	2312.00
71	1	Headlamp Unit Right	Crack	2312.00	2312.00
72	2	Voltage Converter Led, Left & Right	Serviceable	1682.00	0.00
73	1	Xenon Headlamp Range Adjustment, Left	Necessary	296.00	296.00
74	1	Xenon Headlamp Range Adjustment, Right	Necessary	296.00	296.00
75	2	Front Fender, Left & Right	Dent Rh	1320.00	660.00
76	3	Stud Bolt Fender To Left A-pillar	Necessary	18.00	18.00
77	3	Stud Bolt Fender To Right A-pillar	Necessary	18.00	18.00
78	3	Nut Fender To Left A-pillar M6	Necessary	12.00	12.00
79	3	Nut Fender To Right A-pillar M6	Necessary	12.00	12.00
80	2	Fender Gap Cover Left & Right	Necessary	44.00	44.00
81	2	Cover Plug To Fender	Necessary	8.00	8.00
82	2	Cover Plug	Necessary	8.00	8.00
83	2	Absorber Left	Necessary	48.00	48.00
84	1	Wheel House Covering Front Left	Serviceable	203.00	0.00
85	1	Wheel House Covering Front Right	Cut	203.00	203.00
86	2	Closure Left & Right	Necessary	14.00	14.00
87	3	Plastic Nut Paneling On Shell, Left	Necessary	12.00	12.00
88	3	Plastic Nut Paneling On Shell, Right	Necessary	12.00	12.00
89	5	Expansion Rivet Cover Left 6.5x18	Necessary	30.00	30.00

AM

AM

AM

INFINITI APPRAISAL SERVICE

RECOMMENDED SPARE PARTS

SKM5578T-14052018

#	Qty	Parts Description	Condition	Repairer's Estimate (\$)	Our Adjustment (\$)
90	5	Cover Right 6.5x18	Necessary	30.00	30.00
91	2	Cover To Integral Carrier, Left 8mm	Necessary	24.00	24.00
92	1	Hood	Dent	1360.00	1360.00
93	2	Hinge Left & Right	Dent	196.00	196.00
94	2	Hinge Cover Left & Right	Dent	12.00	12.00
95	2	Fastening Cover Left & Right	Necessary	8.00	8.00
96	1	Insulation Engine Hood	Necessary	75.00	75.00
97	19	Plug-in Mounting Insulation	Necessary	133.00	133.00
98	2	Actuator Engine Hoon Left & Right	Necessary	400.00	400.00
99	1	Lock Lower Part	Dent	125.00	125.00
100	1	Limit Switch Engine Hood Catch	Dent	138.00	138.00
101	1	Hood Cable	Serviceable	77.00	0.00
102	1	Engine Hood Release Cable	Serviceable	31.00	0.00
103	1	Clamping Bracket	Necessary	4.00	4.00
104	2	Cable Bracket Engine Hood Release Cable	Necessary	12.00	12.00
105	1	Cable Bracket Engine Hood Release Cable	Necessary	4.00	4.00
106	4	Buffer Stop At Engine Hood Reset To Stiffening	Necessary	88.00	88.00
107	1	Engine Hood Seal At Engine Hood	Necessary	37.00	37.00
108	2	Engine Hood Seal Left & Right	Necessary	70.00	70.00
109	1	Engine Support Right Side	Crack	345.00	345.00
110	1	Transmission Bearing Left	Crack	268.00	268.00
111	1	Console To Motor, Top Right	Necessary	288.00	288.00
112	1	Pendular Support Top	Necessary	259.00	259.00
113	1	Support Rear Bottom Right	Necessary	323.00	323.00
114	1	Pendular Support Rear	Necessary	250.00	250.00
115	1	Intercooler Radiator	Dent	973.00	973.00
116	1	Charge Air Pipe At Charge Air Cooler, Left	Cut	244.00	244.00
117	1	Charge Air Hose At Charge Air Cooler, Right	Cut	216.00	216.00
118	1	Water Cooler	Dent	795.00	795.00
119	1	Drain Screw Drain Plug	Necessary	12.00	12.00
120	1	Spacer Disk	Necessary	6.00	6.00
121	1	Refrigerant Condenser	Dent	1075.00	1075.00
122	1	Refrigerant Drier Condenser	Necessary	235.00	235.00
123	2	Elastomer Bearing Radiator Bottom	Necessary	60.00	60.00
124	2	Bearing Radiator Top	Necessary	60.00	60.00
125	2	Plug-in Mounting Radiator Top	Necessary	16.00	16.00
126	2	Bracket Radiator, Left & Right	Necessary	70.00	70.00
127	1	Radial Blower, Mechanical	Cut	425.00	425.00
128	1	Radiator Assy	Dent	825.00	825.00
129	1	Front Strut Lh	Dent	220.00	220.00
130	1	Front Strut Rh	Dent	265.00	265.00
131	1	Bumper Mtg	Cut	145.00	145.00
132	1	Engine Control Unit	Dent	1516.00	1516.00
133	1	Engine Air Intake Pipe	Crack	116.00	116.00
134	1	Front Grill Panel Set	Crack	1540.00	1540.00