

Special Instruction:

US: \$ 5400.00

ASSIGNMENT (Office)

From (Person): Shawn Wui of ALL Date/Time: 12092018

Estimated Cost: _____ Bill to: _____

Third Parties:

Claimant:

Surveyor: Treasure Appraisal

Workshop: Hendon Automotive

$$OD(\overline{TP \text{ Re-inspection}}) / \text{Evaluation}$$

To Inspect Vehicle No: SKC 5224S Insured: SLH 1558S

at Workshop m/s Hendon Automotive Tel:
of 280 Woodlands Ind Park E5 # 01-19

Policy No: _____ Claim No: 264641582586-003

Sum Insured: _____ Excess: _____

Make of Veh: _____ D.O.A. 21.03.2018

(Client's Record) 17.09.2018 (Monday) @ 12pm

H.O.D. Enregistrement/Date:

Date/Time: _____ Person Contacted: _____ Vehicle IN / OUT _____

Date/Time: _____ Confirmed with _____ Final Fig _____, _____ days (Red \$ _____ / _____ %; Original 7 days)

Date/Time: _____ Submit Final Fig 4683400, 5 days (Red \$ 2000 / 37%; Original _____ days)

Date/Time	Action/Instruction
	NUS (urpark 2A (ms Lynn - 9457 2885)
	SKC 5249 - CS3 / ALH18003476 / Sd3e2
	SLH 15588 - X
	DA: 21022018
	2/10/21

Para(1) : Parts found not replaced (To highlight *R or UB, LR, Etc*)

Para(2) : Comments on consistency of damages (Parts Not Consistent : NC)	
---	--

RECEIVED 03 OCT 2018

Para(3) : Nett Value

Market Value :

Salvage Value :

Nett Value :

1) Date/Time 3/10/18 File Pass to typist

3) Date/Time _____ File Pass to _____

5) Date/Time _____ File Pass to _____

Inspected/
Evaluated by:

2) Date/Time

4) Date/Time

6) Date/Time

Fee Charged:

Basic & Add

Transport

Photos

Others

Total


Date: _____

200

200

ASSIGNMENT

Vehicle No. _____
 Type: M.Cycle / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover
 Truck / Trailer or _____
 Make: Ben / 175
 Colour: Grey / 175
 Sp. Reading: 154125 / 175
 Engine No: _____
 Chassis No: 154125 / 175
 Gen. Cond: Good / Poor / Poor / Burnt
 Steering: Order / Jammed / Leaked / Burnt or
 Brakes: Order / Jammed / Leaked / Burnt or
 Model: 175 / S/Rim / STD A/Rim or
 Tyre Size: F: 23 / 35 / 2 R17
 R: 23 / 35 / 2 R17
 BS / DUN / EXNOVA / GY / FS / LIZA / 175 / OHTSU / PIR / SUMI
 TOYO / YOKO or _____
 Body Condition: _____
 Remarks: The veh had commenced its repair at the time of inspection.

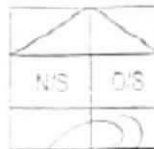

Body Market Value: _____
 BAC Accident Report: _____ Consistent? Yes or No
 BAC / PR Report: _____ Consistent? Yes or No
 Est. Report: _____ days Result: Yes or No
 Job Sum: _____ % 3 Val: Yes or No
 QA / REV / REP. / 24HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Front: _____ Rear: _____
 F/Bal: 6 mm R/Bal: 6 mm
 L/Bal: 6 mm L/Bal: 6 mm
 D.O.A: 21/1/18 D.O.A: 23/2/18
 Survey held at: 11.1.18
 Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision

Day / Time / Action / Instruction
20/10 Submit DAR report

RECEIVED

Days Of Repair: 3
 Resurvey No. of Trip: 1
 Survey Fee: 180
 Transport Fee: 20
 TOTAL: 200

Days Of Repair: 3
 Resurvey No. of Trip: 1
 Survey Fee: 180
 Transport Fee: 20
 TOTAL: 200

Add Fee: ☐ Site Insp. IS
☐ Interview IS
☐ Report IS
☐ Weekend IS

Survey Fee: 180
 Transport Fee: 20
 TOTAL: 200

Catherine Chong (LKK Auto)

From: Wui, Shawnkaijye <Shawnkaijye.Wui@aig.com>
Sent: Wednesday, 12 September, 2018 9:09 AM
To: assignments
Cc: Admin A; Nivitha (LKK Auto)
Subject: Your ref.: CS3/AIG18003476/SD3E2; Our ref.: 2646415825SG-003; Accident involving SKC 5224S and SLH 1558S on 21 Feb 2018
Attachments: Survey Report - 2646415825SG003.pdf; Survey Report - 2646415825SG003 - Photo 2.pdf; Survey Report - 2646415825SG003 - Photo 1.pdf

Dear Sirs,

Please assist to conduct physical re-inspection of TP vehicle.

Enclosed herewith TP survey report.

Please acknowledge this email and reply to kelly from Teo Keng Siang.

Thanks and Regards,
Shawn Wui
AIG
Complex Claims Examiner
Claims | AIG Asia Pacific Insurance Pte. Ltd.

78 Shenton Way, #08-16, Singapore 079120

Tel +(65) 6419 1959 | Fax +(65) 6835 7416

Shawnkaijye.Wui@aig.com | www.aig.com.sg

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by AIG for any loss or damage arising in any way from its use.

From: Kelly Cheng [mailto:kelly.cheng@ksteoptr.com]
Sent: Thursday, September 06, 2018 5:23 PM
To: Wui, Shawnkaijye
Subject: Re: Your ref.: TKS/H600-ACC-40241.18/kc; Our ref.: 2646415825SG-003; Accident involving SKC 5224S and SLH 1558S on 21 Feb 2018

WITHOUT PREJUDICE

Dear Shawn,

We refer to your email dated 23 May 2018.

Kindly note that arrangements have been made for you to re-inspect our client's vehicle **SKC 5224 S**. The details of the re-inspection are as follows:-

Date/Time:	17 September 2018 (Monday) @ 12:00PM
Venue/Location:	NUS Carpark 2A
Person In-Charge:	Ms Lynn
Contact:	9459 2885
Remarks:	Please call our client upon reaching

Kindly confirm the same and arrange for your In-House-Surveyor to attend punctually.

Please let us have your proposed offer within 14 days from the date of re-inspection.

Thank you!

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

MOTORCAR (Rear)

```

25.11.2013
(1) replace (1, 1) (2) Expand (3) (4) (5) (6) (7)
(8) (9) (10) (11) (12) (13) (14) (15) (16) (17) (18) (19) (20) (21) (22) (23) (24) (25) (26) (27) (28) (29) (30) (31) (32) (33) (34) (35) (36) (37) (38) (39) (40) (41) (42) (43) (44) (45) (46) (47) (48) (49) (50) (51) (52) (53) (54) (55) (56) (57) (58) (59) (60) (61) (62) (63) (64) (65) (66) (67) (68) (69) (70) (71) (72) (73) (74) (75) (76) (77) (78) (79) (80) (81) (82) (83) (84) (85) (86) (87) (88) (89) (90) (91) (92) (93) (94) (95) (96) (97) (98) (99) (100) (101) (102) (103) (104) (105) (106) (107) (108) (109) (110) (111) (112) (113) (114) (115) (116) (117) (118) (119) (120) (121) (122) (123) (124) (125) (126) (127) (128) (129) (130) (131) (132) (133) (134) (135) (136) (137) (138) (139) (140) (141) (142) (143) (144) (145) (146) (147) (148) (149) (150) (151) (152) (153) (154) (155) (156) (157) (158) (159) (160) (161) (162) (163) (164) (165) (166) (167) (168) (169) (170) (171) (172) (173) (174) (175) (176) (177) (178) (179) (180) (181) (182) (183) (184) (185) (186) (187) (188) (189) (190) (191) (192) (193) (194) (195) (196) (197) (198) (199) (200) (201) (202) (203) (204) (205) (206) (207) (208) (209) (210) (211) (212) (213) (214) (215) (216) (217) (218) (219) (220) (221) (222) (223) (224) (225) (226) (227) (228) (229) (230) (231) (232) (233) (234) (235) (236) (237) (238) (239) (240) (241) (242) (243) (244) (245) (246) (247) (248) (249) (250) (251) (252) (253) (254) (255) (256) (257) (258) (259) (260) (261) (262) (263) (264) (265) (266) (267) (268) (269) (270) (271) (272) (273) (274) (275) (276) (277) (278) (279) (280) (281) (282) (283) (284) (285) (286) (287) (288) (289) (290) (291) (292) (293) (294) (295) (296) (297) (298) (299) (300) (301) (302) (303) (304) (305) (306) (307) (308) (309) (310) (311) (312) (313) (314) (315) (316) (317) (318) (319) (320) (321) (322) (323) (324) (325) (326) (327) (328) (329) (330) (331) (332) (333) (334) (335) (336) (337) (338) (339) (340) (341) (342) (343) (344) (345) (346) (347) (348) (349) (350) (351) (352) (353) (354) (355) (356) (357) (358) (359) (360) (361) (362) (363) (364) (365) (366) (367) (368) (369) (370) (371) (372) (373) (374) (375) (376) (377) (378) (379) (380) (381) (382) (383) (384) (385) (386) (387) (388) (389) (390) (391) (392) (393) (394) (395) (396) (397) (398) (399) (400) (401) (402) (403) (404) (405) (406) (407) (408) (409) (410) (411) (412) (413) (414) (415) (416) (417) (418) (419) (420) (421) (422) (423) (424) (425) (426) (427) (428) (429) (430) (431) (432) (433) (434) (435) (436) (437) (438) (439) (440) (441) (442) (443) (444) (445) (446) (447) (448) (449) (450) (451) (452) (453) (454) (455) (456) (457) (458) (459) (460) (461) (462) (463) (464) (465) (466) (467) (468) (469) (470) (471) (472) (473) (474) (475) (476) (477) (478) (479) (480) (481) (482) (483) (484) (485) (486) (487) (488) (489) (490) (491) (492) (493) (494) (495) (496) (497) (498) (499) (500) (501) (502) (503) (504) (505) (506) (507) (508) (509) (510) (511) (512) (513) (514) (515) (516) (517) (518) (519) (520) (521) (522) (523) (524) (525) (526) (527) (528) (529) (530) (531) (532) (533) (534) (535) (536) (537) (538) (539) (540) (541) (542) (543) (544) (545) (546) (547) (548) (549) (550) (551) (552) (553) (554) (555) (556) (557) (558) (559) (560) (561) (562) (563) (564) (565) (566) (567) (568) (569) (570) (571) (572) (573) (574) (575) (576) (577) (578) (579) (580) (581) (582) (583) (584) (585) (586) (587) (588) (589) (590) (591) (592) (593) (594) (595) (596) (597) (598) (599) (600) (601) (602) (603) (604) (605) (606) (607) (608) (609) (610) (611) (612) (613) (614) (615) (616) (617) (618) (619) (620) (621) (622) (623) (624) (625) (626) (627) (628) (629) (630) (631) (632) (633) (634) (635) (636) (637) (638) (639) (640) (641) (642) (643) (644) (645) (646) (647) (648) (649) (650) (651) (652) (653) (654) (655) (656) (657) (658) (659) (660) (661) (662) (663) (664) (665) (666) (667) (668) (669) (670) (671) (672) (673) (674) (675) (676) (677) (678) (679) (680) (681) (682) (683) (684) (685) (686) (687) (688) (689) (690) (691) (692) (693) (694) (695) (696) (697) (698) (699) (700) (701) (702) (703) (704) (705) (706) (707) (708) (709) (710) (711) (712) (713) (714) (715) (716) (717) (718) (719) (720) (721) (722) (723) (724) (725) (726) (727) (728) (729) (730) (731) (732) (733) (734) (735) (736) (737) (738) (739) (740) (741) (742) (743) (744) (745) (746) (747) (748) (749) (750) (751) (752) (753) (754) (755) (756) (757) (758) (759) (760) (761) (762) (763) (764) (765) (766) (767) (768) (769) (770) (771) (772) (773) (774) (775) (776) (777) (778) (779) (780) (781) (782) (783) (784) (785) (786) (787) (788) (789) (790) (791) (792) (793) (794) (795) (796) (797) (798) (799) (800) (801) (802) (803) (804) (805) (806) (807) (808) (809) (810) (811) (812) (813) (814) (815) (816) (817) (818) (819) (820) (821) (822) (823) (824) (825) (826) (827) (828) (829) (830) (831) (832) (833) (834) (835) (836) (
```

Rear Portion

NAC	INS	Item	CON	AC	QTY
1137	993626	Rear Number Plate			
1138	993637	Rear Number Plate Base			
1139	993630	Rear Number Plate Garnish			
1140	993632	Rear Number Plate Lamp			
1141	993958	Rear Bumper			
1142	993085	Rear Bumper Upper	CRK	✓	
1143	993017	Rear Bumper Lower			
1144	993084	Rear Bumper Side			
1145	993103	Rear Bumper Tow Cover			
1146	992341	Rear Bumper Clips	NEL	✓	
1147	992976	Rear Bumper Bracket			
1148	993068	Rear Bumper Side Retainer	DM	✓	
1149	993045	Rear Bumper Reinforcement	DD	✓	
1150	993970	Rear Bumper Beam	DD	✓	
1151	993077	Rear Bumper Sponge			
1152	992999	Rear Bumper Damper			
1153	993040	Rear Bumper Protector			
1154	993036	Rear Bumper Pad			
1155	993026	Rear Bumper Moulding			
1156	993044	Rear Bumper Reflector			
1157	993023	Rear Bumper Lower Spoiler	DD	✓	
1158	994023	Reverse Sensor	SC	✓	
1159	991327	Rear End Panel			
1160	991339	Rear End Panel Top Garnish			
1161	993333	Rear End Panel Inner Trim			
1162	990333	Boot Compartment Inner Trim			
1163	993851	Rear LH Taillamp	JCR	✓	
1164	993853	Rear LH Taillamp Garnish			
1165	993859	Rear LH Taillamp Panel			
1166	993116	Rear RH Taillamp			
1167	993853	Rear RH Taillamp Garnish			
1168	993859	Rear RH Taillamp Panel			
1169	993554	Rear Apron Panel			
1170	992895	Boothlid	DD	R	
1171	991328	Boothlid Emblem			
1172	990356	Boothlid Handle			
1173	995250	Boothlid Moulding			
1174	990376	Boothlid Reflector			
1175	995222	Boothlid Lamp LH			
1176	992899	Boothlid Lamp RH			
1177	995243	Boothlid Lock	DD	✓	
1178	990377	Boothlid Rubber			
1179	990382	Boothlid Hinge			
1180	993877	Boothlid Spoiler			
1181	994543	Tailgate			
1182	991328	Tailgate Emblem			
1183	994643	Tailgate Outer Handle			
1184	994640	Tailgate Moulding			
1185	994545	Tailgate Garnish			
1186	994648	Tailgate Reflector			
1187	994549	Tailgate Lamp			
1188	994646	Tailgate Protector			
1189	994676	Tailgate Wiper Arm			
1190	994677	Tailgate Wiper Blade			
1191	994679	Tailgate Wiper Nozzle			
1192	994555	Tailgate Wiper Motor			
1193	994602	Tailgate Glass			
1194	994606	Tailgate Glass Rubber			
1195	994604	Tailgate Glass Moulding			
1196	994607	Tailgate Glass Sealant			
1197	994629	Tailgate Lock			
1198	994631	Tailgate Rubber			
1199	994631	Tailgate Hinge			
1200	994594	Tailgate Damper			






































Vehicle No: SKC 5224 S

































 




 


 




NAC	INC	Item	CON	AC	Qty
1202	993784	Spare Tyre Board			
1203	994328	Spare Tyre Panel			
1204	995065	Spare Tyre			
1205	994126	Spare Tyre Lock Screw			
1206	993787	Spare Tyre Cover			
1207	995323	Triangle Breakdown Sign			
1208	990507	CD Changer Assy			
1209	990164	Antenna			
1210	990534	Centre Exhaust Pipe Assy			
1211	990532	Centre Exhaust Mounting			
1212	993364	Rear Exhaust Pipe			
1213	993357	Rear Exhaust Chrome Pipe			
1214	993361	Rear Exhaust Mounting			
1215	993358	Rear Exhaust Heat Shield			
1216	995223	Rear LH Chassis Member			
1217	993165	Rear RH Chassis Member			
1218	993436	Rear LH Fender			
1219	993449	Rear LH Fender Protector			
1220	993420	Rear LH Fender Inner Panel			
1221	993431	Rear LH Fender Inner Trim			
1222	993415	Rear LH Fender Inner Garnish			
1223	993425	Rear LH Fender Inner Shield			
1224	993621	Rear LH Mudflap			
1225	993933	Rear LH Wheel Rim			
1226	994025	Rear LH Rim Cover			
1227	995065	Rear LH Tyre			
1228	993456	Rear RH Fender			
1229	993450	Rear RH Fender Protector			
1230	993420	Rear RH Fender Inner Panel			
1231	993431	Rear RH Fender Inner Trim			
1232	993415	Rear RH Fender Inner Garnish			
1233	993425	Rear RH Fender Inner Shield			
1234	993622	Rear RH Mudflap			
1235	993934	Rear RH Wheel Rim			
1236	994025	Rear RH Rim Cover			
1237	995065	Rear RH Tyre			
1238	995162	Rear Fender Extension Panel LH			
1239	993491	Rear Fender Extension Panel RH			
1240	993430	Rear Fender Inner Top Garnish			
1241	993673	Rear Fender 1/4 Glass			
1242	993452	Rear Fender 1/4 Glass Rubber			
1243	993453	Rear Fender 1/4 Glass Sealant			
1244	993949	Rear Windscreen Glass			
1245	993976	Rear Windscreen Rubber			
1246	993961	Rear Windscreen Moulding			
1247	993955	Rear Windscreen Sealant			
1248	994729	Third Brake Light			
1249	993385	Rear Fender Air Grille			
1250	992167	Fuel Lid			
1251	992168	Fuel Neck			
1252	992179	Fuel Tank			
1253	992184	Fuel Tank Bracket			
1254	992191	Fuel Tank Float			
1136	990747	Socker			
		* 3 days			

Claim Documents

***SKC5224S (2646415825SG)**
[SLH1558S]

TP
KAMAL BIN YACOB
Feb 21 2018 12:00AM
[LIM KAH GUAN]
Hendon Automotive

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser	
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
2	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
3	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
4	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
5	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
6	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
7	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
8	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
9	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
10	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
11	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
12	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
13	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
14	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
15	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
16	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
17	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
18	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
19	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
20	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
21	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
22	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
23	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
24	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
25	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
26	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
27	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
28	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
29	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
30	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
31	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
32	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
33	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
34	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
35	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
36	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>
37	03/04/18 17:49	General View	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
38	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
39	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
40	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
41	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
42	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
43	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
44	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
45	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
46	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
47	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
48	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
49	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
50	03/04/18 17:49	Odometer Reading		<input checked="" type="checkbox"/>
51	03/04/18 17:49	Chassis Number		<input checked="" type="checkbox"/>
52	03/04/18 17:49	General View		<input checked="" type="checkbox"/>
53	03/04/18 17:49	Reinspection Photo		<input checked="" type="checkbox"/>
54	03/04/18 17:49	Reinspection Photo		<input checked="" type="checkbox"/>
55	03/04/18 17:49	Reinspection Photo		<input checked="" type="checkbox"/>
56	03/04/18 17:49	Reinspection Photo		<input checked="" type="checkbox"/>
57	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
58	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
59	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
60	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
61	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
62	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
63	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
64	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
65	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
66	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
67	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
68	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
69	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
70	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
71	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
72	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
73	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
74	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
75	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
76	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
77	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
78	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
79	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
80	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
81	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
82	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
83	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
84	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
85	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
86	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>
87	03/04/18 17:51	Reinspection Photo		<input checked="" type="checkbox"/>

Photos/Images			
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	3 per page <input type="checkbox"/>
			Thumbnail Print

Documentation			
No	Finalized On	AIG Asia Pacific Insurance Pte. Ltd. (SG)	1 per page <input type="checkbox"/>
1	04/04/18 12:10	OT GIA REPORT	Thumbnail Print
			1 Load PDF

Documents Checklist

DOCUMENTS CHECKLIST		Reset	Save	Print
There are no document checklists configured.				

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)	
<div></div>	

Show Remarks To: ☐ Handling Insurer
Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co. Reg No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG18003476/SD3E2
Date: 23/04/2018

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No:
Claimant Vehicle No: SKC5224S Insured Vehicle No: SLH1558S
Date of Loss: 21/02/2018 Nature of Claim: TP Claim No: 2646415825SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SKC5224S
Make & Model: BMW 318i, 2.0 (A) Engine No: A248I950N46B20BZ
Reg. Date: 06/09/2011 (Man. Year: 2011) Chassis No: WBAPF72050FG90294
Colour: Grey Odometer: 154125 km
Engine Capacity: 1995 cc
Market Value/New Car Price: N/A
Sum Insured (\$\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 235/35Z R19 Rear Tyre Size: 265/30Z R19
Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm
Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 22/02/2018
Date Inspected: 23/02/2018 Inspected At: Hendon Automotive (HQ)
280 WOODLANDS INDUSTRIAL PARK
E5, #01-19 HARVEST @ WOODLANDS
Singapore 757322
Estimated Period of Repair: 3.0 days

Adjuster: Sebastian Yeang Wai Keen

Manager: Nivitha Govindasamy

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Cracked	0.00 F	*- F
2	1		*REAR BUMPER CLIPS	Necessary	0.00 F	*- F
3	1		*REAR BUMPER RETAINER	Damaged	0.00 F	*- F
4	1		*REAR BUMPER REINFORCEMENT	Dented	0.00 F	*- F
5	1		*REAR BUMPER BEAM	Dented	0.00 F	*- F
6	1		*REAR BUMPER LOWER SPOILER	Dented	0.00 F	*- F
7	1		*REVERSE SENSOR	Shorted	0.00 F	*- F
8	1		*REAR LH TAILLAMP	Scratched	0.00 F	*- F
9	1		*BOOTLID	Repair	0.00 F	*- F
10	1		*BOOTLID LOCK	Dented	0.00 F	*- F
Total Parts (S\$)					0.00	0.00

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >

Treasure Appraisal Services

9 Joo Chiat Place Singapore 427743
HP: (65) 9833 1618 Fax: (65) 6747 1017
Email: treasureappraisal@gmail.com
Reg No: 53218791A



VEHICLE ASSESSMENT REPORT

Report No : T-HD-180221/52245
Date : 02-Mar-18

REFERENCE

Assigned By : Kamal Bin Yacob
Name of Workshop : Hendon Automotive Pte Ltd
Place of Inspection : 280 Woodlands Industrial Park E5 #01-19 Harvest @ Woodlands Singapore 757322
Date of Assignment : 21-Feb-18
Date of Accident : 21-Feb-18
Date of Inspection : 21-Feb-18

PARTICULARS OF DAMAGED VEHICLE

Vehicle Reg No	: SKC 5224 S	Chassis No	: WBAPF72050FG90294
Year of Reg	: Sep-11	Odometer/km	: 154125
Make/Model	: B.M.W. 318i	Engine No	: A248I950N46B20BZ
Vehicle Colour	: Grey	Engine Capacity	: 1995 cc
Vehicle Type	: Luxury Sedan	Transmission Type	: Auto

PRE-ACCIDENT CONDITION OF VEHICLE (STATIC TESTS ONLY)

General Condition	: Good		
Body Paint Work	: Good	Footbrake	: Serviceable
Steering	: Serviceable	Handbrake	: Serviceable
Front Undercarriage	: Serviceable	Rear Undercarriage	: Serviceable

TIRES CONDITION		Tire Brand		Size		Tread Balance
Front RH	:	Michelin	:	235/35 R19	:	60%
Rear RH	:	Michelin	:	265/30 R19	:	70%
Front LH	:	Michelin	:	235/35 R19	:	60%
Rear LH	:	Michelin	:	265/30 R19	:	70%

Road Wheels Type : Sport Rim

Note: The above percentages represent the estimated remaining balance of the tire treads in mm.

* Denotes damaged components.

SYNOPSIS OF DAMAGES

At the time of survey, we noted that the vehicle has sustained an impact damages on the rear portions.

For further detail of the damages, please refer to our schedule and 118 pcs of surveyed photograph attached.

Treasure Appraisal Services

9 Joo Chiat Place Singapore 427743
HP: (65) 9833 1818 Fax: (65) 6747 1017
Email: treasureappraisal@gmail.com
Reg No: 53218791A



RECOMMENDATIONS

We referred to your instruction to appraise the above vehicle SKC 5224 S on 21-Feb-18 and in the accordance, we have carried out a physical assessment at your appointed workshop.

A static inspection was carried out and report is enclosed for your reference. The estimated repair cost submitted by the repairer for SGD 8,271.90 as per attached schedule has been scrutinised and revised by us against the actual damages found on the vehicle and we recommended the replacements and rectifications accordingly.

The repair cost has been revised to SGD 6,730.25 and therefore in the consideration of the repairer giving a further 20% even discount, it was agreed that the repairs to be carried out at a contractual lump sum of SGD 5,400.00 nett.

In such event, the repairer shall has the prerogative to either use new, OEM, re-conditioned parts and/or repair any damaged body parts that the repairer is confident and capable of repairing as long as the vehicle is put on the road in its pre-accident and road worthy condition and to the entire satisfaction of the owner.

Under normal circumstances, the estimated period of repairs is **Seven (7)** working days.

Pursuant to your instructions, we have NOT AUTHORISED to carry out the repairs on your behalf and we are submitting this report for your consideration.

This survey and/or appraisalment was carried out to the best of our knowledge, ability and on a "STRICTLY WITHOUT PREJUDICE" basis to any party concern.

We are reverting the matter to you for your discretion.

Yours Truly,
Treasure Appraisal Services



Dixon Yeo P W
Automobile Appraiser

The revised estimate was made from a visual inspection. Any discrepancies or unseen damage/s should be notified to the company within **Fourteen (14) days** from the date thereof. Otherwise, the revised amount should deem to be valid.

This report is strictly confidential and is given for the use of client and their authorised assigned agent and any disclosure or publication of it or part or whole shall be the responsibility of such person and no liability shall be attached to TREASURE APPRAISAL SERVICES thereof.

Treasure Appraisal Services

9 Joo Chiat Place Singapore 427743
 HP: (65) 9833 1618 Fax: (65) 6747 1017
 Email: treasureappraisal@gmail.com
 Reg No: 53218791A



APPRAISEMENT SCHEDULE

Vehicle Registration No: SKC 5224 S

Report No: T-HD-180221/5224S

S/N	Descriptions	Condition	Qty	Repairer's Estimate	Our Assessment
LIST ITEMS					
1	Rear bumper cover	Damaged	1 pc	\$ 1,035.00	\$ 1,035.00
2	Rear bumper cover tow hook cover	Necessary	1 pc	\$ 20.00	\$ 20.00
3	Rear bumper lower cover	Damaged	1 pc	\$ 386.00	\$ 386.00
4	Rear bumper clip	Necessary	1 set	\$ 25.00	\$ 25.00
5	Reverse sensor assy	Damaged	2 pcs	\$ 864.00	\$ 432.00
6	Rear bumper upper center support pad	Damaged	1 pc	\$ 55.00	\$ 55.00
7	Rear RH bumper side retainer bracket	Damaged	1 pc	\$ 45.00	\$ 45.00
8	Rear LH bumper side retainer bracket	Damaged	1 pc	\$ 45.00	\$ 45.00
9	Rear bumper reinforcement	Damaged	1 pc	\$ 415.00	\$ 415.00
10	RH tail lamp lower bracket	Necessary	1 pc	\$ 135.00	\$ 135.00
11	LH tail lamp lower bracket	Necessary	1 pc	\$ 135.00	\$ 135.00
12	Rear end panel	Damaged	1 pc	\$ 770.00	\$ 770.00 Rn
13	Rear end panel garnish	Reusable	1 pc	\$ 75.00	\$ -
14	Trunk lid panel	Damaged	1 pc	\$ 1,090.00	\$ 1,090.00 Rn
15	Trunk lid symbol emblem	Necessary	1 pc	\$ 60.00	\$ 60.00
16	Trunk lid "318i" emblem	Necessary	1 pc	\$ 47.00	\$ 47.00
				\$ 5,202.00	\$ 4,695.00 2835
Less Discount : 5%				\$ 260.10	\$ 234.75
List Parts Sub-Total :				\$ 4,941.90	\$ 4,460.25 2693.25
Parts Total :				\$ 4,941.90	\$ 4,460.25

S/N	Labour Descriptions	Repairer's Estimate	Our Assessment
1	Diagnose, replace and/or repair to rectify rear electrical system for proper functioning.	\$ 60.00	\$ 40.00 30
2	Transfer boot lid / tailgate mechanism and wiring assy to facilitate body repairs.	\$ 150.00	\$ 80.00 X
3	Dismantle, replace and/or re-install reverse sensor assy and rectify for proper functioning.	\$ 150.00	\$ 80.00 30
4	Dismantle and re-install rear interior upholstery; trimming and garnish/es to facilitate body repairs.	\$ 200.00	\$ 180.00 60
5	To carry out accident body repairs; dismantle vehicle body part/s, dismember affected damaged body panel/s, replace and/or repair, re-construction, weld to re-join and re-align vehicle body structures to pre-accident condition.	\$ 1,250.00	\$ 1,000.00 700

Treasure Appraisal Services

9 Joo Chiat Place Singapore 427743
HP: (65) 9833 1618 Fax: (65) 6747 1017
Email: treasureappraisal@gmail.com
Reg No: 53218791A



S/N	Labour Descriptions	Repairer's Estimate	Our Assessment
6	To furnish, putty, sanding, masking, prepare paint mixture & toning, complete cleaning, spray paint, polishing and waxing on affected areas.	\$ 1,250.00	\$ 750.00 700
7	To furnish and apply under-sealing & rust proofing coats on accident affected area.	\$ 150.00	\$ 80.00 60
8	Conduct water leakage tests to ensure proper air and water sealing.	\$ 120.00	\$ 60.00 30
Labour Total :		\$ 3,330.00	\$ 2,270.00
Parts & Labour Total :		\$ 8,271.90	\$ 6,730.25 1610

Note: The repairer has agreed to undertake the repairs at our adjusted amount of **SGD 5,400.00** on a ***Contractual Lump Sum Basis** corresponding to supply of all parts, labour and spray painting charges.

N.B: *Under Contractual Lump Sum Basis, the repairer shall has the prerogative to either use new, OEM, re-conditioned parts and/or repair any damaged body parts that the repairer is confident and capable of repairing as long as the vehicle is put on the road in its pre-accident and road worthy condition and to the entire satisfaction of the owner.

Under normal circumstances, the estimated period of repairs is **Seven (7)** working days. Pursuant to your instruction, we have **NOT AUTHORISED** the repairs on your behalf.

Treasure Appraisal Services



Dixon
Automobile Appraiser

4303.25
13400
5 days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AIG ASIA PACIFIC INSURANCE PTE LTD		Ref : CS3/AIG18003476/T1rbe2-1	
78 SHENTON WAY #08-16 CHARTIS BUILDING SINGAPORE 079120		Date : 04-10-2018	
		Code : AIG	
1. Policy Particulars :- THIRD PARTY CLAIM (RESURVEY INSPECTION)			
Insured Veh.	SLH 1558S	Veh. Inspected	SKC 5224S
Policy No.		Coverage (\$)	0.00
Claim No.	2646415825SG-003	Excess (\$)	0.00
Assign From	SHAWN WUI	Assign Date	12/09/2018
2. Vehicle Particulars & Condition			
Make & Model	B.M.W. 318I	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2011
Chassis No.	WBAPF72050FG90294	Colour	GREY
Odometer	-	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	235/35 R19	MICHELIN	5 mm
L/H Front Tyre	235/35 R19	MICHELIN	5 mm
R/H Rear Tyre	265/30 R19	MICHELIN	5 mm
L/H Rear Tyre	265/30 R19	MICHELIN	5 mm
4. Description of Damages			
THE VEHICLE HAD COMPLETED ITS REPAIR WORKS. REPAIR CONDITION SEE DETAILS.			
5. General Information			
Accident Date	21/02/2018	Inspection Date	17/09/2018
Survey held at	NUS CARPARK 2A		
Repairer	HENDON AUTOMOTIVE		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKC 5224S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER COVER	REPLACED	1,035.00	1,035.00
1	REAR BUMPER COVER TOW HOOK COVER	REPLACED	20.00	20.00
1	REAR BUMPER LOWER COVER	REPLACED	386.00	386.00
1	REAR BUMPER CLIP	REPLACED	25.00	25.00
2	REVERSE SENSOR ASSY	REPLACED	864.00	432.00
1	REAR BUMPER UPPER CENTER SUPPORT PAD	REPLACED	55.00	55.00
1	REAR RH BUMPER SIDE RETAINER BRACKET	REPLACED	45.00	45.00
1	REAR LH BUMPER SIDE RETAINER BRACKET	REPLACED	45.00	45.00
1	REAR BUMPER REINFORCEMENT	REPLACED	415.00	415.00
1	RH TAIL LAMP LOWER BRACKET	REPLACED	135.00	135.00
1	LH TAIL LAMP LOWER BRACKET	REPLACED	135.00	135.00
1	REAR END PANEL	REPAIRED SEE LABOUR	770.00	-
1	REAR END PANEL GARNISH	REUSABLE	75.00	-
1	TRUNK LID PANEL	REPAIRED SEE LABOUR	1,090.00	-
1	TRUNK LID SYMBOL EMBLEM	REPLACED	60.00	60.00
1	TRUNK LID "318I" EMBLEM	REPLACED	47.00	47.00
	LESS 5% DISCOUNT		-260.10	-141.75
			4,941.90	2,693.25
	<u>LABOUR</u>			
	DIAGNOSE, REPLACE AND / OR REPAIR REAR ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		60.00	30.00
	TRANSFER BOOT LID / TAILGATE MECHANISM AND WIRING ASSY TO FACILITATE BODY REPAIRS.	NOT NECESSARY	150.00	-
	DISMANTLE, REPLACE AND / OR RE-INSTALL REVERSE SENSOR ASSY AND RECTIFY FOR PROPER FUNCTIONING.		150.00	30.00
	DISMANTLE AND RE-INSTALL REAR INTERIOR UPHOLSTERY; TRIMMING AND GARNISH / ES TO FACILITATE BODY REPAIRS.		200.00	60.00

Report Ref No. CS3/AIG18003476/T1rbe2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CARRY OUT ACCIDENT BODY REPAIRS; DISMANTLE VEHICLE BODY PART/S, DISMEMBER AFFECTED DAMAGED BODY PANEL/S, REPLACE AND / OR REPAIR, RE-CONSTRUCTION, WELD TO RE-JOIN AND RE-ALIGN VEHICLE BODY STRUCTURES TO PRE-ACCIDENT CONDITION. INCLUSIVE OF THE REPAIR OF REAR END PANEL AND TRUNK LID PANEL.		1,250.00	700.00
	TO FURNISH, PUTTY, SANDING, MASKING, PREPARE PAINT MISTURE & TONING, COMPLETE CLEANING, SPRAY PAINT, POLISHING AND WAXING ON AFFECTED AREAS.		1,250.00	700.00
	TO FURNISH AND APPLY UNDER-SEALING & RUST PROOFING COSTS ON ACCIDENT AFFECTED AREA.		150.00	60.00
	CONDUCT WATER LEAKAGE TESTS TO ENSURE PROPER AIR AND WATER SEALING.		120.00	30.00
			3,330.00	1,610.00
GRAND TOTAL			8,271.90	4,303.25
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,400.00

Report Ref No. CS3/AIG18003476/T1rbe2-1

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.