

22/03/2001

ASS. REC. BY:

REF: CS/MSG18016609/Ktd302 Special Instruction:

Survivor  
Merrimen

Kenneth

ASSIGNMENT (Office)

From (Person):

Pauline tham

of

MSG

Date/Time:

12/9/18 @ 9.25am

Estimated Cost:

Bill to:

OD / ~~TP~~ WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SGL 600Y

Insured:

FBL 7481L

at Workshop m/s

BH Auto

Tel:

6559 8944

of

Blk 1 Sin Ming Ind. Est. Sec. C #01-111

Policy No:

MSD/VMT/18-376915-CA

Claim No:

MSC/V/18-001219

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

09/09/2018

CA / REV / REP. / REV 24 HRS <sup>lup</sup>

H.O.D. Endorsement:

Date/Time:

9:37am @ 12/9/18

Person Contacted:

Jacelyn

Vehicle ☒ IN ☐ OUT

Date/Time

Action/Instruction

(✓) Estimate

SGL 600Y - NBA/MSG16011551/Y

DOR: 20/6/16

FBL 7481L - X

14/9 -

Refer via merrimen pending estimate.

Convert to OD

11/1 -

Submit prelim report.

ASS. REC. BY:

REF: MSG /

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

Consistent?: Yes or No

Consistent?: Yes or No

days Res.: Yes or No

% 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour:

Sp. Reading

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Rear

R/Bal.

L/Bal.

D.O.I.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

RECEIVED 14 JAN 2019

Date/Time, File Pass to?

1) 11/1 Typist

Date/Time, File Return to?

2)

Report Format:

Lump Sum / I.B.I. (\$) TP

☒ : Prell. Report☐ : Final Report

Days Of Repair: 7

Resurvey No. of Trip: /

Add Fee:

☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech Invs (\$)☐ : Weekend (\$)

Survey Fee:

Transportation:

S - RS. \$

Photos

Others

TOTAL

200

200

## ...CLAIM SUBFOLDER...(New Assignment)

### CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	10 Sep 2018		12 Sep 2018 09:25 <a href="#">Assign</a>				<b>New Assignment</b> <a href="#">Cancel Case</a>

Main

Reference

Claim Details

Documents

[Show All](#)

### CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	EVERGREEN REFUSE DISPOSAL & CLEANING SERVICES PTE LTD, Co. Reg. No.: 199804541M		
Main Claimant:	HO LI CHEN CHERYL, ID: S7435801B		
Vehicle Reg. No.:	SGL600Y	Date of Loss:	09/09/2018 09:00 - :59 [105 Months and 22 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / MSC/V/18-001219	Policy/Cover Note No.:	MSD/VMT/18-376915-CA (Third Party Only) Coverage: 22/02/2018 - 21/02/2019
Vehicle Reg. No. (Insured):	FBL7481L	Policy No. (Claimant):	
		Excess:	
Repairer:	BH Auto Services Pte Ltd (Sin Ming) Blk 1 Sin Ming Industrial Estate Sector C, #01/111/113/115/117, 575636 Sin Ming - Tel: 6559 8944		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Pauline Tham - 6594 2545]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 13/09/2018]		
Adj Asg. Remarks:	LIABILITY : NOT CLEAR (NON-REPORTING) VEHICLE IN THE WORKSHOP Please appoint LKK AUTO to conduct the survey and Kindly contact JACELYN KOH @ 6559 8944		

### ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

There are no mail for this case.

### ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

9.25am  
veh  
icover



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MSIG INSURANCE (SINGAPORE) PTE LTD

Ref : CS/MSG18016609/Ktd3

16 RAFFLES QUAY  
#24-01 HONG LEONG BLDG SINGAPORE 048581

Date : 12-09-2018



Code : MSG

## 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	FBL 7481L	Veh. Inspected	SGL 600Y
Policy No.	MSD/VMT/18-376915-CA	Coverage (\$)	0.00
Claim No.	MSC/V/18-001219	Excess (\$)	0.00
Assign From	MERIMEN (PAULINE THAM)	Assign Date	12/09/2018

## 2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

## 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

## 4. Description of Damages

--	--

## 5. General Information

Accident Date	09/09/2018	Inspection Date	11/09/2018
Survey held at	BH AUTO SERVICES PTE LTD BLK 1 SIN MING INDUSTRIAL ESTATE SECTOR C #01-115 SINGAPORE 575636		

## 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

## View Sent Message

This mail is associated with :

**\*SGL600Y (MSC/V/18-001219)**  
**[FBL7481L]**

TP

HO LI CHEN CHERYL

Sep 9 2018 9:00AM

[EVERGREEN REFUSE DISPOSAL & CLEANING SERVICES PTE LTD]

BH Auto Services Pte Ltd

[Resend](#) [View Recipients](#) [Print Message](#) [Delete Message](#) [Forward](#)

**From** LKK Auto Consultants Pte Ltd (LKK\_HQ), sent on **14/09/2018 14:42 PM.**  
**To** pauline\_tham@sg.msg-asia.com  
**Subject** **\*SGL600Y (MSC/V/18-001219) [FBL7481L]**

Dear Sir/Madam,

Please be informed that we have inspected the vehicle SGL 600Y on 11/9/2018  
We are pending estimate from repairer.

Regards,  
Denise

**LKK Auto Consultants Pte Ltd**

### DOCUMENTS SUMMARY

There are no documents.

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	10/09/2018 10:50
Date Of Accident	09/09/2018 09:00
Exact Location Of Accident	RANGOON RD TWDS KITCHENER RD JUNCTION OF LECENT RD
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGL600Y
<b>Insured/Policyholder</b>	
Name Of Registered Owner	HO LI CHEN CHERYL
NRIC No	S7435801B
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-82888980
Alternative Phone No	OFFICE-82888980

### Vehicle Particulars

Manufacturer	MERCEDES-BENZ
Model	E300-3.0 (A)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USED
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

### Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	GA128073
Cover Note Number	

### Driver

Name of Driver	MOHAMED RAFII BIN MOHAMAD
NRIC No	S1598642E
Date Of Birth	13/11/1963
Occupation	INDOOR
Date Of Driving Pass	18/02/1986
Driving Experience	32 YEARS AND 6 MONTHS
Gender	MALE
Mobile Number	+65-90900309
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	NIL
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	SPOUSE
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	NO COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

PLEASE REFER TO STATEMENT

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	FILE TO BIG
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	FBL7481L
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

4  
A  
A

Hand-drawn diagram of the accident site. The diagram shows the intersection of a "one way lane road" (top) and a "one way lane street" (right). A north arrow points towards the top left. The "one way lane road" has an arrow pointing right. The "one way lane street" has an arrow pointing left. A "To Detention Road" is indicated on the left. The diagram shows the positions of the vehicles involved in the accident, with labels for "position of vehicle" and "position of vehicle during accident". A "Sag 600g" is also labeled. The diagram includes a scale bar with markings for 10, 20, 30, 40, 50, 60, 70, 80, 90, and 100 meters.

## This image shows a single sheet of white paper with horizontal blue or grey ruling lines. The lines are evenly spaced and run across the width of the page. There is no handwriting or other markings on the paper.

I/We declare the foregoing particulars are true in every respect

Date &amp; Time 9/01/18

Reporting Centre Personnel's Signature



# Police Report



**SINGAPORE  
POLICE FORCE**



T/20180909/2021

Police Station Of Origin:  
Kampong Java N.P.C  
21 Kampong Java Road SINGAPORE  
228892  
Tel No: 1800-2659999

2 of 3

Report No. T/20180909/2021

## CONTINUATION OF REPORT

<b>Driver</b>			
Name	MOHAMED RAFFI BIN SHARWAN		ID No. S1598642E
Related Vehicle	SGL600Y (Car)		Contact No. 90800309
Hospital/Clinic	NIL		Class of Driving Licence & Expiry Date Class: 2B, 2A, 2, 3 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
<b>Rider</b>			
Name	Unknown Rider		ID No. NIL
Related Vehicle	NIL		Contact No. NIL
Hospital/Clinic	NIL		Class of Driving Licence & Expiry Date Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

### Brief Details:

On 09/09/2018 at about 0900hrs, I was driving along Rangoon Road towards Kitchener Road. I slowed down at the junction of Kent Road and signaled to turn right. As my car (SGL600Y) turned right slightly into Kent Road, one motorcycle (FBL7481L) suddenly collided into me on the right. The motorcyclist then fell on the ground on his left, lying on his back with his motorcycle pinned on him. I quickly alighted from my car and assisted to bring the said motorcycle up. Passerby assisted to bring the said motorcyclist to the side of the road. I observed that the said motorcyclist is conscious and there were some lacerations on his left forearm. I am not sure if the said motorcyclist sustained any other injuries. Subsequently, the ambulance and Traffic Police arrived at scene. The said motorcyclist informed his version to the Traffic Police and was then conveyed by the ambulance. My car's damage is a ripped off right side mirror and multiple dents and scratches along both right doors, right skirting and right front mudguard. The motorcycle's damage is a bent left side mirror and a dent at the top left of the rear vehicle registration number plate based on what I have observed. At the point of accident, I was in a state of shock but as I was lodging a Police report, I think I will see a doctor. I am also lodging this report for a third party claim against the said motorcyclist.

# Police Report



**SINGAPORE  
POLICE FORCE**



T/20180909/2021

Police Station Of Origin  
Kampong Java N.P.C  
21 Kampong Java Road SINGAPORE  
228892  
Tel No: 1800-2956999

1 of 3

Report No: T/20180909/2021

## REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made 09/09/2018 10:48		Vide Report No. E/20180909/0136		Station Diary No. 35
<b>Informant's Particulars</b>				
Name of Informant: MOHAMED RAFFI BIN SHARWAN		Address APT BLK 402 SIN MING AVENUE #05-323 SINGAPORE 570402		
ID Type / ID No. NRIC NO / S1598542E		Contact No. Home/Office Mobile 90900309		
Nationality: SINGAPORE CITIZEN		Email		
Sex Male	Age 54	Date of Birth 13/11/1963	Type of Informant. Driver	
Race Malay		Language	Institution / School Name	
Occupation: Manager		Driving Licence Information: Class: 2B, 2A, 2, 3 Date of Expiry:		

## General Information of the Accident

Type of Accident:	Injury Attended by Police	Drink Drive No	Date/Time of Accident 09/09/2018 09:00	Type of Location Straight Road
Location: Along Road 1 RANGOON ROAD				
Rangoon Road towards Kilchener Road, Junction of Kent Road				
Weather: Clear	Road Surface: Dry		Road Speed Limit:	
Traffic Flow Two Way	Traffic Control Not Controlled		Traffic Volume Light	
Type of Collision: Between Moving Vehicles - Side Swipe - Same Direction			Anyone conveyed by ambulance Yes	

## Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
FBL7481L	Motorcycle	YAMAHA	FZ	Red	Slightly Damaged	0
SGL600Y	Car	MERCEDES BENZ	E300	Black	Seriously Damaged	0

## Details of Person Involved

Any Pedestrian Involved: No	Use of Pedestrian Crossing: NA
No. of Pedestrians Injured: NIL	

Identification Card



SINGAPORE  
POLICE FORCE



T/20150909/2021

Police Station Of Origin  
Kampong Java N.P.C  
21 Kampong Java Road SINGAPORE  
228892  
Tel No: 1800-2959999

3 of 3

Report No: T/20150909/2021

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report  
E /  
Sgt 3 NG JUN MING

Signature Of Interpreter  
Not applicable

Signature Of Informant

Date/Time  
09/09/2018 10:48

Officer In Charge Of Case  
TP / GR /  
Sr Staff Sgt IRMAN BIN MOHAMAD SAID  
Contact No: 65476385

Sgt 107

Authentication Stamp  
NPIC

Classification Of Case

# BH AUTO SERVICES PTE LTD

Blk 1, Sector C, Sin Ming Industrial Estate #01-111 / 113 / 115 / 117 Singapore 575636  
Tel: 6559 8944 / Fax: 6269 2404

MSIG Insurance (Singapore) Pte Ltd  
16 Raffles Quay  
#24-01 Hong Leong Building  
Singapore 048581  
Tel: 6220 9644 Fax: 62257402

DEAR SIR / MADAM :

ACCIDENT REPAIR ON: SGL600Y  
MODEL : MERCEDES BENZ E300  
POLICY NO : GA1280873  
CHASSIS NO : WDD2120542A040924  
YEAR OF MANUFACTURE : 2009  
DATE / TIME OF ACCIDENT: 09/09/2018 0900Hrs at Rangoon rd twds kitchener rd junction of kent rd.  
THIRD PARTY VEHICLE NO: FBL7481L

*Not Withheld  
L/LR B?*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

Date: 11/09/2018  
Page: 1 of 2

Appended below are the estimated cost of repair and parts to be replaced for the above vehicle: -

Replacement Of Parts		Quantity	Unit Price S\$	Condition	Amount S\$
S/N					
1	Front fender RH	1	975.00	Dented	975.00 X
2	Front fender front section RH	1	158.00	Torn	158.00 X
3	Front fender rear section RH	1	165.00	Cut	165.00 X
4	Front fender lower moulding chrome RH	1	34.00	Necessary	34.00
5	Front wheel rim RH	1	900.00	Cut	900.00
6	Front wheel rim centre cap RH	1	45.00	Scratches	45.00 X
7	Front absorber RH	1	845.00	Bented	845.00 ?
8	Front absorber mounting RH	1	195.00	Necessary	195.00 ?
9	Front lower arm RH	1	485.00	Bented	485.00 ?
10	Front tie rod RH	1	170.00	Bented	170.00 ?
11	Front tie rod end RH	1	180.00	Bented	180.00 ?
12	Front stabiliser link RH	1	100.00	Bented	100.00 X
13	Front stabiliser assy RH	1	440.00	Bented	440.00 X
14	Front knuckle arm RH	1	1,180.00	Bented	1,180.00 ?
15	Front knuckle arm bearing RH	1	685.00	Necessary	685.00 ?
16	Front side mirror RH	1	900.00	Broken	900.00
17	Front side mirror indicator RH	1	338.00	Broken	338.00
18	Front side mirror glass RH	1	950.00	Broken	950.00
19	Front side mirror cover RH	1	130.00	Broken	130.00
20	Front door RH	1	1,955.00	Dented	1,955.00
21	Front door glass window outer moulding RH	1	100.00	Necessary	100.00
22	Front door glass window outer seal RH	1	125.00	Necessary	125.00
23	Front door window glass RH	1	220.00	Scratches	220.00 ?
24	Front door weatherstrip RH	1	265.00	Necessary	265.00 50% in
25	Front door hinge upper RH	1	130.00	Bented	130.00 X
26	Front door hinge lower RH	1	160.00	Bented	160.00 X
27	Front door lower moulding lining chrome RH	1	88.00	Bented	88.00
28	Front door handle outer RH	1	390.00	Bented	390.00 X
29	Rear door RH	1	2,005.00	Dented	2,005.00 X
30	Rear door glass window outer moulding RH	1	130.00	Necessary	130.00 X
31	Rear door weatherstrip RH	1	265.00	Necessary	265.00 X
32	Rear door lower moulding lining chrome RH	1	88.00	Necessary	88.00
33	Rocker panel skirting RH	1	650.00	Broken	650.00
34	Rear fender RH	1	2,080.00	Dented	2,080.00 X

Sub-Total:	17,526.00
Less: 10% discount -	1,752.60
<b>Total Parts after 10% discount:</b>	<b>15,773.40</b>

**Special Nett Items**

1	Front tyre RH	1	350.00	350.00	X
2	Rocker panel skirting clips	12	5.00	60.00	✓
3	Front door inner trim board clips	10	5.00	50.00	X
4	Rear door inner trim board clips	10	5.00	50.00	X
				510.00	

**Total Parts: 16,283.40**

**Labour Charges For RH Side Portion**

1	Provide skill labour to remove all damaged parts, panel beat, cut & weld if necessary and align all panel and reinstall all damaged parts.	1,500.00	700/
2	Provide skill labour & material to putty all damaged parts & panel & to respray with 2K paint with oven spray booth facilities	1,500.00	1000/
3	Provide skill labour to disconnect and check electrical wiring	60.00	30/
4	Remove and reinstall cushions, seats, backrest, inner trim, garnish, roof lining and or upholstery to facilitate repairs	150.00	?
5	Dismantle and transfer door fittings and mechanism to new door/facilitate repair	160.00	80/
6	Provide skill labour to check and re-adjust wheel alignment	80.00	✓
7	Provide skill labour to remove and refit door front and rear window glass	180.00	X
8	Provide skill labour to remove and replace/refit front RH undercarriage	250.00	?

**Total Labour:**

	3,880.00
<b>Total Parts &amp; Labour:</b>	<b>20,163.40</b>
<b>GST 7%</b>	<b>1,411.44</b>
<b>Grand Total:</b>	<b>21,574.84</b>

**Estimate Repair Duration**

12 days

7 days

ACCIDENT VEHICLE OF : SGL300Y

Page : 2 of 2

**Remark:** Supplementary estimate will be raised in the event additional damaged parts are found in the course of repair.

Yours sincerely,

ESTIMATOR: WEN ZHENG

Survey attended by:

Name : Kenneth  
 Company : CKK  
 Date : 11/9/18  
 Time :   
 Contact No : 96910663  
 Email :



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MSG INSURANCE (SINGAPORE) PTE LTD		Ref : CS/MSG18016609/Ktd3e2		
16 RAFFLES QUAY #24-01 HONG LEONG BLDG SINGAPORE 048581		Date : 18-01-2019		
		Code : MSG		
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	FBL 7481L	Veh. Inspected	SGL 600Y	
Policy No.	MSD/VMT/18-376915-CA	Coverage (\$)	0.00	
Claim No.	MSC/V/18-001219	Excess (\$)	0.00	
Assign From	PAULINE THAM	Assign Date	12/09/2018	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	MERCEDES BENZ E 300 (A)	c.c	2996	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	WDD2120542A040924	Colour	METALLIC BLACK	
Odometer	67666	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	235/40Z R18	MICHELIN	7 mm	
L/H Front Tyre	235/40Z R18	MICHELIN	7 mm	
R/H Rear Tyre	255/35Z R18	MICHELIN	7 mm	
L/H Rear Tyre	255/35Z R18	MICHELIN	7 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	09/09/2018	Inspection Date	11/09/2018	
Survey held at	BH AUTO SERVICES PTE LTD BLK 1 SIN MING INDUSTRIAL ESTATE SECTOR C #01-115 SINGAPORE 575636			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>7 Working Days</b>		



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGL 600Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	FRONT FENDER RH	TO REPAIR SEE LABOUR	975.00	-
1	FRONT FENDER FRONT SECTION RH	SERVICEABLE	158.00	-
1	FRONT FENDER REAR SECTION RH	SERVICEABLE	165.00	-
1	FRONT FENDER LOWER MOULDING CHROME RH	NECESSARY	34.00	34.00
1	FRONT WHEEL RIM RH	DENTED	900.00	900.00
1	FRONT WHEEL RIM CENTRE CAP RH	SERVICEABLE	45.00	-
1	FRONT ABSORBER RH	* CHECK	845.00	-
1	FRONT ABSORBER MOUNTING RH	* CHECK	195.00	-
1	FRONT LOWER ARM RH	* CHECK	485.00	-
1	FRONT TIE ROD RH	* CHECK	170.00	-
1	FRONT TIE ROD END RH	* CHECK	180.00	-
1	FRONT STABILISER LINK RH	SERVICEABLE	100.00	-
1	FRONT STABILISER ASSY RH	SERVICEABLE	440.00	-
1	FRONT KNUCKLE ARM RH	* CHECK	1,180.00	-
1	FRONT KNUCKLE ARM BEARING RH	* CHECK	685.00	-
1	FRONT SIDE MIRROR RH	CRACKED	900.00	900.00
1	FRONT SIDE MIRROR INDICATOR RH	MISSING	338.00	338.00
1	FRONT SIDE MIRROR GLASS RH	BROKEN	950.00	950.00
1	FRONT SIDE MIRROR COVER RH	MISSING	130.00	130.00
1	FRONT DOOR RH	BENT	1,955.00	1,955.00
1	FRONT DOOR GLASS WINDOW OUTER MOULDING RH	DENTED	100.00	100.00
1	FRONT DOOR GLASS WINDOW OUTER SEAL RH	NECESSARY	125.00	125.00
1	FRONT DOOR WINDOW GLASS RH	* CHECK	220.00	-
1	FRONT DOOR HINGE UPPER RH	TO REPAIR SEE LABOUR	130.00	-
1	FRONT DOOR HINGE LOWER RH	TO REPAIR SEE LABOUR	160.00	-
1	FRONT DOOR LOWER MOULDING LINING CHROME RH	NECESSARY	88.00	88.00
1	FRONT DOOR HANDLE OUTER RH	SERVICEABLE	390.00	-
1	REAR DOOR RH	TO REPAIR SEE LABOUR	2,005.00	-

Report Ref No. CS/MSG18016609/Ktd3e2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR GLASS WINDOW OUTER MOULDING RH	SERVICEABLE	130.00	-
1	REAR DOOR WEATHERSTRIP RH	SERVICEABLE	265.00	-
1	REAR DOOR LOWER MOULDING LINING CHROME RH	NECESSARY	88.00	88.00
1	ROCKER PANEL SKIRTING RH	BENT	650.00	650.00
1	REAR FENDER RH	TO REPAIR SEE LABOUR	2,080.00	-
	LESS 10% DISCOUNT		-1,726.10	-625.80
			15,534.90	5,632.20
1	FRONT DOOR WEATHERSTRIP RH (50%) (SN)	NECESSARY	265.00	132.50
	LESS 10% DISCOUNT		-26.50	-
			238.50	132.50
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FRONT TYRE RH (SN)	SERVICEABLE	350.00	-
12	ROCKER PANEL SKIRTING CLIPS @\$5.00 (SN)	NECESSARY	60.00	60.00
10	FRONT DOOR INNER TRIM BOARD CLIPS @\$5.00 (SN)	NOT NECESSARY	50.00	-
10	REAR DOOR INNER TRIM BOARD CLIPS @\$5.00 (SN)	NOT NECESSARY	50.00	-
			510.00	60.00
	<b><u>LABOUR</u></b>			
	PROVIDE SKILL LABOUR TO REMOVE ALL DAMAGED PARTS, PANEL BEAT, CUT & WELD IF NECESSARY AND ALIGN ALL PANEL AND REINSTALL ALL DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF FRONT FENDER RH, FRONT DOOR HINGE UPPER RH, FRONT DOOR HINGE LOWER RH, REAR DOOR RH AND REAR FENDER RH.		1,500.00	700.00
	PROVIDE SKILL LABOUR & MATERIAL TO PUTTY ALL DAMAGED PARTS & PANEL & TO RESPRAY WITH 2K PAINT WITH OVEN SPRAY BOOTH FACILITIES.		1,500.00	1,000.00
	PROVIDE SKILL LABOUR TO DISCONNECT AND CHECK ELECTRICAL WIRING.		60.00	30.00
	REMOVE & REINSTALL CUSHIONS, SEATS, BACKREST, INNER TRIM, GARNISH, ROOF LINING AND OR UPHOLSTERY TO FACILITATE REPAIRS.	* CHECK	150.00	-
	DISMANTLE AND TRANSFER DOOR FITTINGS AND MECHANISM TO NEW DOOR / FACILITATE REPAIR.}		160.00	80.00

Report Ref No. CS/MSG18016609/Ktd3e2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PROVIDE SKILL LABOUR TO REMOVE AND REFIT DOOR FRONT AND REAR WINDOW GLASS. }		180.00	-
	PROVIDE SKILL LABOUR TO CHECK AND RE-ADJUST WHEEL ALIGNMENT.		80.00	80.00
	PROVIDE SKILL LABOUR TO REMOVE AND REPLACE / REFIT FRONT RH UNDERCARRIAGE.	* CHECK	250.00	-
			3,880.00	1,890.00
GRAND TOTAL			20,163.40	7,714.70
RECOMMENDED COST OF REPAIRS (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$3,964.00 NETT)				7,714.70

Report Ref No. CS/MSG18016609/Ktd3e2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.