PREMIER APPRAISER SERVICES

Our Ref: PT1808007-L

Vehicle No: SKD 3502 Y

Qty	Parts Descriptions	Conditions	Repairer's Est.	Our Revised	
	LISTT ITEMS:				
1	o/s rocker panel	dented cw fender \ S\$. 890.00	S\$	× ×
1	o/s rear fender	badly dented	1,945.30		1,945.30
1	o/s rear fender inner panel	dented - repair	890.30	N. A.	- X
1	o/s rear fender splash shield	warped	255.30	megat	255.30
1	o/s rear fender outer protector	dented	150.90	Int	150.90
1	o/s rear quarter glass mldg	necessary	480.30	rec	480.30
1	o/s tail lamp	chafed/cracked	433.20	11	433.20 😿
1	rear bumper	lug cracked	1,255.30		1 255 20
1	rear bumper o/s retainer	damaged	62.00	to. n	1,255.30
1	o/s rear susp shock absorber	bent/stiffened	510.00	Bul	510.00 X
1	o/s rear susp knuckle arm	bent	630.00	11	
1	o/s rear susp lower arm	bent		17	630.00 ×
1	o/s rear susp control arm	bent	380.00	47	380.00 ℃
1	o/s rear wheel hub & bearings		411.30	20	411.30 🗙
	O'S Teal Wifeel Hou & Deathings	damaged	420.00	· -	420.00 大
		S\$	8,713.90	S\$	6,933.60
		LESS 10%	871.39	10%	$\frac{693.36}{2}$ Ψ/Ψ
			7,842.51		6,240.24
	S/NETT ITEMS:				3734.19
4	1-10-1-10-10-10-10-10-10-10-10-10-10-10-		22.22	2.2	
1	rear bumper clips - set	necessary	20.00	ry	20.00
1	o/s rear fender s/shield clips - set	necessary	20.00	ru	20.00
1	o/s rear quarter glass sealant	necessary	120.00	nec	60.00
1	o/s rear quarter glass inner seal	necessary	120.00	nec	40.00
1	o/s rear 235/40-R18 tyre - Pay 70%	wall grazed	650.00	su	455.00 🗶
1	o/s rear wheel rim	dented/warped	2,500.00	36	960.00 Pro
		TOTAL 01040T0 04		-	
		TOTAL S/PARTS S\$	11,272.51	S\$	7,795.24
	To remove/refit roof linings, upholstery, trims & garnish to facilitate repairs.				150.00 /00
	To remove/refit o/s rear quarter glass to facilitate repairs. To remove/refit fuel tank to facilitate repairs.		150.00		120.00 —
			150.00	17	- X
	Labour charges to repair, panel beat and straighten				1,000.00
	damaged parts and replace the abov (4 Days *\$250.00)	e-mentioned parts			
	To dismantle/replace o/s rear suspension parts.		800.00	u1	250.00 🗶
	To replace/balance tyre, wheel rim and conduct wheel alignment.		120.00		120.00 60
	To remove/transfer reverse sensors.		60.00		50.00 V
	To check wiring functions.				30.00
		14,782.51	S\$	9,515.24	

PREMIER APPRAISER SERVICES

Our Ref: PT1808007-L

Vehicle No: SKD 3502 Y

	Repairer's Est.		Our Revised		
Balance b/f	S\$	14,782.51	\$\$	9,515.24	
Onboard ECU Programming & Calibration.		180.00	- 11	180.00	X
To putty, apply primer & spray-paint the affected areas. (o/s rocker panel, o/s rear fender, fender inner panel, rear bumper)		1,200.00		1,000.00	foo
To apply rust-proofing on repaired/replaced panels.	S\$_	250.00 16,412.51	S\$	60.00 10,755.24	

Note: The repairer has agreed to undertake the repairs at our adjusted amount of \$\$ 8,600.00 lump sum corresponding to supply of parts, labour and spray painting charges.

The estimated period of repairs is EIGHT (8) days. Pursuant to your instruction we have not authorised repairs on your behalf.

6884.19

PREMIER APPRAISER SERVICES

LESLIE K C LIM CAE (UK), MIMI (UK)

MS&A, Automotive Appraiser Dip.MTM. Automotive Engineer