

SURVEYOR COPY

Ah Lim Motor Company
10 Ang Mo Kio Industrial
Park 2A

#01-09 AMK Autopoint
Singapore 568047

Claim Reference: 3 PARTY CLAIM
Assessment Number: AH000940
Version: AHLIM001/1
Date Calculated: 29/09/2018 04:54

Full Report - V1
Registration: SJB7411Y
Printed: 29/09/2018 11:55

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ahlim ahlim	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	3 PARTY CLAIM	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	Vios
Sub Model:	J
Model Sheet Number:	YF3 04
Registration:	SJB7411Y
Registration Month:	January
Registration Year:	2008
VIN Number:	MRO53HY9305046438
Manufacture Year:	2007
Odometer:	Not Known
Colour:	
Engine Number:	1NZX688721
Fuel Level:	%

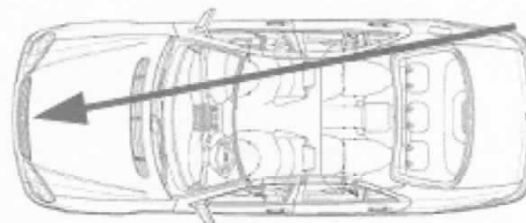
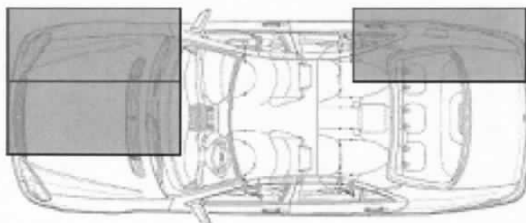
Model Specs

FROM 02/2008	BONNET INSULATION
HEADLAMP TRIM COLOUR	FOG LAMPS
1.5 LTR 80 KW	4-SPEED AUTOMATIC
TYRES 185/60 HR 15	WHEELS 5.5J X 15 ALU
EQUIPMENT "J" GRADE	TWO COAT METALLIC
PREPARE OFF VEHICLE	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on	
	Inspection:	
Brakes Pedal Travel:	Date of Inspection:	29/09/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

Ah Lim Motor Company**Claim Reference: 3 PARTY CLAIM****Assessment Number: AH000940****Version: AHLIM001/1****Date Calculated: 29/09/2018 04:54****Full Report - V1****Registration: SJB7411Y****Printed: 29/09/2018 11:55**

Primary Impact
Secondary Impact

Addresses**Cost Summary**

Total Labour	\$3,753.00
Total Paint/Material	\$429.33
Total Parts	\$10,147.16
Total of Additional Costs	\$1,210.00
Excess:	TBA
Grand Total Exc GST:	\$15,539.49
7 % GST:	\$1,087.76
Grand Total Inc GST:	\$16,627.25

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
B040)	ADJUST HEADLAMPS	2.0	9.00
B100	R + R LEFT FRONT WING	4.0	18.00
	INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R		
	NOT INCLUDED: HEADLAMP AND R + R BUMPER		
B100	R + R RIGHT FRONT WING	4.0	18.00
	INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R		
	NOT INCLUDED: HEADLAMP AND R + R BUMPER		
B140	RENEW FRONT PANEL CPL	9.0	40.50
B110)	RENEW RIGHT FRONT WING	2.0	9.00
	INCLUDES: TRANSFER ATTACHED PARTS		
B010	R + R FRONT BUMPER	5.0	22.50
B020)	RENEW FRONT BUMPER (REMOVED)	4.0	18.00
NO NUMBER	R + R FRONT BUMPER DAMPER	1.0	4.50
B010)	R + R FRONT BUMPER REINFORCEMENT	2.0	9.00
B020)	RENEW FRONT BUMPER REINFORCEMENT	2.0	9.00
B040)	R + R LEFT HEADLAMP	1.0	4.50
	(BUMPER REMOVED)		
	DOES NOT INCLUDE: ADJUST HEADLAMP		
B040)	R + R RIGHT HEADLAMP	1.0	4.50
	(BUMPER REMOVED)		

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000940

Version: AHLIM001/1

Date Calculated: 29/09/2018 04:54

Full Report - V1

Registration: SJB7411Y

Printed: 29/09/2018 11:55

	DOES NOT INCLUDE: ADJUST HEADLAMP		
B100	R + R LEFT FRONT MUD FLAP	3.0	13.50
NO NUMBER	RENEW L/F WING BADGE	1.0	4.50
NO NUMBER	RENEW R/F WING BADGE	1.0	4.50
B100	R + R RIGHT FRONT MUD FLAP	3.0	13.50
B060	TRANSFER ATTACHED PARTS FROM BONNET	2.0	9.00
530051)	RENEW BONNET	1.0	4.50
	INCLUDES: R + R OR RENEW ATTACHED PARTS		
B080	R + R BONNET HINGE/S	1.0	4.50
530121	RENEW BONNET LOCK RELEASE CABLE	6.0	27.00
851091)	R + R WASHER RESERVOIR	1.0	4.50
B085)	RENEW AIR GRILLE (REMOVED)	2.0	9.00
B310)	RENEW R/R SIDE PANEL	54.0	243.00
	(COMPOSITE WORK FOR END PANEL)		
B420)	R + R REAR BUMPER REINFORCEMENT	1.0	4.50
B290	RENEW REAR END PANEL	35.0	157.50
	(BUMPER REMOVED)		
	INCLUDES: BOTH REAR LAMPS, FLOOR MAT		
	BOOT COMPARTMENT AND ALL TRIMS IN		
	REPAIR AREA REMOVE AND REFIT		
640201	R + R TAILGATE LOCK	4.0	18.00
G020	R + R REAR SCREEN	28.0	126.00
	INCLUDES: REAR PARCEL SHELF AND REQUIRED		
	TRIMS REMOVE AND REFIT		
750171	RENEW BADGE "TOYOTA"	2.0	9.00
B410	R + R REAR BUMPER	4.0	18.00
B420)	RENEW REAR BUMPER	1.0	4.50
NO NUMBER	R + R R/R BUMPER REFLECTOR	3.0	13.50
NO NUMBER	RENEW R/RR SIDE MEMBER CPL	25.0	112.50
NO NUMBER	RENEW CONDENSER-/COMPRESSOR HOSE	4.0	18.00
NO NUMBER	R + R COMPRESSOR-/EVAPORATOR HOSE	4.0	18.00
NO NUMBER	R + R EVAPORATOR/CONDENSER PIPE	4.0	18.00
B450)	R + R BOTH REAR SEAT RESTS	1.0	4.50
B450)	R + R COMPLETE REAR SEAT CUSHION	1.0	4.50
711511)	R + R LEFT REAR SEAT BELT	3.0	13.50
	INCLUDES: REAR PARCEL SHELF AND REQUIRED		
	TRIMS REMOVE AND REFIT		
M010	R + R RADIATOR/CONDENSER	15.0	67.50
M010)	RENEW RADIATOR (RADIATOR REMOVED)	2.0	9.00
160101)	R + R UPPER RADIATOR HOSE	2.0	9.00
160111)	R + R LOWER RADIATOR HOSE	2.0	9.00
NO NUMBER	R + R AIR FILTER INTAKE HOSE	1.0	4.50
170011)	R + R INTAKE MANIFOLD	8.0	36.00
NO NUMBER	R + R UPPER ENGINE COVER	1.0	4.50
280011	R + R STARTER	6.0	27.00
NO NUMBER	R + R REAR PROTECTION PANEL	1.0	4.50
M240)	R + R FRONT EXHAUST PIPE	2.0	9.00
420018)	R + R LEFT REAR WHEEL	1.0	4.50
420018)	R + R RIGHT REAR WHEEL	1.0	4.50
471551)	RENEW L/R BRAKE ANCHOR PLATE	8.0	36.00
	(WHEEL REMOVED)		
	INCLUDES: R + R BRAKE DRUM, WHEEL HUB		
	AND BRAKE SHOES		
471551)	RENEW R/R BRAKE ANCHOR PLATE	8.0	36.00

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000940

Version: AHLIM001/1

Date Calculated: 29/09/2018 04:54

Full Report - V1

Registration: SJB7411Y

Printed: 29/09/2018 11:55

	(WHEEL REMOVED)		
	INCLUDES: R + R BRAKE DRUM, WHEEL HUB AND BRAKE SHOES		
481251)	R + R LEFT REAR SHOCK ABSORBER	1.0	4.50
481251)	R + R RIGHT REAR SHOCK ABSORBER	1.0	4.50
NO NUMBER	R + R REAR AXLE CARRIER	16.0	72.00
004466)	BLEED REAR BRAKE SYSTEM	6.0	27.00
NN	REAR SILENCER R&R / NEW PARTS	10.0*	45.00
NN	H LAMP TOP PANAL LH R&R / NEW PARTS	10.0*	45.00
NN	H LMP TOP PANAL RH R&R / NEW PARTS	10.0*	45.00
NN	S TYRE SIDE PAL RH R&R / NEW PARTS	15.0*	67.50
NN	ENGINE MOUNING RH R&R / NEW PARTS	5.0*	22.50
NN	E MOUNING REAR R&R / NEW PARTS	5.0*	22.50
NN	GEAR BOX MOUNING LH R&R / NEW PARTS	5.0*	22.50
0741	REPAIR L/F WING	10.0*	45.00
1117	REPAIR L/F WHEELHOUSE CPL	20.0*	90.00
1118	REPAIR R/F WHEELHOUSE CPL	20.0*	90.00
1201	REPAIR L/F SIDE MEMBER	20.0*	90.00
1202	REPAIR R/F SIDE MEMBER	20.0*	90.00
1481	REPAIR LEFT FRONT DOOR	10.0*	45.00
1482	REPAIR RIGHT FRONT DOOR	10.0*	45.00
2931	REPAIR BOOTLID	10.0*	45.00
3901	REPAIR REAR FLOOR PANEL	20.0*	90.00
4162	REPAIR R/R OUTER WHEELHOUSE	60.0*	270.00
4166	REPAIR R/R INNER WHEELHOUSE	30.0*	135.00

LABOUR COST

Total Work Units	604.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	60.4HRS	\$2,718.00
Paint Labour	23.0HRS	\$1,035.00
Total Labour	83.4HRS	\$3,753.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
340	BUMPER REINFORCEMENTSURFACE PAINT	6.0	
471	BONNET NEW PART PAINTING	12.0	
742	R/F WING NEW PART PAINTING	10.0	
1009	INNER FRT PANEL CPL SURFACE PAINT	6.0	
2711	REAR PANEL NEW PART PAINTING	21.0	
3482	R/R SIDE PANEL NEW PART PAINTING	22.0	
281	FRONT BUMPER NEW PART PAINT K1R	13.0	
293	FRT TOWING EYE COVERNEW PART PAINT K1R	3.0	
2581	REAR BUMPER NEW PART PAINT K1R	10.0	
741	L/F WING REPAIR PAINTING <50%	11.0	
1481	LEFT FRONT DOOR REPAIR PAINTING <50%	16.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	16.0	
2931	BOOTLID REPAIR PAINTING <50%	16.0	
1117	L/F WHEELHOUSE CPL SURFACE PAINT	6.0	
1118	R/F WHEELHOUSE CPL SURFACE PAINT	6.0	

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000940

Version: AHLIM001/1

Date Calculated: 29/09/2018 04:54

Full Report - V1

Registration: SJB7411Y

Printed: 29/09/2018 11:55

1201	L/F SIDE MEMBER SURFACE PAINT	5.0	
1202	R/F SIDE MEMBER SURFACE PAINT	5.0	
3901	REAR FLOOR PANEL SURFACE PAINT	7.0	
4162	R/R OUTER WHEELHOUSE SURFACE PAINT	4.0	
4166	R/R INNER WHEELHOUSE SURFACE PAINT	5.0	
LABOUR COST - PAINT			
	TIME(PAINT)	200.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	230.0	
	Total Paintwork Labour	23.0HRS	\$1,035.00
MATERIAL COST - PAINT			
	New Part Painting		Cost Price
	New Part Painting - Plastic K1R		\$101.34
	Material-Constant Main Work Metal		\$112.18
	Surface-/Blend Paint		\$28.60
	Repair Painting		\$86.16
	Material-Const Main Work Plastic		\$92.05
	Total Excluding Pearlescent Uplift		\$9.00
	Pearlescent Uplift @ 0.0%		\$429.33
	Total Paint Material Cost		\$0.00
			\$429.33

PARTS

				Price Valid: 01/06/2015		
Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
253	1	L/LOWER GRILLE X <i>San</i>	52128 0D070		0%	45.00*
254	1	R/LOWER GRILLE X <i>San</i>	52127 0D150		0%	45.00*
281	1	FRONT BUMPER <i>de</i>	52119 0D996		0%	155.00*
293	1	FRT TOWING EYE COVER <i>at</i>	52721 0D902		0%	20.00*
317	1	L/F BUMPER BRACKET <i>SM</i>	53165 0D030		0%	38.00*
318	1	R/F BUMPER BRACKET <i>de</i>	53164 0D030		0%	38.00*
333	1	FRT BUMPER ABSORBER <i>de</i>	52617 0D050		0%	40.00*
340	1	BUMPER REINFORCEMENT <i>BT</i>	52021 0D090		0%	110.00*
343	1	LOWER FRONT GRILLE <i>de</i>	53112 0D120		0%	38.00*
350	1	FRT BUMPER CLAMP KIT <i>de</i>	SEE GUIDE NO. 0351		0%	24.00*
410	1	GRILLE <i>CRA</i>	53111 0D901		0%	130.00*
431	1	FRONT MANUFACT BADGE <i>de</i>	75301 0D010		0%	32.00*
471	1	BONNET <i>BT</i>	53301 0D100		0%	180.00*
475	1	L/F HINGE <i>BT</i>	53420 0D170		0%	30.00*
476	1	R/F HINGE <i>BT</i>	53410 0D170		0%	30.00*
493	1	BONNET LOCK <i>BT</i>	53510 0D181		0%	45.00*
500	1	BONNET CABLE X <i>nm</i>	53630 0D080		0%	32.00*
527	2	FRONT BONNET SEAL <i>twi</i>	53381 0D060		0%	30.00*
561	1	LEFT HEADLAMP ASSY ?	81150 0D700		0%	130.00*
562	1	RIGHT HEADLAMP ASSY <i>at</i>	81110 0D700		0%	130.00*
742	1	R/F WING X <i>Ref. at</i>	53811 52240		0%	130.00*
789	7	L/F WING MNTG KIT <i>de</i>	91621 40614		0%	20.00*
790	7	R/F WING MNTG KIT <i>de</i>	91621 40614		0%	20.00*
811	1	BADGE "VVT-I" L <i>de</i>	75443 06151		0%	16.31U
812	1	BADGE "VVT-I" R <i>de</i>	75443 06151		0%	16.31U
841	1	L/WHEELHOUSE SHELL X <i>nm</i>	53876 0D080		0%	50.00*
842	1	R/WHEELHOUSE SHELL X <i>nm</i>	53875 0D080		0%	50.00*

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000940

Version: AHLIM001/1

Date Calculated: 29/09/2018 04:54

Full Report - V1

Registration: SJB7411Y

Printed: 29/09/2018 11:55

1009	1	INNER FRT PANEL CPL <i>BT</i>	53201 0D130	0%	200.00*
1391	1	COWL PANEL GRILLE ?	55708 0D130	0%	205.00*
1436	1	WASHER CONTAINER <i>ALA</i>	85315 0D101	0%	60.00*
2581	1	REAR BUMPER <i>Re</i>	52159 0D983	0%	160.00*
2619	1	L/R BUMPER BRACKET <i>X nn</i>	52576 0D070	0%	45.00*
2620	1	R/R BUMPER BRACKET <i>Re</i>	52575 0D070	0%	45.00*
2621	1	L/R OUT BUMPER BRKT <i>X</i>	52156 0D030	0%	55.00*
2622	1	R/R OUT BUMPER BRKT <i>X nn</i>	52155 0D030	0%	55.00*
2711	1	REAR PANEL <i>Buc</i>	58307 0D101	0%	210.00*
2944	1	BOOTLID SEAL <i>Tru</i>	64461 0D050	0%	55.00*
2977	1	BOOT/TAILGATE LOCK	64610 0D030	0%	50.00*
3013	1	REAR MANUFACT BADGE <i>Re</i>	90975 02063	0%	38.00*
3161	1	REAR WINDOW MOULDING <i>Re</i>	75573 0D040	0%	55.00*
3163	1	REAR SCREEN FIX SET <i>X</i>	USE SINGLE PARTS	0%	0.00
3169	1	LWR REAR WINDOW MLDGX <i>Re</i>	64813 52080	0%	0.00
3171	2	CLIP FASTENING <i>Re</i>	56116 22050	0%	3.96U
3172	2	CLIP FASTENING <i>Re</i>	56115 30100	0%	4.04U
3282	1	R/R LAMP ASSY <i>ALA</i>	81550 0D220	0%	95.00*
3292	1	R/R REFLECTOR <i>Aut</i>	81910 0D010	0%	45.00*
3482	1	R/R SIDE PANEL <i>Re</i>	61601 0D160	0%	350.00*
3572	1	R/R LAMP PANEL <i>Re</i>	61063 0D010	0%	60.00*
3990	1	R/R SIDE MEMBER CPL <i>X</i>	57601 0D121	0%	110.00*
4448	1	CONDENSER FIX FRAME ?	88891 0D080	0%	32.00*
4465	1	CONDENSER ?	88460 0D130	0%	300.00*
4481	1	COMPRESSOR HOSE ?	88704 0D050	0%	110.00*
4483	1	COND/EVAPORATOR HOSE ?	88706 0D240	0%	140.00*
4485	1	PRESSURE HOSE COMPRS ?	88711 0D150	0%	140.00*
4978	1	LUGG COMPART CARPET <i>X nn</i>	64711 0D060C0	0%	65.00*
4985	1	END PANEL TRIM <i>Re</i>	58387 0D010	0%	95.00*
4992	1	R/BOOT TRIM COVER <i>Re</i>	64721 0D040C0	0%	135.00*
7751	1	L/RADIATOR STRUT ?	16523 0M050	0%	10.00*
7752	1	R/RADIATOR STRUT ?	16523 0M050	0%	10.00*
7753	1	L/RADIATOR RUBB MNTG ?	90480 W0005	0%	10.00*
7754	1	R/RADIATOR RUBB MNTG ?	90480 W0005	0%	10.00*
7761	1	RADIATOR CPL ?	16400 0M070	0%	330.00*
7765	1	UPP FUEL HOSE FLANGE ?	16502 21070	0%	32.00*
7767	1	RADIATOR SHROUD ?	16711 0M030	0%	78.00*
7773	1	UPPER RADIATOR HOSE ?	16573 0M010	0%	25.00*
7776	1	LWR RADIATOR HOSE ?	16572 0M040	0%	25.00*
7789	1	FAN MOTOR ?	16363 0M020	0%	110.00*
7793	1	COOLING FAN ?	16361 0M050	0%	65.00*
8221	1	INTAKE MANIFOLD ?	17101 0M030	0%	165.00*
8375	1	AIR INTAKE HOSE ?	17751 0M020	0%	45.00*
8391	1	AIR FILTER ASSY ?	17700 0M030	0%	255.00*
8501	1	STARTER MOTOR ?	28100 0M051	0%	340.00*
8833	1	REAR SILENCER <i>BT</i>	17430 0M061	0%	200.00*
8846	1	REAR PROTECT PANEL ?	58327 0D081	0%	0.00
8848	1	R/R EXHAUST RUBBER <i>Re</i>	17565 0M020	0%	105.00*
9081	1	REAR AXLE SUBFRAME <i>X nn</i>	42110 0D171	0%	700.00*
9182	1	R/R WHEEL HUB/BRG <i>Re</i>	42410 0D040	0%	230.00*
9646	1	HORN ?	86520 52170	0%	80.00*
1000	1	F WIPER GAR COVER X2 <i>Renew</i>	Renew	0%	60.00*
1000	1	F WIPER GARH RUBBER <i>Renew</i>	Renew	0%	32.00*
1000	1	F BOT INER STOPER X2 <i>Renew</i>	Renew	0%	20.00*

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000940

Version: AHLIM001/1

Date Calculated: 29/09/2018 04:54

Full Report - V1

Registration: SJB7411Y

Printed: 29/09/2018 11:55

1000	1	H LAMP TOP PANAL LH <i>X</i>	Renew	0%	45.00*
1000	1	H LMP TOP PANAL RH <i>B7</i>	Renew	0%	45.00*
1000	1	H LAMP CLIPS X4 <i>mc</i>	Renew	0%	8.00*
1000	1	F REINFORMET BRT X2 <i>BT</i>	Renew	0%	170.00*
1000	1	E UNDER COVER RH <i>?</i>	Renew	0%	50.00*
1000	1	G BOX LOW COVER LH <i>?</i>	Renew	0%	60.00*
1000	1	R INER AIR GUIDE LH <i>?</i>	Renew	0%	38.00*
1000	1	R INER AIR GUIDE RH <i>?</i>	Renew	0%	38.00*
1000	1	R COOLING PIPE X2 <i>?</i>	Renew	0%	64.00*
1000	1	R BOT LOGO (VIOS) <i>-</i>	Renew	0%	35.00*
1000	1	R BOT LOGO (J) <i>-</i>	Renew	0%	35.00*
1000	1	TAIL LAMP CLIP X3 RH <i>-</i>	Renew	0%	9.00*
1000	1	R BUMPER CLPS X12 <i>-</i>	Renew	0%	24.00*
1000	1	TOOL BOX REAR <i>X</i>	Renew	0%	110.00*
1000	1	TOL BOX SIDE RH <i>mc</i>	Renew	0%	115.00*
1000	1	S TYRE SIDE PAL RH <i>?</i>	Renew	0%	58.00*
1000	1	R FEN TRIM CLPX12 RH <i>mc</i>	Renew	0%	24.00*
1000	1	R FEN AIR VENT RH <i>-</i>	Renew	0%	58.00*
1000	1	R FEN COWLING RH <i>-</i>	Renew	0%	38.00*
1000	1	R EXHAUST CHROME RH <i>mc</i>	Renew	0%	55.00*
1000	1	ENGINE MOUNING RH <i>?</i>	Renew	0%	130.00*
1000	1	E MOUNING REAR <i>?</i>	Renew	0%	60.00*
1000	1	GEAR BOX MOUNING LH <i>?</i>	Renew	0%	75.00*

f: OEM Parts
g: Original
h: Secondhand
p: Parallel
x: Exchange

Sub Total \$8,823.62
Mark Up From Cost (15 %) \$1,323.54
Total Parts \$10,147.16

THIS ASSESSMENT CONTAINS UNPRICED PARTS NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
COOLANT <i>mc</i> SPECIALIST	0%	\$35.00
F NUMBER PLATE <i>mc</i> SPECIALIST		\$35.00
CEHCK WIRING <i>mc</i> SPECIALIST	0%	\$40.00 <i>20</i>
FRONT		
REFILL A/C GAS <i>mc</i> SPECIALIST		\$50.00
R SPORT RIM RH <i>mc</i> SPECIALIST <i>X</i>	0%	\$0.00
R TYRE 185/60/15 <i>mc</i> SPECIALIST		\$0.00
RH <i>TV</i>		
REVERSE SENSORX2 SPECIALIST <i>mc</i>	0%	\$200.00
R WIND SEALANT SPECIALIST <i>mc</i>		\$60.00
R WIND INNER SEAL SPECIALIST <i>mc</i>	0%	\$40.00
CHECK WIRING REAR SPECIALIST		\$40.00 <i>20</i>
WHEEL ALIGMENT SPECIALIST	0%	\$80.00 <i>60</i>
REMOVE R SPECIALIST		\$100.00
WINDSCREEN		
REPLACE RVER SPECIALIST	0%	\$80.00 <i>30</i>
SEOSOR		
ANTI-RUST COATING SPECIALIST		\$200.00 <i>80</i>
RESET AL SPECIALIST	0%	\$250.00
DIAGNOSTIC <i>?</i> <i>(80)</i>		
Total Extras		\$1,210.00

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM
Assessment Number: AH000940
Version: AHLIM001/1
Date Calculated: 29/09/2018 04:54

Full Report - V1
Registration: SJB7411Y
Printed: 29/09/2018 11:55

Final Calculation

Total Parts		\$10,147.16
Labour		
Total Panel/Mechanical	\$2,718.00	
Total Paintwork	\$1,035.00	
Total Labour		\$3,753.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$1,210.00	
Total of Additional Costs		\$1,210.00
Total Paint/Material Costs		\$429.33
Grand Total Excludes GST		\$15,539.49
GST @ 7 %		\$1,087.76
Grand Total Includes GST		\$16,627.25

Assessment Notes

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Summary Information**Vehicle**

Manufacturer & Model: TOYOTA Vios
VIN Number: MRO53HY9305046438
Build Date: 2008

Software

Calculation Date: 29/09/2018
Software Version:
Valid Part Price Date: 01/06/2015

Registration: SJB7411Y
Type: YF3 04
Acknowledged by Repairer
Signature:
Date:

AudaDirect Version: 337
Model Sheet Version:

Model Specification

A5 FROM 02/2008
G1 BONNET INSULATION
I1 HEADLAMP TRIM COLOUR
I2 FOG LAMPS
N3 1.5 LTR 80 KW
P8 4-SPEED AUTOMATIC
R1 TYRES 185/60 HR 15
S7 WHEELS 5.5J X 15 ALU
X4 EQUIPMENT "J" GRADE
Y4 TWO COAT METALLIC
Y7 PREPARE OFF VEHICLE

umpsum Repairs.
After repair photos.
Emo Q:al
01/10/18.
12 Days.
2.00pm

Guide Numbers**Invalid Guide Numbers**

H 471 F : Corrosion