

*Poh kin

哈 汽 車 貿 易 服 務

HUP MOTOR TRADING & SERVICE

Blk 9004 Tampines Street 93 #01-120 Singapore 528838 Tel: 6784 0039 Fax: 6784 0076 Email: hupmotor@gmail.com Reg. No. 378091/00W

Our Ref: TP 2925/10/18

Your Ref:

Date: 1st OCT 2018

MS LIM MAY LING, YVONNE
96, Flora Road, S (507007)

Estimate cost of repair to TOYOTA HARRIER 2.0 (A) Premium 5dr - SJV 6080 U

1 pc rear bumper		\$ 1,381.50	
6 pcs rear bumper top clips	@ \$ 3.80	22.80	
8 pcs rear bumper lower clips	@ \$ 3.80	30.40	
6 pcs rear bumper o/s & n/s side clips & stopper	@ \$ 4.80	28.80	X
1 pc rear bumper lower garnish		366.20	
1 pc rear bumper o/s reflector		54.10	
1 set rear bumper reverse sensor		280.00	2005-N
2 pcs rear bumper o/s & n/s side retainer	@ \$ 92.20	184.40	INC
2 pcs rear bumper o/s & n/s top retainer	@ \$ 94.80	189.60	INC
1 pc rear bumper reinforcement		288.00	X
1 pc rear bumper sponge damper		137.80	
1 pc tail gate door		1,369.50	
12 pcs tail gate door inner trim board clips	@ \$ 5.30	63.60	
1 pc tail gate door o/s reflector		412.20	X
1 pc tail gate door weatherstrip		390.90	
1 pc tail gate door 'HARRIER' emblem		72.10	
1 pc rear windscreen glass lower moulding		40.70	
1 pc rear windscreen glass top moulding		38.80	
2 pcs rear windscreen glass o/s & n/s moulding	@ \$ 28.50	57.00	
1 pc rear windscreen glass inner damper seal		58.00	
1 pc rear windscreen glass sealant		60.00	405-N
1 pc tail gate door lock		963.10	
1 pc tail gate door lock stricker		37.50	X
2 pcs tail gate door stopper	@ \$ 9.70	19.40	X
6 pcs licence lamp garnish clips & stopper	@ \$ 5.70	34.20	X
1 pc o/s tail lamp assy		455.10	
4 pcs o/s tail lamp clips stopper	@ \$ 4.20	16.80	
1 pc rear end panel		715.00	
1 pc rear end panel top garnish		353.80	X
6 pcs rear end panel top garnish clips	@ \$ 4.20	25.20	X
1 pc rear exhaust muffler & pipe		1,872.70	X
2 pcs rear exhaust muffler mounting	@ \$ 32.90	65.80	X
1 pc tool set damper sponge		361.70	X
1 pc rear floor board panel		965.10	X
1 pc spare tyre board cover		562.90	X
1 pc rear number plate		60.00	405-N
		\$ 11,034.70	
Less 25%		\$ 2,758.68	6420.4
		\$ 8,276.02	4815.3

To wiring check up & transfer affected wiring system.

60.00 20

\$ 8,336.02
Balance C/F.....

哈 汽 車 貿 易 服 務

HUP MOTOR TRADING & SERVICE

Blk 9004 Tampines Street 93 #01-120 Singapore 528838 Tel: 6784 0039 Fax: 6784 0076 Email: hupmotor@gmail.com Reg. No. 378091/00W

Our Ref: TP 2925/10/18 Your Ref: _____ Date: 1st Oct 2018

MS LIM MAY LING, YVONNE.,

Balance B/F... \$ 8,336.02

To remove & refix rear windscreen glass, moulding & necessary parts. 150.00 120

To transfer tail gate door inner trim board, wiper motor, arm, inner lock, top & low spoiler, hinge, shock absorber, key less sensor & necessary parts. 180.00 60

To remove & refix rear carpet, garnish, floor board cover, tool set, spare tyre, weatherstrip & necessary parts. 150.00 80

To refix & pump sealant for tail gate door top & lower spoiler & necessary parts. 150.00 X

To jack, straighten & knocking out rear exhaust, pipe & necessary parts. 150.00 X

To respray Tuff-Kote on all affected accident parts. 150.00 80

Labour charge to remove & cut out damaged parts, to jack, straighten & knocking out rear o/s fender, rear floor board panel, rear end panel & necessary parts, to weld, renew & align above parts. 1,850.00 1000

To putty & respray painting on all affected accident parts. 2,000.00 1080

\$ 43,446.02
=====

Dollars : Thirteen Thousand One Hundred Sixteen Dollars And Cents
Two Only.

HUP MOTOR TRADING & SERVICE

KK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: