

22/03/2002

ASS. REC. BY:

REF:

CS/MS618018211 / Dvb 321

Special Instruction:

SUNVAJOY

Byan.

ASSIGNMENT (Office)

Merimen

From (Person): Pauline Thom

of

MOLH

Date/Time: 08/10/18 10:12am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLU 5388

Insured:

SDT 9676m

at Workshop m/s

Optima Werkz

Tel:

6484 9919.

of

9A Serangam North Ave 5

Policy No:

286502291VW

Claim No:

Sum Insured:

Excess:

Make of Veh:

D.O.A. 04-10-2018

(Client's Record)

CA / REV / REP. / REV 24 HRS WPI

H.O.D. Endorsement:

Date/Time: 08/10/18 11:18am

Person Contacted:

Lily

Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SLU 5388 - X
	SDT 9676m - X
10/10/18	Send preli revised via merimen

REF: MSU7

ASSIGNMENT

From: Date: 08/10/2018

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SU 5285

at Workshop m/s:

of

Insured:

Policy No:

Claims No:

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

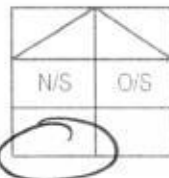

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 10 days Res.: Yes or No

Lum Sum: 71P % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No: 82U 5285 Yr Regn: Nov 2017

Type: ☒ Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Honda Vezel G.C. 1496

Colour: Blue A/C: Insured / Std / NI / NA

Sp. Reading: 26247 T/Radio: Insured / Std / NI / NA

Eng/No: LB35940679

C/No: 2U31240653

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: Nil / ☒ Shim / STD A/Rim or

Tyre Size: F: 215/50 R16

R: — — —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Dunlop

Front

Rear

R/Bal. 5 mm R/Bal. 5 mm

L/Bal. 5 mm L/Bal. 5 mm

D.O.A. 04/10/2018 D.O.I. 08/10/2018

Survey held at Optima Serangoon

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

MSIG SDT 9676M

07/11/18 Jinhua 71P 10,516.16 with 10 days of 1/2 (Red 416472, 28/9)

RECEIVED 08 NOV 2018

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 8/11 - typst

Report Format: merimen

Lump Sum / I.B.I. (\$) 10,516.16

Days Of Repair: 10

Resurvey No. of Trip: 2

Add Fee:

☐

: Site Insp (\$)

☐

: Interview (\$)

☐

: Tech. Invs (\$)

☐

: Weekend (\$)

Survey Fee:

Transportation:

S+RS: \$

Photos

Others

TOTAL

200

/0

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Oct 2018 16:26		08 Oct 2018 10:12 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

Show All

CLAIM SUBFOLDER DETAILS

Insured:	TAN KEY YONG, ID: S6938040I			[Created by insurer]
Main Claimant:	AGAPE AGAPE SERVICES, Co. Reg. No.: 53372791W			
Vehicle Reg. No.:	SLU528S	Date of Loss:	04/10/2018 05:00 - :59 [10 Months and 13 Days From LTA Reg Date (Man Yr)]	
Claim Type:	TP	Policy/Cover Note No.:	28650229AVW Coverage: 30/11/2017 - 29/11/2018	
Vehicle Reg. No. (Insured):	SDT9676M	Policy No. (Claimant):		
Repairer:	Optima Werkz Pte Ltd (HQ) 9A Serangoon North Ave 5, 554500 Serangoon - Tel:			
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Pauline Tham - 6594 2545]			
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 09/10/2018]			
Adj Asg. Remarks:	Liability clear. TP agree with SJE - assign LKK Auto Consultants Pte Ltd. contact: 6484 9919			

ASSOCIATED MAIL RECEIVED

There are no mail for this case.

View All

Compose Case Mail

ALL ASSOCIATED TASKS

Due Date	Priority	Type	Task Group	Subject	Handler	View All	Search Tasks	Create New Task	Complete
No results.						Assigned By	Completed On	Created On	Done?

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Pauline Tham

Date: 10 Oct 2018

Preliminary Advice

Insured Vehicle No : SDT9676M

TP Vehicle No : SLU528S

Accident Date : 04/10/2018

Make : HONDA VEZEL

Assignment Date : 08/10/2018

Date of Inspection : 08/10/2018

Est. Duration of Repair : 10.00

Inspection At : OPTIMA WERKZ PTE LTD (HQ)
9A SERANGOON NORTH AVE 5
SINGAPORE 554500

Point of Impact / General Description of Damages

The vehicle sustained impact / damages rear n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	14,690.88
Revised Amount	:S\$	10,516.16
Check Items (Estimated)	:S\$	0.00
Total	:S\$	10,516.16

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	
COE / PARF Rebate	:S\$	
Salvage Value	:S\$	
Margin for Repair	:S\$	

Remarks

() The vehicle is economical/not economical for repair.

(x) The above survey was conducted on a 'without prejudice' basis.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	04/10/2018 16:23
Date Of Accident	04/10/2018 08:30
Exact Location Of Accident	BUKIT BATOK ROAD TOWARDS PIE (CHANGI NEARBY LP5S3)
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLU528S
Insured/Policyholder	
Name Of Registered Owner	AGAPE AGAPE SERVICES
Co Reg No	53372791W
Email Address	THOMAS_CHEE@HOTMAIL.COM
Mobile Phone No	
Alternative Phone No	OFFICE-90669074

Vehicle Particulars

Manufacturer	HONDA
Model	VEZEL 1.5X HYBRID AT ABS D/AIRBAG 2WD
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	5096075905
Cover Note Number	

Driver

Name of Driver	CHEE TONG TECK THOMAS
NRIC No	S1614755I
Date Of Birth	08/12/1963
Occupation	INDOOR
Date Of Driving Pass	09/11/1981
Driving Experience	36 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90669074
Fax Number	
Contact Number	OTHERS-91002963
EMail Address	THOMAS_CHEE@HOTMAIL.COM

Address	BLK 463 CHOA CHU KANG AVENUE 4 #13-35
Postcode	680463
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

PLEASE REFER TO ACCIDENT STATEMENT AS ATTACHED.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	VIDEO SEND VIA EMAIL
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SDT9676M
Vehicle Make/Model/Colour	VOLKSWAGEN / CHAMPAGNE
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF INJURED PERSON 1

Name	CHEE TONG TECK THOMAS
------	-----------------------

Approximate Age

Injuries Sustain

Injured person in which vehicle?

SLU528S

Were seat belts worn?

YES

Was this injured conveyed to hospital by ambulance?

NO

Address

BLK 463 CHOA CHU KANG AVENUE 4
#13-35

Postcode

680463

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

AGAPE AGAPE
SERVICES
UEN53372791W


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No:

Jibelle Tan
AMK AUTOPPOINT PTE LTD
04.10.2010

Sketch Plan #2

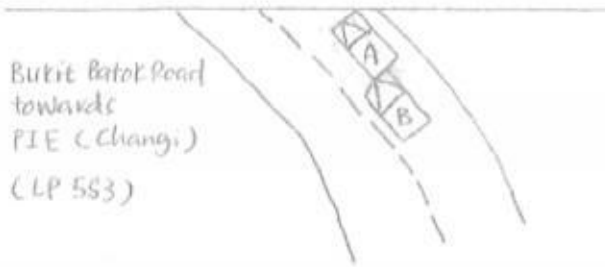

(A) SL4528S
(B) SDT 9676M

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 4/10/2018 at about 8.30am, I was travelling along Bukit Batok Rd towards PIE (Changi) (Nearby LP553). I was stop to check the road condition and to give way to the main road vehicle. Out of sudden, I felt a huge impact and loud bang sound from behind. I alighted & realised vehicle (B) SPT9676M had hit onto my vehicle (A) SLH3285 rear portion. After accident, I felt neck pain, shoulder pain and back pain.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

SERVICES
UEN53372791W

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature

Name: Joelle Tan
NRIC/FIN No.: AMK AUTOPPOINT PTE LTD
0410 2018

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Business
Owner ID:	2791W
Vehicle Details	
Vehicle No.:	SLU528S
Vehicle to be Exported:	Yes
Intended Deregistration Date:	06 Oct 2018
Vehicle Make:	HONDA
Vehicle Model:	VEZEL 1.5X HYBRID AT ABS D/AIRBAG 2WD
Primary Colour:	Blue
Manufacturing Year:	2017
Engine No.:	LEB5940679
Chassis No.:	RU31240653
Maximum Power Output:	112.0 kW (150 bhp)
Open Market Value:	\$25,488.00
Original Registration Date:	21 Nov 2017
First Registration Date:	21 Nov 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	20 Nov 2027
PARF Rebate Amount:	\$3,750.00
Intended COE Rebate Details	
COE Expiry Date:	20 Nov 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$57,414.00
COE Rebate Amount:	\$45,931.00
Total Rebate Amount:	\$49,681.00

The information contained herein is correct as at 06 Oct 2018

OK

OPTIMA WERKZ PTE LTD

Head office : 6 Kung Chong Road Singapore 159143

Tel : +65 6472 1313 Fax : +65 6472 2112

Branch office : 9A Serangoon North Ave 5 Singapore 554500 Tel : +65 6484 9919 Fax : +65 6481 1011

Co. Reg. No. 201212455W

Date: 04 October 2018

Third Party Insurer:

MSIG

Vehicle No: SLU5285

Third Party Veh No:

SDT9676M

Model: HONDA VEZEL 1.5X HYBRID

Date of Accident:

04 OCT 2018

Chassis: RU3-1240653

ESTIMATE

QTY	DESCRIPTION	UNIT S\$	AMOUNT S\$	
1	REAR TAILGATE <i>bro</i>		\$1,072.50	✓
1	REAR TAILGATE WINDSCREEN MOULDING SET <i>Nu</i>		\$74.10	✓
1	REAR TAILGATE OUTER GARNISH <i>deformed</i>		\$267.50	✓
1	REAR TAILGATE LOGO EMBLEM <i>Nu</i>		\$26.70	✓
1	REAR TAILGATE VEZEL EMBLEM <i>Nu</i>		\$48.10	✓
1	REAR TAILGATE HYBRID EMBLEM <i>Nu</i>		\$68.30	✓
1	REAR TAILGATE REFLECTOR LAMP LH <i>crack</i>		\$464.80	✓
2	REAR TAILGATE HINGE LH/RH <i>Nu</i>	\$38.50	\$77.00	X
1	REAR TAILGATE INNER TRIM BOARD <i>Nu</i>		\$170.50	X
1	REAR TAILGATE MECHANISM LOCK <i>Dem</i>		\$221.40	✓
1	REAR TAILGATE WEATHER STRIP <i>deformed</i>		\$123.80	✓
1	REAR TAILLAMP LH <i>crack</i>		\$503.30	✓
1	REAR TAILLAMP HOLDER CLIPS <i>Scr Nu</i>		\$5.80	✓
1	REAR TAILLAMP INNER PANEL <i>2 Deformed</i>		\$96.30	✓
1	REAR BUMPER CENTER <i>broken</i>		\$858.10	✓
2	REAR BUMPER LH/RH <i>Nu (nt) o/s distorted</i>	\$178.80	\$357.60	✓
8	REAR BUMPER CLIPS <i>Nu</i>	\$3.90	\$31.20	✓
2	REAR BUMPER SIDE RETAINER LH/RH <i>Scr</i>	\$21.20	\$42.40	X
1	REAR BUMPER REFLECTOR LH <i>crack</i>		\$151.80	✓
1	REAR FENDER LH <i>Distorted</i>		\$770.00	✓
1	REAR FENDER ARCH GARNISH LH <i>deformed</i>		\$220.20	✓
1	REAR FENDER INNER SHIELD LH <i>deformed</i>		\$134.80	✓
10	REAR FENDER INNER SHIELD CLIPS LH <i>Nu</i>	\$3.90	\$39.00	✓
1	REAR FENDER INNER UPHOLSTERY TRIM BOARD LH <i>2 deformed</i>		\$269.50	✓
1	REAR FENDER INNER AIR VENT <i>2 deformed</i>		\$31.40	✓
1	REAR END PANEL <i>2 Deformed</i>		\$467.50	✓
1	REAR END PANEL INNER TOP GARNISH <i>2 deformed</i>		\$86.80	✓
1	REAR END PANEL TAILGATE ANTENNA SENSOR BUZZER <i>Nu</i>		\$94.30	X
1	REAR SUB CHASSIS FRAME LH <i>2 Nu</i>		\$550.10	✓
1	REAR SUB CHASSIS FRAME TOP PANEL LH <i>2 Nu</i>		\$82.90	✓
1	REAR SUB CHASSIS FRAME BRACKET LH <i>2 Nu</i>		\$34.30	✓
1	REAR WELL PANEL <i>2 Nu</i>		\$863.50	✓
1	REAR WELL PANEL LOWER UNDER COVER <i>deformed</i>		\$157.30	✓
1	REAR WELL PANEL INNER TOP TOOL SPONGE <i>2 deformed</i>		\$163.60	✓
1	REAR WELL PANEL INNER TOP UPHOLSTERY BOARD <i>2 Nu</i>		\$494.80	✓
1	REAR WELL SIDE PANEL LH <i>2 Nu</i>		\$181.30	✓
1	REAR DOOR LH <i>2 Nu</i>		\$990.10	✓

OPTIMA WERKZ PTE LTD

Head office : 6 Kung Chong Road Singapore 159143

Tel : +65 6472 1313 Fax : +65 6472 2112

Branch office : 9A Serangoon North Ave 5 Singapore 554500 Tel : +65 6484 9919 Fax : +65 6481 1011

Co. Reg. No. 201212455W

Date: 04 October 2018

Third Party Insurer:

MSIG

Vehicle No: SLU528S

Third Party Veh No:

SDT9676M

Model: HONDA VEZEL 1.5X HYBRID

Date of Accident:

04 OCT 2018

Chassis: RU3-1240653

ESTIMATE

QTY	DESCRIPTION	UNIT S\$	AMOUNT S\$
1	REAR DOOR GLASS OUTER MOULDING <i>See diagram</i>		\$66.00
1	REAR DOOR STONE PROTECTIVE STICKER <i>Hic</i>		\$30.20
1	REAR DOOR BLACK FRAME STICKER <i>Hic</i>		\$37.10
1	REAR DOOR MECHANISM LOCK <i>NH</i>		\$262.70
		SUB TOTAL	\$10,688.60
		Less 20%	-\$2,137.72
		PARTS TOTAL	\$8,550.88

8545.20
6836.16

QTY	SPECIAL NETT	UNIT S\$	AMOUNT S\$
1	REAR TAILGATE WINDSCREEN SEALANT WITH PRIMER <i>Nic</i>		\$100.00
1	REAR BUMPER REVERSE SENSOR <i>Don</i>		\$280.00
1	REAR WELL PANEL INNER TOP TRAY <i>SVL</i>		\$250.00
		S/N TOTAL	\$630.00

260.00

OPTIMA WERKZ PTE LTD

Head office : 6 Kung Chong Road Singapore 159143

Tel : +65 6472 1313 Fax : +65 6472 2112

Branch office : 9A Serangoon North Ave 5 Singapore 554500 Tel : +65 6484 9919 Fax : +65 6481 1011

Co. Reg. No. 201212455W

Date: 04 October 2018

Third Party Insurer:

MSIG

Vehicle No: SLU528S

Third Party Veh No:

SDT9676M

Model: HONDA VEZEL 1.5X HYBRID

Date of Accident:

04 OCT 2018

Chassis: RU3-1240653

ESTIMATE

LABOUR CHARGES:

TO REMOVE & REPLACED WITH PANEL BEATING ALL ACCIDENT PORTION	\$2,000.00	1400/-
TO PUTTY & SPRAY PAINTING WITH SEALANT ALL ACCIDENT PORTION	\$1,800.00	1400/-
TO TUFF KOTE / ANTI-RUST	\$100.00	40/-
TO DISMANTLE & REPLACED REAR BUMPER REVERSE SENSOR	\$80.00	40/-
TO DISMANTLE & REINSTALL REAR TAILGATE REVERSE CAMERA / INNER CAMERA RECORDER	\$90.00	50/-
TO CHECK WIRING WITH WATER LEAKAGE TEST	\$80.00	50/-
TO REMOVE AND REINSTALL REAR WINDSCREEN PERFORM AND WATER LEAK TEST	\$150.00	120/-
TO DISMANTLE & REINSTALL INTERIOR CARPET, REAR SEAT ASSY, ROOF TOP INNER LINING WITH OTHER ATTACHMENT PARTS COMPONENT TO FACILITATE REPAIR	\$380.00	120/-
TO DISMANTLE & REPLACED REAR UNDER CARRIAGE COMPONENT TO FACILITATE REPAIR	\$220.00	NH
TO SEND VEHICLE FOR 3D COMPUTERISED CHECK & ADJUSTED WHEEL ALIGNMENT	3420.00	\$80.00 NH
TO MOUNT VEHICLE ONTO 3D COMPUTERISE CAR 'O' LINER TO CALIBRATE SUB CHASSIS FRAME & CAR BODY BACK TO MANUFACTURING SPECIFICATION	Photo	200/- 350.00
TO DISMANTLE & REINSTALL REAR LH DOOR INNER COMPONENT MECHANISM TO FACILITATE REPAIR WITH CHECK FOR FUNCTION		\$180.00 NH

LABOUR TOTAL \$5,510.00

TOTAL \$14,690.88

LKK Auto Consultants (Pte) Ltd
the Repairer of the vehicle

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- Modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Photo BY spray with
damaged parts.

10 dys.

Part by Part 10, 516.16

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Oct 2018 16:26		08 Oct 2018 10:12 Edit Adj Rpt	\$10,516.16 Edit Estimates	\$10,516.16 View Rpt		Pending for Survey Report Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	TAN KEY YONG, ID: S6938040I		
Main Claimant:	AGAPE AGAPE SERVICES, Co. Reg. No.: 53372791W		
Vehicle Reg. No.:	SLU528S	Date of Loss:	04/10/2018 08:00 - :59 [10 Months and 13 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / 572417	Policy/Cover Note No.:	28650229AVW (Comprehensive) Coverage: 30/11/2017 - 29/11/2018
Vehicle Reg. No. (Insured):	SDT9676M	Policy No. (Claimant):	
		Excess:	S\$500.00
Repairer:	Optima Werkz Pte Ltd (HQ) 9A Serangoon North Ave 5, 554500 Serangoon - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Pauline Tham - 6594 2545]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by BRYAN TANI] ... [Final Rpt due 07/11/2018]		
Adj Asg. Remarks:	Liability clear. TP agree with SJE - assign LKK Auto Consultants Pte Ltd. contact: 6484 9919		

ASSOCIATED MAIL RECEIVED

There are no mail for this case.

[View All](#)[Compose Case Mail](#)

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLU528S (572417)
[SDT9676M]
TP
AGAPE AGAPE SERVICES
Oct 4 2018 8:00AM
[TAN KEY YONG]
Optima Werkz Pte Ltd

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)




























 





 



























 


































View [View in Browser](#) ▼

Assessment Reports

No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	1 per page ▼	Thumbnail	Print
1	10/10/18 17:32	Adjuster Immediate Advice	1	Load HTM	

















































Photos/Images

No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	3 per page ▼	Thumbnail	Print
1	06/11/18 15:50	Rear View Left	1	Load JPG	✓
2	06/11/18 15:51	General View	1	Load JPG	✓
3	06/11/18 15:51	General View	1	Load JPG	✓
4	06/11/18 15:51	General View	1	Load JPG	✓
5	06/11/18 15:51	General View	1	Load JPG	✓
6	06/11/18 15:51	General View	1	Load JPG	✓
7	06/11/18 15:51	General View	1	Load JPG	✓
8	06/11/18 15:51	General View	1	Load JPG	✓
9	06/11/18 15:51	General View	1	Load JPG	✓
10	06/11/18 15:51	General View	1	Load JPG	✓
11	06/11/18 15:51	General View	1	Load JPG	✓
12	06/11/18 15:51	General View	1	Load JPG	✓
13	06/11/18 15:51	General View	1	Load JPG	✓
14	06/11/18 15:51	General View	1	Load JPG	✓
15	06/11/18 15:51	General View	1	Load JPG	✓
16	06/11/18 15:51	General View	1	Load JPG	✓
17	06/11/18 15:51	General View	1	Load JPG	✓
18	06/11/18 15:51	General View	1	Load JPG	✓
19	06/11/18 15:51	General View	1	Load JPG	✓
20	06/11/18 15:51	General View	1	Load JPG	✓
21	06/11/18 15:51	General View	1	Load JPG	✓
22	06/11/18 15:51	General View	1	Load JPG	✓
23	06/11/18 15:51	General View	1	Load JPG	✓
24	06/11/18 15:51	General View	1	Load JPG	✓
25	06/11/18 15:51	General View	1	Load JPG	✓
26	06/11/18 15:51	General View	1	Load JPG	✓
27	06/11/18 15:51	General View	1	Load JPG	✓
28	06/11/18 15:51	General View	1	Load JPG	✓
29	06/11/18 15:51	General View	1	Load JPG	✓
30	06/11/18 15:51	General View	1	Load JPG	✓
31	06/11/18 15:51	General View	1	Load JPG	✓
32	06/11/18 15:51	General View	1	Load JPG	✓

Assessment Reports			1 per page	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
33	06/11/18 15:51	General View	 Load JPG	
34	06/11/18 15:51	General View	 Load JPG	
35	06/11/18 15:51	General View	 Load JPG	
36	06/11/18 15:51	General View	 Load JPG	
37	06/11/18 15:51	General View	 Load JPG	
38	06/11/18 15:51	General View	 Load JPG	
39	06/11/18 15:51	General View	 Load JPG	
40	06/11/18 15:51	General View	 Load JPG	
41	06/11/18 15:51	General View	 Load JPG	
42	06/11/18 15:51	General View	 Load JPG	
43	06/11/18 15:51	General View	 Load JPG	
44	06/11/18 15:51	General View	 Load JPG	
45	06/11/18 15:51	General View	 Load JPG	
46	06/11/18 15:51	General View	 Load JPG	
47	06/11/18 15:51	General View	 Load JPG	
48	06/11/18 15:51	General View	 Load JPG	
49	06/11/18 15:51	General View	 Load JPG	
50	06/11/18 15:51	General View	 Load JPG	
51	06/11/18 15:51	General View	 Load JPG	
52	06/11/18 15:51	General View	 Load JPG	
53	06/11/18 15:51	Odometer Reading	 Load JPG	
54	06/11/18 15:51	Chassis Number	 Load JPG	
55	06/11/18 15:52	Reinspection Photo	 Load JPG	
56	06/11/18 15:52	Reinspection Photo	 Load JPG	
57	06/11/18 15:52	Reinspection Photo	 Load JPG	
58	06/11/18 15:52	Reinspection Photo	 Load JPG	
59	06/11/18 15:52	Reinspection Photo	 Load JPG	
60	06/11/18 15:52	Reinspection Photo	 Load JPG	
61	06/11/18 15:52	Reinspection Photo	 Load JPG	
62	06/11/18 15:52	Reinspection Photo	 Load JPG	
63	06/11/18 15:52	Reinspection Photo	 Load JPG	
64	06/11/18 15:52	Reinspection Photo	 Load JPG	
65	06/11/18 15:52	Reinspection Photo	 Load JPG	
66	06/11/18 15:52	Reinspection Photo	 Load JPG	
67	06/11/18 15:52	Reinspection Photo	 Load JPG	
68	06/11/18 15:52	Reinspection Photo	 Load JPG	
69	06/11/18 15:52	Reinspection Photo	 Load JPG	
70	06/11/18 15:52	Reinspection Photo	 Load JPG	
71	06/11/18 15:52	Reinspection Photo	 Load JPG	
72	06/11/18 15:52	Reinspection Photo	 Load JPG	
73	06/11/18 15:52	Reinspection Photo	 Load JPG	
74	06/11/18 15:52	Reinspection Photo	 Load JPG	
75	06/11/18 15:52	Reinspection Photo	 Load JPG	
76	06/11/18 15:52	Reinspection Photo	 Load JPG	
77	06/11/18 15:52	Reinspection Photo	 Load JPG	
78	06/11/18 15:52	Reinspection Photo	 Load JPG	
79	06/11/18 15:52	Reinspection Photo	 Load JPG	
80	06/11/18 15:52	Reinspection Photo	 Load JPG	

Assessment Reports

No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	1 per page	Thumbnail	Print
81	06/11/18 15:52	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
82	06/11/18 15:52	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
83	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
84	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
85	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
86	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
87	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
88	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
89	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
90	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
91	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
92	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
93	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
94	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
95	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
96	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
97	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
98	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
99	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
100	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
101	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
102	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
103	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
104	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
105	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
106	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
107	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
108	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
109	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
110	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
111	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
112	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
113	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
114	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
115	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
116	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
117	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
118	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
119	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
120	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
121	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
122	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
123	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
124	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
125	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
126	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
127	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
128	06/11/18 15:53	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page ▼	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
129	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
130	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
131	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
132	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
133	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
134	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
135	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
136	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
137	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
138	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
139	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
140	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
141	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
142	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
143	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
144	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
145	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
146	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
147	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
148	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
149	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
150	06/11/18 15:53	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
151	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
152	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
153	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
154	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
155	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
156	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
157	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
158	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
159	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
160	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
161	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
162	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
163	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
164	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
165	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
166	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
167	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
168	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
169	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
170	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
171	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
172	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
173	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
174	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
175	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>
176	06/11/18 15:54	Replacement Part Photo	 Load JPG	<input checked="" type="checkbox"/>

Assessment Reports

No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	1 per page ▼	✓
			Thumbnail	Print
177	06/11/18 15:54	Replacement Part Photo	Load JPG	✓
178	06/11/18 15:55	Finishing Photo	Load JPG	✓
179	06/11/18 15:55	Finishing Photo	Load JPG	✓
180	06/11/18 15:55	Finishing Photo	Load JPG	✓
181	06/11/18 15:55	Finishing Photo	Load JPG	✓
182	06/11/18 15:55	Finishing Photo	Load JPG	✓
183	06/11/18 15:55	Finishing Photo	Load JPG	✓

Documentation

No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	1 per page ▼	✓
			Thumbnail	Print
1	05/10/18 16:27	SDT9676M E-FILE REPORT	Load PDF	
2	05/10/18 16:28	SLU528S E-FILE REPORT	Load PDF	
3	05/10/18 16:37	TP agree SJE - assign LKK	Load PDF	

Documents Checklist**DOCUMENTS CHECKLIST**

Reset Save Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)**Show Remarks To:** ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG18018211/DVBS2
Date: 14/11/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. Policy No: 28650229AVW
Claimant Vehicle No : SLU528S **Insured Vehicle No :** SDT9676M
Date of Loss: 04/10/2018 Nature of Claim: TP Claim No: 572417

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLU528S**
Make & Model: HONDA VEZEL, 1.5 X CVT ABS D/AIRBAG 2WD 5DR (A) Engine No: LEB5940679
Reg. Date: 21/11/2017 (Man. Year: 2017) Chassis No: RU31240653
Colour: Blue Odometer: 26247 km
Engine Capacity: 1496 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/50R16 Rear Tyre Size: 215/50R16
Front Left Side: Dunlop 5 mm Rear Left Side: Dunlop 5 mm
Front Right Side: Dunlop 5 mm Rear Right Side: Dunlop 5 mm
The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	9,180.88	7,096.16	2,084.72	22.71
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,510.00	3,420.00	2,090.00	37.93
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	14,690.88	10,516.16	4,174.72	28.42
+ GST 7.00/7.00% (S\$)	1,028.36	736.13	292.23	28.42
Nett Amount (S\$)	15,719.24	11,252.29	4,466.95	28.42

INSPECTION

Date of Assignment: 08/10/2018
Date Inspected: 08/10/2018 Inspected At: Optima Werkz Pte Ltd (HQ)
9A Serangoon North Ave 5
Singapore 554500
Estimated Period of Repair: 10.0 days

Adjuster: BRYAN TANI

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 14 Nov 2018)

Parts: 144 HONDA VEZEL 1.5 X CVT ABS D/AIRBAG 2WD 5DR (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SLU528S)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*REAR TAILGATE	Broken	1,072.50 FL	*1,072.50 FL
2	1	*SET REAR TAILGATE WINDSCREEN MOULDING	Necessary	74.10 FL	*74.10 FL
3	1	*REAR TAILGATE OUTER GARNISH	Deformed	267.50 FL	*267.50 FL
4	1	*REAR TAILGATE LOGO EMBLEM	Necessary	26.70 FL	*26.70 FL
5	1	*REAR TAILGATE VEZEL EMBLEM	Necessary	48.10 FL	*48.10 FL
6	1	*REAR TAILGATE HYBRID EMBLEM	Necessary	68.30 FL	*68.30 FL
7	1	*REAR TAILGATE REFLECTOR LAMP LH	Cracked	464.80 FL	*464.80 FL
8	2	*REAR TAILGATE HINGE LH/RH	Repair	77.00 FL	*- FL
9	1	*REAR TAILGATE INNER TRIM BOARD	Not Necessary	170.50 FL	*- FL
10	1	*REAR TAILGATE MECHANISM LOCK	Damaged	221.40 FL	*221.40 FL
11	1	*REAR TAILGATE WEATHER STRIP	Deformed	123.80 FL	*123.80 FL
12	1	*REAR TAILLAMP LH	Cracked	503.30 FL	*503.30 FL
13	1	*REAR TAILLAMP HOLDER CLIPS	Necessary	5.80 FL	*5.80 FL
14	1	*REAR TAILLAMP INNER PANEL	Dented	96.30 FL	*96.30 FL
15	1	*REAR BUMPER CENTER	Broken	858.10 FL	*858.10 FL
16	2	*REAR BUMPER LH/RH	N/s Cut / O/s Distorted	357.60 FL	*357.60 FL
17	8	*REAR BUMPER CLIPS	Necessary	31.20 FL	*31.20 FL
18	2	*REAR BUMPER SIDE RETAINER LH/RH	Serviceable	42.40 FL	*- FL
19	1	*REAR BUMPER REFLECTOR LH	Cracked	151.80 FL	*151.80 FL
20	1	*REAR FENDER LH	Dented	770.00 FL	*770.00 FL
21	1	*REAR FENDER ARCH GARNISH LH	Deformed	220.20 FL	*220.20 FL
22	1	*REAR FENDER INNER SHIELD LH	Deformed	134.80 FL	*134.80 FL
23	10	*REAR FENDER INNER SHIELD CLIPS LH	Necessary	39.00 FL	*39.00 FL
24	1	*REAR FENDER INNER UPHOLSTERY TRIM BOARD LH	Deformed	269.50 FL	*269.50 FL
25	1	*REAR FENDER INNER AIR VENT	Deformed	31.40 FL	*31.40 FL
26	1	*REAR END PANEL	Dented	467.50 FL	*467.50 FL
27	1	*REAR END PANEL INNER TOP GARNISH	Deformed	86.80 FL	*86.80 FL
28	1	*REAR END PANEL TAILGATE ANTENNA SENSOR BUZZER	Not Necessary	94.30 FL	*- FL
29	1	*REAR SUB CHASSIS FRAME LH	Repair	550.10 FL	*- FL
30	1	*REAR SUB CHASSIS FRAME TOP PANEL LH	Repair	82.90 FL	*- FL
31	1	*REAR SUB CHASSIS FRAME BRACKET LH	Buckled	34.30 FL	*34.30 FL
32	1	*REAR WELL PANEL	Repair	863.50 FL	*- FL
33	1	*REAR WELL PANEL LOWER UNDER COVER	Deformed	157.30 FL	*157.30 FL
34	1	*REAR WELL PANEL INNER TOP TOOL SPONGE	Deformed	163.60 FL	*163.60 FL
35	1	*REAR WELL PANEL INNER TOP UPHOLSTERY BOARD	Bent	494.80 FL	*494.80 FL
36	1	*REAR WELL SIDE PANEL LH	Buckled	181.30 FL	*181.30 FL
37	1	*REAR DOOR LH	Bent	990.10 FL	*990.10 FL
38	1	*REAR DOOR GLASS OUTER MOULDING	Deformed	66.00 FL	*66.00 FL
39	1	*REAR DOOR STONE PROTECTIVE STICKER	Necessary	30.20 FL	*30.20 FL
40	1	*REAR DOOR BLACK FRAME STICKER	Necessary	37.10 FL	*37.10 FL
41	1	*REAR DOOR MECHANISM LOCK	Not Necessary	262.70 FL	*- FL
42	1	*REAR TAILGATE WINDSCREEN SEALANT WITH PRIMER	Necessary	100.00 FS	*40.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
43	1		*REAR BUMPER REVERSE SENSOR	Damaged	280.00 FS	*220.00 FS
44	1		*REAR WELL PANEL INNER TOP TRAY	Serviceable	250.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	11,318.60	8,805.20
- List Item Discount on L Items 20.00/20.00% (S\$)	2,137.72	1,709.04

Total Parts (S\$)	9,180.88	7,096.16
-------------------	----------	----------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE & REPLACED WITH PANEL BEATING ALL ACCIDENT PORTION.	New	2,000.00	1,400.00
2	TO PUTTY & SPRAY PAINTING WITH SEALANT ALL ACCIDENT PORTION.	New	1,800.00	1,400.00
3	TO TUFF KOTE / ANTI-RUST.	New	100.00	40.00
4	TO DISMANTLE & REPLACED REAR BUMPER REVERSE SENSOR.	New	80.00	40.00
5	TO DISMANTLE & REINSTALL REAR TAILGATE REVERSE CAMERA / INNER CAMERA RECORDER.	New	90.00	50.00
6	TO CHECK WIRING WITH WATER LEAKAGE TEST.	New	80.00	50.00
7	TO REMOVE AND REINSTALL REAR WINDSCREEN PERFORM AND WATER LEAK TEST.	New	150.00	120.00
8	TO DISMANTLE & REINSTALL INTERIOR CARPET, REAR SEAT ASSY, ROOF TOP LINING WITH OTHER ATTACHMENT PARTS COMPONENT TO FACILITATE REPAIR.	New	380.00	120.00
9	TO DISMANTLE & REPLACED REAR UNDER CARRIAGE COMPONENT TO FACILITATE REPAIR.	New	220.00	0.00
10	TO SEND VEHICLE FOR 3D COMPUTERISED CHECK & ADJUSTED WHEEL ALIGNMENT.	New	80.00	0.00
11	TO MOUNT VEHICLE ONTO 3D COMPUTERISED CAR O LINER TO CALIBRATE SUB CHASSIS FRAME & CAR BODY BACK TO MANUFACTURING SPECIFICATION.	New	350.00	200.00
12	TO DISMANTLE & REINSTALL REAR LH DOOR INNER COMPONENT MECHANISM TO FACILITATE REPAIR WITH CHECK FOR FUNCTION.	New	180.00	0.00
Gross Labour Cost (\$\$)			5,510.00	3,420.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >