

SLR7378C - Submitted by: STA INSPECTION PTE LTD (Sin Ming)




1/25: **Accident Photo** [Linked Accident Report Documents]



2/25: **Accident Photo** [Linked Accident Report Documents]




3/25: **Accident Photo** [Linked Accident Report Documents]

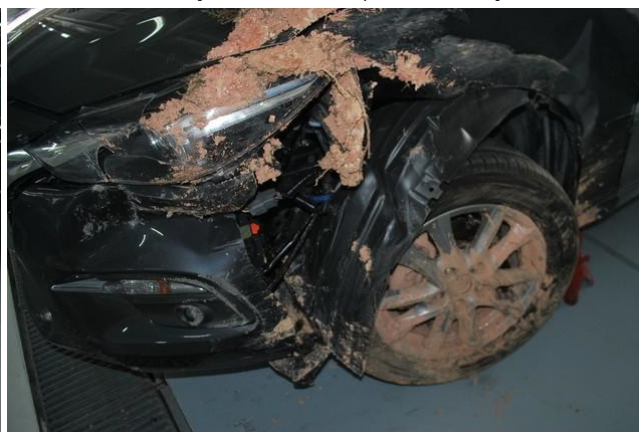


4/25: **Accident Photo** [Linked Accident Report Documents]


SLR7378C - Submitted by: STA INSPECTION PTE LTD (Sin Ming)

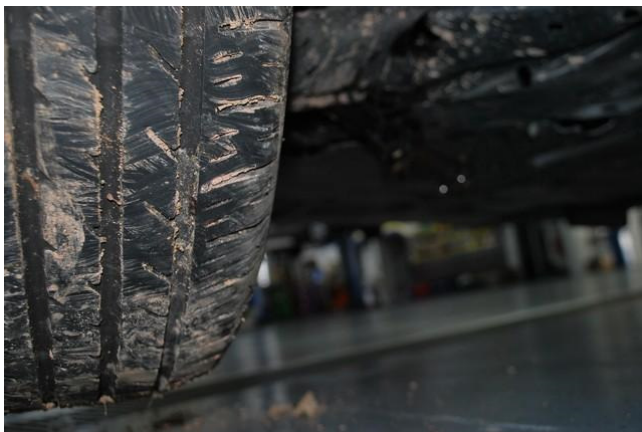

5/25: **Accident Photo** [Linked Accident Report Documents]

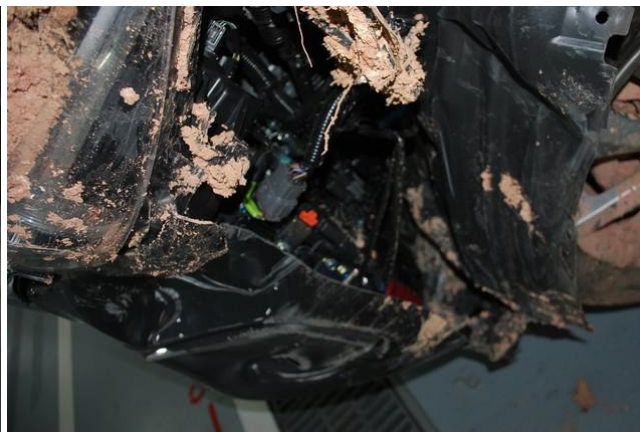

6/25: **Accident Photo** [Linked Accident Report Documents]

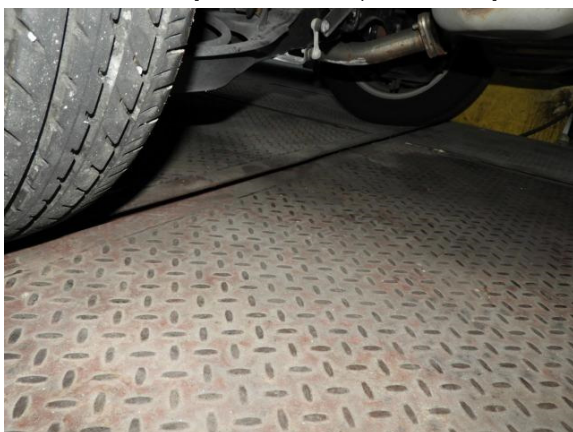

7/25: 5



8/25: 6


SLR7378C - Submitted by: STA INSPECTION PTE LTD (Sin Ming)




9/25: 7



10/25: 9

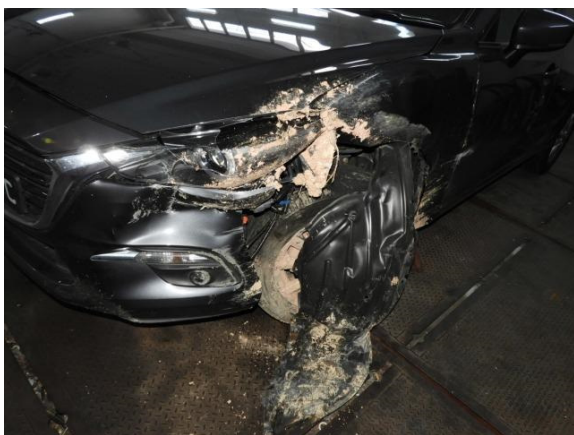

11/25: 12

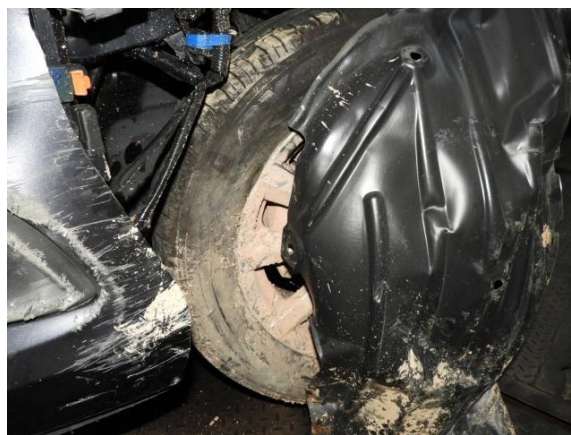

12/25: 16


SLR7378C - Submitted by: STA INSPECTION PTE LTD (Sin Ming)



13/25: 18



14/25: 20

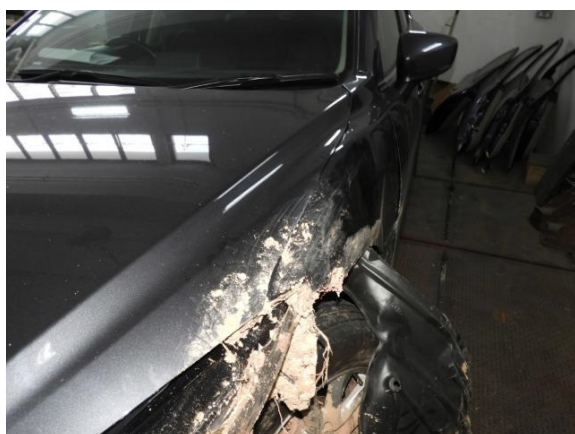

15/25: 22



16/25: 24

SLR7378C - Submitted by: STA INSPECTION PTE LTD (Sin Ming)




17/25: 30



18/25: 31



19/25: 32

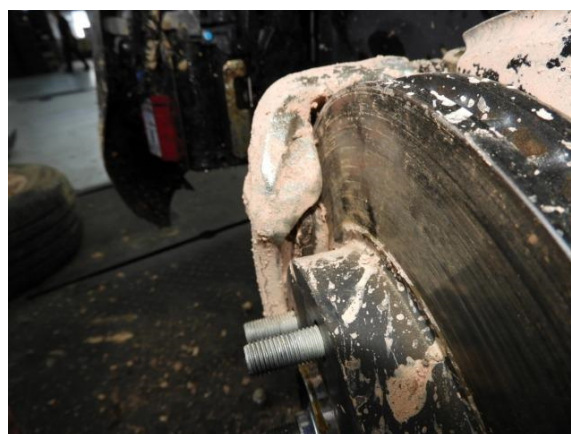


20/25: 34


SLR7378C - Submitted by: STA INSPECTION PTE LTD (Sin Ming)



21/25: **36**

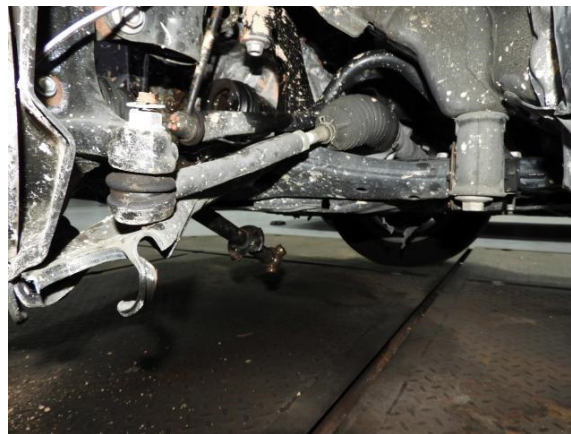

22/25: **37**

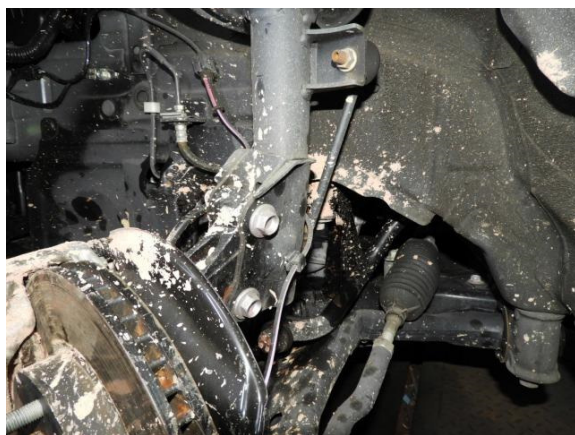


23/25: **39**



24/25: **40**

SLR7378C - Submitted by: STA INSPECTION PTE LTD (Sin Ming)

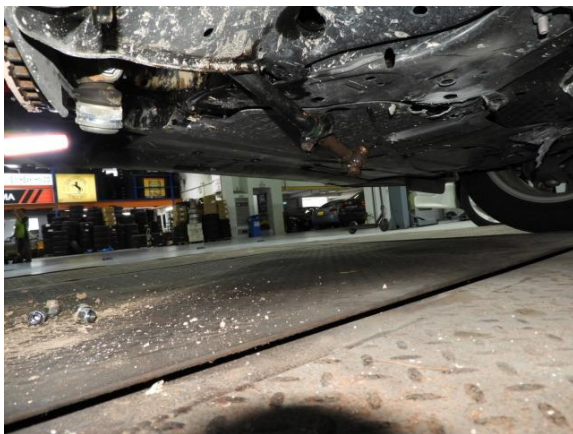

25/25: 42