

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

PASS DATE

25 Jun 1985

Class 3 Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms

Licence No. S1740183A

REPUBLIC OF SINGAPORE DRIVING LICENCE

Licence Number: S1740183A
Name

CHENG KOK WAH

Birth Date: 11 Feb 1966

Issue Date: 21 Apr 2003

000403106G

AUTOBAY TOWING

1 Kaki Bukit Avenue 6
#01-55 AutoBay @ Kaki Bukit
Singapore 417883
tel: 9015 8686 (At P...)

CASH SALE

(TWINCAR)

Sold to:

S1T 9642 K

No.

Date:

18/12/17

CROWN

Item	Quantity	Description	Unit Price	Amount
		Auto Hub to Ubi, 11K		8100
		Reportly Two Trips		7
E. & O. E.			Sub Total :	
			GST Tax :	
			Total :	8100

Issued by: _____

TwinCar AUTOMOTIVE PTE LTD

Kaki Bukit AutoHub
2 Kaki Bukit Ave 2
#01-17 / #01-18 / Heavy Vehicle #01-08 / Spray Painting #02-27
Singapore 417921 Tel No. : +65 6842 0051 Fax No. : +65 6741 0510
E-Mail : sales@n51.com.sg
Company Reg. No. : 200714616M
GST Registration No. : 200714616M

DAVID TPT
BLK 10 NORTH BRIDGE ROAD #12-5113
SINGAPORE 190010

Contact : 91065441, 91012166

TAX INVOICE

Date : 03/09/2018
Date in : 18/12/2017
Vehicle Num. : SDT9642K
Make/Model : NISSAN LATIO 1.5L T-2007
Chassis/Eng# : JN1BAAC11Z0009063/HR15248648A
Accident Date : 16/12/2017
Claim No : CLM13946
Reference : DEC-03/2017
Policy No. : 5088333907 (08/03/2018)

LUMPSUM REPAIR BILL
AS PER SURVEYOR REPORT
REF : 0409-18-TCA DATED 23/07/2018
BY PAR AUTOMOTIVE CONSULTANCY

Amount S\$
5,600.00



E. & O.E.	Sub S\$:	5,600.00
	Add GST (7 %) S\$:	392.00
	Total Amount S\$:	5,992.00

for TWINCAR AUTOMOTIVE PTE LTD

Enquire Vehicle & Owner Information (Vehicle No. SJL1688C As At 16 Dec 2017 / 10:50:00)

Law Firm Search Details

Search Reason: Insurance claim in relation to traffic accident

Law Firm Case No.: T140-107960-18

Current Owner Details

Owner ID Type: Singapore NRIC

Owner ID: S1740183A

Owner Name: CHENG KOK WAH

Registered Address Type: HDB / HUDC

Registered Block/House No.: 81

Registered Street Name: LORONG 4 TOA PAYOH

Registered Unit No.: # 13 - 432

Registered Building Name: -

Registered Postal Code: 310081

Current Vehicle Details

Vehicle No.: SJL1688C

Make Description/Model: TOYOTA / HARRIER PREMIUM 2.0 A

Insurance Company Name: MSIG INSURANCE (SINGAPORE) PTE LTD



Thank you


Ng Ching Boon Eric has successfully logged out.

Your last login date and time was 01 Oct 2018, 18:36:18.

To return to ONE.MOTORING, please [click here](#)

For security reasons, please **CLEAR YOUR CACHE** after each session.

Session Transaction History

S/No. 	Asset Type	Asset ID	Asset Owner ID	Transaction Type	Transaction Amount(\$)
1	Vehicle	SJL1688C -		18.19 Enquire Veh Owner Info (Others) by Law Firm	7.49

PAR Automotive Consultancy

Regn No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0409-18-TCA

23 July 2018

ACCIDENT VEHICLE SURVEY REPORT

David TPT
c/o Twincar Automotive Pte Ltd
2 Kaki Bukit Ave 2 #01-17
Kaki Bukit Auto Hub
Singapore 417921

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	SDT9642K	<i>Odometer:</i>	218602km
<i>Make & Model:</i>	Nissan Latio 1.5L T	<i>Colour:</i>	White
<i>Chassis number:</i>	JN1BAAC11Z0009063	<i>Date of accident:</i>	16/12/2017
<i>Year of Regn.:</i>	14/06/2008	<i>Date inspected:</i>	20/12/2017
<i>Repairer at:</i>	Twincar Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub Singapore 417921	<i>Date inspected (After Repair):</i>	27/12/2017

RE-INSPECTION

We had carried out re-inspection during works in progress and post repair inspection on the above vehicle. Attached in Annex B are the re-inspection photos, showing the work in progress and our re-inspection to the hidden part that were damaged.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	18 Dec 2017		19 Dec 2017 13:44 Edit Adj Rpt	\$2,350.00 Edit Estimates	\$2,350.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	--------------------------

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	CHENG KOK WAH, ID: S1740183A, Tel: +6597553289		
Main Claimant:	DAVID TPT, Co. Reg. No.: 53324419J		
Vehicle Reg. No.:	SDT9642K	Date of Loss:	16/12/2017 10:00 - :59 [114 Months and 2 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / 541348	Policy/Cover Note No.:	A28695028QMX (Comprehensive) Coverage: 01/03/2017 - 28/02/2018
Vehicle Reg. No. (Insured):	SJL1688C	Policy No. (Claimant):	
		Excess:	
Repairer:	Twincar Automotive Pte Ltd (Kaki Bukit) BLK 2 KAKI BUKIT, #01-17/18 KAKI BUKIT AUTOHUB, 417921 Kaki Bukit - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Monica Chung Pei Zhen - 6594 2552]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Lim Teow Guan] ... [Final Rpt due 02/11/2018]		
Driver/Custodian (Insured):	CHENG KOK WAH (51 / Male), NRIC: S1740183A, Tel: +6597553289		
Adj Asg. Remarks:	Third Party Pre-Repair Survey		

ASSOCIATED MAIL RECEIVED

[View All](#) [Compose Case Mail](#)

- MSIG_SG (31/10/2018): Report Send Back Alerts - SDT9642K (TP)

ALL ASSOCIATED TASKS
































 









[View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SDT9642K (541348)**
[SJL1688C]
TP
DAVID TPT
Dec 16 2017 10:00AM
[CHENG KOK WAH]
Twincar Automotive Pte Ltd

Upload Documents		Upload Photos	Compose New Letter	View View in Browser	
Assessment Reports				1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print
1	19/12/17 13:44	Accident Statement Addm. #1 From: SC - Reg. No: SJL1688C, Claimant: CHENG KOK WAH		Load HTM	
Photos/Images				3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
2	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
3	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
4	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
5	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
6	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
7	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
8	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
9	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
10	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
11	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
12	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
13	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
14	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
15	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
16	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
17	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
18	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
19	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
20	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
21	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
22	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
23	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
24	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
25	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
26	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
27	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
28	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
29	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
30	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
31	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
32	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>
33	06/04/18 11:08	General View		Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
34	06/04/18 11:08	General View	 Load JPG	<input checked="" type="checkbox"/>
35	06/04/18 11:08	General View	 Load JPG	<input checked="" type="checkbox"/>
36	06/04/18 11:08	General View	 Load JPG	<input checked="" type="checkbox"/>
37	06/04/18 11:08	General View	 Load JPG	<input checked="" type="checkbox"/>
38	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
39	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
40	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
41	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
42	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
43	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
44	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
45	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
46	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
47	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
48	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
49	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
50	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
51	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
52	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
53	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
54	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
55	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
56	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
57	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
58	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
59	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
60	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
61	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
62	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
63	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
64	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
65	06/04/18 16:23	Photographs of Damaged Parts	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	19/12/17 11:53	E-FILE REPORT (SDT9642K)	 Load PDF	
2	19/12/17 12:01	TP PRI	 Load PDF	
3	19/12/17 13:43	TP LIST OF SJE & OUR REJECTION REPLY & NOMINATED LKK	 Load PDF	
4	19/12/17 15:29	TP LETTER DD 19.12.17 OI VIDEOS IN X:\For Motor Section Only\Video\541348	 Load PDF	
5	30/10/18 14:13	LOD, SURVEY REPORT, LTA SEARCH, COI, B/W IMAGES, DL, TAX INVOICE,	 Load PDF	
6	30/10/18 14:13	COLOURED IMAGES PART 1	 Load PDF	
7	30/10/18 14:13	COLOURED IMAGES PART 2	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	13/11/18 08:43	Colour Photo	 Load PDF	
2	13/11/18 08:43	PRS Invoice	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG17024045/BQBE2-1

Date: 13/11/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No: A28695028QMX

Claimant Vehicle No : SDT9642K

Insured Vehicle No : SJL1688C

Date of Loss: 16/12/2017

Nature of Claim: TP

Claim No: 541348

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SDT9642K

Make & Model: NISSAN LATIO, 1.5 L (A)

Engine No: HR15248648A

Reg. Date: 14/06/2008 (Man. Year: 2007)

Chassis No: JN1BAAC11Z0009063

Colour: White

Odometer: 218602 km

Engine Capacity: 1498 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/60 R15

Rear Tyre Size: 195/60 R15

Front Left Side: Michelin 2 mm

Rear Left Side: Michelin 2 mm

Front Right Side: Michelin 2 mm

Rear Right Side: Michelin 2 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,316.66	1,667.47	2,649.19	61.37
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,250.00	1,270.00	1,980.00	60.92
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	7,566.66	2,937.47	4,629.19	61.18
Approved Total (Overridden) (S\$)		2,350.00		
(S\$)	7,566.66	2,350.00	5,216.66	68.94
+ GST 7.00/7.00% (S\$)	529.67	164.50	365.17	68.94
Nett Amount (S\$)	8,096.33	2,514.50	5,581.83	68.94

INSPECTION

Date of Assignment: 19/12/2017

Date Inspected: 20/12/2017 Inspected At:

Twincar Automotive Pte Ltd (Kaki Bukit)
BLK 2 KAKI BUKIT, #01-17/18 KAKI
BUKIT AUTOHUB
Singapore 417921

Estimated Period of Repair: 5.0 days

Adjuster: Lim Teow Guan**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 13 Nov 2018)
Parts:	143	NISSAN LATIO 1.5 L (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SDT9642K)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Cut	411.30 FL	*411.30 FL
2	1		*FRONT BUMPER LH FOGLAMP	Broken	258.00 FL	*258.00 FL
3	1		*FRONT BUMPER LOWER LIP	Cut	250.00 FL	*250.00 FL
4	2		*FRONT BUMPER SIDE RETAINER L/R	Necessary	41.60 FL	*41.60 FL
5	4		*FRONT GRILLE CLIPS L/R	Necessary	26.00 FL	*26.00 FL
6	1		*FRONT LH ABS SENSOR	Not Necessary	335.40 FL	*- FL
7	4		*FRONT LH HEADLAMP CLIPS	Necessary	26.00 FL	*26.00 FL
8	1		*FRONT LH KNUCKLE ARM	Not Necessary	357.20 FL	*- FL
9	1		*FRONT LH KNUCKLE ARM BEARING	Dislodged	269.70 FL	*269.70 FL
10	1		*FRONT LH SHOCK ABSORBER	Not Necessary	280.80 FL	*- FL
11	1		*FRONT BUMPER LOGO EMBLEM	Necessary	33.80 FN	*33.80 FN
12	1		*FRONT BUMPER LH FOGLAMP GARNISH	Cut	95.90 FN	*95.90 FN
13	1		*FRONT BUMPER TOW HOOK COVER	Reuse	21.20 FN	*- FN
14	2		*FRONT GRILLE L/R	Broken	315.00 FN	*157.30 FN
15	1		*FRONT LH FENDER	Repair	576.80 FN	*- FN
16	1		*FRONT LH FENDER BRACKET	Bent	23.30 FN	*23.30 FN
17	1		*FRONT LH FENDER INNER SHIELD	Cracked	80.20 FN	*80.20 FN
18	1		*FRONT LH FENDER SIGNAL LAMP	Reuse	53.40 FN	*- FN
19	1		*FRONT LH HEADLAMP	Cracked	372.00 FN	*372.00 FN
20	1		*FRONT LH HEADLAMP LOWER BRACKET	Bent	26.00 FN	*26.00 FN
21	1		*FRONT LH LOWER ARM	Not Necessary	200.50 FN	*- FN
22	1		*FRONT LH POWER STEERING RACK END	Not Necessary	93.00 FN	*- FN
23	1		*FRONT LH SHOCK ABSORBER TOP MOUNTING	Not Necessary	96.00 FN	*- FN
24	1		*FRONT LH STABILIZER BAR LINK	Not Necessary	32.30 FN	*- FN
25	1		*SET FRONT BUMPER CLIPS	Necessary	30.00 FS	*30.00 FS
26	1		*FRONT LH 15 RIM	Not Necessary	480.00 FS	*- FS
27	1		*FRONT LH 195/60R15 TYRE	Not Necessary	380.00 FS	*- FS
28	1		*SET FRONT LH FENDER INNER SHIELD CLIPS	Necessary	30.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc. N=NettItemDisc.

Sub Total (S\$)	5,195.40	2,131.10
- List Item Discount on L Items 30.00/30.00% (S\$)	676.80	384.78
- Nett Item Discount on N Items 10.00/10.00% (S\$)	201.94	78.85
Total Parts (S\$)	4,316.66	1,667.47

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING, RESETTNG HEADLAMP FOCUSING AND REWIRE FOR PARKING SENSOR	New	150.00	50.00
2	TO REMOVE, CHANGE FRONT SUSPENSION PARTS, ABSORBER, LOWER ARM, KNUCKLE ARM, WHEEL BEARING, BEARING HUB, DRIVE SHAFT, ANTI-ROLL BAR, TOP-ARM AND STEERING RACK AND PINION	New	550.00	0.00
3	TO ROAD TEST DRIVING, CHECK AND RESETTNG WHEEL ALIGNMENT SYSTEM	New	180.00	60.00
4	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS, REPAIR PORTION, AND WHERE CONSISTENT TO THE ACCIDENT	New	1,000.00	500.00
5	TO PROVIDE LABOUR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT	New	1,250.00	600.00
6	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL	New	120.00	60.00
Gross Labour Cost (S\$)			3,250.00	1,270.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >