PROGRESSIVE CAR CARE PTE LTD **BLK 3022A UBI ROAD 1** #01-45/46 SINGAPORE 408716

Email:

claims@procarcare.com.sg

Claim Reference: TP 1118 - 5291 **Assessment Number: PA001729** 

**Version: PROGRESS/4** Printed: 25/01/2019 09:36 Date Calculated: 24/01/2019 01:30

# **Summary Information**

Claim

Location: Singapore (SG) Currency: SGD Printed by: Ray Lin Date of Incident: 05/11/2018 **Authorisation Status:** Interim Able to Authorise Repairs: TBA

Work Provider: AXA Insurance S'pore Pte Repairs Authorised: **TBA** 

Claim Reference: TP 1118 - 5291 Estimated Repair Time: Policy Number: GA398828 Quote Due Date: Other Reference: TP 1118 - 5291 Actual Repair Days:

Third Party: Parts Ordered Date: **Insured Amount:** Hire Car Start: **Under Warranty:** Hire Car End: Vehicle Collected: Warranty Expired:

### **Vehicle Details**

**Vehicle** 

Manufacturer: **MERCEDES** Model: C Class Sub Model: C 180 Model Sheet Number: 3AP 42 Registration: SLP8255C Registration Month: June Registration Year: 2017

VIN Number: WDD2050402R286201

Manufacture Year: 2017 Odometer: Not Known

Colour:

**Engine Number:** 27491030977152

Fuel Level: % **Model Specs** 

FR PRODUCTION START **EQUIPMENT AVANTGARDE MODEL 2017** A/C THERMATIC FRT COLLISION ALARM KEYLESS GO **AUDIO 20 TOUCHPAD** WIPER/RAIN SENSOR LED HEADLAMP FOLDING REAR SEAT PASSENGER SEAT MEMOR STORAGE PACKAGE ALU MOULDINGS **KEYLESS GO** 

ILLUMINAT AMBIENTE AMG SILL MOULDINGS ECO START/STOP **AUTOMATIC 9-SPEED** AGILITY CONTR SUSPEN TYRES 225/50 WR 17 TYRE W/FLAT RUNNING

PEDESTRIAN PROTECT

**BOOTLID SENSORS HD COOLING** AGILITY SELECT SWITC TYRE PRESSURE SENSOR CRUISE CONTROL

**EQUIPMENT AVANTGARDE** 

**KEYLESS IGNITION SYS** 

MIRROR PACKAGE

REARVIEW CAMERA

INTERIOR LAMP PACK

LEATHER PAD ARTICO

ELEC DRIVER SEAT MEM

RADIO-CD/DVD

PARK ASSISTENT

**ELECTRIC BOOTLID** 

**Full Report - V1** 

Registration: SLP8255C

WHEELS 7J X 17 ALLOY EXTENDED FUEL TANK **CLEAR COAT HARD** 

#### **Vehicle Condition**

**Vehicle Status** 

Pre-Accident Condition: Severity of Impact: Vehicle Status on Steering:

Inspection:

**Brakes Pedal Travel:** Date of Inspection: 07/11/2018 Place of Inspection:

Claim Reference: TP 1118 - 5291 Full Report - V1
Assessment Number: PA001729 Registration: SLP8255C

Version: PROGRESS/4 Registration: SLP8255C Printed: 25/01/2019 09:36


Date Calculated: 24/01/2019 01:30

# Pre-Accident Damage:


Tyres Condition:

Tread Depth LHF: Tread Depth LHR:

Damage Areas:

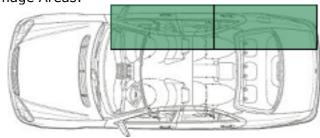

Tread Depth RHF: Tread Depth RHR: Direction of Impact:

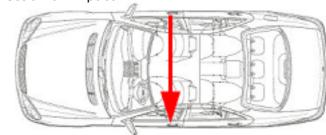

## **Addresses**

Repairer

Name: PROGRESSIVE

Address : Post Code :

**Cost Summary** 

Total Labour	\$1,201.50
Total Paint/Material	\$232.39
Total Parts	\$2,701.35
Total of Additional Costs	\$42.00
Excess:	TBA
Grand Total Exc GST:	\$4,177.24
7 % GST:	\$292.41
Grand Total Inc GST:	\$4,469.65

**Repair Information** 

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR Price/Dent = \$45.00/HR				
r Repair Details	WU	Cost Price (\$)		
R + R BATTERY EARTH CABLE	3.0	13.50		
(WHEN DISCONNECTING ELECTRIC PLUG AND				
SOCKET CONNECTIONS)				
ADDITIONAL FOR FRONT DOOR	1.0	4.50		
(VEHICLE WITH UPPER DOOR TRIM)				
RENEW R/F DOOR AND CONVERT PARTS	32.0	144.00		
•				
AND ALL ATTACHED PARTS ASSEMBLE				
ADJUST R/F DOOR 2.0				
REMOVE + REFIT REAR BUMPER 11.0 49.5				
INCLUDES: R + R CENTRE REAR PANEL TRIM				
AND TAILLAMP				
DIS + ASS REAR BUMPER (REMOVED)	3.0	13.50		
ADDITIONAL FOR DISS/ASS REAR BUMPER 2.0 9.00				
(VEHICLE WITH PARK ASSISTENT)				
CAVITY PROTECTION (ADD/WORK) 2.0 9.				
CAVITIY PROTECTION RIGHT FRONT DOOR 2.0 9.0				
CAVITIY PROTECTION RIGHT REAR DOOR 2.0 9.00				
	Repair Details R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS) ADDITIONAL FOR FRONT DOOR (VEHICLE WITH UPPER DOOR TRIM) RENEW R/F DOOR AND CONVERT PARTS INCLUDES: DOOR TRIM REMOVE AND REFIT AND ALL ATTACHED PARTS ASSEMBLE ADJUST R/F DOOR REMOVE + REFIT REAR BUMPER INCLUDES: R + R CENTRE REAR PANEL TRIM AND TAILLAMP DIS + ASS REAR BUMPER (REMOVED) ADDITIONAL FOR DISS/ASS REAR BUMPER (VEHICLE WITH PARK ASSISTENT) CAVITY PROTECTION (ADD/WORK) CAVITIY PROTECTION RIGHT FRONT DOOR	REPAIR DETAILS  R + R BATTERY EARTH CABLE  (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)  ADDITIONAL FOR FRONT DOOR  (VEHICLE WITH UPPER DOOR TRIM) RENEW R/F DOOR AND CONVERT PARTS INCLUDES: DOOR TRIM REMOVE AND REFIT AND ALL ATTACHED PARTS ASSEMBLE ADJUST R/F DOOR REMOVE + REFIT REAR BUMPER INCLUDES: R + R CENTRE REAR PANEL TRIM AND TAILLAMP DIS + ASS REAR BUMPER (REMOVED) ADDITIONAL FOR DISS/ASS REAR BUMPER (VEHICLE WITH PARK ASSISTENT) CAVITY PROTECTION (ADD/WORK) CAVITIY PROTECTION RIGHT FRONT DOOR		

Claim Reference: TP 1118 - 5291 Full Report - V1
Assessment Number: PA001729 Registration: SLP8255C

Version: PROGRESS/4 Printed: 25/01/2019 09:36

Date Calculated: 24/01/2019 01:30

97-2500 ZAX	R/R WING CAVITY PROTECTION	2.0	9.00
40-2410 01	R + R RIGHT REAR TYRE	3.0	13.50
40-2702 ZAX	ADDITION TO R + R R/R TYRE	1.0	4.50
	(TYRE CROSS-SECTION SMALLER THAN 55)		
40-2055 01	BALANCE R/R WHEEL	2.0	9.00
40-1580 01	R + R REAR WHEEL	3.0	13.50
40-2713 01	ADD TO WHEEL RENEW	3.0	13.50
	(VEHICLE WITH TYRE PRESSURE CHECK)		
40-1470 01	ADD TO R/R WHEEL REMOVE AND REFIT	1.0	4.50
	(ASSEMBLY ON WHEELS FROM 17 INCH		
40-6500 01	ALIGN VEHICLE	7.0	31.50
	INCLUDES: ALIGN FRONT AND REAR TOE AND		
	CAMBER,		
	CHECK FRONT AND REAR VEHICLE LEVEL		
40-6710 01	ADD/WORK FOR VEHICLE WITH BOARDING-/	1.0	4.50
	EXITING SUPPORT		
40-4064 01	ADJUST FRONT WHEEL TOE	2.0	9.00
10 1100 01	(DURING ALIGNMENT)		
40-4403 01	ADJUST REAR WHEEL TOE	2.0	9.00
40 6722 04	(VEHICLE ALIGNMENT)		40.00
40-6723 01	ADJUST L/F AXLE HALF CASTER	3.0	13.50
1702	(VEHICLE ALIGNMENT COMPLETED)	20.0*	125.00
1782	REPAIR R/R DOOR	30.0*	135.00
3482	REPAIR R/R WING	30.0*	135.00
LAB	OUR COST	150.0	
	Total Work Units	150.0	¢571 50
	Panel / Mechanical Labour	12.7HRS	\$571.50 \$67.50
	Visual Alignment Labour Corrosion Protection	1.5 <b>HRS</b>	\$67.50
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.8HRS	36.00
	Sub Total	15.0HRS	\$675.00
	Paint Labour	11.7HRS	\$526.50
	Total Labour	26.7HRS	\$1,201.50
			, ,

<b>PAINT WORK</b>	Time Ba	sis 10 WU = 1 H	R. Price = \$45.00/HR
<b>Guide Number</b>	<sup>.</sup> Description	W	U Cost Price (\$)
1482	RIGHT FRONT DOOR NEW PART PAINTING	17.	.0
2583	REAR BUMPER COVER NEW PART PAINT K1R	12.	.0
1782	R/R DOOR REPAIR PAINTING <50%	15.	.0
3482	R/R WING REPAIR PAINTING <50%	14	.0
	WITHOUT FRT SURFACE BELOW DOOR		
742	R/F WING SURFACE PAINT	6	.0
1564	R/F DOOR OUT HANDLE SURFACE PAINT PLAS	T. <b>3</b> .	.0
1570	R/F COVER SURFACE PAINT PLAST.	3.	.0
1730	R/DOOR MIRROR HSG SURFACE PAINT PLAST.	3.	.0
1864	R/R DOOR OUT HANDLE SURFACE PAINT PLAS	T. 3.	.0
2102	R/SILL PANEL SURFACE PAINT 5.0		.0
2208	R/SILL PANELLING SURFACE PAINT PLAST. 6.0		
LAB	OUR COST - PAINT		
	TIME(PAINT)	87.	.0

Claim Reference: TP 1118 - 5291 **Full Report - V1 Registration: SLP8255C Assessment Number: PA001729** 

**Version: PROGRESS/4** Printed: 25/01/2019 09:36

Date Calculated: 24/01/2019 01:30

Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	117.0	
Total Paintwork Labour	11.7HRS	\$526.50
MATERIAL COST - PAINT		<b>Cost Price</b>
New Part Painting		\$47.47
New Part Painting - Plastic K1R		\$57.07
Material-Constant Main Work Metal		\$28.60
Surface-/Blend Paint		\$18.68
Surface Paint Plastic		\$26.35
Repair Painting		\$45.22
Material-Const Main Work Plastic		\$9.00
Total Excluding Pearlescent Uplift		\$232.39
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$232.39
PARTS		

Ρ	r	۱	R	1	S

				F	Price Valid:	01/06/2015
<b>Guide No</b>	.Qty	Description	Part Number	Supplier	Bet.	Price (\$)
3164	3	REAR SCREEN SUPPORTS	000 987 4566 08	NOT NECESSARY	0%	<b>0.00</b> F
1510	1	R/F DOOR SEAL	204 727 1187		0%	145.00*
9552	1	R/R WHEEL	205 401 0200647X21		0%	570.00*
1656	1	R/F W-FRAME RR MLDG	205 690 0887		0%	10.00*
1482	1	RIGHT FRONT DOOR	205 720 0205		0%	824.00*
2583	1	REAR BUMPER COVER	205 880 0447649999		0%	800.00*
f: OEM Par g: Original h: Second p: Parallel x: Exchang	l hand	REAR SCREEN BOND KIT	221 670 8101 Saving Sub Total Mark Up Fro Sundry Part Total Parts	rs (Fixed) <b>s</b>	•	0.00F \$59.66 \$2,349.00 \$352.35 \$0.00 \$2,701.35
		THIC ACCECOM	ENT CONTAINS LINE	DICED DADTS		

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

#### **Extras**

Description		Betterment	Price
AUDATEX FEE	SPECIALIST	0%	\$42.00
		Total Extras	\$42.00

#### **Final Calculation**

Total Parts		¢2 701 2E
2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2		\$2,701.35
Labour		
Total Panel/Mechanical	\$571.50	
Total Paintwork	\$526.50	
Total Visual Alignment work	\$67.50	
Corr Prot Internal 8 WU	\$36.00	
Total Labour		\$1,201.50
Additional Costs		
Corr Prot Materials External	\$0.00	
Cost of Specialist	\$42.00	
<b>Total of Additional Costs</b>		\$42.00

Claim Reference: TP 1118 - 5291 Full Report - V1
Assessment Number: PA001729 Registration: SLP8255C

Version: PROGRESS/4 Printed: 25/01/2019 09:36

Date Calculated: 24/01/2019 01:30

Total Paint/Material Costs	\$232.39
Grand Total Excludes GST	\$4,177.24
GST @ 7 %	\$292.41
Grand Total Includes GST	<b>\$4,469.65</b>

# **Assessment Notes**