

COMFORTDELGRO ENGINEERING PTE LTD

REPAIR ESTIMATE*

VEHICLE NO : SH 6220A

DATE 19/11/2018

MAKE :

MODEL : HYUNDAI i40

EQ - 4Sum (LKK - kalvin)

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Front Bumper Cover <i>x repair</i>			\$ 544.50
	Front Bumper Bracket Top (RH) <i>x use</i>			\$ 22.40
	Front Bumper Bracket (RH) <i>x use</i>			\$ 24.60
	Headlamp (RH) <i>cut</i>			\$ 1,388.00
	Front Fender (RH) <i>dent</i>			\$ 566.30
	Front Fender Shield (RH) <i>x use</i>			\$ 175.90
	Front Fender Retainer <i>x use</i>			\$ 24.60
	Frt Wheel Hub Cap, RH <i>cracked</i>			\$ 107.10
	Wing mirror RH <i>broken</i>			670.00
	Frt RH Door <i>x repair</i>			\$ 2,853.40
	SUB TOTAL			\$ 570.68
	LESS 20%			\$ 2,282.72
	DISCOUNTED TOTAL			
	Front RH Door Comfort leg <i>new</i>		\$75	
	Labour Charge			
	Panel Beating			\$ 300
	Spray Painting Charge			\$ 400.00
	Wiring			\$ 30.00
	Tuff Kote			\$ 50.00
	Frt Wheel Alignment			\$ 80.00
	TOTAL LABOUR			\$ 1,160.00
	ESTIMATE TOTAL			\$ 3,442.72

Kalvin (LKK)

19/11/18 1230 hrs.

3 Days

L/S

After Repair photo

LKK Auto Consultants hence notify the Repairer of the following:

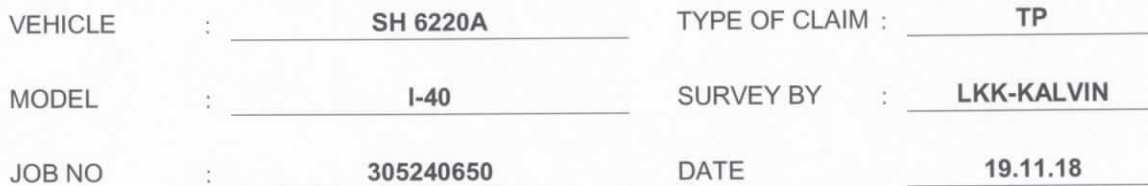
- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplemental claim(s) must be surveyed and is subject to final approval from insurance Company

Acknowledged by Repairer

Signature:

Date:

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

[illegible]