

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI18021104/NCD3E2**Date:** 13/12/2018REFERENCEHandling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSN3094151700

**Claimant Vehicle
No :** GBB1180Y**Insured Vehicle
No :** YP4945S

Date of Loss: 19/11/2018

Nature of Claim: TP

Claim
No: SNM18D05457C02DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **GBB1180Y**

Make & Model: TOYOTA DYNA 100 MANUAL, 3.0 D (M)

Engine No: 1KD1826207

Reg. Date: 07/08/2008 (Man. Year: 2008)

Chassis No: JTFNT24Y305000237

Colour: Silver

Odometer: 712144 km

Engine Capacity: 2982 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195 R15C

Rear Tyre Size:

155 R12

Front Left Side: Yokohama 6 mm

Rear Left Side:

Dunlop 5 mm

Front Right Side: Yokohama 6 mm

Rear Right Side:

Dunlop 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 22/11/2018

Date Inspected: 22/11/2018 Inspected At:

Kent Seng Car Services (yishun) (HQ)
Blk 1016 Yishun Industrial Park A #01-238
Singapore 768758

Estimated Period of Repair: 7.0 days

Adjuster: Muhammad Nazril Bin Abdullah**Manager:** CELINE FONG*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$6,000.00 -\$7,000.00

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 13 Dec 2018)	
Parts:	N/A	TOYOTA DYNA 100 MANUAL 3.0 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBB1180Y)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >