



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

General Details

Involving 1 2013 AUDI A6 2.0 T (SLH9999A)

Date of Loss 5 December 2018

Time of Loss 13.30

Loss Description SLH9999A (INSD) C/W FBN4981U
(MOTORCYCLE)

Comment

Workshop Details

Total Rebate Amount 71443

Nett Loss Amount \$14,557.00

Assigned Workshop LKK AUTO CONSULTANTS PTE LTD (OD)

Days of work
completion * 20



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Vehicle & Driver Details

Vehicle Registration# SLH9999A

Purchase Date

dd/mm/yyyy



Registration State

SINGAPORE

Registration Date *

28/02/2014



Mileage

61701

Age of Vehicle

4

Driver Details

CATEGORY

POLICY INFORMATION

ASSESSMENT
INFORMATIONManufacturing
Year

2013

2013

Make

AUDI

AUDI

Model

A6 2.0 T

A6 2.0 TFSI MU

CATEGORY

FNOL INFORMATION

POST SURVEY
INFORMATION

Driver Name

NICKY H GURNANI

Date of Birth

20 December 1984

dd/mm/yyyy



Age

34

CATEGORY	POLICY INFORMATION	ASSESSMENT INFORMATION
Type		▼
Type of Paint		
Chassis No	WAUZZZ4G7EN062723	WAUZZZ4G7ENC
Engine No	CDN381040	CDN381040
Engine Capacity		1984
Sum Insured	0	0
Market Value	0	86000

CATEGORY	FNOL INFORMATION	POST SURVEY INFORMATION
Occupation	Unknown	
Education Qualification	Other	▼
Driving Experience	13	
Driver License #		
License Type		▼
License Issue Date		dd/mm/yyyy 
License Expiration Date		dd/mm/yyyy 
Address	166 MEYER ROAD, 437952, Singapore	
Address type	Residential	▼

CATEGORY	FNOL INFORMATION	POST SURVEY INFORMATION
Gender	Male	
Marital status	Married	
Identification #	S8439205G	



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Detailed Assessment

Inspection Date *

07/12/2018



Total Loss

Yes

No

Towing Charges

0

Voluntary Excess

0

Compulsory Excess

0

Young/Inexperienced/
Unnamed Driver Excess

0

Other Excess

Condition of Vehicle at time of survey

General condition

Good ▾

Steering (Serviceable)

Yes

No

Footbrake (Serviceable)

Yes

No

Handbrake (Serviceable)

Yes

No

Engine Modification

Yes

No

Pre-accident condition

Good ▾

Tyre Condition

Age of Tyres

Spare wheel

Front Tyre Size

245/45R18

Rear Tyre Size

245/45R18

Front left side

PIRELLI6mm

Rear left side

PIRELLI6mm

Front right side

PIRELLI6mm

Rear right side

PIRELLI6mm



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Tax Eligibility & Additional Deduction for Parts

Depr./Bttr%

Salvage%

Discount%

Settlement%

Paint Labour/Material Ratio

Paint Labour Ratio

Paint Material Ratio

Cash Loss

Yes

No

Part Supplied by AXA

Yes

No

Save



SERVICE REQUESTS

MESSAGES

CLAIMS

<< Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Parts

	EDIT	SR NO	QUANTITY	MATERIAL	PART NAME	CONDITION	LIST PRICE (WORKSHOP)	LIST PRICE (SURVEYOR)	SUPPLEMENTARY PARTS	DEPR./ BTTR%	DISCOUNT%	SALVAGE%	ESTIMATED AMOUNT	ADJUSTED AMOUNT	ACTION (PARTS)	REMOVE
		0	1		FRONT WHEEL HOUSING LINER - LH	Serviceable	0	0	No					0	Deny	
		0	1		WHEEL HOUSING LINER ATTACHMENT PARTS	Serviceable	0	0	No					0	Deny	
		0	1		FRONT WHEEL SPOILER - LH	Serviceable	0	0	No					0	Deny	
		0	1		FRONT STONE CHIP GUARD FILM - LH	Serviceable	0	0	No					0	Deny	
		0	1		FRONT DOOR - LH	Dented	0	3211	No					3211	Reviewing	
		0	1		FRONT STONE CHIP GUARD FILM - LH	Necessary	0	104.5	No					104.5	Reviewing	
		0	1		FRONT DOOR ATTACHMENT PARTS - LH	Serviceable	0	0	No					0	Deny	

	EDIT	SR NO	QUAN TITY	MATERIAL	PART NAME	CONDITION	LIST PRICE (WORKSHOP)	LIST PRICE (SURVEYOR)	SUPPLEMENTARY PARTS	DEPR/ BTTR%	DISC OUNT%	SALV AGE%	ESTIMATED AMOUNT	ADJUSTED AMOUNT	ACTION (PARTS)	REMOV
		0	1		FRONT OUTER DOOR SEAL	Necessary	0	202	No					202	Reviewing	
		0	1		BONDING AGENT	Serviceable	0	0	No					0	Deny	
		0	1		CLEANING SOLUTION	Serviceable	0	0	No					0	Deny	
		0	1		FRONT DOOR CATCH - LH	Serviceable	0	0	No					0	Deny	
		0	1		FRONT DOOR CATCH COVER - LH	Serviceable	0	0	No					0	Deny	
		0	1		FRONT DOOR SEAL OUTER - LH	Serviceable	0	0	No					0	Deny	
		0	1		FRONT EXTERIOR MIRROR MOUNTING - LH	Damaged	0	1237	No					1237	Reviewing	
		0	1		FRONT EXTERIOR MIRROR HOUSING - LH	Cracked	0	158.5	No					158.5	Reviewing	
		0	1		FRONT MIRROR GLASS - LH	Damaged	0	1094	No					1094	Reviewing	
		0	1		FRONT TURN SIGNAL INDICATOR - LH	Cracked	0	111	No					111	Reviewing	
		0	1		FRONT STONE CHIP GUARD - LH	Necessary	0	65.9	No					65.9	Reviewing	

	EDIT	SR NO	QUANTITY	MATERIAL	PART NAME	CONDITION	LIST PRICE (WORKSHOP)	LIST PRICE (SURVEYOR)	SUPPLEMENTARY PARTS	DEPR/ BTTR%	DISCOUNT%	SALVAGE%	ESTIMATED AMOUNT	ADJUSTED AMOUNT	ACTION (PARTS)	REMOV
		0	1		ADHESIVE TAPE	Serviceable	0	0	No					0	Deny	
		0	1		FRONT WINDOW SLOT EAL WITH TRIM STRIP - LH	Serviceable	0	0	No					0	Deny	
		0	1		MOLDING ROOF	Serviceable	0	0	No					0	Deny	
		0	1		SET OF ATTACHMENT PARTS FOR CLIP	Necessary	0	90.5	No					90.5	Reviewing	
		0	1		SET OF ATTACHMENT PARTS FOR ADHESIVE TAPE	Necessary	0	14.2	No					14.2	Reviewing	
		0	1		FRONT STONE GUARD FILM - LH	Necessary	0	102	No					102	Reviewing	
		0	1		FRONT RIM LHS	Cut	0	265	No					265	Reviewing	
		0	1		SUNDRIES	Serviceable	0	0	No					0	Deny	
		0	1		LHS SIDE MEMBER TRIM	Damaged	0	752	No					752	Reviewing	

Labour

	EDIT	SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	ESTIMATE LABOUR AMOUNT	ADJUSTED LABOUR AMOUNT	ESTIMATE PAINT AMOUNT	ADJUSTED PAINT AMOUNT	ACTION (LABOUR)	COMMENT	REMOV
		0		TO RECOVER AND TOW BACK VEHICLE FROM SCENE OF ACCIDENT	0	280	0	0	Reviewing		

EDIT		SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	ESTIMATE LABOUR AMOUNT	ADJUSTED LABOUR AMOUNT	ESTIMATE PAINT AMOUNT	ADJUSTED PAINT AMOUNT	ACTION (LABOUR)	COMMENT	REMOV
		0		TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING SENSOR	0	480	0	0	Reviewing		
		0		TO REMOVE AND TRANSFER LHS FRONT DOOR'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES	0	280	0	0	Reviewing		
		0		TO DISMANTLE FRONT BUMPER, LHS FRONT DOOR AND LHS SILL PANEL TRIM. TO RENEW LHS FRONT DOOR AND LHS WING MIRROR ASSY. TO REPAIR LHS FRONT FENDER. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	0	1050	0	0	Reviewing		
		0		TO RESPRAY FRONT BUMPER, LHS FRONT FENDER, BONNET, LHS FRONT DOOR, LHS WING MIRROR COVER AND LHS SILL PANEL TRIM	0	3650	0	0	Reviewing		
		0		TO RENEW LHS FRONT RIM AND CARRY OUT WHEEL ALIGNMENT	0	280	0	0	Reviewing		
		0		TO CARRY OUT DIAGNOSTIC CHECKS	0	192	0	0	Reviewing		



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Add

Approve

Deny

Submit All

EDIT

SR
NO

NAME

ACTION

ESTIMATED
AMOUNTADJUSTED
AMOUNT

COMMENT

REMOVE



0

DAYS
OF
REPAIR
: 6
DAYS

Reviewing

0





SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Estimated Claim
Amount

\$0.00

Adjusted Claim Amount

\$13,619.60

CATEGORY

ESTIMATE

ADJUSTED

Spare Parts

\$0.00

\$7,407.60

Labour

\$0.00

\$6,212.00

[Submit for Review](#)