51 Ubi Avenue 1, #01-25 **Paya Ubi Industrial Park** Singapore

408933

Claim Reference: WTSSJT1805P **Assessment Number: WTS00041**

Version: WTSAUT01/1

Date Calculated: 12/12/2018 06:05

Full Report - V1 **Registration: SJT1805P**

Printed: 12/12/2018 14:05

Summary Information

Claim

Location: Singapore (SG) LKK AUTO Printed by: **Authorisation Status:** Interim

Work Provider:

MSIG Insurance (Singapore) Pte WTSSJT1805P

Claim Reference: Policy Number: Other Reference:

Third Party: Insured Amount: Under Warranty: Warranty Expired: Currency: SGD

Date of Incident: 29/11/2018

Able to Authorise Repairs: TBA Repairs Authorised: **TBA**

Estimated Repair Time: Quote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

Vehicle Details

Vehicle

Manufacturer: **TOYOTA** Model: Corolla Altis Sub Model: **ALTIS** Model Sheet Number: YCM 13

SJT1805P Registration: Registration Month: September Registration Year: 2009

VIN Number:

Manufacture Month:

September Manufacture Year: 2009 Not Known Odometer:

Colour:

Engine Number:

Fuel Level:

%

Model Specs

FROM 07/2009 AIR CONDITIONING 1.6 LTR 91 KW TWO PACK STRT COLOUR

PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Severity of Impact: Vehicle Status on Steering:

Inspection:

Brakes Pedal Travel: Date of Inspection: 10/12/2018

Place of Inspection: Pre-Accident Damage:

Tyres Condition:


Tread Depth LHF: Tread Depth RHF: Tread Depth RHR: Tread Depth LHR: Direction of Impact: Damage Areas:


51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: WTSSJT1805P Full Report - V1
Assessment Number: WTS00041 Registration: SJT1805P

Version: WTSAUTO1/1 Printed: 12/12/2018 14:05

Date Calculated: 12/12/2018 06:05

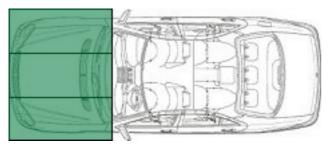

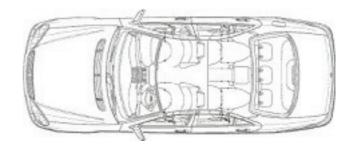

Addresses

Cost Summary

Total Labour		\$365.00
Total Paint/Material		\$85.83
Total Parts		\$2,156.00
Total of Additional Costs		\$115.00
Repair Cost Exc GST:		\$2,721.83
Overall Discount (0.0%):		- \$0.00
Excess:		-\$500.00
After Deduction -	Grand Total Exc GST:	\$2,221.83
	7 % GST:	\$155.53
	Grand Total Inc GST:	\$2,377.36

Repair Information

LABOUR Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR

Price/Dent = \$50.00/HR

7.3HRS _

Repair /		11100, 20110	700100/11II		
	r Repair Details	WU	Cost Price (\$)		
NO NUMBER	ADJUST HEADLAMPS	3.0	15.00		
B140	RENEW FRONT PANEL CPL	9.0	45.00		
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT	2.0	10.00		
B010	R + R FRONT BUMPER	5.0	25.00		
B020)	RENEW FRONT BUMPER (REMOVED)	9.0	45.00		
NO NUMBER	R + R LEFT FRONT OUTER BUMPER BRACKET	1.0	5.00		
NO NUMBER	R + R RIGHT FRONT OUTER BUMPER BRACKET	1.0	5.00		
B040)	R + R LEFT HEADLAMP	1.0	5.00		
B040)	R + R RIGHT HEADLAMP	1.0	5.00		
M010)	R + R AIR CONDITIONING CONDENSER	3.0	15.00		
002889	DRAIN/REFILL AIR CONDITIONING	7.0	35.00		
LABOUR COST					
	Total Work Units	42.0			
	Corrosion Protection External Labour	0.0HRS	0.00		
	Corrosion Protection Internal Labour	0.0HRS	0.00		
	Sub Total	4.2HRS	\$210.00		
	Paint Labour	3.1HRS	\$155.00		

PAINT WOR	K	Time Basis 10 WU = 1 H	HR. Price = \$50.00/HR
Guide Numb	er Description	V	VU Cost Price (\$)
	- TWO PACK STRT COLOUI	₹	
	- PREPARE OFF VEHICLE		
281	FRONT BUMPER SURFACE PAINT PLA	AST.	9.0
410	GRILLE SURFACE PAINT PLAST.	3	3.0

Total Labour

\$365.00

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: WTSSJT1805P Full Report - V1
Assessment Number: WTS00041 Registration: SJT1805P

Version: WTSAUTO1/1 Printed: 12/12/2018 14:05

Date Calculated: 12/12/2018 06:05

1009		INNER FRT PANEL COUR COST - PAINT TIME(PAINT) Preparation Main Preparation Work Total Work Units (Total Paintwork La ERIAL COST - PAIN Surface-/Blend Pa Surface Paint Plas Material-Const Ma Material-Const Co Total Excluding Pe Pearlescent Uplift Total Paint Material	Work Pla . Work M Multi Lay (10WU/H abour IT nint tic in Work mp. Work earlescen @ 0.0%	istic letal yer Pair IR) Plastic k Metal			6.0 18.0 10.0 3.0 0.0 31.0 3.1HR	S	\$155.00 Cost Price \$9.86 \$38.37 \$28.60 \$9.00 \$85.83 \$0.00 \$85.83
PARTS									· .
Guide No	o.Qty	Description CONDENSER CPL		Part N 88450	umber 02350	Supplier	Pr	ice Valid Bet. 0%	: 01/06/2015 Price (\$) 600.00 F
281	1	FRONT BUMPER		52119				0%	380.00 F
410	1	GRILLE		53100	02310			0%	200.00 F
431	1	GRILLE BADGE		75301	02050			0%	60.00 F
1009	1	INNER FRT PANEL C	PL	53201	02270	BUMPER REINFORG	CEMENT	0%	300.00 F
317	1	L/F BUMPER BRACK	ET	52116				0%	45.00 F
8780	1	LOWER ENGINE PRO		51451				0%	250.00 F
251	1	LWR RADIATOR GRI		53112				0%	80.00 F
318	1	R/F BUMPER BRACK	ET	52115				0%	45.00 F
f: OEM Pa					Sub Total		(400()		\$1,960.00
g: Origina					Mark Up Fro		(10 %)		\$196.00
h: Second					Sundry Par		(Fixed)		\$0.00
p: Paralle					Total Parts	5			\$2,156.00
x: Exchar	ige	NB - COLOUR	CODED IT	ΓEMS/TR	IM - PART I	NUMBERS M	AY DIFFE	R	
Extras				•					
		Description				erment			Price
		NUMBER PLATE + FRAME	SPECIA		0%				\$35.00
		AIR CON GAS	SPECIA						\$50.00
		BUMPER CLIPS	SPECIA	LIST	0%				\$30.00
Final C	-11	-4:			Tota	l Extras			\$115.00
Final C		ation						c	2,156.00
Labour	1 (3							Ψ	2,130.00
	Tota	l Panel/Mechanical					\$210.0	00	
		l Paintwork					\$155.0		
Total Labour \$365			\$365.00						
Addition									
		Prot Materials Extern					\$0.0		
·		\$0.0							
	Cost	of Specialist					\$115.0	JU	

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: WTSSJT1805P Full Report - V1
Assessment Number: WTS00041 Registration: SJT1805P

Version: WTSAUTO1/1 Printed: 12/12/2018 14:05

Date Calculated: 12/12/2018 06:05

Total of Additional Costs	\$115.00
Total Paint/Material Costs	\$85.83
Repair Costs Excludes GST	\$2,721.83
Deductions	
Deduction for Excess (Fixed)	-\$500.00
Total Deductions	-\$500.00
Grand Total Excludes GST (After Deduction)	\$2,221.83
GST @ 7 %	\$155.53
Grand Total Includes GST (After Deduction)	\$2,377.36

Assessment Notes