

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/AIG18022254/JCD3S2**Date:** 21/12/2018REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

Claimant Vehicle No : SLP7441M**Insured Vehicle No :** SLH3826E

Date of Loss: 08/12/2018

Nature of Claim: TP

Claim No: 3097479894SG

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SLP7441M**

Make & Model: NISSAN TEANA, 2.0 (A)

Engine No: MR20742822A

Reg. Date: 06/03/2009 (Man. Year: 2008)

Chassis No: JN1BDUJ32Z0000823

Colour: Black

Odometer: 150627 km

Engine Capacity: 1997 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size: 215/60R16

Rear Tyre Size: 215/60R16

Front Left Side: Yokohama 6 mm

Rear Left Side: Yokohama 6 mm

Front Right Side: Yokohama 6 mm

Rear Right Side: Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 11/12/2018

Date Inspected: 11/12/2018 Inspected At:

Eco Automobile Claims And Repair Pte Ltd (HQ)
13 KAKI BUKIT ROAD 4, #03-29
Singapore 417807

Estimated Period of Repair: 5.0 days

Adjuster: ONG HWEE JIE**Manager:** CELINE FONG*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT NUMBER PLATE	Cracked	0.00 F	*- F
2	1		*FRT NUMBER PLATE BASE	Dented	0.00 F	*- F
3	1		*FRT BUMPER	Dented	0.00 F	*- F
4	1		*FRT BUMPER CLIPS	Necessary	0.00 F	*- F
5	2		*FRT BUMPER SIDE RETAINER	Distorted	0.00 F	*- F
6	1		*FRT BUMPER REINFORCEMENT	Dented	0.00 F	*- F
7	1		*FRT BUMPER SPONGE	Cracked	0.00 F	*- F
8	2		*FRT BUMPER MOULDING	Necessary	0.00 F	*- F
9	1		*FRT LH BUMPER FOG LAMP COVER	*Check	0.00 F	*- F
10	1		*FRT RH BUMPER FOG LAMP COVER	*Check	0.00 F	*- F
11	1		*FRT LH BUMPER FOG LAMP	*Check	0.00 F	*- F
12	1		*FRT RH BUMPER FOG LAMP	*Check	0.00 F	*- F
13	1		*FRT GRILLE	Cracked	0.00 F	*- F
14	1		*FRT GRILLE EMBLEM	Cracked	0.00 F	*- F
15	1		*FRT GRILLE CHROME MOULDING	Cracked	0.00 F	*- F
16	1		*FRT LH HEADLAMP ASSY	Scratched	0.00 F	*- F
17	1		*FRT RH HEADLAMP ASSY	Scratched	0.00 F	*- F
18	1		*BONNET	Dented	0.00 F	*- F
19	1		*BONNET LOCK	Dented	0.00 F	*- F
20	1		*AIR CON CONDENSER	Dented	0.00 F	*- F
21	1		*AIR CON FAN ASSY	Cracked	0.00 F	*- F
22	1		*RADIATOR	Dented	0.00 F	*- F
23	1		*RADIATOR COWLING	Cracked	0.00 F	*- F
24	1		*RADIATOR FAN ASSY	Cracked	0.00 F	*- F
25	1		*AIR DUCT	Cracked	0.00 F	*- F
26	1		*FRT LH FENDER	Repair	0.00 F	*- F
27	1		*FRT LH FENDER INNER SHIELD	Cracked	0.00 F	*- F
					Total Parts (\$\$)	0.00 0.00

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >