

ASS. REC. BY:

REF:

CS3/MS(1180)2429/Ucb

Special Instruction:

Surveyor:

ASSIGNMENT (Office)

Mr. Lim

From (Person):

Morica Chung

of

M9261

Date/Time:

13/12/01 9:29am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLM 1024P

Insured:

SFX 9228D

at Workshop m/s

Leung Automotive

Tel:

of

Blk 1 Kaki Bukit Ave 6 #01-68

Policy No:

290987782MY

Claim No:

578679

Sum Insured:

Excess:

Make of Veh:

D.O.A.

06/12/018

(Client's Record)

CA / REV / REP. / REV 24 HRS 'WP'

19/12/018

H.O.D. Endorsement:

Date/Time:

13/12/018 10:35am

Person Contacted:

Mr. Leung

Vehicle IN/OUT

Date/Time	Action/Instruction (X) Estimate
13/12/018	Mr. Leung say will arrange survey after repair when vehicle done for spray painting
	SLM 1024P - X
	SFX 9228D - X

MS161
ASSIGNMENT

From: Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

IDAC Accident Rpt: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: Person Contacted:

Vehicle: IN / OUT

Veh No:

Yr Regn: 2017, Mar 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour:

Sp. Reading:

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Rear

R/Bal.

L/Bal.

D.O.I.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

3/1 Submit PRS report without range. Photo taken after repair.

Date/Time, File Pass to?

1)

Date/Time, File Return to?

2)

Report Format: PRS.

Lump Sum / I.B.I: (\$)

☐: Preli. Report☐: Final Report

Days Of Repair:

Resurvey No. of Trip: -

Add Fee: ☐: Site Insp (\$)☐: Interview (\$)☐: Tech. Invs (\$)☐: Weekend (\$)

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	07 Dec 2018		13 Dec 2018 09:29 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
CLAIM SUBFOLDER DETAILS		[Created by insurer]		
Insured:	BRYSON MAREE CECILIA, ID: G1752279K			
Main Claimant:	LIM PEI YUN, ID: S8022481H			
Vehicle Reg. No.:	SLM1024P	Date of Loss:	06/12/2018 17:00 - :59 [20 Months and 15 Days From LTA Reg Date (Man Yr)]	
Claim Type:	TP / 578679	Policy/Cover Note No.:	29098778QMY (Comprehensive) Coverage: 03/11/2018 - 02/11/2019	
Vehicle Reg. No. (Insured):	SFX9228D	Policy No. (Claimant):		
Repairer:	Leang Automotive - Kaki Bukit (HQ) AUTOBAY @ KAKI BUKIT 1 KAKI BUKIT AVE 6 #01-68, 417883 Kaki Bukit - Tel: MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Monica Chung Pei Zhen - 6594 2552] LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 14/12/2018] Driver/Custodian (Insured): ROBERT RHURAI DH JOSHUA BRYSON (44 / Male), NRIC: G3039854N Adj Asp. Remarks: Pls contact Workshop at 90286516. Vehicle is in the midst of repairing. Liab-100%. No SJE appointed. Surveyor to take photos after spray.			
ASSOCIATED MAIL RECEIVED		View All Compose Case Mail		
There are no mail for this case.				
ALL ASSOCIATED TASKS		View All Search Tasks Create New Task Complete		
Due Date	Priority	Type	Task Group	Subject
		Handler	Assigned By	Completed On
		Created On	Done?	
No results.				

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	07 Dec 2018		13 Dec 2018 09:29 Edit Adj Rpt	S\$0.00 Edit Estimates	S\$0.00 View Rpt		Pending for Survey Report Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	BRYSON MAREE CECILIA, ID: G1752279K		
Main Claimant:	LIM PEI YUN, ID: S8022481H		
Vehicle Reg. No.:	SLM1024P	Date of Loss:	06/12/2018 17:00 - :59 [20 Months and 15 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / 578679	Policy/Cover Note No.:	29098778QMY (Comprehensive) Coverage: 03/11/2018 - 02/11/2019
Vehicle Reg. No, (Insured):	SFX9228D	Policy No. (Claimant):	
		Excess:	
Repairer:	Leang Automotive (Kaki Bukit) AUTOBAY @ KAKI BUKIT 1 KAKI BUKIT AVE 6 #01-68, 417883 Kaki Bukit - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Monica Chung Pei Zhen - 6594 2552]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Imm.Advice due 14/12/2018]		
Driver/Custodian (Insured):	ROBERT RHURAI DH JOSHUA BRYSON (44 / Male), NRIC: G3039854N		
Adj Asg. Remarks:	Pls contact Workshop at 90286516. Vehicle is in the midst of repairing. Liab-100%. No SJE appointed. Surveyor to take photos after spray.		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLM1024P (578679)
[SFX9228D]
TP
LIM PEI YUN
Dec 6 2018 5:00PM
[BRYSON MAREE CECILIA]
Leang Automotive

Upload Documents			Upload Photos		Compose New Letter		View		View In Browser	
Photos/Images							3 per page			
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)						Thumbnail	Print	
1	19/12/18 14:04	Photo After Spray						Load JPG		
2	19/12/18 14:04	Photo After Spray						Load JPG		
3	19/12/18 14:04	Photo After Spray						Load JPG		
4	19/12/18 14:04	Photo After Spray						Load JPG		
5	19/12/18 14:04	Photo After Spray						Load JPG		
6	19/12/18 14:04	Photo After Spray						Load JPG		
7	19/12/18 14:04	Photo After Spray						Load JPG		
8	19/12/18 14:04	Photo After Spray						Load JPG		
9	19/12/18 14:04	Photo After Spray						Load JPG		
10	19/12/18 14:04	Photo After Spray						Load JPG		
11	19/12/18 14:04	Photo After Spray						Load JPG		
12	19/12/18 14:04	Photo After Spray						Load JPG		
13	19/12/18 14:04	Photo After Spray						Load JPG		
14	19/12/18 14:04	Photo After Spray						Load JPG		
15	19/12/18 14:04	Photo After Spray						Load JPG		
16	19/12/18 14:04	Photo After Spray						Load JPG		
17	19/12/18 14:04	Photo After Spray						Load JPG		
18	19/12/18 14:04	Photo After Spray						Load JPG		
19	19/12/18 14:04	Photo After Spray						Load JPG		
20	19/12/18 14:04	Photo After Spray						Load JPG		
21	19/12/18 14:04	Photo After Spray						Load JPG		
22	19/12/18 14:04	Photo After Spray						Load JPG		
23	19/12/18 14:04	Photo After Spray						Load JPG		
24	19/12/18 14:04	Photo After Spray						Load JPG		
25	19/12/18 14:04	Photo After Spray						Load JPG		
26	19/12/18 14:04	Photo After Spray						Load JPG		
27	19/12/18 14:04	Photo After Spray						Load JPG		
28	19/12/18 14:04	Photo After Spray						Load JPG		
29	19/12/18 14:04	Photo After Spray						Load JPG		
30	19/12/18 14:04	Photo After Spray						Load JPG		
31	19/12/18 14:04	Photo After Spray						Load JPG		
32	19/12/18 14:04	Photo After Spray						Load JPG		
33	19/12/18 14:04	Photo After Spray						Load JPG		
34	19/12/18 14:04	Photo After Spray						Load JPG		
35	19/12/18 14:04	Photo After Spray						Load JPG		

Photos/Images			3 per page ▼	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
36	19/12/18 14:04	Photo After Spray	 Load JPG	☒
37	19/12/18 14:04	Photo After Spray	 Load JPG	☒
38	19/12/18 14:04	Photo After Spray	 Load JPG	☒
39	19/12/18 14:04	Photo After Spray	 Load JPG	☒
40	19/12/18 14:04	Photo After Spray	 Load JPG	☒
41	19/12/18 14:04	Photo After Spray	 Load JPG	☒
42	19/12/18 14:04	Photo After Spray	 Load JPG	☒
43	19/12/18 14:04	Photo After Spray	 Load JPG	☒
44	19/12/18 14:04	Photo After Spray	 Load JPG	☒
45	19/12/18 14:04	Photo After Spray	 Load JPG	☒
46	19/12/18 14:04	Photo After Spray	 Load JPG	☒
47	19/12/18 14:04	Photo After Spray	 Load JPG	☒
48	19/12/18 14:04	Photo After Spray	 Load JPG	☒
49	19/12/18 14:04	Photo After Spray	 Load JPG	☒
50	19/12/18 14:04	Photo After Spray	 Load JPG	☒
51	19/12/18 14:04	Photo After Spray	 Load JPG	☒
52	19/12/18 14:04	Photo After Spray	 Load JPG	☒
53	19/12/18 14:04	Photo After Spray	 Load JPG	☒
54	19/12/18 14:04	Photo After Spray	 Load JPG	☒
55	19/12/18 14:04	Photo After Spray	 Load JPG	☒
56	19/12/18 14:04	Photo After Spray	 Load JPG	☒
57	19/12/18 14:04	Photo After Spray	 Load JPG	☒
58	19/12/18 14:04	Photo After Spray	 Load JPG	☒
59	19/12/18 14:04	Photo After Spray	 Load JPG	☒
60	19/12/18 14:04	Photo After Spray	 Load JPG	☒
61	19/12/18 14:04	Photo After Spray	 Load JPG	☒
62	19/12/18 14:04	Photo After Spray	 Load JPG	☒
63	19/12/18 14:04	Photo After Spray	 Load JPG	☒
64	19/12/18 14:04	Photo After Spray	 Load JPG	☒
65	19/12/18 14:04	Photo After Spray	 Load JPG	☒
66	19/12/18 14:04	Photo After Spray	 Load JPG	☒
67	19/12/18 14:04	Photo After Spray	 Load JPG	☒
68	19/12/18 14:04	Photo After Spray	 Load JPG	☒
69	19/12/18 14:04	Photo After Spray	 Load JPG	☒
70	19/12/18 14:04	Photo After Spray	 Load JPG	☒
71	19/12/18 14:04	Photo After Spray	 Load JPG	☒
72	19/12/18 14:04	Photo After Spray	 Load JPG	☒
73	19/12/18 14:04	Photo After Spray	 Load JPG	☒
74	19/12/18 14:04	Photo After Spray	 Load JPG	☒
75	19/12/18 14:04	Photo After Spray	 Load JPG	☒
76	19/12/18 14:04	Photo After Spray	 Load JPG	☒
77	19/12/18 14:04	Photo After Spray	 Load JPG	☒
78	19/12/18 14:04	Photo After Spray	 Load JPG	☒
79	19/12/18 14:04	Photo After Spray	 Load JPG	☒
80	19/12/18 14:04	Photo After Spray	 Load JPG	☒
81	19/12/18 14:04	Photo After Spray	 Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST

Reset

Save

Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)**Show Remarks To:** ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG18022429/UCBS2
Date: 04/01/2019

REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	29098778QMY
Claimant Vehicle No :	SLM1024P	Insured Vehicle No :	SFX9228D
Date of Loss:	06/12/2018	Nature of Claim:	TP
		Claim No:	578679

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLM1024P	Engine No:	HRA2349823A
Make & Model:	NISSAN QASHQAI, 1.2 (A)	Chassis No:	SJNFEAJ11U1814883
Reg. Date:	21/03/2017 (Man. Year: 2016)	Odometer:	49634 km
Colour:	Red		
Engine Capacity:	1197 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	215/60R17	Rear Tyre Size:	215/60R17
Front Left Side:	Goodyear 6 mm	Rear Left Side:	Goodyear 6 mm
Front Right Side:	Goodyear 6 mm	Rear Right Side:	Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	13/12/2018	Leang Automotive (Kaki Bukit) AUTOBAY @ KAKI BUKIT 1 KAKI BUKIT AVE 6 #01-68 Singapore 417883
Date Inspected:	18/12/2018 Inspected At:	
Estimated Period of Repair:	0.0 days	

Adjuster: MARCUS CHUA

Manager: CELINE FONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 04 Jan 2019)

Parts: M1-SUV NISSAN QASHQAI 1.2 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SLM1024P)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >