Intimated Co	est .	MI Date/Time: 3/1/2019@
To Inspect V at Workshop of	9.10 - 000	D Insured: YN 7527G Tel: 65425119
	MU 011172	Claim No: M19 00049
Sum Insured.		Eccess:
Make of Veh (Client's Recor		D.O.A. 29/12/2018
CA / REV	REP. / REV 24 HRS 447	H-1-1-1
Date/Time: 1	Person Contacted	Vehic IN OUT
Date/Time	Action/testruction () Estimate SHB 20360 - CN/TM113611	
	X-9ECENY	50 - 20 - 30 - 30 - 30 - 30 - 30 - 30 - 3

CHUNNI MOTOR WORK PIE LTD

REPAIR ESTIMATE*

VEHICLE NO: SHB 2036D

MAKE

DATE : 31.12.2018

1/ 13

TEL : 6542 5119

OBO MATRE MODEL : HYUNDAI i40 : 6542 6039 FAX Parts Description/ Labour Unit Price Amount Qty Type Bonnet Bro 2,265.90 Bonnet Hinge (LH/RH) W+ S 41.00 5 82.00 Bonnet Lock 15+ 36.90 58.10 Bonnet Absorber HH 2 S 116.20 × Bonnet Insulator Wumpled 196.50 S Bonnet Insulator Clips Hec. 8.40 Radiator Grille baku S 251.00 Radiator Grille H Emblem disladed S 27.50 Front Bumper Cover +3/4 5 544.50 S 99.20 Front Bumper Sponge + how Front Bumper Reinforcement 5w. 402.10 Front Bumper Centre Grille oblived 178.60 Front Bumper Centre Grille Top Garnish N S destated distarts S 00.08 X Front Bumper Bracket Top (LH/RH) 22.40 44.80 S 24.60 Front Bumper Bracket (LH/RH) HH S 49.20 X S Headlamp Support Top Cover baken 222.60 Headlamp Support Panel Assy by 907.40 Headlamp (LH/RH) Ms distributed of s braken moreting S 1,388.00 2,776.00 Radiator Pundual 184 698.30 Radiator Fan Blade, Cowling, Motor Assy boken 792.95 S Radiator Bracket (RH/LH) WA 6.50 S 13.00 × Radiator Hose Upper torw 36.50 Radiator Hose Lower -torn 36.50 Radiator Expansion Tank HLI 28.30 X Radiator Guard distaly s 20.00 40.00 Horn Unit (LH/RH) baken 73.80 5 147.60 Hom Wire boken amounton 156.50 Front Fender (LH/RH) ols Danies S (566.30 1,132.60 4 S 637.00 1,274.00 × Front Fender Apron Panel (LH/RH) NA S 174.90 Front Fender Shield (LH/RH) 349.80 Air Cleaner Assy balen 118.60 Air Duct bake S 134.60 Air Flow Sensor D---502.20 Air Cleaner Bottom Assy of Jowe L | broken 325.00 Aircon Condenser Pratum | 15+ S 927.50 Aircon Suction & Liquid Hose 624.00 Aircon Discharge Hose ha Kt 162.60 Aircon Compressor by distribed 2,578.00 4 -Battery Tray HILL 52.00 × Frt Safety Belt (Assy) (LH/RH) Retrible 475,40 950.80 Wiper Panel Top Gamish Wu \$ 222,60 S × Wiper Container HILL 61.90 19305:55 5 Wiper Container Motor LL 75.00 Front Chasis Member , HH S 1,060.70 Engine Mounting Ha S 456.30 Engine Under Cover dishedyd broken 334.60 Engine Crossmember Haldistation 2,094,40

-	-	-		-	-
SH		71	12	6	г.
	ш	-	,,,		.,

-				$\overline{}$	1B 2036D	1
Qty	Parts Description/ Labour	Type	Unit Price		Amount	
	Front Seat Adjuster (Outer) (LH/RH)		\$ 1,212.50	S	2,425.00	200
	Engine Mtg (Rear) HA			S	279.60	×
	Gearbox oil sump overk		SH 3000 -	S	14.808.00	Thota
	Gearbox Mounting KIN		,	S	215.40	×
	Steering Wheel Horn Button Assy ►1ы			S	864.00	X
	Inter Cooler practical 1 let			S	1,032.50	-
	Inter Cooler Mounting (2 PCS) HH			S	25.90	×
	Hose B To Inter Cooler torn			5	229.70	-
	Hose C To Inter Cooler Inlet down			S	294.50	-
	Pipe To Inter Cooler of June 1			S	167.05	-
	Pipe To Inter Cooler Outlet W.4			S	244.55	×
	Wiring-Engine & broken 30cket.			S	3,326.00	- pt-40
	Wiring-FEM NA		12364.75	S	168.00	×
	Actuator - Swirl Control 454 broken			S	814.60	*-
	Auto Gear Oil oil sump jundens unc			S	110.40	-
	Engine Top Cover Had			S	386.00	×
	Throttle Body Assy NIA			S	1,096.60	×
	Intake Manifold Assy Den			S	1,141.10	Photo
	Airbag Complete drive actives			S	2,948.50	-
	Airbag Control Module estimated			S	1,140.40	ماسطة ب
	Steering Angle Assy NH			S	1,150.60	1/2
	Sensor Assy Impact -Frt Inpact him			S	198.30	100
	Airbag Sensor Code Code A		\$ 580.00	5	1,160.00	Laket
	Electric Power Steering		10.20	S	4,880.50	X
			31670.30		110 MINITURATED	
	SUB TOTAL		25336.24	5	62,782.85	1
	LESS 20%		93300	S	12,556.57	
	DISCOUNTED TOTAL			5	50,226.28	
						1
	Front Number Plate distant			s	25,00	Nett -
	Front No Plate Trim Cover 154			S		Nett -
	200000000000000000000000000000000000000		55.00			
			+ 3000.00	s	55.00	1
						1
	Labour Charge		3055.00			
	Panel Beating		/	S	1,800.00	10001-
	Spray Painting Charge			5	1,250:00	
	Wiring Charge			S	100.00	1 20 M
	Tuff Kote			S	150.00	401-
	Towing Charge			S	50.00	10.00
	Front Chassis Alignment Charge			5	400:00	1000
	Remove/Refix Aircon & Refill Gas			5	150.00	
	Remove/Refix Engine/Gearbox		3800.00	5	650.00	3001-
	Remove/Refix Dashboard		1	5	450.00	
	Remove/Refix Fuse Box		^	S	180.00	153
	R/Refix Air Bag/Steering Wheel/Dashboard/Seat			5	550.00	50/-
	Diagnostic & Resetting To Erase Fault Code			S	480.00	150/-
	Singhosis is reseming to make rault code			3	304100	156 -
	TOTAL LABOUR			s	6,210.00	1

SHB 2036D

4				SH	B 2036D	
Qty	Parts Description/ Labour	Type	Unit Price	_	Amount	
	Boot Lid Brc			5	2,174.90	-
1	Boot Lid Rubber departed			\$	96.50	_
	Boot Lid Hinge (LH/RH) o c + r s NA		\$ (142.30)	S	284.60	سا
	Boot Lid Lock Upper ⊌↓			S	102.60	_
	Boot Lid Lock Lower 154			S	31.70	-
	Boot Lid 'H' Emblem 14 C			S	28.70	-
	Boot Lid CRDI Plate -4c			S	27.90	-
	Boot Lid Lamp (LH/RH) Creck broken		\$ 565.60	S	1,131.20	<u></u>
	Licence Lamp (LH/RH) ≒⊔		\$ 33.95	\$	67.90	×
	Boot Lid Trimboard torn 124			S	116.40	<u></u>
	Boot Lid Trimboard Clips (10pcs) He			\$	11.00	L-
	Bootlid Moulding			S	85.00	-
	Bootlid i40 Emblem NL			S	27.90	-
	Bootlid Lower Garnish Source			\$	227.90	-
	Rear Bumper Toyon			S	553.00	-
	Rear Bumper Reinforcement Work broken			S	428.40	-
	Rear Bumper Reinforcement Bracket (LH/RH)		\$ 80.30	S	160.60	-
	Rear Bumper Clip 10 pcs - Lc_		~	\$	22.00	_
	Rear Bumper Bracket of S dished ye wis svc		\$ (35.60)s	71.20	سا
	Rear Bumper Sponge Torw			S	118.40	-
	Rear Bumper Under Cover Autoria			5	228.00	_
	Rear Bumper Reflector Lamp (RH)			S	30.60	
	Tail Lamp (LH/RH) creck broke		\$ 697.80	S	1,395.60	
	Tail Lamp Quarter Panel (LH/RH) 0 S Ducket HIS	щ	\$ (226.50)	S	453.00	ب
	Rear Panel ()			\$	526.70	-
	Rear Panel Garnish dufamed			\$	57.70	-
	Rear Panel Lower Panel Dank			\$	495.50	-
1	Spare Tyre Holder https: Vy+			5	223.10	* -
	Tail Lamp Panel Top (RH) Duted			5	545.90	
1	Spare Tyre Panel			5	852.80	×
	Spare Tyre Panel Cushion ►₩			S	209.05	×
	Rear Towing Hook			S	94.60	×
	Member Assy- Rear Floor Centre ≒4			S	570.40	17.62
	Panel Assy-Rear Floor Side (LH/RH) HH		\$ 90.10	S	180.20	X
	Exhaust Pipe Insulator >>>		S 58.55	S	117.10	×
	Exhaust Silencer of S 54' N/S LL		\$ (967,70)	s	1,935.40	4
- v	Exhaust Pipe Hanger Ha		\$ 58.55	S	117.10	×
	Exhaust Pipe Centre & Anton 141 144			s	730.10	2-
	Rear Fender With Housing (LH/RH) 0 5 5 K HS D	entral	\$ 4,736.80	S	9,473.60	4-6757
	Rear Fender Inner Lining (LH/RH) NH	when	\$ 169.30	S	338.60	×
	Rear Fender Air-Duct Actioned	plus		S	51.60	-
	Rear Fender Trim Board (RH) 164	0		5	188.75	
	Rear Windscreen Glass 900 the		26	S	607.20	بسا
	Rear Windscreen Moulding		18587.10	S	28.30	-
	Fire Extingusher Holder		18582.25	S	35.00	×
	SUB TOTAL		,	-	25,253.70	1
	LESS 20%			S	5,050,74	
	DISCOUNTED TOTAL			\$	20,202.96	
7	- N					

SHB 2036D

Qty	Parts Description/ Labour	Type	Unit Price	1	mount	1
	Boot Lid Comfort Logo & Tel No. Sticker Huc			S	30.00	N
	Rear No.Plate broku			S	25.00	N
	Rear Windscreen Sealant			S	46.00	100
	Real Wildscreen Scalant File		101.00	3	40.00	1.44
			~	s	101.00	+
				3	101.00	1
				1		
						L
	Labour Charge				2 500.00	in
	Panel Beating			S	2,600:00	
	Spray Painting Charge			S	1,800.00	
	Wiring Charge			S	100:00	1
	Tuff Kote			S	150.00	4
	Rear Chassis Alignment Charge			S	400.00	
	Remove/Refix Cushion & Upholstery Rear		9090.00	S	150.00	8
	Remove/Refix Rear Windscreen Glass		1	S	120.00	
	Remove/Refix Fuel Tank			S	150.00	
	Remove/Refix Exhaust Pipe			5	300.00	10
	Kemovo Kema Camada Fipe			"	200,00	6
	TOTAL LABOUR			S	5 770 00	1
	TOTAL LABOUR			3	5,770.00	1
				-	00.078.01	-
	ESTIMATE TOTAL			2	82,565.24	4
			11474414			
	03/2019 @ 1430 mm NA Andrul L/Sna		48248.04			
	05/8/19 @ 1430 m	Syno	5976.80			
	MA Achal	22.14				ı
	7 10000		54224.84			
	L Same	25				
	2	DIS	30,000	1		
	· No	H.	5976.80 54224.84 30,000			
	- ma					
	IKK A I					
	1KK ANDO	100	W 1. 12 M	-		L
	28	1 10	K Auto Consultents h	Bons	notify	
	to days.		Repairer of the folio	ving:	Elizani.	
		1 7	purpose descriped our est	during	OTHER DESIGNATION OF THE PERSON OF THE PERSO	L
		1 77	THE STREET WITE SUDDICE TO CO	of Green	Dan	
		+10	hid party survey is on a TV	hout	rejudice" pasis	
		1 177	CARREL HILLINGSTROOM DES	9 Octobril 9		ı
		1 10	optomentary ecos(a) must object to first approval fig	on lines	Propertiend	
						1
	Provide BV		colledged by Receiver			
	1 rovide SV	Dete	1113-125-			
	3			-		L
	Prinde pres price list Dome financian.					
	R	/	120			
	Dive Induction		89307.04			
	1 1 1 1 1 1 1) -	0 12-0			
	CONTRACTOR OF THE PROPERTY OF		hicle. The final repai	_	- TAX	-

REPAIR ESTIMATE*

VEHICLE NO: SHB 2036D (Supplementary)

DATE : 24.01.2019

-

MAKE

TEL : 6542 5119 EAV + 6542 6030

EL	: HYUNDAI i40		: 6542 6039	
Qty	Parts Description/ Labour	Type	Unit Price	Amount
	EGR Valve & Pipe Assy broke			\$ 2,480.50
	Aircon Outside Temperature			S 168.00
	Bonnet Switch broken			S 148.00
	Gearbox Cooler Hose Inlet form			S 120.00
	Gearbox Cooler Hose Outlet +ww			S 120.00
	Tube -Fuel Feed looks			S 638.00
	Tube -Fuel Return broken			S 738.00
	Tube -Connector To Rear LH (Brake) 164			The second second second
	Tube -Connector To Rear RH (Brake) 154		7108.50	\$ 598.00
	Under Cover Assy Side, LH broken		7108.50 5686.80	S 1,430.00
	SUB TOTAL		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	\$ 7,108.50
	LESS 20%			\$ 1,421.70
	DISCOUNTED TOTAL			\$ 5,686.80
	Labour Charge			
	Remove/Refix Fuel Tank			S 150:00
	Remove/Refix Undercarriage (RR)			S 400.00
	Remove/Refix Brake Line			\$ 250.00-
	Remove/Refix Fuel Line		990.00	S 250.00
	TOTAL LABOUR			\$ 1,050.00
	ESTIMATE TOTAL			\$ 6,736.80
			-2/10	
	0		5976.80	
	1			
	- Jya			
	- Dryan 2 Ek Ando			
	2 EK Audo			
	24/01/249			1 1
	I Poly			
	1			
	This is an initial estimate based on a visual inspection of the		<u> </u>	

be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUE	FOLDER TRA	CKING								
	Monthise	Tel Summittee	(Ad) Assigned	Act Roll	Tain	Submittee	Day Author	line.		
Main	03 Jan 2019		03 Jan 2019 11:48 Assign				3102 - 5013 - 617		Assignm	ent
	Main	Ref	erence		Claim Detai	ls	Docur	ments	7	Show All
CLAIM SU	BFOLDER DE	TAILS				Tan			_	SHOW AN
Insured:	A YONG P		No.: 20132840	DIA!		[Cre	ated by insurer	1		
Main Claimant:	CITYCAB F	Le vivero de la colo	, No.: 1995028	70000						
Vehicle Reg No.:	SHB2036	SD .			Date of Lo	ss: 29/12	2/2018 05:00 - :5	9		
Claim Type		11900049			Policy/Cov		1172 (Compreher	nsive)		
Vehicle Reg No. (Insured):	YN7527G				Policy No. (Claimant)		Coverage: 19/10/2017 - 28/01/2019			
Repairer:	Chunni Mo	tor Work Dec 114			Excess:	S\$750	0.00			
Handling	Tokio Mari	tor Work Pte Ltd ne Insurance Sin	gapore Ltd (H	k 10 #01-0	221 6111 (stopoint, 5	68047 Ang Ma Ki	o - Tel: 648:	36016	
Adjuster:	LKK Auto C	onsultants Pto I	d (NO) - Tole (TES 2554	fet	nanujeu p	y reima Gomez	65926402	1	
Driver/Cust dian (Insured):	ZHANG QIA	onsultants Pte Li	2500420K	250-3561	[Final R	pt due 1	4/01/2019]			
Adj Asg. Remarks:	OUR INSD H	AVE NOT RPT THE	ACCDT, PLS. CH	ECK PARTS	PRICE.					
SSOCIAT	ED MAIL REC	EIVED								
here are no	mail for this ca	ise.						View All	Compos	e Case Mai
ALL ASSO	CIATED TASK	şi:i				View	All Search Task	al e a		la ververance
Due Date lo results.	Priority	Type Task Gr	oup Subje	er Hand	iter Assig	gned fly	Completed		New Task	Complete

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars				
Owner ID Type:	Company			
Owner ID: Vehicle Details	2839G			
Vehicle No.:	SHB2036D			
Vehicle to be Exported:	Yes			
Intended Deregistration Date:	03 Jan 2019			
Vehicle Make:	HYUNDAI			
Vehicle Model:	140 1.7L CRDI AT ABS AIRBAG 4DR			
Primary Colour:	Yellow			
Manufacturing Year:	2013			
Engine No.:	D4FDEU430013			
Chassis No.:	KMHLB41UMDU039788			
Maximum Power Output:	100.0 kW (134 bhp)			
Open Market Value:	\$18.880.00			
Original Registration Date:	30 Sep 2013			
First Registration Date:	30 Sep 2013			
Transfer Count:	0			
Actual ARF Paid:	\$11,380.00			
Intended PARF Rebate Details				
PARF Eligibility:	Yes			
PARF Eligibility Expiry Date:	29 Sep 2021			
PARF Rebate Amount:	\$7,966.00			
Intended COE Rebate Details	W//- WW-			
COE Expiry Date:	29 Sep 2021			
COE Category:	A - Car (1600cc & below)			
COE Period(Years):	8			
PQP Paid:	\$58,144.00			
COE Repate Amount:	\$19,906.00			
Total Rebate Amount: Message	\$27,872.00			
	be further renewed. The vehicle must be de-registered upon COE expiry or when the			

The information contained herein is correct as at 03 Jan 2019

vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

MCD61900938 / ComfortDelGre Engineering Pte Ltd - Loyeng ENTRY CATE 4 TIME: 03/01/2019 09:42 SUBMITTED 8Y: Huang XiboYen Your NCD will be affected due to late reporting Actual e-Filling Submission Date & Time: 03/01/2019 10:33

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

Fax Number Contact Number

EMail Address

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for Investigation.
- This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
- 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

	ACCIDENT STATEMENT
Date Of Report	03/01/2019 09:42
Date Of Accident	29/12/2018 05:20
Exact Location Of Accident	ALONG YISHUN AVE 3
Country/State of Loss	SINGAPORE
	DETAILS OF OWN VEHICLE
Vehicle Registration Number	SHB2036D
Insured/Policyholder	
Name Of Registered Owner	CITYCAB PTE LTD
Co Reg No	199502839G
Email Address	FLEETSAFETY@CDGTAXI.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-65508768
Vehicle Particulars	6.8
Manufacturer	HYUNDAI
Model	140
Exact Purpose for which vehicle was being used time of accident	at:
Are you claiming under your own insurance police for repair to your vehicle?	TY NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI
Insurance Company	
Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18088937MFSH
Cover Note Number	
Driver	
Name of Driver	ONG KIAN KOON
NRIC No	\$1539951A
Date Of Birth	23/04/1962
Occupation	OUTDOOR
Date Of Driving Pass	21/06/1982
Driving Experience	36 YEARS AND 6 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-91174424

NOEMAIL

BLK 284 YISHUN AVENUE 6 #05-118 Address

Postcode 760284

Was driver an employee of the Insured's Company NO

If No. Relationship of the Driver with the Insured OTHER - TAXI DRIVER

Vehicle Registration Number of Oriver's Own

Vehicle

Insurance Company of Driver's Own Vehicle

General Information of the Accident

Type Of Accident CHAIN COLLISION

Weather Conditions CLEAR Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident?

Number of vehicles (including own vehicle)

involved in the accident

2 YES

Was any body injured in the Accident?

Was any injured conveyed to hospital by ambulance?

NO YES

Was any other material or property damaged?

I have been approached by unknown person(s) soliciting/offering accident claims assistance.

NO

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police?

YES

If Yes, Please state which Police Station

POLICE STATION NAME (OTHER) YISHUN NORTH N.P.C

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

PLS REFER TO POLICE REPORT: T/20181229/2055

Attachment(s)

YES Are accident photos available for attachment? Was there any video captured by Car Camera?

Remarks/ Reasons:

YES

Was there any audio recorded?

NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number YN7527G

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category COMMERCIAL VEHICLE

ZHANG QIANG Name of Driver NRIC/Passport Number G2500420K

Contact Number

Address Postcode

Insurance Company Name

TOKIO MARINE INSURANCE SINGAPORE LTD

FRT Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vohicle Registration Number

Vehicle Make/Model/Colour

Details Of Properties

ROAD KERB NAJUNKNOWN

Vehicle Category

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name ONG KIAN KOON 56

Approximate Age

PAIN ON NECK AND WAIST, ON 5 DAYS MC. Injuries Sustain

Injured person in which vehicle? SHB2036D

YES Were seat belts worn?

Was this injured conveyed to hospital by

ambulance?

NO

Address

Postcode

IMPORTANT NOTICE

- Please report correctly the details of the accident to speed up the claims process.
- This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the Insurance companies.
- Any false reporting may be referred to the Police for Investigation.
- The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, Investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

CITYCAB PTE LTD JO. REG. NO. 199502839G

Driver's Signature

(If driver is not the policyholder)


Date & Time: 31.12.18@1400 HRS

Reporting Centre Personnel's Signature

NRIC/FIN No .: June Tan

Policyholder's Signature Date & Time:

SKETCH PLAN

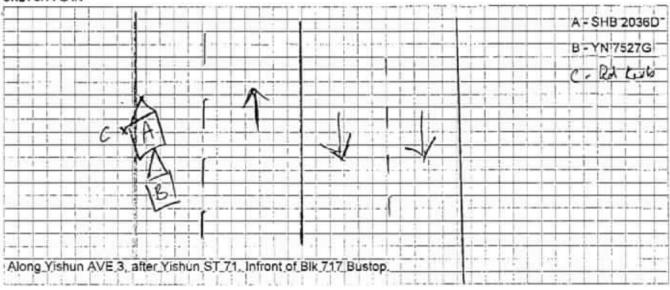

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer	to attachment. T/20181229/2055

DECLARATION

I/We declare the foregoing particulars are true in every respect.

JULYCAB PTE LTD JO. REG. NO. 199502839G

Policyholder's Signature Date & Time: Driver's Signature

(If driver is not the policyholder)

Date & Time: 31.12.18@1400HRS

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:June Tan



Occupation:

Taxi driver



Date of Expiry:

1 of 4

Police Station Of Origin: Yishun North N.P.C 31 Yishun Central SINGAPORE 768827 Tel No: 1800-8529999

Report No. T/20181229/2055

REPORTO	FA TRAFFIC	ACCIDENT		Station Diary No.:		
Date/Time Report Made: 29/12/2018 12:51			Vide Report No.:	77		
Informa	nt's Particu	lars 24	の数ではは、整計と、正	· · · · · · · · · · · · · · · · · · ·		
Name of	Informant: AN KOON		Address: APT BLK 284 YISHUN A 760284	VENUE 6 #05-118 SINGAPORE		
	/ ID No.: D / S15399	51A	Contact No.: Home/Office:	Mobile: 91174424		
National	ity: ORE CITIZ	EN	Email:			
Sex: Male	Age: 56	Date of Birth: 23/04/1962	Type of Informant: Driver	100000000000000000000000000000000000000		
Race: Chinese		Language:	Institution / School Name:			
Occupation:			Driving Licence Information:			

Class:

Seneral Inform	mation of the Accident	10.00	1	Tunn of Location
Type of Accident:	Injury Conveyed By Ambulance	Drink Drive: No.	Date/Time of Accident: 29/12/2018 05:20	Type of Location Straight Road
Location: Along Road 1 YISHUN AVE along Yishun Weather:	NUE 3 avenue 3, after Yishun st 71.	near to bus st	op opposite of Blk 717 Y	ishun Road Speed Limit:
Clear	Dr			
Traffic Flow: Traffic Control			100	raffic Volume: No Traffic
One Way Type of Colli Between Mo	8	Anyone conveyed by ambulance: /es		

	Type	Make	Model -	Color		No of Passenge
SHB2036D	Car	HYUNDAI	I40 1.7L CRDI AT ABS AIRBAG 4DR	Yellow	Seriously Damaged	0
YN7527G	Lorry	MITSUBISHI	CANTER FEB21ER4S DEB (CBU)	White	Slightly Damaged	0





Police Station Of Origin: Yishun North N.P.C 31 Yishun Central SINGAPORE 768827 Tel No: 1800-8529999 2 of 4 Report No. T/20181229/2055

CONTINUATION OF REPORT

Any Pedestrian Ir	ivolved: No			5-1-15		
No. of Pedestrian	s Injured: NIL		Use of Pede			
Driver - Charles	Control of the second	米斯马子	管理機能和	的相	を記述	T-54500
Name	ONG KIAN KOON		1	D No.	8	S1539951A
Related Vehicle	SHB2036D (Car)		- 0	Conta	ct No.	91174424
Hospital/Clinic	KHOO TECK PUAT HOS	PITAL	C	Class Driving Licence Expiry	9	Class: NIL Date of Expiry: NIL
Date Treatment	29/12/2018		Date Discha			2/2018
No. of Days gran	ted Medical Leave 05		Degree of In	ijury	Sligh	t
		一定生态		图图》	进现	2000年の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の
Name	ZHANG QIANG		1	D No.		G2500420K
Related Vehicle	YN7527G (Lorry)		(Conta	ct No.	86703484
Hospital/Clinic	NIL .		i i	Class Driving Licence Expiry	g	Class: NIL Date of Expiry: NIL
Date Treatment	NIL		Date Discha	arge	NIL	
No. of Days gran	ted Medical Leave NIL		Degree of Ir	njury	NIL	

Brief Details.

On 29/12/2018 at 0520hrs, I was driving my taxi vehicle, bearing vehicle registration plate number SHB2036D, along Yishun Ave 3. As I went pass the junction of Yishun Ave 3 and Yishun St 71, I spotted a passenger flagging for taxl vehicle at the bus stop opposite of Blk 717 Yishun, I then signal accordingly and make a stop to pick up the passenger. Shortly after, before the passenger boarded my taxi, a lorry vehicle, bearing vehicle registration plate number YN7527G, hit into my vehicle's rear with great force. Due to the collision, my vehicle surged forward onto the bus stop and the other vehicle went up the grass patch on the other lane. My vehicle's airbag was deployed, however, my abdominal area still knocked into the steering wheel and my head still hit onto the headrest of my driver seat. I was in pain and shocked, and I came out of my vehicle slowly as I was feeling nauseous too. I remembered the passenger that was flagging for my taxi vehicle had assisted to call for ambulance before leaving the scene. Traffic police only arrived at scene when I was in the ambulance and I was informed that my vehicle would be towed to Traffic Police HQ and I was also advised to lodge a traffic accident report. Thereafter, I was conveyed to Khoo Teck Puat Hospital and was given 5 days of MC, starting from 29/12/2018. Due to the incident, I strained my neck and back, doctor had given me a neck support as well, I also suffered abrasion on my left forearm as well. I was given X-ray scans and doctor informed that no fracture was found. However, I wish to state that I am still feeling pain in my abdominal area. I am currently unable to get up from my bed naturally, I had to support my neck as I felt no strength in my neck area.



Police Station Of Origin: Yishun North N.P.C 31 Yishun Central SINGAPORE 768827 Tel No: 1800-8529999



3 of 4 Report No. T/20181229/2055

CONTINUATION OF REPORT





Police Station Of Origin: Yishun North N.P.C 31 Yishun Central SINGAPORE 768827 Tel No: 1800-8529999 4 of 4 Report No. T/20181229/2055

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report: Signature, Of Informant: L/ Sgt 2 LOW WEI DE Date/Time: Signature Of Interpreter: 29/12/2018 12:51 Not applicable Classification Of Case: Officer In Charge Of Case: TP / GIT / Staff Sgt SUFIYAN BIN KHAIRI SN 085 Contact No.: 65476390 Authentication Stamp NP168 Singapore ~ SE

...CLAIM SUBFOLDER...(Pending for Survey Report)

AIM SUBF	OLDER TRA	CKING							
Case 1	latified	Est Submitted	Adj Assigned	Adj Rpt	Adj	Submitted	Ins Auth'ed	Status	
Main (3 Jan 2019		03 Jan 2019 11:48 Edit Adj Rpt	5\$30,000.00 Edit Estimate	6 1575	ew Rpt		Report	Gase
H	lain	R	eference	Claim	Details		Documents		Show All
CLAIM SUE	FOLDER DE	TAILS				[Created	by insurer]		
Insured:	A YONG F	TE LTD. Co. Res	. No.: 201328409V	V.		5811			
Main Claimant:	CITYCAB	TTYCAB PTE LTD, Co. Reg. No.: 199502839G							
Vehicle Reg. No.:	SHB203	6D		Date	e of Loss:		8 05:00 - :59 s and 29 Days Fro	m LTA Reg	Date (Man Yr)]
Claim Type:	TP / M19	900049		0.000	y/Cover No.:		(Comprehensive) 19/10/2017 - 28/0	01/2019	
Vehicle Reg. No. (Insured):	YN7527G				y No. imant):				
				Exc	1881	5\$750.00			
Repairer:	Chunni M	otor Work Pte L	td - Amk (HQ) Blk	10 #01-05/06, 4	MK Autor	point, 568047	7 Ang Mo Kio - Tel	64836016	
Handling Insurer:	DOWNTOUR	All the second to the second	ingapore Ltd (HQ		7.11	All the second second		A. J. A. T. T. A.	
Adjuster:	LKK Auto	Consultants Pte	Ltd (HQ) - Tel: 62	56-3561 [Har	idled by E	BRYAN TAN] [Final Rpt	due 14/0	1/2019]
Driver/Custo dian (Insured):		ANG (58) . NRIG	2: G2500420K Emai	tt					
Adj Asg. Remarks:	OUR INSO	HAVE NOT RPT TO	HE ACCDT, PLS. CH	ECK PARTS PRIC	Ē,				
ASSOCIATI	ED MAIL RE	CEIVED					Vie	w All C	impose Case Mail
There are no	mail for this	case.							
ALL ASSO	CIATED TAS	iks⊟				View All	Search Tasks C	reate New T	ask Complete
Due Date No results.	Priority	Type Task	Group Subject	t Handler	Assign	ned By	Completed On	Creat	ed On Done

Claim Documents

*SHB2036D (M1900049)

[YN7527G]

TP

CITYCAB PTE LTD

Dec 29 2018 5:00AM

[A YONG PTE LTD]

Chunni Motor Work Pte Ltd - Amk

Pho	otos/Images		3 per page	
Νo	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbra	II Prin
1	17/03/19 13:32	Rear View Left	■ Load 3PG	V
ż	17/03/19 13:32	Rear View Right	1 Load 3PG	2
3	17/03/19 13:33	General View	1 Load 3PC	1
4	17/03/19 13:33	General View	1 Load JPC	V
5	17/03/19 13:33	General View	■ Load 3PG	V
6	17/03/19 13:33	General View	Epad 3PG	N Z
7	17/03/19 13:33	General View	1 Load JPC	V
8	17/03/19 13:33	General View	■ Load JPG	V
9	17/03/19 13:33	General View	1 Load 3PG	V
10	17/03/19 13:33	General View	1 Load 3PC	W
11	17/03/19 13:33	General View	1 Load 3PG	V
12	17/03/19 13:33	General View	■ Load JPC	V
13	17/03/19 13:33	General View	Load 3PG	V
14	17/03/19 13:33	General View	1 Load JPG	V
15	17/03/19 13:33	General View	1 Load JPC	1
16	17/03/19 13:33	General View	1 Load JPG	12
17	17/03/19 13:33	General View	■ Load 3PG	1
18	17/03/19 13:33	General View	1 Load 3PG	₩.
19	17/03/19 13:33	General View	■ Load 3PG	V
20	17/03/19 13:33	General View	① Load 3PG	V
21	17/03/19 13:33	General View	1 Load 3PG	V
22	17/03/19 13:33	General View	1 Load JPG	V
23	17/03/19 13:33	General View	■ Load JPG	₩.
24	17/03/19 13:33	General View	1 Load JPG	V
25	17/03/19 13:33	General View	1 Load JPG	- EZ
26	17/03/19 13:33	General View	1 Load 3PG	~
27	17/03/19 13:33	General View	Load JPG	1
28	17/03/19 13:33	General View	1 Load JPG	3
29	17/03/19 13:33	General View	1 Load JPG	1
30	17/03/19 13:33	General View	1 Load JPG	V
31	17/03/19 13:33	General View	1 Load JPG	~
32	17/03/19 13:33	General View	1 Load JPG	V
33	17/03/19 13:33	General View	1 Load JPG	V
34	17/03/19 13:33	General View	■ Load JPG	-
35	17/03/19 13:33	General View	1 Load JPG	₩
36	17/03/19 13:33	General View	1 Load JPG	-
37.	17/03/19 13:33	General View	● Load JPG	V

Pho	tos/Images		3 per page 🔍	V
No 38	Relabel/Reorder 17/03/19 13:33	LKK Auto Consultants Pte Ltd (HQ) General View	Thumbnall Load JPG	Prin
		Para Santa	■ Load JPG	Z.
9	17/03/19 13:33	General View	Load JPG Load JPG	V
0	17/03/19 13:33	General View	● Load 3PG	V
1	17/03/19 13:33	General View	10000000	12
2	17/03/19 13:33	General View		EX.
3	17/03/19 13:33	General View	O Load JPG	+
4	17/03/19 13:33	General View	● Load JPG	2
5	17/03/19 13:33	General View	Load 3PG	2
6	17/03/19 13:33	General View	1 Load JPG	5
7	17/03/19 13:33	General View	1 Load JPG	5
8	17/03/19 13:33	General View	1 Lnad JPG	V
9	17/03/19 13:35	General View	1 Load JPG	4
0	17/03/19 13:35	General View	1 Load JPG	2
1	17/03/19 13:35	General View	1 Load JPG	1
2	17/03/19 13:35	General View	1 Load 3PG	2
3	17/03/19 13:35	General View	1 Load JPG	5
4	17/03/19 13:35	General View	1 Load JPG	E
5	17/03/19 13:35	General View	■ Load JPG	E
б	17/03/19 13:35	General View	Load JPG	5
7	17/03/19 13:35	General View	1 Load JPG	5
8	17/03/19 13:35	General View	■ Load JPG	6
9	17/03/19 13:35	General View	■ Load JPG	15
0	17/03/19 13:35	General View	Load JPG	5
1	17/03/19 13:35	General View	■ Load JPG	Б
2	17/03/19 13:35	General View	1 Load JPG	1
3	17/03/19 13:35	General View	■ Load JPG	15
14	17/03/19 13:35	General View	1 Load JPG	Б
5	17/03/19 13:35	General View	■ Load 3PG	1
6	17/03/19 13:35	General View	■ Load JPG	5
7	17/03/19 13:35	General View	■ Load JPG	5
8	17/03/19 13:35	General View	■ Load JPG	Б
9	17/03/19 13:35	General View	■ Load JPG	5
0	17/03/19 13:35	General View	D Load JPG	1
1	17/03/19 13:35	General View	1 Load JPG	150
2	17/03/19 13:35	General View	● Load 3PG	V
3	17/03/19 13:35	General View	■ Load 3PG	5
4	17/03/19 13:35	General View	■ Load 3PG	2
5	17/03/19 13:35	General View	● Load JPG	P
6	17/03/19 13:35	General View	Load JPG	E
7	17/03/19 13:35	General View	Load JPG	2
8	17/03/19 13:35	General View	Load JPG Load JPG	E
9	17/03/19 13:35	General View	O Load JPG	6
	DOMESTIC OF THE STATE OF THE ST	General View	O Load 3PG	5
0	17/03/19 13:35		3 Load JPG	5
1	17/03/19 13:35	General View		2
2	17/03/19 13:35	General View		-
3	17/03/19 13:35	General View	Load JPG	5
4	17/03/19 13:35	General View	1 Load JPG	5
15	17/03/19 13:35	General View	1 Load JPG	2
16	17/03/19 13:35	General View	1 Load JPG	E

Pho	tos/Images		3 per page V	2
No.	Relabel/Reorder 17/03/19 13:35	LKK Auto Consultants Pte Ltd (HQ) General View	Thumbnail Load 3PG	Prin
200			● Load JPG	1 Y
9	17/03/19 13:35	General View		-
0	17/03/19 13:35	General View	6 Load JPG	1
1	17/03/19 13:35	General View	■ Load JPG	V
12	17/03/19 13:35	General View	1 Lbad JPG	E.
3	17/03/19 13:35	General View	1 Load JPG	2
4	17/03/19 13:35	General View	1 Load JPG	1
15	17/03/19 13:35	General View	Load 3PG	E
16	17/03/19 13:35	General View	€ Load JPG	1
97.	17/03/19 13:35	General View	1 Load JPG	Б
98	17/03/19 13:35	General View	■ Load JPG	E
99	17/03/19 13:35	General View	Load JPG	12
100	17/03/19 13:35	General View	Load JPG	2
101	17/03/19 13:35	General View	■ Load 3PG	Б
102	17/03/19 13:36	Front View Left	Load JPG	E
E01	17/03/19 13:39	General View	1 Load JPG	5
104	17/03/19 13:39	General View	■ Load JPG	5
105	17/03/19 13:39	General View	Load JPG	5
106	17/03/19 13:39	General View	■ Load JPG	Б
107	17/03/19 13:39	General View	■ Load JPG	5
801	17/03/19 13:39	General View	■ Load JPG	6
109	17/03/19 13:39	General View	■ Load JPG	6
110	17/03/19 13:39	General View	■ Load JPG	5
111	17/03/19 13:39	General View	O Load JPG	5
112	17/03/19 13:39	General View	O Load 3PG	5
113	17/03/19 13:39	General View	O Load JPG	E
-	17/03/19 13:39	General View	D Load 3PG	5
115		General View	D Load JPG	5
	17/03/19 13:39	(ASS) (ASS) (ASS)		-
116	17/03/19 13:39	General View	1000	5
117	17/03/19 13:39	General View	B Load JPG	5
118	17/03/19 13:39	General View	1 Load JPG	5
119	17/03/19 13:39	General View	1 Load JPG	5
	17/03/19 13:39	General View	Load 3PG	Б
121		General View	1 Load JPG	15
122	17/03/19 13:39	General View	■ Load JPG	N
123		General View	Load JPG	Б
124	17/03/19 13:39	General View	1 Load JPG	2
125	17/03/19 13:39	General View	1 Load JPG	Ь
126	17/03/19 13:39	General View	■ Load JPG	Б
127	17/03/19 13:39	General View	1 Load JPG	6
128	17/03/19 13:39	General View	1 Load JPG	15
129	17/03/19 13:39	General View	1 Load JPG	1
130	17/03/19 13:39	General View	0 Load 3PG	5
131	17/03/19 13:39	General View	1 Load JPG	5
132	17/03/19 13:39	General View	■ Load JPG	Б
133	17/03/19 13:39	General View	■ Load JPG	15
134	17/03/19 13:39	General View	■ Load 3PG	5
135	17/03/19 13:39	General View	1 Load JPG	5
136	17/03/19 13:39	General View	1 Load JPG	Б
137	17/03/19 13:39	General View	■ Load JPG	E

Pho	tos/Images		3 per page 🗸	N N
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnai Load JPG	-
138	17/03/19 13:39	General View		N N
139	17/03/19 13:39	General View	1 Load JPG	<u>∞</u>
140	17/03/19 13:39	General View	1 Load JPG	Z)
141	17/03/19 13:39	General View	1 Load JPG	A
142	17/03/19 13:39	General View	1 Load JPG	N
143	17/03/19 13:39	General View	Load JPG	✓
144	17/03/19 13:39	General View	● Load JPG	150
145	17/03/19 13:39	General View	Load 1PG	V
146	17/03/19 13:39	General View	■ Load JPG	8
147	17/03/19 13:39	General View	1 Load JPG	N
148	17/03/19 13:39	General View	Load JPG	V
149	17/03/19 13:39	General View	■ Load JPG	N.
150	17/03/19 13:39	General View	Load JPG	V
151	17/03/19 13:39	General View	■ Lpad JPG	N.
152	17/03/19 13:39	General View	1 Load JPG	V
153	17/03/19 13:39	General View	Load JPG	V
154	17/03/19 13:39	General View	1 Load JPG	₩.
155	17/03/19 13:39	General View	■ Load JPG	V
156	17/03/19 13:39	General View	■ Load 3PG	121
157	17/03/19 13:39	General View	Load JPG	120
158	17/03/19 13:39	General View	■ Load JPG	1
159	17/03/19 13:39	General View	■ Load JPG	V
160	17/03/19 13:39	General View	■ Load JPG	V
161	17/03/19 13:39	General View	Load 3PG	100
162	17/03/19 13:39	General View	O Load JPG	V
163	17/03/19 13:39	General View	O Load JPG	Z
164	17/03/19 13:39	General View	O Load JPG	V
165	17/03/19 13:39	General View	■ Load 3PG	V
166	17/03/19 13:39	General View	D Load 3PG	V
167	17/03/19 13:39	General View	D Load JPG	V
168	17/03/19 13:39	General View	D Load JPG	8
169	17/03/19 13:39	General View	D Load JPG	<u>A</u>
	17/03/19 13:39	General View		FTE
100	U1790000482317230723			150
171	17/03/19 13:39	General View	■ Load JPG	Z
172	17/03/19 13:39	General View	1 Load JPG	V
I PICKI	17/03/19 13:39	General View	1 Load JPG	<u> </u>
74	17/03/19 13:39	General View	1 Load JPG	V
175	17/03/19 13:39	General View	1 Load JPG	<u>S</u>
176	17/03/19 13:39	General View	1 Load JPG	N.
177	17/03/19 13:39	General View	■ Load JPG	V
178	17/03/19 13:39	General View	1 Load JPG	N N
179	17/03/19 13:39	General View	1 Load JPG	V
180	17/03/19 13:39	General View	1 Load JPG	150
181	17/03/19 13:39	General View	1 Load JPG	2
182	17/03/19 13:39	General View	1 Load JPG	N/
183	17/03/19 13:39	General View	1 Load JPG	3
184	17/03/19 13:39	General View	■ Load JPG	V
185	17/03/19 13:39	General View	■ Load 3PG	Ø
186	17/03/19 13:39	General View	■ Load JPG	V
187	17/03/19 13:39	General View	1 Load JPG	8

Pho	tos/Images	VIII.	processor of the same of the s	· V
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbn	-
188	17/03/19 13:39	General View		13.7
189	17/03/19 13:39	General View	1 Load JP	
190	17/03/19 13:39	General View	1 Load JP	-
191	17/03/19 13:39	General View	● Load 3P	
192	17/03/19 13:39	General View	1 Load JP	-
193	17/03/19 13:39	General View	1 Load JP	- 100
194	17/03/19 13:39	General View	D Load 3P	
195	17/03/19 13:39	General View	1 Lpad 3P	
196	17/03/19 13:39	General View	1 Load JP	
197	17/03/19 13:39	General View	1 Load JP	
198	17/03/19 13:39	General View	■ Load JP	
199	17/03/19 13:39	General View	1 Load JP	-
500	17/03/19 13:39	General View	1 Load JP	-
201	17/03/19 13:39	General View	D Load 3P	
202	17/03/19 13:39	General View	Used JP	-
203	17/03/19 13:39	General View	1 Load JP	-
204	17/03/19 13:39	General View	1 Load JP	_
205	17/03/19 13:39	General View	■ Load JP	
206	17/03/19 13:39	General View	1 Load JP	G 😡
207	17/03/19 13:39	General View	■ Load JP	_
208	17/03/19 13:39	General View	■ Load JP	G ✓
209	17/03/19 13:39	General View	1 Load JP	_
210	17/03/19 13:39	General View	10 Load JP	6 2
211	17/03/19 13:39	General View	Load JP	G EZ
212	17/03/19 13:39	General View	U Load 3P	G V
213	17/03/19 13:39	General View	E Load JP	G 🗷
214	17/03/19 13:39	General View	■ Load JP	G 🗷
215	17/03/19 13:39	General View	■ Load JP	G 🔽
116	17/03/19 13:39	General View	O Load JP	G Z
117	17/03/19 13:39	General View	E Load JP	G Z
218	17/03/19 13:39	General View	£coad JP	G 🗷
219	17/03/19 13:39	General View	■ Load JP	G [2
220	17/03/19 13:39	General View	O Load JP	G 🗷
221	17/03/19 13:39	General View	D Load JP	G Z
222	17/03/19 13:39	General View	■ Load JP	G ✓
223	17/03/19 13:39	General View	● Load 3P	G 🔽
224	17/03/19 13:39	General View	1 Load JP	6 2
225	17/03/19 13:39	General View	■ Load JP	G 🗷
226	17/03/19 13:39	General View	Load 3P	g 5 2
227	17/03/19 13:39	General View	Load JP	G Z
228	17/03/19 13:39	General View	Load 3P	G Z
229	17/03/19 13:39	General View	D Load 3P	G ₹
230	17/03/19 13:39	General View	1 Load 3P	g 😡
231	17/03/19 13:39	General View	1 Load JP	G Z
32	17/03/19 13:39	General View	■ Load JP	
133	17/03/19 13:39	General View	■ Load JP	
134	17/03/19 13:39	General View	■ Load JP	-
235	17/03/19 13:39	General View	■ Load JP	-
236	17/03/19 13:39	General View	■ Load 3P	-
100	17/03/19 13:39	Odometer Reading	■ Load 3P	array array

	tos/Images	Y	3 per page	2
No 238	Relabel/Reorder 17/03/19 13:39	LKK Auto Consultants Pte Ltd (HQ) Chassis Number	Thumbnail Load JPG	Prin
		100 mm 1		Z
39	17/03/19 13:45	Reinspection Photo	1 Load 3PG	-
40	17/03/19 13:45	Reinspection Photo	6 Load 3PG	12
41	17/03/19 13:45	Reinspection Photo	1 Load 3PG	4
42	17/03/19 13:45	Reinspection Photo	1 Load 3PG	2
43	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
44	17/03/19 13:45	Reinspection Photo	1 Load JPG	¥
45	17/03/19 13:45	Reinspection Photo	■ Load JPG	V
46	17/03/19 13:45	Reinspection Photo	Load JPG	b
47	17/03/19 13:45	Reinspection Photo	■ Load JPG	9
48	17/03/19 13:45	Reinspection Photo	■ Load 3PG	V
49	17/03/19 13:45	Reinspection Photo	Load JPG	5
250	17/03/19 13:45	Reinspection Photo	£ Load JPG	2
51	17/03/19 13:45	Reinspection Photo	Load JPG	E.
152	17/03/19 13:45	Reinspection Photo	■ Load JPG	1
53	17/03/19 13:45	Reinspection Photo	■ Load JPG	5
154	17/03/19 13:45	Reinspection Photo	O Load JPG	E
55	17/03/19 13:45	Reinspection Photo	O Load JPG	F
56	17/03/19 13:45	Reinspection Photo	O Load JPG	5
57	17/03/19 13:45	Reinspection Photo	O Load JPG	5
	TOP SHARE ELECTRICAL	A STATE OF THE PARTY OF THE PAR		[N
58	17/03/19 13:45	Reinspection Photo		-
59	17/03/19 13:45	Reinspection Photo	0 Load JPG	15
60	17/03/19 13:45	Reinspection Photo	1 Load JPG	2
61	17/03/19 13:45	Reinspection Photo	1 Load JPG	Б
162	17/03/19 13:45	Reinspection Photo	D Load 1PG	-
163	17/03/19 13:45	Reinspection Photo	1 Load JPG	-
64	17/03/19 13:45	Reinspection Photo	1 Load 3PG	E
165	17/03/19 13:45	Reinspection Photo	1 Load JPG	1
266	17/03/19 13:45	Reinspection Photo	■ Load JPG	1
67	17/03/19 13:45	Reinspection Photo	£ Load JPG	5
883	17/03/19 13:45	Reinspection Photo	Load JPG	2
269	17/03/19 13:45	Reinspection Photo	£ Load 3PG	5
270	17/03/19 13:45	Reinspection Photo	Load 3PG	5
71	17/03/19 13:45	Reinspection Photo	■ Load JPG	5
72	17/03/19 13:45	Reinspection Photo	■ Load JPG	-
73	17/03/19 13:45	Reinspection Photo	■ Load JPG	1 -
74	17/03/19 13:45	Reinspection Photo	■ Load 3PG	1 -
75	17/03/19 13:45	Reinspection Photo	■ Load JPG	_
76	17/03/19 13:45	Reinspection Photo	■ Load JPG	B
77	17/03/19 13:45	Reinspection Photo	■ Load JPG	15
78	17/03/19 13:45	Reinspection Photo	Load JPG	1 5
		2 Files Control (State Control (Stat	O Load JPG	1
79	17/03/19 13:45	Reinspection Photo	1 Load JPG	1
80	17/03/19 13:45	Reinspection Photo	Load 3PG Load 3PG	5
81	17/03/19 13:45	Reinspection Photo		5
82	17/03/19 13:45	Reinspection Photo	Load JPG	+
183	17/03/19 13:45	Reinspection Photo	O Load JPG	5
284	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
285	17/03/19 13:45	Reinspection Photo	1 Load JPG	1
186	17/03/19 13:45	Reinspection Photo	■ Load JPG	5

Pho	tos/Images		3 per page 🔍	V
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	-
288	17/03/19 13:45	Reinspection Photo	1 Load JPG	Y
89	17/03/19 13:45	Reinspection Photo	1 Load JPG	×
90	17/03/19 13:45	Reinspection Photo	1 Load 3PG	V
91	17/03/19 13:45	Reinspection Photo	■ Load 3PG	2
92	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
93	17/03/19 13:45	Reinspection Photo	 Load JPG 	V
94	17/03/19 13:45	Reinspection Photo	 Load JPG 	V
95	17/03/19 13:45	Reinspection Photo	■ Load JPG	2
96	17/03/19 13:45	Reinspection Photo	Load JPG	1
97	17/03/19 13:45	Reinspection Photo	Load 3PG	V
98	17/03/19 13:45	Reinspection Photo	Load 3PG	2
99	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
00	17/03/19 13:45	Reinspection Photo	Load JPG	V
101	17/03/19 13:45	Reinspection Photo	Load JPG	V
102	17/03/19 13:45	Reinspection Photo	■ Load JPG	V
103	17/03/19 13:45	Reinspection Photo	■ Load 3PG	1
104	17/03/19 13:45	Reinspection Photo	Load 3PG	V
05	17/03/19 13:45	Reinspection Photo	Load JPG	1
06	17/03/19 13:45	Reinspection Photo	■ Load JPG	V
07	17/03/19 13:45	Reinspection Photo	Load JPG	V
108	17/03/19 13:45	Reinspection Photo	Load 3PG	5
09	17/03/19 13:45	Reinspection Photo	1 Load JPG	5
-	DOMESTIC CONTRACTOR	Landy Chapter Control of Control		[A
10	17/03/19 13:45	Reinspection Photo		
111	17/03/19 13:45	Reinspection Photo	U Load JPG	2
112	17/03/19 13:45	Reinspection Photo	1 Load JPG	2
113	17/03/19 13:45	Reinspection Photo	1 Load JPG	5
114	17/03/19 13:45	Reinspection Photo	1 Lead JPG	1
15	17/03/19 13:45	Reinspection Photo	■ Load JPG	2
16	17/03/19 13:45	Reinspection Photo	1 Load JPG	5
17	17/03/19 13:45	Reinspection Photo	1 Load JPG	5
318	17/03/19 13:45	Reinspection Photo	1 Load 3PG	V
119	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
320	17/03/19 13:45	Reinspection Photo	1 Load JPG	×
21	17/03/19 13:45	Reinspection Photo	■ Load JPG	1×
122	17/03/19 13:45	Reinspection Photo	■ Load JPG	V
23	17/03/19 13:45	Reinspection Photo	■ Load JPG	4
24	17/03/19 13:45	Reinspection Photo	E Load JPG	1
125	17/03/19 13:45	Reinspection Photo	■ Load 3PG	4
26	17/03/19 13:45	Reinspection Photo	Load JPG	¥
27	17/03/19 13:45	Reinspection Photo	£oad JPG	5
28	17/03/19 13:45	Reinspection Photo	1 Load JPG	E.
29	17/03/19 13:45	Reinspection Photo	1 Load JPG	2
30	17/03/19 13:45	Reinspection Photo	■ Load JPG	G
31	17/03/19 13:45	Reinspection Photo	■ Load 3PG	B
32	17/03/19 13:45	Reinspection Photo	■ Load 3PG	V
133	17/03/19 13:45	Reinspection Photo	O Load 3PG	1
134	17/03/19 13:45	Reinspection Photo	■ Load 3PG	V
35	17/03/19 13:45	Reinspection Photo	O Load JPG	150
136	17/03/19 13:45	Reinspection Photo	O Load 3PG	E
337	17/03/19 13:45	Reinspection Photo	O Load 3PG	E

Pho	tos/Images		3 per page	di car
Vo:	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbna	Antique Commenter
38	17/03/19 13:45	Reinspection Photo	6 Load JPG	1.3
39	17/03/19 13:45	Reinspection Photo	■ Load 3PG	-
40	17/03/19 13:45	Reinspection Photo	1 Load 3PG	-
41	17/03/19 13:45	Reinspection Photo	① Load 3PG	
42	17/03/19 13:45	Reinspection Photo	1 Load 3PG	_
43	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
44	17/03/19 13:45	Reinspection Photo	■ Load JPG	14
45	17/03/19 13:45	Reinspection Photo	■ Load 3PG	12
146	17/03/19 13:45	Reinspection Photo	■ Load 3PG	5
47	17/03/19 13:45	Reinspection Photo	1 Load 3PG	2
148	17/03/19 13:45	Reinspection Photo	■ Load 3PG	V
149	17/03/19 13:45	Reinspection Photo	Load JPG	1
350	17/03/19 13:45	Reinspection Photo	1 Load JPG	1
151	17/03/19 13:45	Reinspection Photo	1 Load JPG	1 E
152	17/03/19 13:45	Reinspection Photo	Load JPG	1
153	17/03/19 13:45	Reinspection Photo	1 Load JPG	2
354	17/03/19 13:45	Reinspection Photo	■ Load JPG	_
155	17/03/19 13:45	Reinspection Photo	■ Load JPG	V
156	17/03/19 13:45	Reinspection Photo	■ Load JPG	1 -
157	17/03/19 13:45	Reinspection Photo	■ Load JPG	
158	17/03/19 13:45	Reinspection Photo	■ Load JPG	
159	17/03/19 13:45	Reinspection Photo	O Load 3PG	
160	17/03/19 13:45	Reinspection Photo	Load 3PG	-
161	17/03/19 13:45	Reinspection Photo	■ Load JPG	
362	17/03/19 13:45	Rainspection Photo	Load JPG	
163	17/03/19 13:45	Reinspection Photo	Load JPG	-
364	17/03/19 13:45	Reinspection Photo	Load JPG	
365	17/03/19 13:45	Reinspection Photo	Load JPG	
366	17/03/19 13:45	Reinspection Photo	Load JPG	-
			O Load JPG	-
367	17/03/19 13:45	Reinspection Photo	O Load JPG	
368	17/03/19 13:45	Reinspection Photo	D Load 3PG	_
369	17/03/19 13:45	Reinspection Photo		_
370	17/03/19 13:45	Reinspection Photo	O Load JPG	_
371	17/03/19 13:45	Reinspection Photo	1 Load JPS	-
372	17/03/19 13:45	Reinspection Photo	■ Load JPG	_
173	17/03/19 13:45	Reinspection Photo	Load JPG	_
374	17/03/19 13:45	Reinspection Photo	1 Load JPG	_
175	17/03/19 13:45	Reinspection Photo	1 Load JPG	_
376	17/03/19 13:45	Reinspection Photo	■ Load JPG	_
177	17/03/19 13:45	Reinspection Photo	■ Load JPG	_
178	17/03/19 13:45	Reinspection Photo	1 Load JPG	-
179	17/03/19 13:45	Reinspection Photo	1 Load JPG	-
180	17/03/19 13:45	Reinspection Photo	Dead JPG	_
181	17/03/19 13:45	Reinspection Photo	1 Load JPG	_
182	17/03/19 13:45	Reinspection Photo	1 Load 3PG	-
383	17/03/19 13:45	Reinspection Photo	■ Load JPG	_
384	17/03/19 13:45	Reinspection Photo	■ Load JPG	-
385	17/03/19 13:45	Reinspection Photo	■ Load 3PG	-
386	17/03/19 13:45	Reinspection Photo	■ Load JPG	
387	17/03/19 13:45	Reinspection Photo	■ Load JPG	Б

Pho	tos/Images		3 per page 🔍	₩.
No 388	Relabel/Reorder 17/03/19 13:45	LKK Auto Consultants Pte Ltd (HQ) Reinspection Photo	Thumbnail Load JPG	Prin
			● Load JPG	₩.
189	17/03/19 13:45	Reinspection Photo		-
90	17/03/19 13:45	Reinspection Photo	€ Load 3PG	12
91	17/03/19 13:45	Reinspection Photo	● Load 3PG	V
92	17/03/19 13:45	Reinspection Photo	● Load JPG	2
93	17/03/19 13:45	Reinspection Photo	1 Load 3PG	V
194	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
95	17/03/19 13:45	Reinspection Photo	● Load JPG	Z
96	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
97.	17/03/19 13:45	Reinspection Photo	1 Load JPG	12
198	17/03/19 13:45	Reinspection Photo	■ Load 3PG	4
199	17/03/19 13:45	Reinspection Photo	■ Load 3PG	1
100	17/03/19 13:45	Reinspection Photo	1 Load JPG	2
101	17/03/19 13:45	Reinspection Photo	Load JPG	×
102	17/03/19 13:45	Reinspection Photo	Load JPG	2
103	17/03/19 13:45	Reinspection Photo	1 Load JPG	V
104	17/03/19 13:45	Reinspection Photo	1 Load JPG	B
105	17/03/19 13:45	Reinspection Photo	■ Load 3PG	V
106	17/03/19 13:45	Reinspection Photo	■ Load JPG	E
107	17/03/19 13:46	Reinspection Photo	Load JPG	E
108	17/03/19 13:46	Reinspection Photo	Load JPG	E.
109	17/03/19 13:46	Reinspection Photo	■ Load JPG	5
10	17/03/19 13:46	Reinspection Photo	■ Load JPG	E
111	17/03/19 13:46	Reinspection Photo	O Load 3PG	12
112	17/03/19 13:46	Reinspection Photo	Load JPG	E
113	17/03/19 13:46	Reinspection Photo	O Load JPG	Ex.
414	17/03/19 13:46	Reinspection Photo	O Load JPG	E.
	17/03/19 13:40	Finishing Photo	Load JPG Load JPG	1
115	17/03/19 13:47	Communicativa Property and	O Load JPG	E
116		Finishing Photo	■ Load JPG	12
417	17/03/19 13:47	Finishing Photo		12
818	17/03/19 13:47	Finishing Photo		+
419	17/03/19 13:47	Finishing Photo		V
120	17/03/19 13:47	Finishing Photo	D Load 3PG	5
121	17/03/19 13:47	Finishing Photo	0 Load JPG	E.
122	17/03/19 13:47	Finishing Photo	1 Load JPG	1
23	17/03/19 13:47	Finishing Photo	● Load 3PG	V
124	17/03/19 13:47	Finishing Photo	1 Load JPG	K
25	17/03/19 13:47	Finishing Photo	1 Load JPG	×
126	17/03/19 13:47	Finishing Photo	1 Load JPG	Y
27	17/03/19 13:47	Finishing Photo	● Load JPG	-
28	17/03/19 13:47	Finishing Photo	1 Load JPG	E
29	17/03/19 13:47	Finishing Photo	1 Load JPG	E
0.64	17/03/19 13:47	Finishing Photo	■ Load JPG	V
31	17/03/19 13:47	Finishing Photo	1 Load JPG	E
32	17/03/19 13:47	Finishing Photo	■ Load JPG	P
133	17/03/19 13:47	Finishing Photo	■ Load JPG	5
434	17/03/19 13:47	Finishing Photo	■ Load JPG	
435	17/03/19 13:47	Finishing Photo	■ Load JPG	150
436	17/03/19 13:47	Finishing Photo	1 Load JPG	5
437	17/03/19 13:47	Finishing Photo	■ Load 3PG	5

Pho	tos/Images		3 per page 🗸	N.
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnai	indigent and related
438	17/03/19 13:47	Finishing Photo	■ Lbad 3PG	V
139	17/03/19 13:47	Finishing Photo	■ Load 3PG	V
440	17/03/19 13:47	Finishing Photo	1 Load JPG	3
141	17/03/19 13:47	Finishing Photo	♠ Load 3PG	V
142	17/03/19 13:47	Finishing Photo	● Load JPG	2
143	17/03/19 13:47	Finishing Photo	1 Load JPG	4
444	17/03/19 13:47	Finishing Photo	Load JPG	V
445	17/03/19 13:47	Finishing Photo	 Load JPG 	Z
145	17/03/19 13:47	Finishing Photo	Load JPG	12
447	17/03/19 13:47	Finishing Photo	■ Load JPG	V
148	17/03/19 13:47	Finishing Photo	■ Load 3PG	V
449	17/03/19 13:47	Finishing Photo	Load JPG	V
150	17/03/19 13:47	Finishing Photo	1 Load JPG	V
451	17/03/19 13:47	Finishing Photo	■ Load JPG	V
452	17/03/19 13:47	Finishing Photo	■ Load 3PG	12
153	17/03/19 13:47	Finishing Photo	■ Load JPG	V
154	17/03/19 13:47	Finishing Photo	O Load JPG	R
155	17/03/19 13:47	Finishing Photo	D Load 3PG	V
156	17/03/19 13:47	Finishing Photo	O Load ≯PG	1
157	17/03/19 13:47	Finishing Photo	O Load JPG	R
		STREET AND STREET	Load JPG Load JPG	12
58	17/03/19 13:47	Finishing Photo		130
59	17/03/19 13:47	Finishing Photo		-
160	17/03/19 13:47	Finishing Photo	O Load JPG	2
61	17/03/19 13:47	Finishing Photo	1 Load JPG	12
162	17/03/19 13:47	Finishing Photo	1 Load JPG	V
163	17/03/19 13:47	Finishing Photo	1 Load JPG	Z
164	17/03/19 13:47	Finishing Photo	1 Load JPG	EZ.
165	17/03/19 13:47	Finishing Photo	1 Load JPG	4
166	17/03/19 13:47	Finishing Photo	1 Load JPG	V
167	17/03/19 13:47	Finishing Photo	Load 3PG	Z
168	17/03/19 13:47	Finishing Photo	1 Load JPG	N.
169	17/03/19 13:47	Finishing Photo	£ Load JPG	V
170	17/03/19 13:47	Finishing Photo	■ Load 3PG	1
171	17/03/19 13:47	Finishing Photo	Load JPG	V
72	17/03/19 13:47	Finishing Photo	■ Load JPG	V
73	17/03/19 13:47	Finishing Photo	■ Load JPG	E/
74	17/03/19 13:47	Finishing Photo	Load JPG	1
75	17/03/19 13:47	Finishing Photo	■ Load 3PG	B.
76	17/03/19 13:47	Finishing Photo	■ Load JPG	E
77	17/03/19 13:47	Finishing Photo	■ Load JPG	V
78	17/03/19 13:47	Finishing Photo	■ Load JPG	E
79	17/03/19 13:47	Finishing Photo	■ Load JPG	V
80	17/03/19 13:47	Finishing Photo	■ Load JPG	E.
81	17/03/19 13:47	Finishing Photo	■ Load JPG	E.
182	17/03/19 13:47	Finishing Photo	■ Load JPG	12
83	17/03/19 13:47	Finishing Photo	■ Load JPG	E
184	17/03/19 13:47	Finishing Photo	● Load JPG	V
			Load 3PG	12
85	17/03/19 13:47	Finishing Photo	Load JPG Load JPG	1
186	17/03/19 13:47	Finishing Photo	1 Load JPG	EX.

Merimen e-Claims

Pho	tos/Images		3 per page 🔍		
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
488	17/03/19 13:47	Finishing Photo	0	Load JPG	W
489	17/03/19 13:47	Finishing Photo	0	Load JPG	W
490	17/03/19 13:47	Finishing Photo	0	Load JPG	V
Doc	umentation		1 per p	age 🔻	V
No	Finalized On	Tokio Marine Insurance Singapore Ltd (HQ)	[F.F.]	Thumbnail	-
1	03/01/19 11:25	SHB2036D GIA+EST	0	Load PDF	
2	03/01/19 11:25	WSHOP RQ SURVEY-TMIS SURVEYOR LIST	0	Load PDF	
3	03/01/19 11:48	WSHOP SELECT LKK-ASSIGN	0	Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	21/03/19 15:27	Supplementary	0	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset Save Print
There are no document checklists configured.	
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)	
	^
	~
Show Remarks To: Handling Insurer Note: Remarks are private unless you show it to other parties.	

LKK Auto Consultants Pte Ltd (Co.Reg. No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No:

CS/TMI19000115/DQD3E2

Date:

22/03/2019

REFERENCE

Handling Insurer: Tokio Marine Insurance Singapore Ltd

Policy No:

MU011172

Claimant Vehicle

SHB2036D

Insured Vehicle No:

YN7527G

No: Date of Loss:

29/12/2018

Nature of Claim:

TP

Claim No: M1900049

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:

SHB2036D

Make & Model:

HYUNDAI 140, 1.7 D (A)

Engine No:

D4FDEU430013

Reg. Date:

30/09/2013 (Man. Year: 2013)

Chassis No: Odometer:

KMHLB41UMDU039788 713501 km

Colour: Engine Capacity:

1685 cc

Market Value/New Car Price: N/A Sum Insured (S\$):

Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:

Steering (Serviceable):

Yes Footbrake (Serviceable):

Yes

Handbrake (Serviceable):

Yes Engine Modification:

Pre-accident Condition: No

CONDITION OF TYRES

Front Tyre Size:

205/60 R16

Rear Tyre Size:

205/60 R16

Front Left Side:

West Lake 5 mm

Rear Left Side: Rear Right Side: West Lake 5 mm West Lake 5 mm

Front Right Side: West Lake 5 mm The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		76,272.04	49,044.84	27,227.20	35.70
Miscellaneous Items		0.00	0.00	0.00	
Labour		13,030.00	5,180.00	7,850.00	60.25
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
	Calculated Gross Total (S\$)	89,302.04	54,224.84	35,077.20	39.28
	Approved Total (Overridden) (S\$)		30,000.00		
	(S\$)	89,302.04	30,000.00	59,302.04	66.41
	+ GST 7.00/7.00% (S\$)	6,251.14	2,100.00	4,151.14	66.41
	Nett Amount (S\$)	95,553.18	32,100.00	63,453.18	66.41

INSPECTION

Date of Assignment:

03/01/2019

Date Inspected:

03/01/2019 Inspected At:

Chunni Motor Work Pte Ltd - Amk (HQ)

Blk 10 #01-05/06, AMK Autopoint

Singapore 568047

Estimated Period of Repair:

28.0 days

Adjuster: BRYAN TANI

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Referen	ce	
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 22 Mar 2019)
Parts:	143	HYUNDAI I40 1.7 D (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted,	no print-code for SHB2036D)
Validity:		es are valid only if they contain the print code (above) on all estimate pages, running page he END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values n	ot in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Buckled	2,265.90 FL	*2,265.90 FL
2	2		*BONNET HINGE (LH/RH)	Bent	82.00 FL	*82.00 FL
3	1		*BONNET LOCK	Bent	36.90 FL	*36.90 FL
4	2		*BONNET ABSORBER	Not Necessary	116.20 FL	*-FL
5	1		*BONNET INSULATOR	Crumpled	196.50 FL	*196.50 FL
5	1		*BONNET INSULATOR CLIPS	Necessary	8.40 FL	*8.40 FL
7	1		*RADIATOR GRILLE	Broken	251.00 FL	*251.00 FL
В	1		*RADIATOR GRILLE H EMBLEM	Dislodged	27.50 FL	*27.50 FL
9	1		*FRONT BUMPER COVER	Torn	544.50 FL	*544.50 FL
10	1		*FRONT BUMPER SPONGE	Torn	99.20 FL	*99.20 FL
11	1		*FRONT BUMPER REINFORCEMENT	Buckled	402.10 FL	*402.10 FL
12	1		*FRONT BUMPER CENTRE GRILLE	Deformed	178.60 FL	*178.60 FL
13	1		*FRONT BUMPER CENTRE GRILLE TOP GARNISH N/S	Distorted	80.00 FL	*80.00 FL
14	2		*FRONT BUMPER BRACKET TOP (LH/RH)	Not Necessary	44.80FL	*-FL
15	2		*FRONT BUMPER BRACKET (LH/RH)	Not Necessary	49.20 FL	*-FL
16	1		*HEADLAMP SUPPORT TOP COVER	Broken	222.60 FL	
17	1		*HEADLAMP SUPPORT PANEL ASSY	Broken	907.40 FL	
18	2		*HEADLAMP (LH/RH)	N/S Dislodged/O/S Mtg Broken	2,776.00 FL	*2,776.00 FL
19	1		*RADIATOR	Punctured / Bent	698.30 FL	*698.30 FL
20	1		*RADIATOR FAN BLADE, COWLING, MOTOR ASSY	Broken	792.95 FL	*792.95 FL
21	2		*RADIATOR BRACKET (RH/LH)	Not Necessary	13.00 FL	*-FL
22	1		*RADIATOR HOSE UPPER	Torn	36.50 FL	*36.50 FL
23	1		*RADIATOR HOSE LOWER	Torn	36.50 FL	*36.50 FL
24	1		*RADIATOR EXPANSION TANK	Not Necessary	28.30 FL	*-FL
25	2		*RADIATOR GUARD	Dislodged	40.00 FL	*40.00 FL
26	2		*HORN UNIT (LH/RH)	Broken	147.60 FL	*147.60 FL
27	1		*FRONT FENDER (LH/RH)	O/S Dented / N/S Repair	1,132.60 FL	*566.30 FL
28	2		*FRONT FENDER APRON PANEL (LH/RH)	Not Necessary	1,274,00 FL	*-FL
29	2		*FRONT FENDER SHIELD (LH/RH)	Not Necessary	349.80 FL	
30	1		*AIR CLEANER ASSY	Broken	118.60 FL	*118.60 FL
31	1		*AIR DUCT	Broken	134.60 FL	*134.60 FL
32	1		*AIR FLOW SENSOR	Damaged	502.20 FL	
33	1		*AIR CLEANER BOTTOM ASSY	Deformed / Broken	325.00 FL	
34	1		*AIRCON CONDENSER	Punctured / Bent	927.50 FL	E-0.000 100 100
35	1		*AIRCON SUCTION & LIQUID HOSE	Bent	624.00 FL	
36	1		*AIRCON DISCHARGE HOSE	Bent	162.60 FL	
37	1		*BATTERY TRAY	Not Necessary	52.00 FL	100000000000000000000000000000000000000
			Report was unsubmitted	1115-475-4 1411111 23-11-4-11 -	10 to	-cafeet

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
38	2		*FRT SAFETY BELT (ASSY) (LH/RH)	Activated	950.80 FL	*950.80 FL
39	1		WIPER PANEL TOP GARNISH	Not Necessary	222.60 FL	*-FL
40	1		*WIPER CONTAINER	Not Necessary	61.90 FL	*-FL
41	1		*WIPER CONTAINER MOTOR	Not Necessary	75.00 FL	*-FL
42	1		*FRONT CHASSIS MEMBER	Not Necessary	1,060.70 FL	*-FL
43	1		*ENGINE MOUNTING	Not Necessary	456.30 FL	*-FL
44	1		*ENGINE UNDER COVER	Dislodged / Broken	334.60 FL	
45	1		*ENGINE CROSSMEMBER	Distorted		*2,094.40 FL
46	2		*FRONT SEAT ADJUSTER (OUTER) (LH/RH)	Not Necessary	2,425.00 FL	
47	1		*ENGINE MTG (REAR)	Not Necessary	279.60 FL	*-FL
48	1		*GEARBOX MOUNTING	Not Necessary	215.40 FL	*-FL
49	1		*STEERING WHEEL HORN BUTTON ASSY	Not Necessary	864.00 FL	*-FL
50	1		*INTER COOLER	Punctured / Bent		*1,032.50 FL
51	2		*INTER COOLER MOUNTING	Not Necessary	25.90 FL	
52	1		*HOSE B TO INTER COOLER	Torn	229.70 FL	
			*HOSE C TO INTER COOLER INLET	Tom		
53 54	1		*PIPE TO INTER COOLER INLET	Deformed	294.50 FL 167.05 FL	
	1			2010111100		
55	1		*PIPE TO INTER COOLER OUTLET	Not Necessary	244.55 FL	
56	1		*WIRING - FEM	Not Necessary	168.00 FL	
57	1		*ACTUATOR-SWIRL CONTROL	Broken	814.60 FL	
58	1		*ENGINE TOP COVER	Not Necessary	386.00 FL	
59	1		*THROTTLE BODY ASSY	Not Necessary	1,096.60 FL	*-FL
60	1		"INTAKE MANIFOLD ASSY	Damaged	1,141.10FL	*1,141.10 FL
61	1		*AIRBAG CONTROL MODULE	Activated	1,140.40 FL	*1,140.40 FL
62	1		*STEERING ANGLE ASSY	Not Necessary	1,150.60 FL	*-FL
63	1		*SENSOR ASSY IMPACT - FRT IMPACT	Not Necessary	198.30 FL	*-FL
64	2		*AIRBAG SENSOR	Activated	1,160.00 FL	*1,160.00 FL
65	1		*ELECTRIC POWER STEERING	Not Necessary	4,880.50 FL	*-FL
66	1		*FRONT NUMBER PLATE	Dislodged	25.00 FS	*25.00 FS
67	1		*FRONT NO PLATE TRIM COVER	Bent	30.00FS	
68	1		*BOOT LID	Buckled		*2,174.90 FL
69	1		*BOOT LID RUBBER	Deformed	96.50 FL	The last Company of the last of
70	4		*BOOT LID HINGE (LH/RH)	O/S Bent / N/S Not Necessary	284.60 FL	*142.30 FL
71	1		*BOOT LID LOCK UPPER	Bent Bent	102.60 FL	
72	1			Bent	31.70FL	*31.70 FL
			*BOOT LID LOCK LOWER			
73	1		*BOOT LID H EMBLEM	Necessary	28.70 FL	*28,70 FL
74	1		*BOOT LID CRDI PLATE	Necessary	27.90 FL	*27.90 FL
75	2		*BOOT LID LAMP (LH/RH)	Cracked / Broken		*1,131.20 FL
76	2		*LICENCE LAMP (LH/RH)	Not Necessary	67.90 FL	*-FL
77	1		*BOOT LID TRIMBOARD	Torn / Bent	116,40FL	distribution of the contract o
78	10		*BOOT LID TRIMBOARD CLIPS	Necessary	11.00 FL	*11.00 FL
79	1		*BOOTLID MOULDING	Cut	85.00 FL	*85.00 FL
80	1		*BOOTLID 140 EMBLEM	Necessary	27.90 FL	*27.90 FL
81	1		*BOOTLID LOWER GARNISH	Broken	227.90 FL	*227.90 FL
82	1		*REAR BUMPER	Tom	553.00 FL	*553.00 FL
83	1		*REAR BUMPER REINFORCEMENT	Cracked / Broken	428.40 FL	*428.40 FL
84	2		*REAR BUMPER REINFORCEMENT BRACKET (LH/RH)	Bent	160.60 FL	*160.60 FL
85	10		*REAR BUMPER CLIP	Necessary	22.00 FL	*22.00 FL
86	1		*REAR BUMPER BRACKET	O/S Dislodged/N/S Serviceable	71.20FL	*35.60 FL
87	1		*REAR BUMPER SPONGE	Torn	118.40FL	*118.40 FL
Marie .			THE STATE OF STATE	167000		

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
38	1		*REAR BUMPER UNDER COVER	Distorted	228.00 FL	*228.00 FL
89	1		*REAR BUMPER REFLECTOR LAMP (RH)	Dislodged	30.60 FL	*30.60 FL
90	2		*TAIL LAMP (LH/RH)	Cracked / Broken	1,395.60 FL	*1,395.60 FL
91	1		*TAIL LAMP QUARTER PANEL (LH/RH)	O/S Dented / N/S Not Necessary	453.00 FL	*226.50 FL
92	1		*REAR PANEL	Buckled	526,70 FL	*526.70 FL
93	1		*REAR PANEL GARNISH	Deformed	57.70 FL	*57.70 FL
94	1		*REAR PANEL LOWER PANEL	Dented	495.50 FL	*495.50 FL
95	1		*SPARE TYRE HOLDER	Bent	223.10 FL	*223.10 FL
96	1		*TAIL LAMP PANEL TOP (RH)	Dented	545.90 FL	*545.90 FL
97	1		*SPARE TYRE PANEL	Not Necessary	852.80 FL	*-FL
98	1		*SPARE TYRE PANEL CUSHION	Not Necessary	209.05 FL	*-FL
99	1		*REAR TOWING HOOK	Not Necessary	94.60 FL	
100	1		*MEMBER ASSY-REAR FLOOR CENTRE	Not Necessary	570.40 FL	
101	2		*PANEL ASSY-REAR FLOOR SIDE (LH/RH)		180.20 FL	*-FL
102	2		*EXHAUST PIPE INSULATOR	Not Necessary	117.10FL	
103			*EXHAUST SILENCER	O/S Bent / N/S Not Necessary	1,935,40 FL	The second secon
104			*EXHAUST PIPE HANGER	Not Necessary	117.10FL	
105			*EXHAUST PIPE CENTRE	Distorted / Bent	730.10 FL	
106			*REAR FENDER WITH HOUSING (LH/RH)	O/SBuckled/N/SDented- Outeronly		*6,757.00 FL
107	2		*REAR FENDER INNER LINING (LH/RH)	Not Necessary	338.60 FL	*-FL
108	1		*REAR FENDER AIR-DUCT	Deformed	51.60 FL	*51.60 FL
109	1		*REAR FENDER TRIM BOARD (RH)	Bent	188.75 FL	
110	1		*REAR WINDSCREEN GLASS	Scratched	607.20 FL	
111	1		*REAR WINDSCREEN MOULDING	Necessary	28.30 FL	100 - 100 - 100 - 100 - 100
112	1		*FIRE EXTINGUSHER HOLDER	Not Necessary	35.00 FL	
113	1		*BOOT LID COMFORT LOGO & TEL NO. STICKER	Necessary	30.00 FS	
114	1		*REAR NO. PLATE	Broken	25.00 FS	*25.00 FS
115	1		*REAR WINDSCREEN SEALANT	Necessary	46.00 FS	*46.00 FS
	1		*EGR VALVE & PIPE ASSY	Broken		*2,480.50 FL
117	1		*AIRCON OUTSIDE TEMPERATURE	Broken	168.00 FL	
118	1		*BONNET SWITCH	Broken	148.00 FL	
119	1		*GEARBOX COOLER HOSE INLET	Torn	120.00 FL	*120.00 FL
120			*GEARBOX COOLER HOSE OUTLET	Torn	120.00 FL	
121			*TUBE-FUEL FEED	Broken	638.00 FL	The state of the s
122	1		*TUBE-FUEL RETURN	Broken	738.00 FL	
123			*TUBE-CONNECTOR TO REAR LH (BRAKE)	10.50M 1517	668.00 FL	الرحكاء والتراجلة والمتار
124			*TUBE-CONNECTOR TO REAR RH (BRAKE)	Bent	598.00 FL	
125	1		*UNDER COVER ASSY SIDE, LH	Broken	1,430.00 FL	*1,430.00 FL
126			*HORN WIRE	Broken connector	156.50 FL	*156.50 FL
127	1		*GEARBOX	Oil sump cracked	11,846.40 FS	*3,000.00 FS
128			*WIRING-ENGINE	Broken socket	3,326.00 FL	*3,326.00 FL
129			*AUTO GEAR OIL	Oil sump punctured leak		*110.40 FL
130			*AIRCON COMPRESSOR	Distorted		*2,578.00 FL
131			*AIRBAG COMPLETE	Driver activated		*2,948.50 FL
		part. S=	SpcNett. L=ListItemDisc.	Sub Total (S\$)		60,517.05
			- List Item Discoun	t on L Items 20.00/20.00% (S\$)	16,067.41	11,472.21

Total Parts (S\$) 76,272.04 49,044.84

Report was unsubmitted during this print-out.

No. Qty Part No. Particulars Condition Repairer's Amount

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			
1	PANEL BEATING	New	4,400.00	2,000.00
2	SPRAY PAINTING CHARGE	New	3,050.00	1,600.00
3	WIRING CHARGE	New	200.00	60.00
4	TUFF KOTE	New	300.00	80.00
5	TOWING CHARGE	New	50.00	0.00
6	FRONT CHASSIS ALIGNMENT CHARGE	New	400.00	150.00
7	REMOVE / REFIX AIRCON & REFILL GAS	New	150.00	80.00
8	REMOVE / REFIX ENGINE / GEARBOX	New	650.00	200.00
9	REMOVE / REFIX DASHBOARD	New	450.00	150.00
10	R/REFIX AIR BAG / STEERING WHEEL / DASHBOARD / S	EAT New	550.00	150.00
11	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE	New	480.00	150.00
12	REAR CHASSIS ALIGNMENT CHARGE	New	400.00	0.00
13	REMOVE / REFIX CUSHION & UPHOLSTERY REAR	New	150.00	80.00
14	REMOVE / REFIX REAR WINDSCREEN GLASS	New	120.00	80.00
15	REMOVE / REFIX FUEL TANK	New	150.00	0.00
16	REMOVE / REFIX EXHAUST PIPE	New	300.00	60.00
17	REMOVE / REFIX FUEL TANK	New	150.00	60:00
18	REMOVE / REFIX UNDERCARRIAGE (RR)	New	400.00	150.00
19	REMOVE / REFIX BRAKE LINE }	New	250.00	80.00
20	REMOVE / REFIX FUEL LINE }	New	250.00	- 2
21	REMOVE / REFIX FUSE BOX	New	180.00	50.00
	Gross L	abour Cost (S\$)	13,030.00	5,180.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >